

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 31 OCTOBER 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 24



[Motor Vehicle \(43\)](#)

[Child Safety Seat \(1\)](#)

[Motor Vehicle Equipment \(12\)](#)

SGS

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAINGER	MEASURES ADOPTED
AUSTRALIA	<p>Peugeot—307, 308 and Expert—Exterior Lighting Malfunction</p> <p>PRODUCT DESCRIPTION</p> <p>307, 308 and Expert vehicles manufactured between December 2006 till February 2008.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign: YWB Target Number: 307</p> <p>SUPPLIER</p> <p>Sime Darby Automobiles Pty Ltd t/as Peugeot Automobiles Australia</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The lighting switch position may be incorrectly detected by the lighting management system. In rare cases, this may cause the exterior lights to inadvertently cut out with no action taken by the driver.</p> <p>DEFECTS</p> <p>These vehicles had a previous safety recall campaign to download new lighting control software to the management system. There is a possibility that this software upgrade did not complete satisfactorily and therefore, the vehicle requires the latest software upgrade to be performed.</p>	<p>CONSUMERS ACTION</p> <p>A registered letter is being sent to all owners contactable by Peugeot Automobiles Australia within the affected VIN range.</p>
AUSTRALIA	<p>Volvo—S60, S80, V70, XC60 and XC70</p> <p>PRODUCT DESCRIPTION</p> <p>S60, S80, V70, XC60 and XC70 vehicles MY 2010 to 2011.</p> <p>IDENTIFYING FEATURES</p> <p>VIn Range: S60 - 000194 to 000701 S80 - 123254 to 136536 V70 - 142445 to 172769 XC60 - 087281 to 141518 XC70 - 082543 to 096858 Campaign Number: R89140 Target Number: 1308</p> <p>SUPPLIER</p> <p>Volvo Car Australia Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the short circuit occurs during driving and the driver ignores the warning, in the event of an accident where the deployment of the driver's airbag is required, the airbag may not deploy as intended or not deploy at all.</p> <p>DEFECTS</p> <p>There may be an electrical short circuit in the driver's airbag clockspring wiring connector. If the deviation occurs the supplemental restraint system lamp (SRS) will be permanently lit and the message "AIRBAG SYSTEM SERVICE REQUIRED" will be displayed in the Driver Information Module (DIM).</p>	<p>CONSUMERS ACTION</p> <p>Contact your authorised Volvo dealer to have the driver's airbag clockspring wiring connector upgraded.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAINGER	MEASURES ADOPTED
AUSTRALIA	<p>Kawasaki Motors Pty Ltd—Kawasaki Jet Skis JT1500A9F and JT1500D9F</p> <p>PRODUCT DESCRIPTION</p> <p>A total of 32 units imported between December 2009 and April 2010 are affected.</p> <p>IDENTIFYING FEATURES</p> <p>JT1500A9F and JT1500D9F</p> <p>SUPPLIER</p> <p>Kawasaki Motors Pty. Ltd.</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.kawasaki.com.au/index.php</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the clamp is installed incorrectly, fuel may leak into the engine compartment, creating the potential for an explosion and/or fire resulting in injury or death.</p> <p>DEFECTS</p> <p>On some units, the lower fuel pump clamp may have been installed incorrectly at the factory.</p>	<p>CONSUMERS ACTION</p> <p>Customers will be contacted by their Kawasaki dealer and referred to an authorised repairer for correct installation of the clamp if necessary.</p>
AUSTRALIA	<p>Toyota—Hiace Commuter Bus KDH222, KDH223 & TRH223—Rear Propeller Shaft Guide</p> <p>PRODUCT DESCRIPTION</p> <p>Hiace Commuter Bus KDH222, KDH223 & TRH223 vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: 0518J# Target Number: 13, 256</p> <p>SUPPLIER</p> <p>Toyota Motor Corporation Australia Limited</p> <p>No picture available.</p>	<p>DEFECTS</p> <p>The rear propeller shaft guard fitted does not meet the Australian Design Rule (ADR: 58.21*) due to a lack of propeller shaft guard rigidity.</p>	<p>CONSUMERS ACTION</p> <p>All owners of affected vehicles will be notified by Recall Notification Letter.</p> <p>Owners are advised to contact their authorised Toyota Dealership for inspection and replacement of the rear propeller shaft guard.</p>
AUSTRALIA	<p>Honda—2007 Legend Sedan</p> <p>PRODUCT DESCRIPTION</p> <p>2007 Legend Sedan vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Identification Plate Number: 35889 VIN Range: JHMKB16507C200040 - JHMKB16507C204774 Campaign Number: 5LB Target Number: 482</p> <p>SUPPLIER</p> <p>Honda Australia Pty Ltd</p>	<p>HAZARDS</p> <p>In the worst case scenario, the defect may cause brake force reduction.</p> <p>DEFECTS</p> <p>It is possible that the rubber seal portion at the rear end of the brake master cylinder may turn and brake fluid may leak from the seal portion, causing the warning light to be illuminated.</p>	<p>CONSUMERS ACTION</p> <p>Owners of affected vehicles will be contacted by mail.</p> <p>Owners are advised to contact their authorised Honda Dealership for replacement of the brake master cylinder.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	<p>Nissan—C11 Tiida, D40 Navara & R51 Pathfinder</p> <p>PRODUCT DESCRIPTION</p> <p>C11 Tiida vehicles produced in Japan. D40 Navara and R51 Pathfinder produced in Europe.</p> <p>IDENTIFYING FEATURES</p> <p>VIN Ranges: C11 Tiida JN1BBAC11A0100013 - JN1BBAC11A0103267 JN1FBAC11A0000010 - JN1FBAC11A0003883 D40 Navara VSKCLAD40A0063242 - VSKCLAD40A0119258 VSKCLND40A0062675 - VSKCLND40A0118785 R51 Pathfinder VSKJLWR51A0066034 - VSKJLWR51A0119527 Note: Not all vehicles in the above ranges are included. Campaign Numbers: C11 Tiida -1033 D40 Navara - PS0BF R51 Pathfinder - PS0BF Target Numbers: C11 Tiida -6,539 D40 Navara - 526 R51 Pathfinder - 79</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>All authorised Nissan Australian dealers</p> <p>SUPPLIER</p> <p>Nissan Motor Co (Australia) Pty Ltd No picture available.</p>	<p>HAZARDS</p> <p>In the extreme case, the resulting poor contact can potentially result in the engine stalling and failure to restart the vehicle.</p> <p>DEFECTS</p> <p>A concern affecting the intelligent power distribution module (IPDM) relay has been identified. There is a possibility that the ignition relay contacts in the IPDM may become contaminated with a build up of silicon oxide due to silicon evaporating from the relay diode. This can lead to poor conduction at the relay contacts.</p>	<p>CONSUMERS ACTION</p> <p>Nissan will shortly mail directly to the owners of affected vehicles advising them to return the vehicle to a Nissan dealer to have the relay replaced free of charge with a counter-measure part. In the meantime, should any consumers experience difficulties, they can contact a Nissan dealer or our Customer Assistance Centre on 1800 035 035.</p>
AUSTRALIA	<p>Nissan—T31 X-Trail—Overstated GVM Specification on Compliance Label</p> <p>PRODUCT DESCRIPTION</p> <p>T31 X-Trail vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: S1010 Target Number: 68 VIN Range: JN1TANT31A0100176 - JN1TANT31A0100402 JN1TCNT31A0100122 - JN1TCNT31A0100170 NB. Not all vehicles in the above range are included</p> <p>SUPPLIER</p> <p>Nissan Motor Co. (Australia) No picture available.</p>	<p>HAZARDS</p> <p>Potential to overload the vehicle.</p> <p>DEFECTS</p> <p>A concern has been detected relating to the Gross Vehicle Mass (GVM) specification on the locally printed compliance label. This print error occurred during 16 and 18 August 2010.</p>	<p>CONSUMERS ACTION</p> <p>Owners will receive a phone call or letter from Nissan.</p> <p>Owners are advised to contact their nearest Nissan Dealer to arrange rectification of their vehicle.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
<p>AUSTRALIA</p>	<p>Toyota—Lexus G300, IS250, RX330 and Toyota Kluger—Brake Master Cylinder</p> <p>PRODUCT DESCRIPTION</p> <p>Lexus G300, IS250, RX330 and Toyota Kluger MCU28</p> <p>IDENTIFYING FEATURES</p> <p>See attached VIN list.</p> <p>Campaign Number: 0516K Target Numebr: 25, 783</p> <p>SUPPLIER</p> <p>Toyota Motor Corporation Australia Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the defect occurs, a small amount of brake fluid could leak from the rear of the brake master cylinder resulting in a low brake fluid level and illumination of the brake warning light. If the vehicle is operated in this condition, the brake pedal feel could change, and eventually braking performance could begin to gradually degrade.</p> <p>DEFECTS</p> <p>During vehicle assembly, Toyota brake fluid contains polymers that act as a lubricant for certain brake system components. If the replacement brake fluid used has insufficient polymers, the brake master cylinder rear rubber seal may become dry and curl during brake application.</p>	<p>CONSUMERS ACTION</p> <p>All owners of affected vehicles will receive a Recall Notification Letter.</p> <p>Owners are advised to contact their authorised Toyota Dealership for inspection and replacement of the rear rubber cup of the brake master cylinder.</p>
<p>AUSTRALIA</p>	<p>Toyota—Lexus GS300 GRS190—Fuel Suction Tube Connector Replacement</p> <p>PRODUCT DESCRIPTION</p> <p>Certain Lexus GS300 vehicels produced from 28 September 2004 to 28 February 2006.</p> <p>IDENTIFYING FEATURES</p> <p>See attached VIN range. Target Number: 674 Campaign Number: 0515K</p> <p>SUPPLIER</p> <p>Toyota Motor Corporation Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The engine may not start or may stall while driving due to a loss of fuel pressure.</p> <p>DEFECTS</p> <p>The fuel suction tube assembly is located in the fuel tank and incorporates the fuel pump and wiring power supply.</p> <p>The fuel pump wire harness insulation has insufficient flexibility and over time the internal connector may move resulting in wear and poor electrical contact.</p>	<p>CONSUMERS ACTION</p> <p>All owners of affected vehicles will receive a Recall Notification Letter.</p> <p>Owners are advised to contact their authorised Toyota Dealership for inspection and replacement of the fuel pump wire harness.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Mercedes-Benz—Vito & Viano Vans (Type 639)</p> <p>PRODUCT DESCRIPTION</p> <p>Vito & Viano Vans (Type 639)</p> <p>Identifying features</p> <p>Chassis Range: 378470 to 562988</p> <p>Campaign Number: RC843</p> <p>SUPPLIER</p> <p>Mercedes-Benz Australia/Pacific Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>In unfavourable circumstances localised overheating of the relay may occur.</p> <p>DEFECTS</p> <p>It is possible that during extreme weather conditions the air-conditioning fan relay may fail.</p>	<p>CONSUMERS ACTION</p> <p>Contact your authorised Mercedes-Benz dealership to have the additional fan relay replaced with a modified version free of charge.</p> <p>A full list of authorised dealerships can be found at http://www.mercedes-benz.com.au</p>
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - S80, V70, XC70 and S60</p> <p>BRAND: Volvo</p> <p>TYPE/NUMBER OF MODEL: S80, V70, XC70 and S60. Model year 2010 and 2011.</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Sweden</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because there may be an electrical problem with the driver's airbag. The problem will cause the message "Airbag system service required" to be displayed. If the driver ignores the warning however, the driver's airbag may not deploy as intended, or not deploy at all, in the event of a road accident.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - Astra J and Meriva B</p> <p>BRAND: Opel</p> <p>TYPE/NUMBER OF MODEL: The recall concerns 2011 model year vehicles:</p> <ul style="list-style-type: none"> - Astra J vehicles, with VIN numbers from B 8 012507 to B 8 016159 and from B G 013718 to B G 028039; - Meriva B vehicles, with VIN numbers from B 4 023636 to B 4 061403. <p>Only vehicles with a passenger seat without seat height adjustment are affected.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: United Kingdom, Poland, Spain</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the bolts connecting the passenger seat rails to the seat frame could break in the event of an accident.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>BMW / K1200 GT 2004-2010 BMW / K1200 R 2004-2010 BMW / K1200 S 2004-2010 BMW / K1300 GT 2004-2010 BMW / K1300 R 2004-2010 BMW / K1300 S 2004-2010</p> <p>MANUFACTURER: BMW OF NORTH AMERICA, LLC</p> <p>COMPONENT: SUSPENSION:FRONT:WHEEL BEARING</p> <p>SUMMARY: BMW is recalling certain model year 2004-2010 motorcycles. The bearings could be subject to corrosion. This could lead to reduced movement of the link lever.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This could affect the handling of the motorcycle increasing the risk a driver may lose control of the vehicle resulting in a crash.</p>	<p>REMEDY</p> <p>The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact bmw at 1-800-525-7417.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>CARRIAGE / CAMEO 2002-2010 CARRIAGE / CARRI-LITE 2002-2008 CARRIAGE / CARRIAGE 2004 CARRIAGE / COMPASS 2005-2006 CARRIAGE / ROYALS 2004</p> <p>MANUFACTURER: CARRIAGE, INC</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 394</p> <p>SUMMARY: Carriage is recalling certain recreational vehicles equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p>	<p>REMEDY</p> <p>Carriage is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>GREAT DANE / MPA 2009</p> <p>MANUFACTURER: GREAT DANE LIMITED PARTNERSHIP</p> <p>COMPONENT: SUSPENSION</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 292</p> <p>SUMMARY: Great Dane is recalling certain mpa20, mpa38, and mpa40 trailers equipped with arvin meritor suspension systems. The suspect systems may have missing welds at the interface of the lower seat bracket and axle beam.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Missing welds could allow the axle to roll out of position and potentially impact the handling of the trailer such that a driver may lose control of the vehicle, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Great Dane is working with arvin meritor to identify owners with the affect suspension systems. The affected vehicles will be repaired free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Great Dane at 1-912-644-2100 or arvin meritor at 1-248-435-0896.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>CROSSROADS / ALL AMERICAN 2002-2003 CROSSROADS / HAMPTON 2008-2011 CROSSROADS / KINGSTON 2008-2010 CROSSROADS / PARADISE POINTE 2002-2008 CROSSROADS / SEVILLE 2008-2011 CROSSROADS / SILVERADO 2003-2006 CROSSROADS / TRANQUILITY 2009-2011 CROSSROADS / ZINGER 2010-2011</p> <p>MANUFACTURER: CROSSROADS RV</p> <p>SUMMARY: Crossroads is recalling certain recreational vehicles equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p>	<p>REMEDY</p> <p>Crossroads is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539 or crossroads at 888-226-7496.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>HYUNDAI TRANSLEAD / COMPOSITIVE 2010</p> <p>MANUFACTURER: HYUNDAI TRANSLEAD</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 203</p> <p>SUMMARY: Hyundai translead is recalling certain model year 2003 53 foot composite dry van trailers, equipped with arvin meritor suspension systems. The suspect systems may have missing welds at the interface of the lower seat bracket and axle beam.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Missing welds could allow the axle to roll out of position and potentially impact the handling of the trailer such that a driver may lose control of the vehicle, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Hyundai translead is working with arvin meritor to identify owners with the affect suspension systems. The affected vehicles will be repaired free of charge. The safety recall is expected to begin during October 2010. Owners may contact hyundai translead at 619-680-3144 or arvin meritor at 1-248-435-0896.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>OPEN RANGE / FIFTH WHEEL 2011 OPEN RANGE / TOY HAULER 2011</p> <p>MANUFACTURER: OPEN RANGE R.V. COMPANY</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 56</p> <p>SUMMARY: Open range is recalling certain model year 2011 fifth wheel travel trailers and toy haulers manufactured from august 17, 2010, and September 9, 2010, equipped with dexter axles. On some axles, cracks could appear in the spindle weld.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle increasing the risk of a vehicle crash.</p>	<p>REMEDY</p> <p>Open range is working with dexter axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin during October or early November 2010. Owners may contact open range at 1-260-768-7771 and dexter axle at 1-800-400-2164.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>STARCRAFT / AUTUMN RIDGE 2011 STARCRAFT / LEXION S-LITE 2011 STARCRAFT / TRAVEL STAR 2011 STARCRAFT / TRAVEL STAR EXP 2011 STARCRAFT / TRAVEL STAR EXP 2011 SPORT 2011</p> <p>MANUFACTURER: STARCRAFT RV, INC. COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 98</p> <p>SUMMARY: Starcraft is recalling certain model year 2011 travel trailers and fifth wheel trailers manufactured from august 16, 2010, through October 1, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Starcraft is working with atwood and will replace or repair the stoves free of charge. The safety recall is expected to begin during October or early November 2010. Owners may contact atwood at 1-574-266-4749 or starcraft at 1-800-945-4787.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>OPEN RANGE / JOURNEYER 2011 OPEN RANGE / OPEN RANGE 2011 OPEN RANGE / ROAMER 2011</p> <p>MANUFACTURER: OPEN RANGE R.V. COMPANY COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 404</p> <p>SUMMARY: Open range is recalling certain model year 2011 journeyer, open range, and roamer recreational vehicles manufactured from July 1, 2010, through September 20, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Open range is working with atwood and will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact atwood at 1-574-266-4749.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) CROSSROADS / SUNSET TRAIL 2011 CROSSROADS / ZINGER 2011</p> <p>MANUFACTURER: CROSSROADS RV COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 6</p> <p>SUMMARY: Crossroads is recalling certain model year 2011 zinger and sunset trail trailers manufactured from august 15, 2010, through september 29, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Crossroads is working with atwood and will replace or repair the stoves free of charge. The safety recall is expected to begin during October 2010. Owners may contact atwood at 1-574-266-4749 or crossroads at 1-888-226-7496.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) HEARTLAND / NORTH COUNTRY 2011</p> <p>MANUFACTURER: HEARTLAND RECREATIONAL VEHICLES, LLC COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 198</p> <p>SUMMARY: Heartland is recalling certain model year 2011 North Country travel trailers, manufactured from July 14, 2010, through September 14, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Heartland is working with atwood and will replace or repair the stoves free of charge. The safety recall is expected to begin during October 2010. Owners may contact atwood at 1-574-266-4749 or heartland at 1-877-262-8032.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) NEWMAR / BAY STAR 2011</p> <p>MANUFACTURER: NEWMAR CORPORATION COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 16</p> <p>SUMMARY: Newmar is recalling certain model year 2011 bay star ca recreational vehicles manufactured from august 6, 2010, through October 5, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Newmar is working with atwood and will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact atwood at 1-574-266-4749 or newmar at 574-773-7791.</p>

AUTO: MOTOR VEHICLE							
NOTIFYING COUNTRY	PRODUCT		ANGER	MEASURES ADOPTED			
USA	VEHICLE MAKE / MODEL	MODEL YEAR(S)	CONSEQUENCE	REMEDY			
	EVER-LITE / 25RB	2011					
	EVER-LITE / 27RB	2011					
	EVER-LITE / 29FK	2011					
	EVER-LITE / 29RK	2011					
	EVER-LITE / 30RLS-5	2011					
	EVER-LITE / 31BHS	2011					
	EVER-LITE / 31DS	2011					
	EVER-LITE / 31RB	2011					
	EVER-LITE / 31RKS	2011					
	EVER-LITE / 31RLS	2011					
	EVER-LITE / 32MKS	2011					
	EVER-LITE / 33QB	2011					
	EVER-LITE / 34BH-DS	2011					
	EVER-LITE / 34BHK	2011					
EVER-LITE / 35RL-DS	2011						
EVER-LITE / 35RLS	2011						
MANUFACTURER: EVERGREEN RECREATIONAL VEHICLES, LLC							
COMPONENT: EQUIPMENT							
POTENTIAL NUMBER OF UNITS AFFECTED: 67							
SUMMARY: Evergreen is recalling certain model year 2011 rvs equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. No picture available.							
USA	VEHICLE MAKE / MODEL	MODEL YEAR(S)	CONSEQUENCE	REMEDY			
	COACHMEN / BROOKSTONE	2011					
	COACHMEN / CHAPARRAL	2011					
	COACHMEN / NORTHRIDGE	2011					
	MANUFACTURER: COACHMEN RV COMPANY, LLC						
	COMPONENT: EQUIPMENT						
	POTENTIAL NUMBER OF UNITS AFFECTED: 124						
	SUMMARY: Coachmen is recalling certain model year 2011 chaparral, brookstone, and northridge fifth wheel travel trailers manufactured from july 1, 2010, through september 20, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. No picture available.						

AUTO: CHILD SAFETY SEAT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>CHILD RESTRAINT BRAND NAME / MODEL OR MODEL NO.:</p> <p>CHAPERONE / E9L69N9 (MOONSTONE) CHAPERONE / E9L69P2 (RED MILL) CHAPERONE / E9L69P3 (SAVANNAH) CHAPERONE / E9L69P5 (COWMOOFLAGE)</p> <p>MANUFACTURER: BRITAX CHILD SAFETY, INC.</p> <p>COMPONENT: CHILD SEAT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 17251</p> <p>SUMMARY: Britax is recalling certain britax chaperon infant car seats model e9l69n9 moonstone, e9l69p2 red mill, e9l69p3 savannah, and e9l69p5 cowmooflage, manufactured from April 2009 through may 2010. The chest clip was incorrectly produced which could result in a more brittle chest clip than was intended. As a result, the chest clip which positions the harness straps across the infant's shoulders may break when the chest clip is engaged as the infant is secured into the infant car seat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sharp edges of the broken chest clip could create a risk of a skin laceration and the fractured components of the chest clip may present a small parts/choking hazard.</p>	<p>REMEDY</p> <p>Britax will mail to consumers notice and remedy kits that contain a replacement chest clip and instruction sheet. The safety campaign is expected to begin on or about November 11, 2010. Owners may contact britax customer service department at 1-888-427-4829.</p>

AUTO: MOTOR VEHICLE EQUIPMENT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: BLUE SKY CUSTOM AUTOMOTIVE RESTYLERS</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 158</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by blue sky on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during October 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by blue sky by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: SOUTHSIDE TRIM Component: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 781</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by southside trim on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during October 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by southside trim by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: ADVICS / BRAKE MASTER CYLINDER</p> <p>MANUFACTURER: ADVICS NORTH AMERICA, INC.</p> <p>COMPONENT: SERVICE BRAKES, HYDRAULIC: FOUNDATION COMPONENTS:MASTER CYLINDER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1200364</p> <p>SUMMARY: Advics is recalling certain brake master cylinders installed as original equipment in certain Toyota and Honda passenger vehicles. Brake fluid containing polymers is used that acts as a lubricant for certain brake system components. If replacement brake fluid is used that does not contain such polymers, or that contains only small amounts, a part of the rubber seal located at the rear of the brake master cylinder may become dry, and the seal may curl during movement of the piston. If this occurs, a small amount of brake fluid could slowly leak from the seal into the brake booster.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A leak of brake fluid could lead to a change in brake pedal feel and, over time, a degradation in braking performance increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Owners of the defective brake master cylinders will be notified by their vehicle manufacturer. The safety recall is expected to begin during November 2010. Owners may contact Toyota at 1-800-331-4331 and lexus at 1-800-255-3987 and Honda owners may contact Honda at 1-800-999-1009. See Toyota recall campaign no. 10v-499 and Honda recall campaign no. 10v-504.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS