

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 AUGUST 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 16



[Motor Vehicle \(33\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(4\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	HAZARD	MEASURES ADOPTED
AUSTRALIA	Kawasaki—Models KLX110CAF and KLX110DAF PRODUCT DESCRIPTION Models KLX110CAF and KLX110DAF Imported between October 2009 and June 2010 IDENTIFYING FEATURES Target Number: 345 Campaign Number: DAC910A VIN Range: Model KLX110CAF - JKALXSC1#ADA71827 to JKALXSC1#ADA76724 Model KLX110DAF - JKALXSD1#ADA71830 to JKALXSD1#ADA76317 SUPPLIER Kawasaki Motors Pty Ltd No picture available.	HAZARDS Possible exhaust fume inhalation. DEFECTS If the engine stop switch "Kill Switch" is left in the "RUN" position it is possible, if water is present, that an electrical short may cause the motorcycle to start up and commence idling without physically operating the start switch. If this unintended start up occurred in a closed area, exhaust fumes will fill the area where people could be exposed.	CONSUMERS ACTION Contact your authorised Kawasaki dealer to conduct the necessary repairs free of charge.
AUSTRALIA	Kenworth Trucks—T402 & K108 PRODUCT DESCRIPTION T402 & K108 Model Years 2009 & 2010 IDENTIFYING FEATURES Target Number: 14 Campaign Number: 10-02 VIN range: 6F50000009A440089—6F5000000AA442880 SUPPLIER PACCAR Australia Pty Ltd No picture available.	HAZARDS The passenger may not be secured sufficiently in the event of sudden stopping or an accident. DEFECTS The affected vehicles are not compliant with the latest ADR regulations. The vehicles are fitted with a lap belt on the passenger side instead of a lap sash belt as per ADR regulations.	CONSUMERS ACTION Customers will be notified by registered mail.
AUSTRALIA	Isuzu—F and N Series PRODUCT DESCRIPTION F and N Series vehicles produced in Japan between January 2006 and May 2009. IDENTIFYING FEATURES Campaign Number: 10-Z-05 Target Number: 15,370 SUPPLIER Isuzu Australia Limited No picture available.	HAZARDS Horn may fail. DEFECTS The horn may fail to operate due to the routing of the electrical harness inside the steering wheel pad.	CONSUMERS ACTION Contact your authorised Isuzu dealership in order to have the horn harness repositioned.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
USA	NAME OF PRODUCT: Kawasaki 2010 KLX110 Off-Road Motorcycles UNITS: About 4,000 DISTRIBUTORS: Kawasaki Motors Corp. U.S.A., of Irvine, Calif. DESCRIPTION: This recall involves Kawasaki 2010 model year KLX110CAF and KLX110DAF off-road motorcycles. They were sold in green and have Kawasaki written on the sides of the fuel tank. MANUFACTURED IN: Thailand 	HAZARD A faulty housing for the ignition switch can allow water to enter and activate the electric starter unintentionally. This poses a serious hazard of injury or death. INCIDENTS/INJURIES No injuries have been reported.	Voluntary recall
AUSTRALIA	Kawasaki—Model KLX450ABF PRODUCT DESCRIPTION Model KLX450ABF motorcycles imported between May 2010 and July 2010. Identifying features Target Number: 130 Campaign Number: DAD010L VIN range: JKALXGA1#BA015001 - JKALXGA1#BA015065 SUPPLIER Kawasaki Motors Pty Ltd No picture available.	HAZARDS If the drive chain derails from the rear sprocket there is the potential for a crash to occur. DEFECTS The chain guide bracket is not welded properly on the swingarm. This could result in weld cracking which may cause the drive chain to derail from the rear sprocket.	CONSUMERS ACTION Contact your authorised Kawasaki dealer to conduct the necessary repairs free of charge.
EU/GERMANY	CATEGORY: Motor vehicles PRODUCT: Passenger car - Cube BRAND: Nissan TYPE/NUMBER OF MODEL: Type Z12, EC type -approval e13*2007/46*1059 DESCRIPTION: Vehicles manufactured during 2009 are affected. COUNTRY OF ORIGIN: France No picture available	INJURIES The product poses a risk of injuries because if triggered, the front passenger window airbag does not deploy properly and would not, therefore, protect the occupant properly in the event of an accident.	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/POLAND	CATEGORY: Motor vehicles PRODUCT: Passenger car - XC90 BRAND: Volvo TYPE/NUMBER OF MODEL: XC90 made in 2010. DESCRIPTION: The recall concerns vehicles with VIN numbers range: 0551239 – 0553207. COUNTRY OF ORIGIN: Sweden No picture available	FIRE The product poses a risk of fire due to possible leakage from the fuel hose which may lead to self-ignition in the area of the front right wheel.	Voluntary recall from consumers by the manufacturer.
EU/GERMANY	CATEGORY: Motor vehicles PRODUCT: Passenger car - Focus BRAND: Ford TYPE/NUMBER OF MODEL: e13*2001/116*0157*04, e13*2001/116*0144*09 DESCRIPTION: The vehicles concerned are: Focus 1.6L diesel, 4/5-door, manufactured between 1 January 2006 and 31 May 2006 and Focus 1.8L & 2.0L petrol, estate, manufactured between 1 January 2006 and 25 January 2007. COUNTRY OF ORIGIN: Germany No picture available	FIRE Corrosion of the control module of the radiator fan, can lead to overheating and cause the module and the surrounding cables and components to catch fire.	Voluntary corrective actions taken by the manufacturer.
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Passenger car - Patrol BRAND: Nissan TYPE/NUMBER OF MODEL: Vehicles manufactured between 25 and 31 August 2001. DESCRIPTION: 4x4 saloon car COUNTRY OF ORIGIN: Spain No picture available	INJURIES The front passenger airbag could over-inflate if triggered in the event of a collision and, in extreme cases, the inflator housing could rupture, possibly projecting metal fragments. One incident has been identified.	Voluntary corrective actions taken by the manufacturer.
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Passenger car - Legacy/Outback BRAND: Subaru TYPE/NUMBER OF MODEL: 2010 model, 2.5 with CVT automatic transmission DESCRIPTION: Passenger car COUNTRY OF ORIGIN: Japan No picture available	FIRE The oil cooler hose may break due to a material defect, in which case oil could leak onto the exhaust manifold causing fire.	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GERMANY	CATEGORY: Motor vehicles PRODUCT: Passenger car - Sprinter BRAND: Mercedes-Benz TYPE/NUMBER OF MODEL: Sprinter, types 903 and 906. The vehicles affected were manufactured between 10 August 2009 and 5 March 2010 and have Vehicle Identification Numbers ranging from WDB906 *** ** E022768 to E031632. DESCRIPTION: Passenger car / goods vehicle. COUNTRY OF ORIGIN: Germany No picture available	INJURIES The seat belts may not have been attached with the required tightening torque. This means that in the event of an accident, the restraining function of the seat belt cannot be fully guaranteed.	Voluntary corrective actions taken by the manufacturer.
EU/GERMANY	CATEGORY: Motor vehicles PRODUCT: All Terrain Vehicle - Blade 250, Blade 325/Target 325 BRAND: Taiwan Golden Bee TYPE/NUMBER OF MODEL: Type: TGB FCB Model: Blade 250, EC type-approval e4*2002/24*0842*, Type: TGB FCC, Model: Blade 325/Target 325, EC type-approval e4*2002/24*1489*, DESCRIPTION: All Terrain Vehicle (ATV). The notification concerns vehicles manufactured between 2008 and 2010. COUNTRY OF ORIGIN: Taiwan No picture available	INJURIES The product poses a risk of injuries because the bolts securing the rear swing arm axle fastening can become loose, impairing driving stability.	Voluntary corrective actions taken by the manufacturer.
EU/PORTUGAL	CATEGORY: Motor vehicles PRODUCT: Passenger car - Land Cruiser 100 BRAND: Toyota. TYPE/NUMBER OF MODEL: Year: 2005-2006. The VINs of the affected vehicles are attached. DESCRIPTION: Passenger car. COUNTRY OF ORIGIN: Japan No picture available	INJURIES The product poses a risk of injuries because a snap ring on the steering shaft may disengage when the vehicle experiences an unusually severe impact to the front wheels. Over time this could lead to the steering shaft becoming disconnected, which could result in a loss of steering control.	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) MERCEDES BENZ / G CLASS 2002-2009 MANUFACTURER: MERCEDES-BENZ USA, LLC. COMPONENT: EXTERIOR LIGHTING: HEADLIGHTS POTENTIAL NUMBER OF UNITS AFFECTED: 1938 SUMMARY: MERCEDES-BENZ is recalling certain model year 2002-2009 g-class vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment." the headlamps of the affected vehicles are equipped with a protective grill that is not permissible under fmvss no. 108. No picture available.	CONSEQUENCE The vehicles fail to meet the requirements of the standard.	REMEDY Dealers will remove the headlamp grills free of charge. The safety recall is expected to begin on or before November 2010. Owners may contact mercedes-benz at 1-800-367-6372.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) AUTOCAR / ACX 2008-2009 MANUFACTURER: AUTOCAR, LLC COMPONENT: ELECTRICAL SYSTEM:IGNITION POTENTIAL NUMBER OF UNITS AFFECTED: 2317 SUMMARY: AUTOCAR is recalling certain model year 2008-2009 acx heavy duty class 8 vehicles manufactured from November 30, 2007 through august 3, 2010. Water intrusion in the ignition relay may lead to corrosion, which may short-circuit the relay causing the part to fail. No picture available.	CONSEQUENCE Failure of the relay could cause the engine to shut down without warning or fail to start increasing the risk of a crash.	REMEDY An owner notification letter will be mailed which will provide instructions for scheduling repair of the vehicle at an authorized autocar service facility. This service will be performed free of charge. The safety recall is expected to begin on or before august 31, 2010. Owners may contact autocar at 1-765-489-5499.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) COLLINS / BANTAM 2008 COLLINS / GRAND BANTAM 2008 COLLINS / SUPER BANTAM 2008 MANUFACTURER: COLLINS BUS CORPORATION COMPONENT: SEATS SUMMARY: Collins is recalling certain model year 2008 bantam, grand bantam, and super bantam model school buses. The 39 inch three passenger seats fail to meet the minimum performance requirements of federal motor vehicle safety standard no. 222, "school bus passenger and crash protection." No picture available.	CONSEQUENCE Seat occupants are at an increased risk of injury in the event of a crash.	REMEDY The manufacturer has not yet provided the agency with a notification schedule or a remedy plan. Owners may contact collins at 1-800-533-1850.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) MERCEDES BENZ / G CLASS 2002-2010 MANUFACTURER: MERCEDES-BENZ USA, LLC. COMPONENT: EXTERIOR LIGHTING:TURN SIGNAL POTENTIAL NUMBER OF UNITS AFFECTED: 3552 SUMMARY: MERCEDES-BENZ is recalling certain model year 2002-2010 g-class vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment." these vehicles are equipped with a grill cover for front turn signal protection that, while permissible, may impact over time the signal's ability to meet the minimum requirements of fmvss 108. No picture available.	CONSEQUENCE The signal light's visibility to other motorists may be reduced over time, increasing the risk of a crash.	REMEDY Dealers will install improved turn light units optimized for usage with grills. This service will be performed free of charge. The safety recall is expected to begin on or before November 2010. Owners may contact mercedes-benz at 1-800-367-6372.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) YAMAHA / YZF-R6 2005-2010 MANUFACTURER: YAMAHA MOTOR CORPORATION, USA COMPONENT: EXTERIOR LIGHTING POTENTIAL NUMBER OF UNITS AFFECTED: 54000 SUMMARY: YAMAHA is recalling certain model year 2006 through 2010 yzf-r6 motorcycles manufactured from august 2005 through March 2010. The motorcycle's front side reflector was not placed at the proper height which fails to comply with the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment." No picture available.	CONSEQUENCE Visibility of the motorcycle will be decreased, possibly increasing the risk of a crash.	REMEDY Yamaha will notify owners and dealers will repair the motorcycles free of charge. The safety recall is expected to begin on or about august 11, 2010. owners may contact yamaha at 1-800-962-7926.

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) HONDA / ACCORD 2003 HONDA / CIVIC 2003 HONDA / ELEMENT 2003-2004 MANUFACTURER: HONDA (AMERICAN HONDA MOTOR CO.) COMPONENT: ELECTRICAL SYSTEM: IGNITIONPotential Number of Units Affected: 384220 SUMMARY: HONDA is recalling certain model year 2003 Honda accord, civic two and four door, and model year 2003-2004 Honda element vehicles. The interlock lever of the ignition switch may unexpectedly deform, which can allow the interlock function of a vehicle with an automatic transmission to be defeated. No picture available.	CONSEQUENCE Removal of the ignition key when the gear selector of a vehicle with an automatic transmission has not been shifted to the park position can allow the vehicle to roll away, increasing the risk of a crash.	REMEDY Dealers will remove the original interlock pin and lever within the ignition switch, and replace them with new, designed components. This service will be performed free of charge. The safety recall is expected to begin on or about September 29, 2010. Owners may contact honda at 1-800-999-1009.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) FREIGHTLINER / M2 2011 MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA COMPONENT: EXTERIOR LIGHTING:HEADLIGHTS POTENTIAL NUMBER OF UNITS AFFECTED: 16 SUMMARY: Daimler trucks is recalling certain model year 2011 business class m2 106v trucks manufactured from april 12, 2010 through july 16, 2010, for failing to comply with the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment." these trucks may have headlights which measure greater than 54" from the road surface. No picture available.	CONSEQUENCE Improper height of headlights may not fully illuminate road surface or may inhibit the ability of motorist to see vehicles increasing the risk of a crash.	REMEDY Dealers will measure the headlamps and vehicles with above 54" will receive new headlamps that lower the bulb center to be at or below 54". This service will be performed free of charge. The safety recall is expected to begin on or before October 25, 2010. Owners may contact Daimler trucks at 1-800-547-0712.

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DA	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S)		CONSEQUENCE	REMEDY
	FORD / ODYSSEY			

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) FOREST RIVER / WILDCAT 2011 MANUFACTURER: FOREST RIVER, INC. COMPONENT: EQUIPMENT:OTHER:LABELS POTENTIAL NUMBER OF UNITS AFFECTED: 155 SUMMARY: Forest River is recalling certain model year 2011 wilcat travel trailers manufactured from January 1, 2010 through July 22, 2010. The information for the models' gross vehicle weight rating, gross axle weight rating, tires, rims, and air pressure was incorrectly inputted in the corporate computer system. As a result, the gross axle weight rating label and the tire label on the vehicles is incorrect and may lead an owner to inadvertently overload the vehicle. No picture available.	CONSEQUENCE An overload condition may result in an axle or tire failure increasing the risk of a crash.	REMEDY Forest River will be mailing corrected labels to retail purchasers, and/or to dealers. The safety recall is expected to begin during august 2010. Owners may contact Forest River at 574-206-7600.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) ELDORADO / TRANSTECH 2007-2010 MANUFACTURER: EL DORADO R.V. INC. COMPONENT: WHEELS POTENTIAL NUMBER OF UNITS AFFECTED: 246 SUMMARY: ELDORADO NATIONAL—Kansas is recalling certain model year 2007-2010 transtech buses. These vehicles were manufactured with an incorrect wheel well profile cutout. The smaller profile results in a reduced clearance between the wheel well rubber molding attachment screws and the bus's tires. The attachment screws could rub against the bus's tires resulting in a tire failure. No picture available.	CONSEQUENCE A tire failure could result in loss of control of the vehicle increasing the risk of a crash.	REMEDY Dealers will inspect the vehicles to ensure they have the correct rear wheel well profile. If a bus is found to have the incorrect profile, the wheel well opening will be cut to the correct profile to ensure proper clearance to the tire. Additionally, new fasteners will be installed attaching the wheel well rubber molding. This service will be performed free of charge. The safety recall is expected to begin on or before august 16, 2010. Owners may contact eldorado national—kansas at 1-800-955-9086.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) CHRYSLER / TOWN AND COUNTRY 1997-2007 DODGE / CARAVAN 1996-2007 PLYMOUTH / VOYAGER 1996-2004 EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: CURT / CLASS 3 MANUFACTURER: CURT MFG. INC. COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 6686 SUMMARY: Curt mfg is recalling certain class 3 receiver hitches, p/n 13347, sold as aftermarket equipment for use on 1997-2007 Chrysler town and country vans, 1996-2007 dodge caravans, and 1996-2004 Plymouth voyager vans. When the hitch is loaded to the maximum rating, the hitch may fracture or break at the bend location where the main body of the hitch meets the hitch muffler strap. No picture available.	CONSEQUENCE If the area in question fractures or breaks, this could cause an unstable driving condition, possibly resulting in a crash.	REMEDY curt mfg will notify owners of record and will replace the hitch free of charge. The safety recall is expected to begin during august 2010. Owners may contact curt mfg at 1-715-831-8713.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) HONDA / VT1300CR 2010 HONDA / VT1300CRA 2010 HONDA / VT1300CT 2010 MANUFACTURER: HONDA (AMERICAN HONDA MOTOR CO.) COMPONENT: EQUIPMENT:OTHER:LABELS POTENTIAL NUMBER OF UNITS AFFECTED: 3184 SUMMARY: Certain model year 2010 Honda vt1300cr, vt1300cra, and vt1300ct motorcycles manufactured from December 17, 2009 through May 24, 2010, fail to conform to the certification requirements of part 567. The gross axle weight rating (gawr) is incorrect. No picture available.	CONSEQUENCE An owner may be lead to believe from the incorrect information the motorcycle can carry more weight that it is certified to carry, resulting in an overloaded condition which can increase the risk of a crash.	REMEDY The owners of all affected motorcycles will be mailed a letter containing a durable correction sticker and installation instructions. If the owner prefers that the dealer apply the sticker, they will be instructed to take their motorcycle to a Honda dealer who will apply the corrected label free of charge. The campaign is expected to begin on or about august 20, 2010. Owners may contact Honda at 1-310-783-2000.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: XANTREX / FREEDOM SW 3000 MANUFACTURER: SCHNEIDER ELECTRIC HOLDINGS, INC. COMPONENT: EQUIPMENTPotential Number of Units Affected: 572 SUMMARY: XANTREX technology has decided that certain freedom sw 3000 electric inverters/charges sold as aftermarket equipment and also installed as original equipment in some recreational vehicles contain a safety defect. Due to poor soldering in close proximity to inadequately torqued bus bars in the product, melted solder can result in a short circuit failure. No picture available.	CONSEQUENCE A short circuit can result in the unit overheating, possibly resulting in a fire.	REMEDY XANTREX will notify the owners of the aftermarket equipment and will repair or replace the units free of charge. The safety recall is expected to begin during august 2010. Owners may contact xantrex at 1-800-670-0707.
AUSTRALIA	SAF-Holland (Aust) Pty Ltd—2" Kingpin Type 65 - KPB-51050 PRODUCT DESCRIPTION Flange bolt-on 2" Kingpins Type 65 - KPB-51050, rated as D=210kN. IDENTIFYING FEATURES KPB-51050 SUPPLIER SAF-Holland (Aust) Pty Ltd SUPPLIER'S WEB SITE http://www.safholland.com.au 	HAZARDS Kingpin could potentially wear quicker than usual DEFECTS The Kingpins conform to the relevant AS/NZS 4968.3:2003 standard up to certain D-value. However, they may experience a shorter life as a consequence of a combination of factors.	CONSUMERS ACTION If you have purchased an affected Kingpin please go to the place of purchase and for a installation of a replacement Kingpin.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: SUBURBAN / RSA3LBBE SUBURBAN / RSA3LBGE SUBURBAN / RSA3LBSE SUBURBAN / RSA3LPSS SUBURBAN / RSA3SBBE SUBURBAN / SRS3SPSS MANUFACTURER: SUBURBAN MANUFACTURING CO COMPONENT: EQUIPMENTPotential Number of Units Affected: 491 SUMMARY: Suburan is recalling certain gas cook stoves with sealed burners and oven manufactured from November 2, 2009 through july 31, 2010, sold as aftermarket equipment and sold as originally installed equipment on various recreational vehicles. The units involved use an aluminum tube to carry lp gas from the over control valve to the gas orifice which supplies gas to the burner. The tube may break resulting in a gas leak. No picture available.	CONSEQUENCE A gas leak occurring in the area of the oven pilot can cause a flash when the gas ignites, and would cause a fire if the oven valve is not properly turned off.	REMEDY SUBURBAN will notify owners of record who purchased the equipment as aftermarket and will repair the units free of charge. Suburban will notify the vehicle manufactures on whose vehicles the equipment was installed as original equipment and coordinate with those manufacturers to have their owners notified and the free remedy provided. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact suburban at 1-423-775-2131.
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: STABILUS / BLOC-O-LIFT Manufacturer: NATIONAL SEATING COMPANY COMPONENT: SEATS POTENTIAL NUMBER OF UNITS AFFECTED: 3892 SUMMARY: National seating co. (NSC) is recalling certain stabilus bloc-o-lift, p/n 5561ed, driver seats manufactured from March 10 through December 4, 2009, sold for use as aftermarket service parts and also sold as originally installed equipment in certain school and commercial buses. The weld which holds the mounting tab to the shock body was improperly welded and can break. No picture available.	CONSEQUENCE The seat could drop unexpectedly with out prior warning and could cause momentary loss of steering control, possibly resulting in a crash.	REMEDY NSC will notify the owners of the aftermarket equipment and will repair the affected seats free of charge. The safety recall is expected to begin during august 2010. Owners may contact nsc at 1 -423-884-6651.

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS