

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 31 AUGUST 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 12



[Motor Vehicle \(27\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(5\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/IRELAND	CATEGORY: Motor vehicles PRODUCT: Passenger car - Jazz BRAND: Honda TYPE/NUMBER OF MODEL: The recall concerns some vehicles produced in 2010. The VINs of the 11 vehicles affected are attached. DESCRIPTION: Passenger car COUNTRY OF ORIGIN: United Kingdom No picture available	INJURIES The tyres on the affected vehicles may have a cut on the inner sidewall, which in the long term may eventually lead to sudden deflation which may result in an accident.	Voluntary corrective actions taken by the manufacturer.
EU/POLAND	CATEGORY: Motor vehicles PRODUCT: Passenger car - XF/XK BRAND: Jaguar TYPE/NUMBER OF MODEL: 1. XF V8 5.0L, model year: 2010, VIN range: R36913 – R59480 2. XK V8 5.0L, model year: 2010/2011, VIN range: B28268 – B39482 DESCRIPTION: Passenger car COUNTRY OF ORIGIN: United Kingdom No picture available	INJURIES The product poses a risk of injuries because the in-tank electric fuel pump may not be correctly activated following a vehicle start-up cycle which can lead to the engine cutting out without any detectable warning signs which could lead to a road accident.	Voluntary corrective actions taken by the manufacturer.
EU/France	CATEGORY: Motor vehicles PRODUCT: Motor scooter - Moving 50cc BRAND: Qingqi / Hooper TYPE/NUMBER OF MODEL: Type QM50QT2EC Type approval No e4*2002/24*1358*00. Models manufactured in 2009 until June 2010. Chassis numbers starting with: LAEA BZ4009B99 (followed by 4 characters). DESCRIPTION: Four-stroke petrol-engine scooter with 12-inch alloy wheels. COUNTRY OF ORIGIN: China 	INJURIES The product poses a risk of injuries because there is a possibility that the chassis can break at the level of the horizontal and longitudinal spars at the centre of the scooter, due to a structural weakness, with a consequent risk of an accident. Ten cases of breakage have been reported, including one serious case involving a fatality.	Voluntary recall from consumers by the importer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Passenger car—ZAFIRA-B and COMBO-C BRAND: Opel TYPE/NUMBER OF MODEL: ZAFIRA-B: VIN from 6 2 000073 to 7 2 093405 COMBO-C: VIN from 5 3 030635 to 7 3 027257 DESCRIPTION: Passenger car COUNTRY OF ORIGIN: Poland No picture available	FIRE The product poses a risk of fire because the magnetic valve of the fuel tank may deteriorate potentially causing fuel leaks.	Voluntary corrective actions taken by the manufacturer.
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Motorcycle - XT1200Z BRAND: Yamaha TYPE/NUMBER OF MODEL: XT1200Z, code 23P1/23P2 DESCRIPTION: 1200 cc motorcycle. COUNTRY OF ORIGIN: Japan No picture available	INJURIES The product poses a risk of injuries because the top-box mounting plate may break as it is not sufficiently strong and this may cause the top-box to come off and fall from the motorcycle causing injuries to third parties.	Voluntary corrective actions taken by the manufacturer.
EU/POLAND	CATEGORY: Motor vehicles PRODUCT: Passenger car - Wrangler BRAND: Jeep TYPE/NUMBER OF MODEL: Wrangler, JK (Recall campaign K15). Cars made from 22 April 2010 to 19 May 2010. VIN NUMBERS OF THE FOURTEEN CARS AFFECTED IN POLAND: 1J4HA6H58AL199635 1J4HA6H50AL202446 1J4HA2D52AL199435 1J4HA3H52AL196583 1J4HA3H56AL196585 1J4HA3H54AL196584 1J4HA2D5XAL199764 1J4HA3H52AL199774 1J4HA3H56AL199762 1J4HA3H58AL199763 1J4HA3H50AL199773 1J4HA3H58AL199651 1J4HA3H5XAL199652 1J4HA6H59AL202171 DESCRIPTION: Passenger car. COUNTRY OF ORIGIN: United States No picture available	INJURIES The product poses a risk of injuries because there is a possibility that the braking system may lose brake fluid, consequently reducing braking performance and increasing the risk of road accident.	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	Jayco—Motor Homes PRODUCT DESCRIPTION Selected Jayco motor homes IDENTIFYING FEATURES Selected chassis numbers between M90120 and M90210 Target Number: 30 Campaign Number: JC0022 SUPPLIER Jayco Corporation Pty Ltd No picture available.	HAZARDS Vehicle malfunction DEFECTS Selected motor homes may have been manufactured with a screw that has been screwed through the floor, possibly piercing the wiring loom.	CONSUMERS ACTION Contact your authorised Jayco dealer to inspect the wiring and repair if necessary.
AUSTRALIA	Jayco—Motor Homes PRODUCT DESCRIPTION Selected Jayco motor homes IDENTIFYING FEATURES Selected chassis numbers between M90135 and M90240 Target Number: 91 Campaign Number: JC0023 SUPPLIER Jayco Corporation Pty Ltd No picture available.	HAZARDS There is the potential for the gas to leak. DEFECTS The gas pipe for the hot water service may have been damaged during manufacture of the motor home.	CONSUMERS ACTION Contact your authorised Jayco dealer to inspect and replace any damaged gas pipes to the hot water service
AUSTRALIA	Ateco Automotive Pty Ltd—Fiat 500 PRODUCT DESCRIPTION Fiat 500 vehicles IDENTIFYING FEATURES Target Number: 226 Campaign Number: 5583 SUPPLIER Ateco Automotive Pty Ltd SUPPLIER'S WEB SITE http://www.fiat.com.au No picture available.	HAZARDS The side bags could inflate inconsistently with the impact side. DEFECTS Air bag control unit software non-compliance in cases of side impact.	CONSUMERS ACTION Contact your authorised Fiat Dealer. For any additional information and assistance, please call Fiat Customer Assist on the toll free number 1800 786 885.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAKER	MEASURES ADOPTED
AUSTRALIA	Jaguar—XF and XK 5.0L Normally Aspirated V8 Models PRODUCT DESCRIPTION XF and XK 5.0L Normally Aspirated V8 Models IDENTIFYING FEATURES VIN Range: Jaguar XF 2010 MY—R36913 to R59480 Jaguar XK 2010 and 2011 MY—B28268 to B39482 Target Number: 81 Campaign Number: J017 SUPPLIER Jaguar Australia No picture available.	HAZARDS It is possible that the engine may cut out whilst driving, but the engine can be instantly re-started. Power Assisted Steering (PAS) will be lost once the vehicle speed drops below the torque converter speed threshold, however, the vehicle steering will remain functional with increased steering effort required. DEFECTS The in-tank electric fuel pump may not be correctly activated following a vehicle start-up cycle.	CONSUMERS ACTION Letters will be sent to affected owners. Owners are advised to contact their authorised Jaguar dealer who will introduce new software to prevent the fuel pump de-energising whilst the engine is running.
AUSTRALIA	Scania Australia Pty Ltd—Rigid Trucks with Two-Bellows Rear Air Suspension –Low Torque for Bolts PRODUCT DESCRIPTION Rigid trucks with two-bellows rear air suspension IDENTIFYING FEATURES Target number: 64 Campaign number: RC 101203 See attached supporting documentation for chassis list. SUPPLIER Scania Australia Pty Ltd No picture available.	HAZARDS Vehicle malfunction. DEFECTS There have been instances where the M20 bolts for the spring brackets for the driven axle and tag axle, have not been tightened to the correct torque during production.	CONSUMERS ACTION Contact your authorised Scania dealership for inspection and replacement of bolts if necessary.
USA	MANUFACTURER: Nissan SUMMARY: Nissan is recalling certain model year 2010 Nissan Frontier king cab vehicles manufactured from June 10, 2010 through June 26, 2010. These vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 225, "Child Restraint Anchorage Systems." The weld between the tether anchor and the seat gusset bracket is out-of-specification. As a result, and based on Nissan's engineering judgment, the tether anchor could separate from the seat when tested under the conditions required by the standard. No picture available.	CONSEQUENCE In the event of a crash, the tether anchorage could separate from the vehicle seat increasing the risk of injury to an occupant in a child seat that uses the tether anchor.	REMEDY The seat gusset containing the tether anchorage will be replaced with a new one free of charge. The safety recall began on August 30, 2010. Owners may contact Nissan at 1-800-647-7261.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	MANUFACTURER: MCI SUMMARY: MCI is recalling certain model year 2001-2004 E4500, model year 2002-2006 E4500C, model year 2001-2005 J4500, and model year 2006 J4500C motor coaches equipped with SE-GI passenger windows. The adhesive bond between the window glass and the aluminum window frame on the affected coaches may degrade. No picture available.	CONSEQUENCE If the window glass becomes partially or completely debonded from its frame, the window glass may detach and fall from the coach and cause personal injury or property damage.	REMEDY Dealers will inspect, test, and repair, as necessary, the SE-GI window assemblies free of charge. The safety recall began on August 23, 2010. Owners may contact MCI Customer Service at 1-800-241-2947. MCI's recall campaign 348.
USA	MANUFACTURER: Mazda SUMMARY: Mazda is recalling certain model year 2007-2009 Mazda3 and Mazda5 vehicles manufactured from April 2, 2007 through November 30, 2008. These vehicles may have a condition in which a sudden loss of power steering assist could occur at any time while driving the vehicle. No picture available.	CONSEQUENCE Power steering assist is suddenly lost reducing the driver's ability to steer the vehicle as typically expected, and increasing the risk of a crash.	REMEDY Due to short supply of parts, the first phase of mailing of owner notification letters will begin on or before September 15, 2010 and the second phase mailing will begin in September 2010 and be completed in February 2011. Owners may contact Mazda Customer Assistance Center at 1-800-222-5500.
USA	MANUFACTURER: General Motors SUMMARY: General Motors is recalling certain model year 2009-2010 Chevrolet Traverse, Buick Enclave, GMC Acadia, and Saturn OUTLOOK vehicles. The second row seat side trim shield restricts the upward rotation of the safety belt buckle when the seat back is returned to a seating position after being folded flat. If the buckle contacts the seat frame, additional effort is required to return the seat to a seating position. If sufficient force is applied, the buckle cover could be pushed down the strap, exposing and partially depressing the red release button. No picture available.	CONSEQUENCE The safety belt may not restrain the occupant as intended during a crash, increasing the risk of injury to the seat occupant.	REMEDY Dealers will modify the second row seat side trim shields. If a safety belt buckle is damaged, dealers will replace it free of charge. The safety recall began on August 18, 2010. Owners may contact Chevrolet at 1-800-630-2438, Buick at 1-866-608 – 8080, GMC at 1-866-996-9463, and Saturn at 1-800-972-8876, or at the owner center at www.gmownercenter.com. GM's recall No. N100243.
USA	MANUFACTURER: Spartan SUMMARY: Spartan is recalling certain model year 2009 and 2010 emergency rescue chassis manufactured from February 3, 2009 through June 3, 2010. The control module which houses the cab tilt control circuit is subject to fluid intrusion. When fluid enters the module, an electrical short could occur causing the cab to tilt (hoist) without warning. No picture available.	CONSEQUENCE If the cab were to tilt while the vehicle is in motion, it may surprise the driver who may then react adversely which could result in a crash.	REMEDY Spartan will notify owners and dealers will repair the vehicles free of charge. Owners may contact Spartan at 1-800-543-4277 Option 1. Spartan's recall campaign number is 10017.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	MANUFACTURER: Micro Bird SUMMARY: Certain Girardin model year 2006 through 2010 and Micro Bird by Girardin model year 2009 through 2010 G5 transit buses fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 217, "Bus Emergency Exits and Window Retention and Release." The vehicles are equipped with tslider or panoramic type push-out windows with 2 release mechanisms (one on each side). The window handle base spacer plate can tear due to the rotation of the exterior window frame. In the event of a crash, the emergency exit could not sufficiently restrain the occupant(s) or become inoperable. No picture available.	CONSEQUENCE The occupant(s) could be thrown from the vehicle or not be capable of opening the emergency exits which could cause injury or death of the vehicle occupant(s).	REMEDY Manufacturer has not yet provided the agency with a remedy plan or notification schedule. Owners may contact Micro Bird at 1-819-477-2012. Corp. Micro Bird, Inc.'s recall campaign number is 10-038-WIU.
USA	MANUFACTURER: Club Car SUMMARY: Club Car is recalling certain model year 2010 Villager 2+2 LVS passenger vehicles manufactured from April 14 through July 18, 2010. The pedal may be missing a critical load bearing weld between the brake arm and the pivot shaft. No picture available.	CONSEQUENCE If the weld is missing, the brake pedal may fail during operation resulting in a loss of braking, which could result in a crash.	REMEDY Club Car will notify owners and dealers will, if necessary, replace the pedal free of charge. The safety recall began on August 27, 2010. Owners may contact Club Car at 1-800-227-0739. Club Car's recall campaign number is 5J5.
USA	MANUFACTURER: Hyundai-Kia SUMMARY: Hyundai-Kia is recalling certain model year 2010 Soul and model year 2011 Sorento vehicles manufactured from September 7, 2009 through July 30, 2010. A limited number of wiring harnesses supplied by JCI and used for the lighting in the KIA Soul vehicle's advanced lighting speakers, located in the front door trim panels, and the KIA Sorento vehicle's interior accent illumination, located in the front and rear door trim panels, may have been improperly soldered. No picture available.	CONSEQUENCE When the lights are illuminated under certain conditions, an electrical short may occur that can result in a fire.	REMEDY Dealers will replace the wiring harnesses for the lights in the KIA soul vehicle's advanced lighting speakers, and the wiring harness for the KIA Sorento vehicle's interior accent illumination. This service will be performed free of charge. The safety recall is expected to begin during September 2010. Owners may contact KIA consumer Assistance center at 1-800-333-4542.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	MANUFACTURER: Blue Bird SUMMARY: Blue Bird is recalling certain model year 2007 through 2010 All American school buses manufactured from May 29, 2006 through August 7, 2010 equipped with Cummins ISB-02, ISB-07, and ISB-10 engines. An incorrect combination of flat washer and serrated nut was installed on the bolt that secures the starter cable retaining clamp to its attaching bracket at the front of the engine above the engine cooling fan. The flat washer prevents the serrated nut from locking against the attaching bracket. Over time, the serrated nut may back off allowing the starter cable to fall and contact the fan hub while in operation. If the starter cable contacts the fan hub while the fan hub is in operation, the cable covering may abrade which could result in a direct short. No picture available.	CONSEQUENCE A short could potentially result in a vehicle fire.	REMEDY Blue Bird will notify owners and repair the buses free of charge. The safety recall is expected to begin on or about September 24, 2010. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign number is R10SL.
USA	MANUFACTURER: Blue Bird SUMMARY: Blue Bird is recalling certain model year 2007 through 2010 All American non school buses manufactured from July 16, 2006 through August 3, 2010 equipped with Cummins ISB-02, ISB-07, and ISB-10 engines. An incorrect combination of flat washer and serrated nut was installed on the bolt that secures the starter cable retaining clamp to its attaching bracket at the front of the engine above the engine cooling fan. The flat washer prevents the serrated nut from locking against the attaching bracket. Over time, the serrated nut may back off allowing the starter cable to fall and contact the fan hub while in operation. If the starter cable contacts the fan hub while the fan hub is in operation, the cable covering may abrade which could result in a direct short. No picture available.	CONSEQUENCE A short could potentially result in a vehicle fire.	REMEDY Blue Bird will notify owners and repair the buses free of charge. The safety recall is expected to begin on or about September 24, 2010. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign number is R10SL.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	MANUFACTURER: Jag Mobile Solutions SUMMARY: Jag Mobile Solutions is recalling certain model year 2006 through 2011 Porta-Lisa and Porta-Lisa Plus mobile restrooms, showers, and combinations towable trailers. The hitch assembly of the chassis may be built with steel tubes that are not of adequate size to withstand the forces exerted on the hitch while in certain applications. No picture available.	CONSEQUENCE The hitch on the front of the trailer could crack and become nonfunctional or break completely separating the trailer tongue from the rest of the chassis, which could result in a crash.	REMEDY Jag will notify owners and Dexter Chassis Group field representatives or their assigned agents will repair the trailers free of charge. The safety recall began in August 2010. Owners may contact Jag at 1-260-562-1045.
USA	MANUFACTURER: Navistar SUMMARY: Navistar is recalling certain model year 2008 through 2011 International ProStar and LoneStar heavy trucks manufactured from January 2, 2007 through June 1, 2010. The passenger side windshield wiper linkage rod may separate from either the wiper drive arm or passenger side pivot assembly. No picture available.	CONSEQUENCE When the linkage separates, the passenger side wiper arm will no longer operate which could lead to reduced driver visibility, increasing the risk of a crash.	REMEDY Navistar will notify owners and international dealers will replace the windshield wiper linkage assembly free of charge. The safety recall is expected to begin on or about December 17, 2010. Owners may contact Navistar at 1-800-448-7825. Navistar's campaign number is 10514.
USA	MANUFACTURER: Toyota SUMMARY: Toyota is recalling certain model year 2005-2008 Corolla and Corolla Matrix vehicles. The engine control module (ECM) for the subject models equipped with the 1ZZ-FE engine and two-wheel drive may have been improperly manufactured. There is a possibility that a crack may develop at certain solder points or on varistors on the circuit board. There are a variety of warnings and consequences associated with the defect. The engine warning lamp could be illuminated, harsh shifting could result, the engine may not start, or the engine could shut off while the vehicle is being driven. No picture available.	CONSEQUENCE An engine shutoff while the vehicle is being driven increases the risk of a crash.	REMEDY Dealers will inspect the production number of the ECM and replace the ECM if necessary. This service will be performed free of charge. Toyota will mail an interim owner notification the middle of September 2010 to advise owners of this defect and recall. This interim notification will inform owners that they will receive a future notification when parts become available to have the free remedy performed on their vehicle. A schedule has not been set for the future notifications. Owners may contact Toyota at 1-800-331-4331.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	MANUFACTURER: Ford SUMMARY: Ford is recalling certain model year 1998-2003 Windstar vehicles manufactured from September 1, 1997 through February 28, 2003 and currently registered or originally sold in Connecticut, Delaware, District of Columbia, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, and Wisconsin. After many years of vehicle service in these areas, corrosion can weaken the rear axle, making it susceptible to torsional stress. Corrosion and stress can lead to cracks which if undetected can propagate and result in a complete fracture of the axle. No picture available.	CONSEQUENCE A fractured axle can affect vehicle handling and increase the risk of a crash.	REMEDY As parts become available, dealers will inspect and if necessary install the rear axle reinforcement brackets free of charge. This service will be performed free of charge. The safety recall is expected to begin on or before September 27, 2010. Owners may contact Ford at 1- 866-436-7332.
USA	MANUFACTURER: KME SUMMARY: KME is recalling certain model year 2007 through 2009 Predator model emergency vehicles manufactured from October 15, 2007 through November 23, 2009, and equipped with Detroit Diesel Series 60 engines. The software on these engines may cause the engine to shut down unexpectedly when a diesel particulate filter over-temperature condition is detected. No picture available.	CONSEQUENCE Unexpected emergency vehicle engine shutdown could hamper rescue operations and put first responders and or the public at risk.	REMEDY All customers with affected vehicles have been contacted by Daimler Trucks and repairs will be performed by Detroit Diesel. Please see Daimler Trucks/Detroit Diesel's defect report 10E-005. Owners may contact Detroit Diesel at 1-800-547-0712 or on line http://www.detroitdiesel.com/supportnetwork.
USA	MANUFACTURER: GM SUMMARY: GM is recalling certain model year 2005-2008 Pontiac vibe vehicles. The engine control module (ECM) for the subject models equipped with the 1ZZ-FE (LV6) engine and two-wheel drive may have been improperly manufactured. There is a possibility that a crack may develop at certain solder points or on varistors on the circuit board. There are a variety of warnings and consequences associated with the defect. The engine warning lamp could be illuminated, harsh shifting could result, the engine may not start, or the engine could shut off while the vehicle is being driven. No picture available.	CONSEQUENCE An engine shutoff while the vehicle is being driven increases the risk of a crash.	REMEDY Dealers will inspect the production number of the ECM and replace the ECM if necessary. This service will be performed free of charge. GM has not yet provided an owner notification schedule. Owners may contact gm at 1 -800-620-7668.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	MANUFACTURER: General Parts, Inc. (GPI) SUMMARY: General Parts, Inc. (GPI) is recalling certain Proven Valu alternators sold as replacement equipment for various motor vehicles, part numbers 1386A, 8237A, 8237AN, 8274A, 8290A, 8290AN, 8292A, AND 8292AN. The internal voltage regulator can become damaged by transient voltage that may occur when the regulator and alternator are built, tested, and installed. No picture available.	CONSEQUENCE When the circuit is damaged, there is a potential to generate sufficient heat to result in an engine compartment fire or heat damage, even when the vehicle is off.	REMEDY GPI will notify owners of record who purchased the alternators and replace the alternators free of charge. The safety recall began on May 5, 2010. Owners may contact GPI at 1-919-573-3000.
USA	MANUFACTURER: Webasto SUMMARY: Webasto is recalling certain Hollandia 700 and 600 series and Hollandia TVS 900 series sunroofs sold as aftermarket equipment for various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. These conditions may be observable for several months before complete glass-to-frame adhesion debonding can ultimately occur. No picture available.	CONSEQUENCE In the event of a separation, the falling glass could cause a road hazard that results in a vehicle crash or could strike a trailing vehicle.	REMEDY Webasto will notify owners of record and installers will repair the sunroofs free of charge. Webasto also plans to launch a public notification campaign that may include press releases and website postings, among other materials. The safety recall is expected to begin during September 2010. Owners may contact Webasto at 1-888-749-8632.
USA	MANUFACTURER: Garmin SUMMARY: Garmin is recalling certain nuvi model portable automotive GPS products sold for use as aftermarket equipment and sold and installed as original equipment in certain passenger vehicles that contain thirdparty lithium-ion batteries manufactured in a certain date range. In rare circumstances the batteries contained in the affected GPS units can overheat. No picture available.	CONSEQUENCE Overheated batteries could result in a fire. Garmin will notify owners of record and technicians will repair the	REMEDY GPS units by replacing the battery and inserting a spacer on top of the battery free of charge. Garmin also plans to launch a public notification campaign that will include press releases and website postings, among other materials. The safety recall began on August 23, 2010. Owners may contact Garmin at 1-913-397-8200.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	MANUFACTURER: Yamaha SUMMARY: Yamaha is recalling certain accessory Yamaha Double "T" Fat handlebars , part numbers STR-5PX75- 12-00 and STR-4WM75-12-00, manufactured from August 1, 2008 through July 31, 2009, to be used on model year 2002-2009 XV1700PC Warrior, 1999-2003 VX1600 and 2004-2010 XV1700 Road Star motorcycles. These handlebars may have tubing thinner than designed where the bars narrow for the switch housings and grips. The affected handlebars could be weak enough in the area to break. No picture available.	CONSEQUENCE Should this breakage occur while the motorcycle is being operated, the operator could lose control of the motorcycle which could result in a crash.	REMEDY Yamaha will notify owners of record and dealers will replace the affected handlebars free of charge. The safety recall began on August 31, 2010. Owners may contact Yamaha toll-free at 1-800-962-7926.
USA	MANUFACTURER:Goodyear SUMMARY: Goodyear is recalling certain Dunlop SP193 commercial trailer tires, size 295/75R22.5, produced from January 24 through May 29, 2010. These tires could experience air loss and if gone undetected, the tire could be driven while under inflated. No picture available.	CONSEQUENCE Driving a vehicle with under inflated tires increases the risk of a crash. Goodyear will notify owners of record and will visually inspect the tires for the defect. If the defect is present,	REMEDY Goodyear dealers will replace the tires free of charge. If the defect is not present at the time of inspection, the tire is ok and will not need to be replaced. The safety recall is expected to begin on or about September 30, 2010. Owners may contact Goodyear at 1-800-321-2136.

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS