

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 DECEMBER 2010

## CONTENTS

### AUTOMOTIVE

Pages 1 to 19



[Motor Vehicle \(35\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(8\)](#)

**AUTO: MOTOR VEHICLE**

NOTIFYING COUNTRY	PRODUCT	VEHICLE MAKE / MODEL	MODEL YEAR(S)	CONSEQUENCE	MEASURES ADOPTED
USA	<b>VEHICLE MAKE / MODEL</b> NEW FLYER / D40LF NEW FLYER / DE60LF NEW FLYER / E40LFR	<b>MODEL YEAR(S)</b> 2008 2008-2009 2008	<b>CONSEQUENCE</b> Failure of a radius rod bracket assembly may result in restricted steering capability increasing the risk of vehicle crash, injury or death.	<b>REMEDY</b> Dealers will inspect for radius rod brackets and will be replaced with certified product free of charge. The safety recall is expected to begin during December 2010. Owners may contact new flyer at 204-934-4876.	
	<b>MANUFACTURER:</b> NEW FLYER INDUSTRIES LTD <b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 522 <b>SUMMARY:</b> New flyer is recalling certain model year 2008-2009 heavy duty transit buses. The radius rod bracket which attaches the front axle radius rods to the vehicle frame may be missing two of the four required welds. No picture available.				
USA	<b>VEHICLE MAKE / MODEL</b> ALTEC / AT35-G ALTEC / AT37-G	<b>MODEL YEAR(S)</b> 1998-2008 1998-2008	<b>CONSEQUENCE</b> Failure of the glue bond and fasteners could result in separation of the fiberglass link from the steel inserts. As a result, the platform on which a service technician would stand could fail during use resulting in death or serious injury.	<b>REMEDY</b> Altec will provide instructions on how to inspect the fiberglass insulating link and fasteners. This service will be performed free of charge. The safety recall is expected to begin during December 2010. Owners may contact altec at 1-877-462-5832.	
	<b>MANUFACTURER:</b> ALTEC INDUSTRIES INC. <b>SUMMARY:</b> Altec is recalling certain model year 1998-2008 aerial devices vehicles built from January 1998 through may 2008. The glue bond joint in the insulating arm link may fail over time. The connection is also secured by eight bolts, but with the loss of the glue bond, the fasteners could fatigue over time and fail. No picture available.				
USA	<b>VEHICLE MAKE / MODEL</b> KIA / SORENTO	<b>MODEL YEAR(S)</b> 2011	<b>CONSEQUENCE</b> As a result, brake fluid will leak, followed by illumination of the malfunction indicator light indicating the brake fluid level is low and should be checked, then a soft or spongy brake pedal feel, and if not serviced, reduced braking power which could increase the risk of a crash.	<b>REMEDY</b> Dealers will inspect the rear calipers and replace it if necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact kia consumer assistance center at 1-800-333-4542.	
	<b>MANUFACTURER:</b> KIA MOTORS CORPORATION <b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC: FOUNDATION COMPONENTS:DISC:CALIPER <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 7697 <b>SUMMARY:</b> Kia is recalling certain model year 2011 sorento vehicles manufactured from September 14, 2010, through October 4, 2010. Some of the rear brake calipers may not have been properly machined. No picture available.				

**AUTO: MOTOR VEHICLE**

<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b>    <b>MODEL YEAR(S)</b> MAZDA / MAZDA5                      2009-2010</p> <p><b>MANUFACTURER:</b> MAZDA MOTOR CORP <b>COMPONENT:</b> FUEL SYSTEM, OTHER: DELIVERY:FUEL PUMP</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 16200</p> <p><b>SUMMARY:</b> Mazda is recalling certain model year 2009-2010 mazda5 vehicles manufactured from june 29, 2009, through april 28, 2010. Water may not have been removed completely from the harness connector of the fuel pump due to variations in the fuel tank leak check process performed before vehicle assembly. The connector pin may corrode, potentially causing the pin to break.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could lead to an inoperative fuel pump, engine stall and the inability to restart the engine increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect the fuel pump connector and if necessary it will be replaced and the harness will be repaired free of charge. The safety recall is expected to begin on or before December 11, 2010. Owners may contact mazda customer assistance center at 1-800-222-5500.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>    <b>MODEL YEAR(S)</b> KENWORTH / T660                      2011 KENWORTH / T800                      2011</p> <p><b>MANUFACTURER:</b> PACCAR INCORPORATED <b>COMPONENT:</b> EQUIPMENT:OTHER:LABELS</p> <p><b>POTENTIAL</b> Number of Units Affected: 73</p> <p><b>SUMMARY:</b> Paccar is recalling certain model year kenworth t660 and t800 vehicles manufactured from September 15, 2010, through November 9, 2010, for failing to comply with the requirements of federal motor vehicle safety standard no. Part 567, "certification." the steer axle gawr and gvwr recorded on the vehicle's door labels may be inaccurate and overstate the actual load capacity of components installed on the vehicle.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This may lead to an owner overloading the vehicle which can increase the risk of a tire failure and crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect and replace the door labels free of charge. The safety recall is expected to begin during December 2010. Owners may contact kenworth at 425-828-5440.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>    <b>MODEL YEAR(S)</b> KIA / SORENTO                              2011</p> <p><b>MANUFACTURER:</b> KIA MOTORS CORPORATION</p> <p><b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC: FOUNDATION COMPONENTS:DISC:CALIPER</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 7697</p> <p><b>SUMMARY:</b> Kia is recalling certain model year 2011 sorento vehicles manufactured from September 14, 2010, through October 4, 2010. Some of the rear brake calipers may not have been properly machined.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>As a result, brake fluid will leak, followed by illumination of the malfunction indicator light indicating the brake fluid level is low and should be checked, then a soft or spongy brake pedal feel, and if not serviced, reduced braking power which could increase the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect the rear calipers and replace it if necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact kia consumer assistance center at 1-800-333-4542.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DANGER	MEASURES ADOPTED
USA	<b>VEHICLE MAKE / MODEL</b> <b>MODEL YEAR(S)</b> VAN HOOL / A300K                      2006 2008-2009 VAN HOOL / A300K HYB                      2005 VAN HOOL / A300L                      2008-2010 VAN HOOL / A330                      2002-2004 VAN HOOL / A330FC                      2004 VAN HOOL / AG300                      2002-2004 2006-2007 2009 VAN HOOL / C2045                      2006-2011 VAN HOOL / T2140                      2006-2010 VAN HOOL / T2145                      2006-2010 VAN HOOL / TD925                      2008-2011  <b>MANUFACTURER:</b> VAN HOOL N.V.  <b>COMPONENT:</b> VISIBILITY:REARVIEW MIRRORS/DEVICES:INTERIOR  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1673  <b>SUMMARY:</b> Van hool is recalling certain model year 2002 through 2011 transit buses manufactured from august 2002 through october 2010, equipped with hadley remote mirror switches, part numbers 509vh and 509vh1f. The rear view mirror switch may overheat, causing the plastic housing to melt.  No picture available.	<b>CONSEQUENCE</b>  Excessive heating can cause a fire resulting in smoke, operator distraction, or personal injury. An overheated mirror switch could cause the exterior rear view mirrors to not operate. The mirrors may not adjust properly from the interior switch or operate poorly. Therefore, the driver may not be able to have full use of the rear view mirror, increasing the risk of a crash..	<b>REMEDY</b>  Van hool will notify owners and dealers will repair the buses free of charge. The manufacturer has not yet provided the agency with a notification schedule.	
USA	<b>VEHICLE MAKE / MODEL</b> <b>MODEL YEAR(S)</b> SKYLINE / ALJO                      2011 SKYLINE / LAYTON                      2011 SKYLINE / MOUNTAIN VIEW                      2011 SKYLINE / NOMAD                      2011 SKYLINE / WEEKENDER                      2011  <b>MANUFACTURER:</b> SKYLINE CORPORATION  <b>COMPONENT:</b> WHEELS:RIM  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 57  <b>SUMMARY:</b> Skyline is recalling certain model year 2011 layton, aljo, nomad, weekender, and mountain view recreational vehicles and fifth wheel travel trailers manufactured from august 23, 2010, through september 28, 2010, equipped with tredit tire 15" painted wheels, models spoke or mod. Some of the wheels, which fasten to the axle of the vehicle body and serve as a mounting point for tires, could contain mis-aligned welds.  No picture available.	<b>CONSEQUENCE</b>  The wheels may break while in use, increasing the risk of a crash.	<b>REMEDY</b>  Skyline will notify owners and repair the vehicles free of charge. The safety recall is expected to begin during December 2010. Owners may contact skyline consumer relations at 1-800-733-4250.	

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>KEYSTONE / COUGAR                      2011  KEYSTONE / ENERGY                      2011  KEYSTONE / HORNET                      2011  KEYSTONE / LAREDO                      2011  KEYSTONE / OUTBACK                      2011  KEYSTONE / SPRINGDALE                      2011  KEYSTONE / SPRINTER                      2011</p> <p><b>MANUFACTURER:</b> KEYSTONE RV COMPANY  <b>COMPONENT:</b> WHEELS  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  2338</p> <p><b>SUMMARY:</b> Keystone is recalling certain model year 2011 travel trailers equipped with 15" x 6" white spoke or modular design steel wheels with a six hole bolt pattern. Some of the wheels may have inadequate weld penetration between the outer ring and the center plate due to improper plate alignment.  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>There could be a potential wheel failure and wheel loss increasing the risk of a crash, or personal injury.</p>	<p><b>REMEDY</b></p> <p>Keystone will replace the wheels free of charge. The safety recall is expected to begin during December 2010. Owners may contact keystone at 1-866-425-4369.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>COACHMEN / CATALINA                      2011  COACHMEN / FREEDOM EXPRESS                      2011</p> <p><b>MANUFACTURER:</b> COACHMEN RV COMPANY, LLC  <b>COMPONENT:</b> WHEELS  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  215</p> <p><b>SUMMARY:</b> Coachmen is recalling certain model year 2011 catalina and freedom express coaches manufactured from august 23, 2010, through september 28, 2010 and equipped with 15" x 6" white spoke or modular design steel wheels with a six hole bolt pattern. Some of the wheels may have inadequate weld penetration between the outer ring and the center plate due to improper plate alignment.  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>There could be a potential wheel failure and wheel loss increasing the risk of a crash, or personal injury.</p>	<p><b>REMEDY</b></p> <p>Coachmen will replace the wheels free of charge. The safety recall is expected to begin on or before January 2, 2011. Owners may contact coachmen rv customer service at 1-800-453-6064.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>  FOREST RIVER / GEORGETOWN                      2011</p> <p><b>MANUFACTURER:</b> FOREST RIVER, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  58</p> <p><b>SUMMARY:</b> Forest River is recalling certain model year 2011 Georgetown class a motor homes for failing to comply with the requirements of federal motor vehicle safety no. 302, "flammability of interior materials". The fabrics used in window treatments, window valances, drapery, and bed spreads are not treated with flame retardant.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Failure to have the fabric treated with flame retardant in the event of a fire could cause the fabric to burn faster increasing the risk of injuries to occupants.</p>	<p><b>REMEDY</b></p> <p>Dealers will treat the fabric with flame retardant fabric to assure compliance. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Forest River at 574-206-7605.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>  KEYSTONE / ALPINE                                      2010-2011  KEYSTONE / AVALANCHE                                2010-2011  KEYSTONE / CHALLENGER                              2009-2010  KEYSTONE / EVEREST                                    2009-2010  KEYSTONE / FUZION                                     2009-2011  KEYSTONE / MONTANA                                  2009-2011  KEYSTONE / MONTANA HIGH COUNTRY            2010-2011  KEYSTONE / MONTANA-BIG SKY                      2009-2011  KEYSTONE / MONTANA-MOUNTAINEER            2010-2011  KEYSTONE / RAPTOR                                    2009-2011</p> <p><b>MANUFACTURER:</b> KEYSTONE RV COMPANY</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  6297</p> <p><b>SUMMARY:</b> Keystone is recalling certain fifth wheel trailers with a generator ready option. If the transfer switch is not installed to the proper specifications, the elevated electrical loads associated with the recreational vehicle use in higher ambient temperatures may cause overheating of the lugs and degrading of the electrical connections.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Overheating of the connections could result in a fire.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect and replace the transfer switch if necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact keystone customer service at 1-866-425-4369.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>            CHAMPION / CHALLENGER                      2005-2008            CHAMPION / INTERNATIONAL            DEFENDER    2007-2008</p> <p><b>MANUFACTURER:</b> CHAMPION BUS, INC.  <b>COMPONENT:</b> EQUIPMENT  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            107</p> <p><b>SUMMARY:</b> Champion bus is recalling certain buses equipped with trans air ta 73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse.</p> <p>No picture available</p>	<p><b>CONSEQUENCE</b></p> <p>This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire.</p>	<p><b>REMEDY</b></p> <p>Champion bus in cooperation with Trans air will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Trans air warranty and service center at 1-800-673-2446.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>            VOLVO / S40    2009-2011            VOLVO / S60    2009 2011            VOLVO / V50    2009-2011            VOLVO / XC60    2010-2011</p> <p><b>MANUFACTURER:</b> VOLVO CARS OF N.A. LLC.  <b>COMPONENT:</b> SEATS  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            7420</p> <p><b>SUMMARY:</b> Volvo is recalling certain passenger vehicles equipped with power front passenger seats. The front seat rail's detection system was manufactured incorrectly and may permit the passenger to forward the seat beyond the intended maximum.</p> <p>No picture available</p>	<p><b>CONSEQUENCE</b></p> <p>Positioning of the seat beyond the intended maximum can cause increased risk of injury to the passenger in the event of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect the front passenger side seat rails for the presence of an "end stop" and repair the vehicles as necessary free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Volvo at 1-800-458-1552 or at <a href="mailto:customercare@volvoforlife.com">customercare@volvoforlife.com</a>.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>            HYUNDAI / SANTA FE    2011</p> <p><b>MANUFACTURER:</b> HYUNDAI-KIA AMERICA TECHNICAL CENTER INC  <b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC:            FOUNDATION COMPONENTS:DISC:CALIPER  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            1783</p> <p><b>SUMMARY:</b> Hyundai is recalling certain model year 2011 Santa Fe vehicles manufactured from September 28, 2010, through November 25, 2010. Some of the rear brake calipers may not have been properly machined.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>As a result, brake fluid will leak, followed by illumination of the malfunction indicator light indicating the brake fluid level is low and should be checked, then a soft or spongy brake pedal feel, and if not serviced, reduced braking power which could increase the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect the rear calipers and replace it if necessary free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact hyundai roadside assistance at 1-800-243-7766.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>HEIL / DURAPACK PYTHON              2004-2010  HEIL / MULTIPACK                              2004-2010</p> <p><b>MANUFACTURER:</b> HEIL ENVIRONMENTAL</p> <p><b>COMPONENT:</b> STRUCTURE: BODY:  HATCHBACK/ LIFTGATE:HINGE AND  ATTACHMENTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  2201</p> <p><b>SUMMARY:</b> Heil is recalling certain 2004 through 2010 durapack and multipack refuse collection vehicle automated side loaders with python lifts utilizing programmable logic control (plc) to activate grabber close and lift functions. Carbon can build up on internal relays within the plc and this can cause a bridging or inadvertent circuit completion due to vibration.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Should this happen, the arm can lift or grab without operator inputs, possibly resulting in a vehicle crash or injuries to persons outside the vehicle.</p>	<p><b>REMEDY</b></p> <p>Heil will notify owners and dealers will install a retrofit kit to repair the vehicles free of charge. The safety recall is expected to begin during December 2010. Owners may contact heil customer support toll free at 1-866-275-4345.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>DUTCHMEN / AEROLITE                      2011  DUTCHMEN / COLEMAN                      2011  DUTCHMEN / COLORADO                      2011  DUTCHMEN / DENALI                              2011  DUTCHMEN / DUTCHMEN                      2011  DUTCHMEN / FOUR WINDS                      2011  DUTCHMEN / GRAND JUNCTION              2011  DUTCHMEN / KODIAK                              2011  DUTCHMEN / VOLTAGE                              2011</p> <p><b>MANUFACTURER:</b> DUTCHMEN  MANUFACTURING, INC.</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM:FUSES  AND CIRCUIT BREAKERS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  1723</p> <p><b>SUMMARY:</b> Dutchmen is recalling certain model year 2011 travel trailers manufactured from june 10, 2010, through september 3, 2010, and equipped with siemens and murray one inch plug-in circuit breakers. The "spring clip" plug-in assembly may break or fail to provide sufficient force to maintain a proper electrical connection in the panel board.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could lead to excessive temperature, arcing or thermal damage at the connection point, and potential damage to the panel board's electrical insulation which could lead to fire, property damage, or personal injury.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect the breakers and replace as necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact Dutchmen warranty service department at 574-537-0700.</p>



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>VOLKSWAGEN / GOLF                      2007-2009  VOLKSWAGEN / JETTA                      2007-2009  VOLKSWAGEN / JETTA SPORTWAGEN    2007-2009  VOLKSWAGEN / NEW BEETLE            2006-2010  VOLKSWAGEN / RABBIT                    2007-2009</p> <p><b>MANUFACTURER:</b> VOLKSWAGEN OF AMERICA, INC</p> <p><b>COMPONENT:</b> VISIBILITY:WINDSHIELD WIPER/WASHER:LINKAGES</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 228236</p> <p><b>SUMMARY:</b> Volkswagen is recalling certain model year 2007-2009 jetta, jetta sportwagen, golf and rabbit, as well as model year 2006 -2010 new beetle and new beetle convertible vehicles equipped with 2.5l engines. The jetta, jetta sportwagen, golf and rabbit vehicles may have a small plastic tab located on the windshield washer fluid reservoir that may chafe against an underhood fuel supply line. The new beetle and the new beetle convertible vehicles may have a fastening clamp on a hydraulic hose of the power steering system that may be located in an improper position which could cause chafing against an underhood fuel supply line.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If chafing occurs, there is the potential for a fuel leak to develop. Fuel leakage, in the presence of an ignition source, could result in a fire.</p>	<p><b>REMEDY</b></p> <p>Depending on the vehicle model, dealers will either remove the plastic tab from the windshield washer fluid reservoir, or inspect the position of the fastening clamp and adjust the related fastening clamp into the correct position. This service will be performed free of charge. The safety recall is expected to begin on or before january 31, 2011. owners may contact volkswagen at 1-800-822-8987.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>TOYOTA / SIENNA                              2011</p> <p><b>MANUFACTURER:</b> TOYOTA MOTOR NORTH AMERICA, INC.</p> <p><b>COMPONENT:</b> EXTERIOR LIGHTING:BRAKE LIGHTS:SWITCH</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 94126</p> <p><b>SUMMARY:</b> Toyota is recalling certain model year 2011 sienna vehicles. The brake stop lamp switch is mounted on a small bracket welded on the left side of the service brake pedal support assembly. Due to its proximity to the parking brake pedal, in limited circumstances the stop lamp switch bracket could be damaged by the operator's foot during parking brake application.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could result in brake drag with associated brake noise, vibration, and/or illumination of the brake warning light. Braking effectiveness could be reduced increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will replace the bracket assembly free of charge. Toyota plans to mail an interim owner notification in the middle of January 2011, to advise owners of the recall and when parts are available to complete repairs. Owners may contact Toyota at 1-800-331-4331.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>UNIVERSAL / CHEROKEE                      2008  UNIVERSAL / CIMARRON                      2008  UNIVERSAL / ELITE                              2008  UNIVERSAL / EXISS/SOONER                2004-2008  UNIVERSAL / FEATHERLITE                2004-2008</p> <p><b>MANUFACTURER:</b> UNIVERSAL TRAILER CORP. INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 57</p> <p><b>SUMMARY:</b> Universal trailer is recalling certain trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could result in a fire.</p>	<p><b>REMEDY</b></p> <p>Universal trailer is working with dimplex and will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact universal trailers at 405-422-7359 or dimplex North America customer service at 1-888-346-7539.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>GLAVAL / APOLLO                      2002-2003 2006-2008  GLAVAL / TITAN                              2002-2003 2006-2008  GLAVAL / UNIVERSAL                      2002-2003 2006-2008</p> <p><b>MANUFACTURER:</b> GLAVAL BUS DIVISION</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 119</p> <p><b>SUMMARY:</b> Glaval is recalling certain model year 2002, 2003, 2006, 2007, and 2008 ford e350/e450 universal, chevy/gmc 4500/550 titan and freightliner mb-55 apollo transit buses manufactured from august 1999 through july 2007, and equipped with a trans/air ta73 evaporator. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire.</p>	<p><b>REMEDY</b></p> <p>Glaval in cooperation with Trans air will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin late December 2010 or early January 2011. Owners may contact trans air warranty and service center at 1-800-673-2446.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	danger	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b></p> <p>PETERSON / CLASSIC                      2001</p> <p>PETERSON / EXCEL CLASSIC                      2005</p> <p>PETERSON / EXCEL LIMITED                      2007 2011</p> <p>PETERSON / EXCEL LIMITED                      2004-2005 2009-2010</p> <p>PETERSON / EXCEL LIMITED EDITION                      2001-2003 2006-2008</p> <p>PETERSON / EXCEL WILD CARGO                      2010</p> <p><b>MANUFACTURER:</b> PETERSON INDUSTRIES, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 110</p> <p><b>SUMMARY:</b> PETERSON is recalling certain fifth wheel trailers equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p><b>REMEDY</b></p> <p>Peterson is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101 or Peterson at 785-282-6825.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b></p> <p>DODGE / RAM                                      2010-2011</p> <p><b>ANUFACTURER:</b> CHRYSLER GROUP LLC</p> <p><b>COMPONENT:</b> STEERING:HYDRAULIC POWER ASSIST:POWER STEERING FLUID</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 76122</p> <p><b>SUMMARY:</b> Chrysler is recalling certain model year 2010-2011 dodge ram trucks manufactured from March 2009 through October 2010. Some vehicles equipped with diesel engine and a hydroboost brake system may be equipped with a power steering reservoir cap with excessive vent pressure levels that may result in brake pedals that are slow to return.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Brake lights that are slow to extinguish could increase the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Chrysler will notify owners and dealers will replace the power steering reservoir cap free of charge. The safety recall is expected to begin during February 2010. Owners may contact chrysler at 1-800-853-1403.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>ALTEC / AA500                          1996  ALTEC / AM450                          1995-1996  ALTEC / AM550                          1995-1996  ALTEC / AM600                          1995-1996  ALTEC / AM600-E76                      1996  ALTEC / AM755                          1995-1996  ALTEC / AM800                          1996-1997  ALTEC / AM900                          1996-1997  ALTEC / AN543                          1994-1997  ALTEC / AN546                          1994-1997  ALTEC / AN650                          1994-1997  ALTEC / AN755                          1994-1997</p> <p><b>MANUFACTURER:</b> ALTEC INDUSTRIES INC.  <b>COMPONENT:</b> EQUIPMENT  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  174</p> <p><b>SUMMARY:</b> ALTEC is recalling certain model year 1994-1997 service vehicles built from September 1994 through March 1997, and equipped with aerial devices with boom lift cylinder part number 350-40094. The hydraulic cylinder as manufactured could fail when subject to frequent tensile loading.  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Failure of the lower boom lift cylinder can cause death or serious injury.</p>	<p><b>REMEDY</b></p> <p>Altec will replace the hydraulic cylinders free of charge. The safety recall is expected to begin on or before December 17, 2010. Owners may contact altec at 1-877-462-5832.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>CUSTOM CAMPERS / LS                      2008  NU WA / CHAMPAGNE EDITION      2003-2011  NU WA / DISCOVER AMERICA      2008-2011  NU WA / PREMIER                              2006</p> <p><b>MANUFACTURER:</b> NU WA INDUSTRIES, INC.  <b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  292</p> <p><b>SUMMARY:</b> NU WA is recalling certain fifth wheel trailers equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p><b>REMEDY</b></p> <p>NU WA is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101 or nu wa industries at 800-835-0676.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DANGER	MEASURES ADOPTED
USA	<b>VEHICLE MAKE / MODEL</b>	<b>MODEL YEAR(S)</b>	<b>CONSEQUENCE</b> This could lead to excessive temperature, arcing or thermal damage at the connection point and potential damage to the panel board's electrical insulation which could lead to fire, property damage, or personal injury.	<b>REMEDY</b> Dealers will inspect the breakers and replace as necessary free of charge. The safety recall is expected to begin during December 2010. Owners may contact keystone customer service at 1-866-425-4369.
	KEYSTONE / COUGAR	2011		
	KEYSTONE / FUZION	2011		
	KEYSTONE / SPRINTER	2011		
	<b>MANUFACTURER:</b> KEYSTONE RV COMPANY			
	<b>COMPONENT:</b> ELECTRICAL SYSTEM:FUSES AND CIRCUIT BREAKERS			
	<b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 2693			
	<b>SUMMARY:</b> Keystone is recalling certain model year 2011 sprinter, cougar and fuzion travel trailers equipped with siemens and murray one inch plug-in circuit breakers. The "spring clip" plug-in assembly may break or fail to provide sufficient force to maintain a proper electrical connection in the panel board.  No picture available.			
USA	<b>VEHICLE MAKE / MODEL</b>	<b>MODEL YEAR(S)</b>	<b>CONSEQUENCE</b> There could be a potential wheel failure and wheel loss increasing the risk of a crash, or personal injury.	<b>REMEDY</b> Heartland will replace the wheels free of charge. The safety recall is expected to begin during December 2010. Owners may contact heartland at 877-262-8032.
	HEARTLAND / CALIBER	2011		
	HEARTLAND / ELK RIDGE	2011		
	HEARTLAND / FOCUS	2011		
	HEARTLAND / MPG	2011		
	HEARTLAND / NORTH COUNTRY	2011		
	HEARTLAND / NORTH TRAIL	2011		
	HEARTLAND / SUNDANCE	2011		
	HEARTLAND / TRAIL RUNNER	2011		
		<b>MANUFACTURER:</b> HEARTLAND RECREATIONAL VEHICLES, LLC		
	<b>COMPONENT:</b> WHEELS			
	<b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 527			
	<b>SUMMARY:</b> Heartland is recalling certain model year 2011 travel trailers equipped with 15"x6" white spoke or modular design steel wheels with a six hole bolt pattern. Some of the wheels may have inadequate weld penetration between the outer ring and the center plate due to improper plate alignment.  No picture available.			



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b></p> <p>GLAVAL / ENTOURAGE                      2009-2011</p> <p><b>MANUFACTURER:</b> GLAVAL BUS DIVISION</p> <p><b>COMPONENT:</b> EXTERIOR LIGHTING:HAZARD FLASHING WARNING LIGHTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 94</p> <p><b>SUMMARY:</b> Glaval is recalling certain model year 2009 through 2011 entourage transit buses manufactured from November 2009 through November 1, 2010. The rear hazard lights do not operate properly which fails to conform to the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and other associated equipment.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The rear hazard lights will not function if the key is in the ignition increasing the risk of a crash if the bus is incapacitated.</p>	<p><b>REMEDY</b></p> <p>Glaval will notify owners and repair the buses free of charge. The safety recall is expected to begin during December 2010. Owners may contact glaval at 1-574-262-2212.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b></p> <p>NEW FLYER / D40LF                              2008</p> <p>NEW FLYER / DE60LF                              2008-2009</p> <p>NEW FLYER / E40LFR                              2008</p> <p><b>MANUFACTURER:</b> NEW FLYER INDUSTRIES LTD</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 522</p> <p><b>SUMMARY:</b> New flyer is recalling certain model year 2008-2009 heavy duty transit buses. The radius rod bracket which attaches the front axle radius rods to the vehicle frame may be missing two of the four required welds.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Failure of a radius rod bracket assembly may result in restricted steering capability increasing the risk of vehicle crash, injury or death.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect for radius rod brackets and will be replaced with certified product free of charge. The safety recall is expected to begin during December 2010. Owners may contact new flyer at 204-934-4876.</p>
EU/ GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Santa Fe and Trajet</p> <p><b>BRAND:</b> Hyundai</p> <p><b>TYPE/NUMBER OF MODEL:</b> Types SM and FO, EC type approval e11*98/14*0162 and e11*98/14*0130.</p> <p><b>DESCRIPTION:</b> Passenger car. Vehicles built between 2000 and 2004 are affected.</p> <p><b>COUNTRY OF ORIGIN:</b> Korea</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>On the affected vehicles, there is a possibility that the longitudinal arms on the rear axle will rust through on account of inadequate anti-corrosion protection. This may affect the stability of the vehicle whilst in motion or prevent the vehicle from being steered properly which could lead to a road accident.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Ford Galaxy and S-Max</p> <p><b>BRAND:</b> Ford</p> <p><b>TYPE/NUMBER OF MODEL:</b> The vehicles affected were manufactured on 6 November 2007 (1-day production) with type approval number: e13*2001/116*0185*05.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Belgium</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries because the sun roof may not have been correctly affixed to the vehicle and may consequently become detached whilst the car is moving, which could lead to a road accident.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>
AUSTRALIA	<p>Mercedes-Benz—Passenger Cars with OM651 Engine</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Mercedes-Benz passenger cars with OM651 Engine produced between November 1st 2009 and November 1st 2010.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign number: RC860</p> <p><b>TARGET NUMBER:</b>14</p> <p><b>SUPPLIER</b></p> <p>Mercedes-Benz Australia/Pacific Pty Ltd</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>If the fuel filter should leak diesel fuel this could create a hazard to other road users.</p> <p><b>DEFECTS</b></p> <p>The fuel filter may leak diesel fuel.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Letters will be sent to affected owners.</p> <p>Owners are advised to contact their authorised Mercedes-Benz dealer to have the fuel filter checked and if required replaced free of charge.</p>
AUSTRALIA	<p>Mercedes-Benz—Sprinter and Vito Vans, with OM651 Engine</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Mercedes-Benz Sprinter and Vito vans with OM651 engines produced between December 2009 and October 2010</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign number: RC858</p> <p>Target number: 63</p> <p><b>SUPPLIER</b></p> <p>Mercedes-Benz Australia/Pacific Pty Ltd</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>If the fuel filter should leak diesel fuel this could create a hazard to other road users.</p> <p><b>DEFECTS</b></p> <p>The fuel filter may leak diesel fuel.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Letters will be sent to affected owners.</p> <p>Owners are advised to contact their authorised Mercedes-Benz dealer to have the fuel filter checked and if required replaced free of charge.</p>



**AUTO: MOTOR VEHICLE EQUIPMENT**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600            WEBASTO / HOLLANDIA 700            WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> PRECISION AUTO UPHOLSTERY, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 221</p> <p><b>SUMMARY:</b> Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by precision auto upholstery, Inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by precision auto upholstery, Inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600            WEBASTO / HOLLANDIA 700            WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> S&amp;C AUTOMOTIVE</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 577</p> <p><b>SUMMARY:</b> Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by s&amp;c automotive on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p><b>REMEDY</b></p> <p>webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by s&amp;c automotive by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>

<b>AUTO: MOTOR VEHICLE EQUIPMENT</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> ARVINMERITOR / TL SERIES</p> <p><b>MANUFACTURER:</b> ARVINMERITOR, INC</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 14869</p> <p><b>SUMMARY:</b> Arvinmeritor is recalling certain tl series trailer axles sold as aftermarket replacement equipment and sold and installed as original equipment in heavy trucks and recreational vehicles. The spindle nut may not have been properly torqued or not torqued at all allowing excessive end-play in the wheel-end system and could progress to a wheel separation.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Separation of the wheel could result in a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Arvinmeritor will notify owners who purchase any affected axle as aftermarket replacement equipment. Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Owners may contact their vehicle manufacturer or arvinmeritor at 1-248-435-1725.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> ARVINMERITOR / TL SERIES</p> <p><b>MANUFACTURER:</b> ARVINMERITOR, INC</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 3776</p> <p><b>SUMMARY:</b> Arvinmeritor is recalling certain tl series trailer axles that contain the fag brand bearing system. These axles are sold and installed as original equipment on various recreational vehicles. The bearing system has exhibited low durability life in certain vehicle applications.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Prolonged use of the system in these applications can result in the degradation of the bearing grease, thereby potentially resulting in a bearing failure and subsequent wheel end fire.</p>	<p><b>REMEDY</b></p> <p>Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Owners may contact their vehicle manufacturer or arvinmeritor at 1-248-435-1725.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> JL AUDIO / HD750/1 (AUDIO AMPLIFIER)</p> <p><b>MANUFACTURER:</b> JL AUDIO, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 5900</p> <p><b>SUMMARY:</b> JL audio is recalling certain mobile audio amplifiers, model hd750/1, sold as aftermarket equipment for use in motor vehicles. A part of the circuit board can fail which will allow the circuit board to overheat and melt.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This can produce smoke and possibly fire in the motor vehicle.</p>	<p><b>REMEDY</b></p> <p>JL audio will notify owners of record and will repair the amplifiers free of charge. The safety recall is expected to begin during December 2010. Owners may contact jl audio customer service department at 1-888-jludio (552-8346).</p>

**AUTO: MOTOR VEHICLE EQUIPMENT**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> ARVINMERITOR / TL SERIES</p> <p><b>MANUFACTURER:</b> ARVINMERITOR, INC</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 14869</p> <p><b>SUMMARY:</b> Arvinmeritor is recalling certain tl series trailer axles sold as aftermarket replacement equipment and sold and installed as original equipment in heavy trucks and recreational vehicles. The spindle nut may not have been properly torqued or not torqued at all allowing excessive end-play in the wheel-end system and could progress to a wheel separation.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Separation of the wheel could result in a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Arvinmeritor will notify owners who purchase any affected axle as aftermarket replacement equipment. Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Owners may contact their vehicle manufacturer or arvinmeritor at 1-248-435-1725.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> KINEDYNE / WINCH BAR (10032) KINEDYNE / WINCH BAR (10033)</p> <p><b>MANUFACTURER:</b> KINEDYNE CORPORATION</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 10816</p> <p><b>SUMMARY:</b> Kinedyne is recalling certain aftermarket combination winch bars, part numbers 10032 (black) and 10033 (chrome) shipped from January 1, 2009, through October 25, 2010. Due to a manufacturing anomaly, the subject winch bars may be prone to fracture at the weld that joins the steel bar to the box end (chain binder).</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This anomaly may cause the weld joint to fail and the box end to abruptly separate during normal use. If the weld fails unexpectedly, the winch bar could strike the user or cause the user to lose his or her balance and fall (especially when the user is positioned on top of the trailer or its cargo during use).</p>	<p><b>REMEDY</b></p> <p>Kinedyne will notify owners of record and replace the subject combination winch bars free of charge. The safety recall is expected to begin during December 2010. Owners may contact kinedyne customer service at 1-800-848-6057.</p>

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[Product.Recalls@sgs.com](mailto:Product.Recalls@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

**SGS**