

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 FEBRUARY 2011

## CONTENTS

### AUTOMOTIVE

Pages 1 to 38



[Motor Vehicle \(52\)](#)

[Child Safety Seat \(1\)](#)

[Motor Vehicle Equipment \(28\)](#)

| AUTO: MOTOR VEHICLE |  |  |   |
|---------------------|--|--|---|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER   | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>CADILLAC / CTS- 2009-2010</p> <p><b>MANUFACTURER:</b> GENERAL MOTORS CORP.</p> <p><b>COMPONENT:</b> SUSPENSION:REAR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>11,147</p> <p><b>SUMMARY:</b> GENERAL MOTORS is recalling certain model year 2009-2010 Cadillac cts vehicles. Some of these vehicles have a condition in which a wax coating on the rear suspension toe link jam nuts may allow the nut(s) to loosen. If a nut sufficiently loosens, the toe link could separate and the rear wheel would be able to turn inboard or outboard. Owners may hear a metallic clanking noise coming from the rear of the vehicle that may warn of a loosening nut.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The driver may experience sudden changes with vehicle handling and may not be able to control the vehicle increasing the risk of a crash.</p>   | <p><b>REMEDY</b></p> <p>Dealers will clean all wax residue from the rear suspension toe link and install two new jam nuts. If necessary the rear suspension toe link may be replaced. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Cadillac at 1-866-982-2339 and at the owner center at <a href="http://www.gmownercenter.com">www.gmownercenter.com</a>.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>FLEETWOOD / FIESTA- 2010</p> <p><b>MANUFACTURER:</b> FLEETWOOD RV, INC.</p> <p><b>COMPONENT:</b> EXTERIOR LIGHTING:HEADLIGHTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>76</p> <p><b>SUMMARY:</b> Fleetwood RV is recalling certain model year 2010 fiesta class a motor homes. The headlights may have been incorrectly wired, resulting in reduced headlight illumination with the headlights on low beam.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>Inadequate illumination of the low beam headlights may result in decreased driver's vision, as well as the vehicles' visibility to other drivers, increasing the risk of a crash.</p> | <p><b>REMEDY</b></p> <p>Dealers will inspect the headlight wiring and if necessary the headlight wires will be moved to the correct position on the headlight bulb socket connectors. This service will be performed free of charge. The safety recall is expected to begin during February 2011. Owners may contact fleetwood relations at 1-800-509-3418.</p>   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>COACH &amp; EQUIPMENT / PHOENIX -2006-2010</p> <p><b>MANUFACTURER:</b> COACH AND EQUIPMENT MFG CORP</p> <p><b>COMPONENT:</b> EQUIPMENT: ELECTRICAL:AIR CONDITIONER</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>2,500</p> <p><b>SUMMARY:</b> Coach and equipment is recalling certain model year 2006-2010 buses equipped with carrier genv em-1 evaporator units. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire.</p>   | <p><b>REMEDY</b></p> <p>Coach and equipment will notify owners and provide information on how to obtain the retrofit kit from carrier along with repair instructions. This service will be performed free of charge. The safety recall is expected to begin on or before February 28, 2011. Owners may contact carrier hotline at 1-800-793-4741 or coach and equipment at 315-536-2321, extension 1212.</p>  |

| AUTO: MOTOR VEHICLE |   |   |   |
|---------------------|---|---|---|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER  | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>T &amp; E / 56 SEMI-TRAILER- 2007</p> <p><b>MANUFACTURER:</b> T&amp;E ENTERPRISES</p> <p><b>COMPONENT:</b> EQUIPMENT: RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1</p> <p><b>SUMMARY:</b> T&amp;E is recalling one recreational vehicle equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>T&amp;E is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p>           |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>TIFFIN / ALLEGRO- 1997-2007 2010-2011<br/>TIFFIN / BAY- 1997-2007 2011<br/>TIFFIN / BUS- 1997-2011<br/>TIFFIN / PHAETON- 2001-2007 2010-2011<br/>TIFFIN / STAR-1997-1998<br/>TIFFIN / ZEPHYR-1999-2003 2007 2010</p> <p><b>MANUFACTURER:</b> TIFFIN MOTORHOMES, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT: RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 10,683</p> <p><b>SUMMARY:</b> TIFFIN MOTORHOMES is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>Tiffin motorhomes is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p> |

**AUTO: MOTOR VEHICLE**

| <b>NOTIFYING COUNTRY</b> | <b>PRODUCT</b>   | <b>DANGER</b>   | <b>MEASURES ADOPTED</b>   |
|--------------------------|--|---|---|
| USA                      | <p><b>VEHICLE MAKE / MODEL</b><br/>UNITED / MOTOR HOMES- 2004-2010</p> <p><b>MANUFACTURER:</b> UNITED SPECIALTIES INC.</p> <p><b>COMPONENT:</b> EQUIPMENT: RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>25</p> <p><b>SUMMARY:</b> UNITED SPECIALTIES is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>UNITED SPECIALTIES is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall is expected to begin during February 2011. Owners may contact norcold at 1-800-767-9101.</p> |
| USA                      | <p><b>VEHICLE MAKE / MODEL</b><br/>KING OF THE ROAD / CROWN- 1997-2007<br/>KING OF THE ROAD / MARQUIS- 1997-2007<br/>KING OF THE ROAD / ROYAL VILLA-1997-2007<br/>KING OF THE ROAD / ROYALITE-1997-2007</p> <p><b>MANUFACTURER:</b> KING OF THE ROAD</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>761</p> <p><b>SUMMARY:</b> King of the road is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>King of the road is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall began on January 14, 2011. Owners may contact norcold at 1-800-767-9101.</p>                          |

| AUTO: MOTOR VEHICLE |   |  |  |
|---------------------|---|--|--|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER   | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>           BLUE BIRD / ALL AMERICAN- 2011-2012<br/>           BLUE BIRD / VISION- 2011-2012</p> <p><b>MANUFACTURER:</b> BLUE BIRD BODY COMPANY</p> <p><b>COMPONENT:</b> STRUCTURE:BODY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>           363</p> <p><b>SUMMARY:</b> Blue bird is recalling certain model year 2011 and 2012 vision and all American model school buses manufactured from october 18, 2010, through january 6, 2011. the sheet metal rain visors over the pushout side window on the left side of the bus may prohibit the emergency exit window from opening sufficiently which fails to conform to the emergency egress requirements of federal motor vehicle safety standard no. 217, "bus emergency exists and window retention and release."<br/>           No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of an emergency, passengers could be injured if they are unable to quickly exit the bus.</p>               | <p><b>REMEDY</b></p> <p>Blue bird will notify owners and dealers will repair the buses free of charge. The safety recall is expected to begin on or about March 10, 2011. Owners may contact blue bird at 1-478-822-2242.</p>  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>           FREIGHTLINER / BUSINESS CLASS M2 106V-2005</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> STRUCTURE:BODY:DOOR<br/>           Potential Number of Units Affected: 207</p> <p><b>SUMMARY:</b> DAIMLER TRUCKS is recalling certain model year 2011 freightliner coronado, columbia, fld military, business class m2, cascadia, century, and western star 4900 trucks manufactured from august 9, 2010, through october 27, 2010 for failing to comply with the requirements of federal motor vehicle safety standard no. 120, "tire selection and rims for motor vehicles other than passenger cars." these vehicles were equipped with labels missing recommended cold tire inflation pressures.<br/>           No picture available.</p>                                    | <p><b>CONSEQUENCE</b></p> <p>Failure to follow proper tire inflation recommendations can result in tire failure, increasing the risk of a crash.</p> | <p><b>REMEDY</b></p> <p>Labels with missing information will be replaced with corrected labels. This service will be performed free of charge. The safety recall is expected to begin on or before January 15, 2011. Owners may contact Daimler trucks at 1-800-547-0712. This safety recall campaign is an expansion of a previous recall (please see 10v-551).</p> |

| AUTO: MOTOR VEHICLE |   |   |  |
|---------------------|---|---|--|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b></p> <p>FLEETWOOD / AMERICAN ALLEGIANCE- 2009<br/> FLEETWOOD / BOUNDER- 2010<br/> FLEETWOOD / DISCOVERY-2009<br/> FLEETWOOD / REVOLUTION LE-2009<br/> FLEETWOOD / SOUTHWIND- 2010-2011</p> <p><b>MANUFACTURER:</b> FLEETWOOD RV, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>88</p> <p><b>SUMMARY:</b> FLEETWOOD RV is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>Fleetwood RV is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b></p> <p>TRIAL BOSS / BLOOMER 2007<br/> TRIAL BOSS / SOONER 2006</p> <p><b>MANUFACTURER:</b> TRAIL BOSS CONVERSIONS, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>2</p> <p><b>SUMMARY:</b> Trail boss is recalling two horse trailers, model year 2006 sooner and 2007 bloomer models, equipped with a 1200-series norcold refrigerator. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>Trail boss is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during February 2011. Owners may contact norcold at 1-800-767-9101.</p>                   |

| AUTO: MOTOR VEHICLE |  |   |   |
|---------------------|--|---|---|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER  | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>NRC / MOTOR HOME- 1999-2010</p> <p><b>MANUFACTURER:</b> NRC MODIFICATIONS, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>158</p> <p><b>SUMMARY:</b> NRC is recalling certain model year 1999 through 2010 motorhomes vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>     | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>NRC is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall began on December 6, 2010. Owners may contact norcold at 1-800-767-9101.</p>                        |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>MARATHON / CUSTOM 2- ROOM -2003</p> <p><b>MANUFACTURER:</b> MARATHON HOMES CORP.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>1</p> <p><b>SUMMARY:</b> Marathon homes corp. (marathon) is recalling one motorhome, model year 2003 custom 2 - room, equipped with a 1200-series norcold refrigerator. The refrigerator being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>Marthon is working with norcold to identify and notify the affected owner. The owner will be instructed to contact a norcold dealer to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall is expected to begin during February 2011. Owners may contact norcold at 1-800-767-9101.</p> |

| AUTO: MOTOR VEHICLE |  |   |  |
|---------------------|--|---|--|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>NRC / MOTOR HOME- 1999-2010</p> <p><b>MANUFACTURER:</b> NRC MODIFICATIONS, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>158</p> <p><b>SUMMARY:</b> NRC is recalling certain model year 1999 through 2010 motorhomes vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>   | <p><b>REMEDY</b></p> <p>NRC is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall began on December 6, 2010. Owners may contact norcold at 1-800-767-9101.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>CAN-AM / ROADSTER SPYDER RT SM5- 2011</p> <p><b>MANUFACTURER:</b> BOMBARDIER RECREATIONAL PRODUCTS INC.</p> <p><b>COMPONENT:</b> POWER TRAIN:MANUAL TRANSMISSION:COLUMN SHIFT ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>160</p> <p><b>SUMMARY:</b> BRP is recalling certain model year 2011 spyder RT sm5 roadsters. While down shifting it may be possible to inadvertently engage reverse without depressing the reverse button due to a defective reverse actuator cable.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>If this happens while the vehicle is moving forward, the rear wheel could lock and the engine could stall. If this happens while vehicle is stopped, the vehicle could back up. A vehicle stall without warning or an expected movement in reverse may increase the risk of a crash possibly resulting in injury or death.</p> | <p><b>REMEDY</b></p> <p>Dealers will validate proper operation of the reverse actuator and if defective, the reverse actuator assembly will be replaced free of charge. The safety recall is expected to begin on or before February 11, 2011. Owners may contact brp at 1-888-638-5397</p>  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>KEYSTONE / AVALANCHE-2011<br/>KEYSTONE / LAREDO- 2011<br/>KEYSTONE / SPRINGDALE -2011</p> <p><b>MANUFACTURER:</b> KEYSTONE RV COMPANY</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>318</p> <p><b>SUMMARY:</b> Keystone is recalling certain model year 2011 avalanche, Laredo, and springdale recreational vehicles equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>   | <p><b>REMEDY</b></p> <p>Dealers will isolate and perform a drop pressure test on the oven supply tube and if the tube leaks it will be replaced free of charge. The safety recall has started. Owners may contact keystone customer service at 1-866-425-4369. This safety recall campaign is an expansion of a previous recall (please see 10v-478).</p>        |



| AUTO: MOTOR VEHICLE |  |   |  |
|---------------------|--|---|--|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>MARATHON / CUSTOM 2- ROOM- 2003</p> <p><b>MANUFACTURER:</b> MARATHON HOMES CORP.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>1</p> <p><b>SUMMARY:</b> MARATHON HOMES CORP. (MARATHON) is recalling one motorhome, model year 2003 custom 2 - room, equipped with a 1200-series norcold refrigerator. The refrigerator being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>Marthon is working with norcold to identify and notify the affected owner. The owner will be instructed to contact a norcold dealer to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall is expected to begin during February 2011. Owners may contact norcold at 1-800-767-9101.</p>                            |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>ITASCA / LATITUDE- 2008<br/>WINNEBAGO / DESTINATION- 2008</p> <p><b>MANUFACTURER:</b> WINNEBAGO INDUSTRIES, INC.</p> <p><b>COMPONENT:</b> FUEL SYSTEM, GASOLINE:STORAGE:TANK ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>241</p> <p><b>SUMMARY:</b> WINNEBAGO is recalling certain model year 2008 destination and latitude motor homes built on workhouse custom chassis. The fuel fill cap assemblies used to seal the unused fuel tank inlet where produced with an incorrect hose material.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>A fuel leak increases the risk of a fire which may result in property damage, personal injury or death.</p>  | <p><b>REMEDY</b></p> <p>Navistar/workhorse is handling the remedy and owner notification for this campaign please see navistar/workhorse's defect report 10v-348. Navistar/workhorse will replace the original fuel-fill cap assemblies with ones assembled with hose material that meets design specifications. This service will be performed free of charge. Owners may contact navistar at 1-260-461-1890.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>TEREX / AERIAL DEVICES -2008-2010<br/>TEREX / DIGGER DERRICK- 2008-2010</p> <p><b>MANUFACTURER:</b> TEREX UTILITIES SOUTH, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>254</p> <p><b>SUMMARY:</b> Terex is recalling certain model year 2008-2010 aerial device and digger derrick utility vehicles manufactured from June, 2008 through November, 2010. The lanyard anchors were not heat treated properly and may fracture.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>Failure of the lanyard anchor could occur increasing the risk of personal injuries or death.</p>   | <p><b>REMEDY</b></p> <p>Dealers will replace the lanyard anchors with a new part free of charge. The safety recall began on February 11, 2011. Owners may contact terex at 1-605-884-3892.</p>   |

| AUTO: MOTOR VEHICLE |  |  |   |
|---------------------|--|--|---|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER   | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>H-D / SOFTAIL-2011</p> <p><b>MANUFACTURER:</b> HARLEY-DAVIDSON MOTOR COMPANY</p> <p><b>COMPONENT:</b> ENGINE AND ENGINE COOLING:ENGINE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>6,964</p> <p><b>SUMMARY:</b> Harley-davidson is recalling certain model year 2011 softail motorcycles manufactured from June 7, 2010 through October 8, 2010. The body control modules (bcm) installed on these motorcycles (part numbers 69991-11 and 69993-11) have a case that may not have been properly sealed during production. An improper seal may allow water intrusion into the bcm which may cause engine stall.</p> <p>No picture available.</p>                              | <p><b>CONSEQUENCE</b></p> <p>An engine stall while in traffic can result in a crash, which could lead to injury or death to the rider.</p> | <p><b>REMEDY</b></p> <p>Harley-davidson will notify owners and dealers will replace the bcm free of charge. The safety recall is expected to begin on or about February 21, 2011. Owners may contact harley-davidson at 1-414-343-4056.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>NEWMAR / ESSEX DIESEL PUSHER-2011<br/>NEWMAR / KING AIRE-2011<br/>NEWMAR / MOUNTAIN AIRE DP- 2011</p> <p><b>MANUFACTURER:</b> NEWMAR CORPORATION</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>106</p> <p><b>SUMMARY:</b> Newmar is recalling certain model year 2011 Essex dp, king aire db, and mountain aire dp recreational vehicles manufacturer from october 14, 2009, through november 30, 2010. These vehicles are equipped with v-bus fet-8 control boards manufactured by kib electronics and there is a potential defect that may result in an unrecognized excessive current situation.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>This failure may create a shock or fire hazard.</p>   | <p><b>REMEDY</b></p> <p>Dealers will reprogram the kib v-bus lighting and control network free of charge. The safety recall is expected to begin on or about February 25, 2011. Owners may contact newmar at 1-574-773-7791.</p>            |

| AUTO: MOTOR VEHICLE |   |   |   |
|---------------------|---|---|---|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER  | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b></p> <p>COACHMEN / CHAPARRAL- 2007-2008<br/> COACHMEN / SANTARA- 2004-2005<br/> COACHMEN / SOMERSET -2004-2006<br/> COACHMEN / SPORTSCOACH ELITE-2004-2006<br/> COACHMEN / WYOMING- 2007-2008</p> <p><b>MANUFACTURER:</b> COACHMEN RV COMPANY, LLC</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>740</p> <p><b>SUMMARY:</b> Coachmen is recalling certain model year 2007-2008 chaparral, model year 2004-2006 somerset, model year 2007-2008 wyoming, model year 2004-2005 santara, and model year 2004-2006 sportscoach elite motor homes and fifth wheel trailers manufactured from october 2003, through september 2007. These vehicles are equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>               | <p><b>CONSEQUENCE</b></p> <p>An overheated receiver could cause a fire.</p>   | <p><b>REMEDY</b></p> <p>Coachmen is working with dimplex to identify and notify any affected owners. Dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539 or coachmen motor works customer service at 1-866-953-5555.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b></p> <p>COACHMEN / AURORA-1997<br/> GEORGIE BOY / CRUISE AIR -2000-2002<br/> GEORGIE BOY / CRUISE MASTER- 1999-2003<br/> GEORGIE BOY / LANDAU -1999-2002<br/> GEORGIE BOY / MAVERICK-1999-2002<br/> GEORGIE BOY / SUITE -2000-2002<br/> SPORTSCOACH / ELITE - 2004-2009<br/> SPORTSCOACH / LEGEND- 2008-2009</p> <p><b>MANUFACTURER:</b> COACHMEN RV COMPANY, LLC</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>888</p> <p><b>SUMMARY:</b> Coachmen is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>Coachmen is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p>    |

| AUTO: MOTOR VEHICLE |   |   |  |
|---------------------|---|---|--|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>DYNAMAX / DYNA AIRE- 2009-2010</p> <p><b>MANUFACTURER:</b> DYNAMAX CORPORATION</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>14</p> <p><b>SUMMARY:</b> DYNAMAX is recalling certain model year 2009 and 2010 dyna aire 5th wheels equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>DYNAMAX is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p>                      |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>DAMON / CHALLENGER-2007-2010<br/>DAMON / DAYBREAK- 2007-2011<br/>DAMON / OUTLAW- 2007-2009<br/>FOUR WINDS / HURRICANE -2011</p> <p><b>MANUFACTURER:</b> THOR MOTOR COACH</p> <p><b>COMPONENT:</b> FUEL SYSTEM,<br/>GASOLINE:STORAGE:TANK ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>371</p> <p><b>SUMMARY:</b> Thor motor coach is recalling certain model year 2007-2010 damon challenger, model year 2008-2009 challenger platinum, model year 2007-2011 daybreak, model year 2010 daybreak classic, model year 2009-2010 daybreak sport, model year 2007-2009, outlaw and model year 2011 four winds hurricane, recreational vehicles manufactured from march 2007, through august 2008. the fuel-fill cap assemblies used to seal the unused side of the dual-fill gasoline fuel tank were produced with a hose material that did not meet design specifications. During normal usage the hose material may deteriorate which may result in fuel leaks.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>A fuel leak increases the risk of a fire which may result in property damage, personal injury, or death.</p>   | <p><b>REMEDY</b></p> <p>Navistar/workhorse is handling the remedy and owner notification for this campaign please see navistar/workhorse's defect report 10v-348. navistar/workhorse will replace the original fuel-fill cap assemblies with ones assembled with hose material that meets design specifications. This service will be performed free of charge. Owners may contact navistar at 1-260-461-1890.</p> |

| AUTO: MOTOR VEHICLE |  |  |   |
|---------------------|--|--|---|
| NOTIFYING COUNTRY   | PRODUCT  | ANGER  | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>SUZUKI / GRAND VITARA- 2009-2011<br/>SUZUKI / SX4- 2010-2011</p> <p><b>MANUFACTURER:</b> AMERICAN SUZUKI MOTOR CORP.</p> <p><b>COMPONENT:</b> ELECTRICAL<br/>SYSTEM:ALTERNATOR/GENERATOR/REGULATOR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>32,291</p> <p><b>SUMMARY:</b> SUZUKI is recalling certain model year 2009-2010 suzuki grand vitara multipurpose passenger vehicles equipped with 4-cylinder engines; model year 2011 suzuki grand vitara multipurpose passenger vehicles produced prior to october 17, 2010; model year 2010 suzuki sx4 passenger vehicles; and 2011 suzuki sx4 passenger vehicles produced prior to october 14, 2010. the tension adjuster pulley for the drive belt that operates the alternator, water pump, air conditioner compressor and power steering pump, has an improperly manufactured internal spring that can break due to repeated stress. If the spring breaks, the drive belt will not be adjusted properly and can slip, causing a squeaking noise. Or the drive belt could come off causing the driver to increase to steer the vehicle. This can also cause the coolant temperature indication to rise, which can lead to the engine overheating, or can cause the charging light to come on, which can lead to battery discharge and engine stall.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>If the drive belt comes off, requiring the driver to use increased steering effort, or the engine stalls, a vehicle crash could occur</p> | <p><b>REMEDY</b></p> <p>Dealers will replace the tension adjuster pulley with an improved part. This service will be performed free of charge. The safety recall is expected to begin on or before February 16, 2011. Owners may contact Suzuki at 1-887-697-8985 or visit suzuki's website at <a href="http://www.suzukiauto.com">http://www.suzukiauto.com</a>.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>FORD / EXPLORER- 2011</p> <p><b>MANUFACTURER:</b> FORD MOTOR COMPANY</p> <p><b>COMPONENT:</b> SEATS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>1,658</p> <p><b>SUMMARY:</b> FORD is recalling certain model year 2011 explorer vehicles manufactured from July 15, 2010, through December 13, 2010, equipped with second row 60% seats with manual recliner mechanisms that may have components that are out of dimensional specification. These seats fail to conform to the requirements of federal motor vehicle safety standard no. 207, "seating systems."</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>In the event of a crash, the seat back may not provide the required strength, increasing the risk of injury.</p>                          | <p><b>REMEDY</b></p> <p>Ford will notify owners and dealers will repair the seats free of charge. The safety recall is expected to begin on or about February 14, 2011. Owners may contact ford motor company customer relationship center at 1-866-436-7332.</p>   |

| AUTO: MOTOR VEHICLE |  |  |   |
|---------------------|--|--|---|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER   | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>STRICK / DRY FREIGHT-2006-2009</p> <p><b>MANUFACTURER:</b> STRICK CORPORATION</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>94</p> <p><b>SUMMARY:</b> Strick is recall certain model year 2006-2009 dry freight vans equipped with arvinmeritor axles. These vehicles have a defect involving spindle nuts and stake washers which has been identified as low torque on the spindle nut on arvinmeritor tl series trailer axles installed in van trailers where the stake washer for the nut is staked in a single location as opposed to multiple locations.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>Low and/or no torque on the nut can result in excessive end-play in the wheel-end system and could progress to a wheel separation which could result in a crash.</p>          | <p><b>REMEDY</b></p> <p>Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Please see arvinmeritor defect report 10e-058. The manufacturer has not yet provided an owner notification schedule. Owners may contact arvinmeritor at 1-248-273-4641 or strick at 1-260-692-1334.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>R-VISION / ONYX -2011</p> <p><b>MANUFACTURER:</b> NAVISTAR, INC</p> <p><b>COMPONENT:</b> SUSPENSION</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>11</p> <p><b>SUMMARY:</b> Navistar is recalling certain model year 2011 onyx travel trailers manufactured from June 18, 2010, through September 29, 2010. under extreme rough road conditions, the suspension equalizer linkages may contact, and possibly damage, brake wiring and/or liquid propane line that are routed above the suspension.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>Damage to brake wiring may result in a loss of braking ability of the trailer which may lead to a crash possibly resulting in property damage, personal injury, or death.</p> | <p><b>REMEDY</b></p> <p>The brake wiring and the liquid propane line will be routed away from the suspension components. This service will be performed free of charge. The safety recall is expected to begin on or about February 28, 2011. Owners may contact navistar at 1-800-448-7825.</p>  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>FAIRPLAY / EVE LSV -2010-2011</p> <p><b>MANUFACTURER:</b> FAIRPLAY ELECTRIC CARS</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM:WIRING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>1,632</p> <p><b>SUMMARY:</b> Fairplay is recalling certain model year 2010 and 2011 eve lsv electric low speed vehicles manufactured from July 31, 2009, through December 27, 2010. A fuse specified to be in the 12v accessory circuit was not built into the wiring harness. The fuse value on the input to the voltage reducer was too large to prevent possible damage. There was no fuse inserted in the 12 volt circuit.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>Without this fuse for protection, a short in any portion of the 12v wiring can melt wire insulation and pose the risk of a fire.</p>  | <p><b>REMEDY</b></p> <p>Fairplay will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin on or about February 17, 2011. Owners may contact fairplay at 1-866-557-0342.</p>   |

| AUTO: MOTOR VEHICLE |   |   |   |
|---------------------|---|---|---|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER  | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>SPACE CRAFT / FIFTH WHEEL TRAILER- 2006</p> <p><b>MANUFACTURER:</b> SPACE CRAFT MFG. INC.</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>2</p> <p><b>SUMMARY:</b> Space craft is recalling certain model year 2006 530 and v420 space craft recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p> | <p><b>REMEDY</b></p> <p>Space craft is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>VOLVO / VNL- 2011</p> <p><b>MANUFACTURER:</b> VOLVO TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM:BATTERY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>1,847</p> <p><b>SUMMARY:</b> Volvo trucks is recalling certain model year 2011 vnl trucks manufactured from march 23, 2010, through december 22, 2010. There is a potential for the vehicle to start without warning because of an unintended path to ground that exists. This can occur when either the negative battery cable is disconnected at the battery/fusible link or if the fusible link opens as a result of a short circuit.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>This presents a risk of injury with nonoperational conditions such as when the vehicle is being serviced.</p>  | <p><b>REMEDY</b></p> <p>Dealers will replace a wiring harness free of charge. The safety recall is expected to begin on or before March 18, 2011. Owners may contact Volvo trucks at 1-800-528-6586.</p>  |

| AUTO: MOTOR VEHICLE |  |   |  |
|---------------------|--|---|--|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>COACHMEN / BROOKSTONE- 2010-2011</p> <p><b>MANUFACTURER:</b> COACHMEN RV COMPANY, LLC</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>365</p> <p><b>SUMMARY:</b> Coachmen is recalling certain model year 2010-2011 brookstone trailers equipped with dometic conventional microwave oven. The conventional microwave oven may not have been installed according to the manufacturers installation instructions. The blower unit should have been rotated to 180 degrees to direct the exhaust out of the front of the conventional oven, prior to installing the appliance.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>This could present a risk of a fire.</p>   | <p><b>REMEDY</b></p> <p>Dealers will inspect the conventional microwave oven and if the defect is present, the blower tube will be rotated to comply with the manufacturers instructions. This service will be performed free of charge. The safety recall is expected to begin during February 2011. Owners may contact coachmen at 574-825-8360.</p>   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>GEORGIE BOY / CRUISE MASTER-2009</p> <p><b>MANUFACTURER:</b> COACHMEN INDUSTRIES, INC.</p> <p><b>COMPONENT:</b> FUEL SYSTEM, GASOLINE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>27</p> <p><b>SUMMARY:</b> Coachmen is recalling certain model year 2009 georgie boy cruise master class a motorhomes. The fuel-fill cap assemblies used to seal the unused side of the dual-fill gasoline fuel tank were produced with a hose material that did not meet design specifications. During normal usage the hose material may deteriorate which may result in fuel leaks.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>A fuel leak increases the risk of a fire which may result in property damage, personal injury, or death.</p>   | <p><b>REMEDY</b></p> <p>Workhorse/navistar is handling the owner notification and remedy for this campaign. Please see workhorse/navistar safety defect report 10v-348. workhorse/navistar will replace the original fuel-fill cap assemblies with ones assembled with hose material that meets design specifications. This service will be performed free of charge. Owners may contact workhorse/navistar at 1-260-461-1890.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>KEYSTONE / RAPTOR -2011</p> <p><b>MANUFACTURER:</b> KEYSTONE RV COMPANY</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>47</p> <p><b>SUMMARY:</b> Keystone is recalling certain model year 2011 raptor recreational vehicles. The fresh water fill/draw line may be connected to the black waste water's tank.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>In the event the fresh water line is connected to the black waste water's tank, the fresh water may become contaminated leading to an increased risk of personal injury.</p> | <p><b>REMEDY</b></p> <p>Dealers will inspect the water lines to verify they are plumbed correctly and correct if necessary. This service will be performed free of charge. The safety recall is expecting to begin during February 2011. Owners may contact keystone customer service at 1-866-425-4369.</p>   |




| AUTO: MOTOR VEHICLE |   |  |   |
|---------------------|---|--|---|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER   | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b></p> <p>CUSTOM DESIGNED / 4200FB-5 -2005<br/>           CUSTOM DESIGNED / 5000FB-5 -2000 2008<br/>           CUSTOM DESIGNED / 5100FB-5 - 2004<br/>           CUSTOM DESIGNED / 5300FB-5- 2001 2005 2007 2009</p> <p><b>MANUFACTURER:</b> TRAVEL UNITS INC.</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>9</p> <p><b>SUMMARY:</b> Travel units is recalling certain custom designed recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>  | <p><b>REMEDY</b></p> <p>Travel units is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall is expected to begin during february 2011. Owners may contact norcold at 1-800-767-9101.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b></p> <p>PITTS TRAILERS / HD-35 -2005-2008<br/>           PITTS TRAILERS / LB-35 - 2004-2008<br/>           PITTS TRAILERS / LP - 2004-2008<br/>           PITTS TRAILERS / LT - 2004-2008<br/>           PITTS TRAILERS / PT - 2005-2008<br/>           PITTS TRAILERS / TA- 2005-2008</p> <p><b>MANUFACTURER:</b> PITTS ENTERPRISES, INC</p> <p><b>COMPONENT:</b> SERVICE BRAKES, AIR:ANTILOCK:ABS WARNING LIGHT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>3,650</p> <p><b>SUMMARY:</b> Pitts enterprises is recalling certain model year 2005 through 2008 flatbed tractor trailers, models lt, lp, lb-35, hd-35, ta, and pt, manufactured from august 2004 through october 2008, equipped with the msqr 5000 differential pressure regulator/quick release valve device manufactured by air brake systems. The msqr 5000 does not contain the requisite warning light which fails to conform to the requirements of federal motor vehicle safety standard no. 121, "air brake systems."</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The purpose of the federal motor vehicle safety standard (fmvss) for air brake systems, no. 121, is to insure safe braking performance under normal and emergency conditions. The msqr 5000, which was installed in the trailers subject to the recall to satisfy fmvss no. 121's abs requirements, does not meet the definition of an abs as required by fmvss no. 121. also, the trailers do not have a light to warn the operator of an abs malfunction as required by fmvss no. 121. pitts has received no complaints or reports of any onroad failures associated with this noncompliance.</p> | <p><b>REMEDY</b></p> <p>Pitts enterprises will notify owners and dealers will replace the msqr 5000 system with a compliant system free of charge. The safety recall is expected to begin during February 2011. Owners may contact the sales department of pitts enterprises at 1-334-855-4754.</p>   |

| AUTO: MOTOR VEHICLE |  |   |  |
|---------------------|--|---|--|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>FORD / F-150-2009 -2010</p> <p><b>MANUFACTURER:</b> FORD MOTOR COMPANY</p> <p><b>COMPONENT:</b> STRUCTURE:BODY:DOOR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>280,946</p> <p><b>SUMMARY:</b> Ford is recalling certain model year 2009 and 2010 f-150 vehicles manufactured from january 18, 2008, through november 30, 2009. The interior door handle housing embossment retaining the interior door handle spring may fracture during normal usage resulting in insufficient spring force to return the handle to the fully stowed position.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>In the event of a side impact crash, the door handle spring can fail causing the door latch to open.</p> | <p><b>REMEDY</b></p> <p>Owners will be initially notified and instructed to take their vehicles to a ford or lincoln/mercury dealer if any interior door handle is loose or fails to return to the stowed position after activation for replacement of the affect module. Once parts become available, owners will be renotified and instructed to take their vehicles to a ford or lincoln/mercury dealer for inspection of each interior door handle. Depending on the results of the inspection, the dealer will either add a spring embossment reinforcement or replace the interior door handle module free of charge. The safety recall is expected to begin on or about february 14, 2011. owners may contact ford at 1-866-436-7332.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b><br/>MORGAN / PENSKE -2010</p> <p><b>MANUFACTURER:</b> MORGAN TRAILER MANUFACTURING</p> <p><b>COMPONENT:</b> STRUCTURE:FRAME AND MEMBERS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>729</p> <p><b>SUMMARY:</b> Morgan is recalling certain model year 2010 penske vehicles. The "z" mounting brackets, which support the van body above the chassis, are subject to bending and, in extreme cases, individually are subject to breaking. If multiple "z" mounting brackets break, the parcel van body may lower onto the chassis frame rail. The parcel van body touching the frame rail may cause interference between the walk ramp and the fuel line, and may pull away from the chassis cab.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>Severe overloading could cause the brackets to break increasing the risk of a crash.</p>                 | <p><b>REMEDY</b></p> <p>Dealers will replace all of the "z" mounting brackets free of charge. The safety recall began in in May 2010. Owners may contact morgan at 1-610-286-2223.</p>   |

| AUTO: MOTOR VEHICLE |  |  |  |
|---------------------|--|--|--|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER   | MEASURES ADOPTED                                       |
| EU/IRELAND          | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p>1) Discovery 3</p> <p>2) Range Rover Sport</p> <p><b>BRAND:</b> Land Rover</p> <p><b>TYPE/NUMBER OF MODEL:</b></p> <p>Model year: 2007 – 2009. The vehicles affected by the recall have had high pressure fuel pumps installed as aftermarket replacement parts:</p> <p>1) Discovery 3: TDV6 EU4, VIN range: LA412306 – LA512711 (specific vehicles);</p> <p>2) Range Rover Sport: TDV6 EU4, VIN range: LS983192 – LS999999 (specific vehicles) and LS100000 – LS215295 (specific vehicles).</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> United Kingdom</p> <p>No picture available</p> | <p><b>FIRE</b></p> <p>The products pose a fire risk because the high pressure fuel pump installed as an aftermarket replacement part may leak fuel. In extreme cases, it is possible that the vehicle may catch fire.</p>  | Voluntary corrective action taken by the manufacturer. |
| EU/IRELAND          | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car C4, C4 Picasso, C5 II, C5 (X7), Dispatch</p> <p><b>BRAND:</b> Citroen II</p> <p><b>TYPE/NUMBER OF MODEL:</b></p> <p>e2*98/14*0254*13, e2*98/14*0254*14, e2*2001/116*0302*02, e2*2001/116*0302*14, e2*2001/116*0302*03, e2*2001/116*0306*04, e2*2001/116*0360*00, e2*2001/116*0360*01, e2*2001/116*0345*01, e2*2001/116*0345*06, e2*2001/116*0350*03, e2*2001/116*0350*03</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> France</p> <p>No picture available</p>  | <p><b>INJURIES</b></p> <p>The products pose an injuries risk because the vacuum pump valve may have problems opening and may occasionally limit braking assistance.</p>  | Voluntary corrective action taken by the manufacturer. |
| EU/GREECE           | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car "Wrangler and Wrangler Unlimited (type JK)"</p> <p><b>BRAND:</b> Jeep</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns 2007 to 2010 model year vehicles.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> United States</p> <p>No picture available</p>  | <p><b>INJURIES</b></p> <p>The product poses a risk of injuries as the front bumper liner may detach or sag allowing the bumper liner to contact one or more brake tubes, which could result in a hydraulic leak and reduce braking performance leading to a road accident.</p> | Voluntary corrective action taken by the manufacturer. |

| AUTO: MOTOR VEHICLE |   |  |  |
|---------------------|---|--|--|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER   | MEASURES ADOPTED                                       |
| EU/<br>PORTUGAL     | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car "Avensis"</p> <p><b>BRAND:</b> Toyota.</p> <p><b>TYPE/NUMBER OF MODEL:</b> Certain vehicles with 2.0 or 2.4 litre direct injection petrol engine (D4), model year: 2000 to 2008.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> United Kingdom</p> <p>No picture available</p> | <p><b>FIRE</b></p> <p>The product poses a risk of fire as:</p> <p>(1) The fuel pipe may develop small cracks and, in the worst case, causing fuel to leak.</p> <p>(2) Over time, fuel leakage may occur from the high pressure fuel pump check valve during operation of the fuel pump.</p>    | Voluntary corrective action taken by the manufacturer. |
| EU/<br>PORTUGAL     | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car "IS250, IS250C"</p> <p><b>BRAND:</b> Lexus</p> <p><b>TYPE/NUMBER OF MODEL: YEAR:</b> 2007 to 2009.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Japan</p> <p>No picture available</p>  | <p><b>FIRE</b></p> <p>The product poses a risk of fire as there is a possibility that, over time, the fuel pressure sensor connected to the engine fuel delivery pipe could become loose causing fuel to leak.</p>   | Voluntary corrective action taken by the manufacturer. |
| EU/GREECE           | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle "Multistrada"</p> <p><b>BRAND:</b> Ducati</p> <p><b>TYPE/NUMBER OF MODEL:</b> Models 1200 MY2010, 1200 ABS MY2010, 1200 S Touring MY2010 and 1200 S Sport MY2010</p> <p><b>COUNTRY OF ORIGIN:</b> Italy</p> <p>No picture available</p>  | <p><b>INJURIES</b></p> <p>The product poses a risk of injuries as it is possible that the engine can stall under certain conditions (when changing down gear or manoeuvring with the clutch disengaged with the engine at idle) which could lead to a road accident.</p>                       | Voluntary corrective action taken by the manufacturer. |
| EU/GREECE           | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car "Cherokee (type KK)"</p> <p><b>BRAND:</b> Jeep</p> <p><b>TYPE/NUMBER OF MODEL:</b><br/>The recall concerns 2008 model year vehicles.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> United States</p> <p>No picture available</p>  | <p><b>INJURIES</b></p> <p>The product poses a risk of injuries as the windshield wiper motor on the affected vehicles may fail without warning. Loss of the use of the windshield wipers could limit the driver's visibility under certain driving conditions and lead to a road accident.</p> | Voluntary corrective action taken by the manufacturer. |

| <b>AUTO: MOTOR VEHICLE</b> |   |  |   |
|----------------------------|---|--|---|
| <b>NOTIFYING COUNTRY</b>   | <b>PRODUCT</b>  | <b>DANGER</b>  | <b>MEASURES ADOPTED</b>   |
| <b>AUSTRALIA</b>           | <p>Toyota—Lexus IS250 (GSE20)—Fuel Pressure Sensor</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Lexus IS250 (GSE20)</p> <p><b>IDENTIFYING FEATURES</b></p> <p>VIN Range:<br/>           JTHBK262#02060424 - JTHBK262#02093965<br/>           JTHBK262#05052880 - JTHBK262#05097364<br/>           Campaign Number: 1523A<br/>           Target Number: 4,844</p> <p><b>SUPPLIER</b></p> <p>Toyota Motor Corporation Australia Limited<br/>           No picture available.</p>  | <p><b>HAZARDS</b></p> <p>Fuel could leak past a gasket used in the connection between the sensor and pipe and through the threaded portion of the sensor.</p> <p><b>DEFECTS</b></p> <p>Due to insufficient tightening of the fuel pressure sensor connected to the engine fuel delivery pipe with Nickel Phosphorus plating, there is a possibility that, over time, the pressure sensor could loosen.</p> | <p><b>CONSUMERS ACTION</b></p> <p>All owners of affected vehicles will receive a Recall Notification Letter.</p> <p>Owners are advised to contact their authorised Toyota Dealership for inspection and retightening of the fuel pressure sensor, and if the fuel is leaking, replacement of the fuel pressure sensor gasket with a new one.</p>                                      |
| <b>AUSTRALIA</b>           | <p>Ford—PJ and PK Ranger Models—Cruise Control</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Certain Ford PK Ranger XLT and Wildtrak models sold between April 2009 and January 2011 with cruise control fitted as a standard feature as well as certain PJ and PK Ranger vehicles that have had cruise control fitted as a Ford Genuine Accessory between April 2009 and January 2011.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign Number: S1102<br/>           Target Number: 8082</p> <p><b>SUPPLIER</b></p> <p>Ford Motor Company of Australia Limited<br/>           No picture available.</p> | <p><b>HAZARDS</b></p> <p>The driver may experience the inability to 'set' or 'activate' cruise control, or to 'cancel' or 'de-activate' cruise control when it is engaged.</p> <p><b>DEFECTS</b></p> <p>The cruise control system may not operate correctly.</p>   | <p><b>CONSUMERS ACTION</b></p> <p>Ford will write to owners of all PK Ranger XLT and Wildtrak vehicles at their last known address. Owners of PJ and PK Ranger models will be contacted by the Ford Dealer who installed the system in their vehicles.</p> <p>For further information, contact any authorised Ford Dealer or Ford's Customer Relationship Centre on 1800 503 672.</p> |
| <b>AUSTRALIA</b>           | <p>Suzuki—LT-A450/500/750</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>LT-A450XK8/K9/L0, LT-A500XP/K9/L0, LT-A500XPL1, LT-A750X/XP/K8/K9/L0/L1 - ATV and quad bikes.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>LT-A450X : year model 2008 to 2010<br/>           LT-A500XP: year model 2009 to 2011<br/>           LT-A750X: year model 2008 to 2011<br/>           LT-A750XP: year model 2008 to 2011<br/>           Campaign Number: SRC11-01<br/>           Target Number 2352</p> <p><b>SUPPLIER</b></p> <p>Suzuki Australia Pty Limited<br/>           No picture available.</p>                     | <p><b>HAZARDS</b></p> <p>Fuel may leak past the fuel pump gasket.</p> <p><b>DEFECTS</b></p> <p>The fuel tank opening (machining) for the pump installation may not have the adequate width of sealing surface around its complete circumference.</p>   | <p><b>CONSUMERS ACTION</b></p> <p>Suzuki Australia Pty Limited will write to owners of all affected vehicles.</p> <p>Owners are advised to contact their authorised Suzuki dealership to have the width of the sealing surface of the fuel tank inspected and if necessary replaced.</p>  |

| AUTO: MOTOR VEHICLE |  |  |  |
|---------------------|--|--|--|
| NOTIFYING COUNTRY   | PRODUCT  | DANGER   | MEASURES ADOPTED   |
| AUSTRALIA           | <p>Webasto Product Australia Pty Ltd—Webasto Hollandia 700/900 Series Sunroofs</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Vehicle sunroofs</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Affected sunroofs can be identified as follows:</p> <ul style="list-style-type: none"> <li>• For the Hollandia 700 models, consumers should look at the sunshade handle. If it says “Webasto” and the serial number located on the sunroof frame is within the range of 6000000 to 6396298, it is included in this replacement program.</li> <li>• The Hollandia 900 models have two tilt up glass panels, and there is a black, beige or grey plastic bar crossing the glass from side to side. If “Webasto” is embossed on the bar, it is included in this replacement program.</li> </ul> <p>All details on how to identify the sunroofs including photos are available on the dedicated website: <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a></p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised installers</p> <p><b>SUPPLIER</b></p> <p>Webasto Product Australia Pty Ltd</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://www.sunroofcheck.com">http://www.sunroofcheck.com</a></p>  | <p><b>HAZARDS</b></p> <p>Debonded glass presents an accident risk when the vehicle is in motion.</p> <p><b>DEFECTS</b></p> <p>Although unlikely, the adhesive bond between the glass and metal frame in certain Hollandia 700 and 900 series sunroofs may be insufficient. There is consequently a risk that the sunroof glass panel may completely debond from its frame.</p> | <p><b>CONSUMERS ACTION</b></p> <p>Webasto is asking all consumers who have a vehicle with a sunroof to check if their sunroof is included in the replacement program. The glass panel will be replaced at no cost to the consumer. Consumers who have an affected sunroof or require further information on this replacement program please go to <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a> or contact the Webasto Customer Service Centre on 1800 450 755 to schedule a repair. Until the Safety Recall Service is completed, the vehicle should be driven with caution and at a moderate speed.</p> |

| <b>AUTO: MOTOR VEHICLE</b> |   |   |   |
|----------------------------|---|---|---|
| <b>NOTIFYING COUNTRY</b>   | <b>PRODUCT</b>  | <b>DANGER</b>   | <b>MEASURES ADOPTED</b>   |
| <b>AUSTRALIA</b>           | <p>Holden—AH Astra, V2 Monaro, VX &amp; VY Commodore, VZ Commodore &amp; Monaro, WH Statesman &amp; Caprice, WK Statesman &amp; Caprice &amp; WL Statesman &amp; Caprice</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>AH Astra<br/>V2 Monaro<br/>VX &amp; VY Commodore<br/>VZ Commodore &amp; Monaro<br/>WH Statesman &amp; Caprice<br/>WK Statesman &amp; Caprice<br/>WL Statesman &amp; Caprice<br/>Models fitted with a factory fitted sunroof built between 2002 and 2006.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign Number: 11-H-01<br/>Target Number: 14,612</p> <p><b>SUPPLIER</b></p> <p>GM Holden Ltd<br/>No picture available.</p> | <p><b>HAZARDS</b></p> <p>In some instances, the glass panel could separate from its frame and dislodge from the vehicles while in motion.</p> <p><b>DEFECTS</b></p> <p>A bonding condition may exist with the glass panel on the sunroof.</p> | <p><b>CONSUMERS ACTION</b></p> <p>Owners of affected vehicles will be contacted by letter.</p> <p>Owners are advised to contact their authorised dealership for inspection and rectification.</p> |
| <b>AUSTRALIA</b>           | <p>Ford—BA/BAII and BF/BFII Falcon, Fairlane, LTD and FPV</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>BA/BAII and BF/BFII Falcon, Fairlane, LTD and FPV built between 8 May 2002 through to March 7 2008 with a factory fitted sunroof.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign Number: S1101<br/>Target Number: 5,658</p> <p><b>SUPPLIER</b></p> <p>Ford Motor Company of Australia Limited<br/>No picture available.</p>  | <p><b>HAZARDS</b></p> <p>In some instances, the glass panel could separate from its frame and dislodge from the vehicles while in motion.</p> <p><b>DEFECTS</b></p> <p>A bonding condition may exist with the glass panel on the sunroof.</p> | <p><b>CONSUMERS ACTION</b></p> <p>Ford will write to owners of affected vehicles.</p> <p>Owners are advised to contact their authorised dealership for inspection and rectification.</p>          |

| AUTO: CHILD SAFETY SEAT |  |   |  |
|-------------------------|--|---|--|
| NOTIFYING COUNTRY       | PRODUCT  | ANGER   | MEASURES ADOPTED   |
| USA                     | <p><b>CHILD RESTRAINT BRAND NAME / MODEL OR MODEL NO.:</b></p> <p>DJG / 17439 DJG / 22077 DJG / 22078<br/>           DJG / 22148 DJG / 22149 DJG / DJG / 22152<br/>           DJG / 22154 DJG / 22155 DJG / 22158<br/>           DJG / 22159 DJG / 22172 DJG / 22177<br/>           DJG / 22178 DJG / 22185 DJG / 22188<br/>           DJG / 22195 DJG / 22346 DJG / 22356<br/>           DJG / 22371 DJG / 22372 DJG / 22412<br/>           DJG / 22439 DJG / 22449 DJG / 22452<br/>           DJG / 22453 DJG / 22456 DJG / 22458<br/>           DJG / 22459 DJG / 22462 DJG / 22465<br/>           DJG / 22469 DJG / 22475 DJG / 22476<br/>           DJG / 22486 DJG / 22546 DJG / 22547<br/>           DJG / 22553 DJG / 22554 DJG / 22560<br/>           DJG / 22561 DJG / 22564 DJG / 22567<br/>           DJG / 22574 DJG / 22580 DJG / 22657<br/>           DJG / 22740 DJG / 22741 DJG / 22755<br/>           DJG / 22758 DJG / 22759 DJG / 22790<br/>           DJG / 22799 DJG / 22880 DJG / IC072</p> <p><b>MANUFACTURER:</b> DOREL JUVENILE GROUP<br/> <b>COMPONENT:</b> CHILD SEAT: HARNESS<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>           794,247</p> <p><b>SUMMARY:</b> DOREL JUVENILE GROUP (DJG) is recalling certain infant, convertible, and booster child restraint systems which were sold both as stand alone seats or part of a travel system (with stroller). Child restraint systems included in this recall begin with model numbers 22077, 22078, 22148, 22149, 22150, 22152, 22154, 22155, 22158, 22159, 22172, 22177, 22178, 22185, 22188, 22195, 22356, 22371, 22372, 22412, 22439, 22452, 22453, 22456, 22458, 22459, 22462, 22465, 22469, 22476, 22486, 22546, 22547, 22553, 22554, 22561, 22564, 22567, 22574, 22580, 22657, 22740, 22741, 22755, 22758, 22759, 22790, 22799, 22880, 22560, 22346, 17439, 22449, 22475, and ic072, manufactured from may 1, 2008, through april 30, 2009. the harness locking and release button does not always return to its locked position. A button that is not in the locked position can allow the harness adjustment strap to slip back through the adjuster as a child moves around in the seat and results in a loose harness.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a vehicle crash, the child may not be adequately protected and is at an increased risk for injury.</p> | <p><b>REMEDY</b></p> <p>Registered owners will receive a free remedy kit consisting of a small tube of non-toxic, food-grade lubricant to be applied to the center front adjuster (cfa) to prevent sticking and allow it to properly engage the cfa strap. Instruction on how to apply the lubricant will be provided, along with a label to indicate that the repair has been completed. Non-registered owners should contact djg at 1-866-623-3139 or by email at harnessadjustment@djgusa.com. Consumers will need the entire model number on the child restraint when contacting the manufacturer.</p> |



| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |  |
|-------------------------------|--|--|--|
| NOTIFYING COUNTRY             | PRODUCT  | DANGER   | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> TOPS UNLIMITED, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 637</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by tops unlimited, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by tops unlimited, Inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> FLORISUN CUSTOM COACH</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 397</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by florisun custom coach on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, THE MANUFACTURER OF THE SUNROOFS, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by florisun custom coach by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |   |
|-------------------------------|--|--|---|
| NOTIFYING COUNTRY             | PRODUCT  | ANGER  | MEASURES ADOPTED  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> ACCESSORIES UNLIMITED</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>524</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by [accessories unlimited on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by accessories unlimited by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll -free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> KOI WILCOX</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>31</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by koi wilcox on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                         | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by koi wilcox by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll -free at 1-888-749-8632.</p>            |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |  |  |
|-------------------------------|---|--|--|
| NOTIFYING COUNTRY             | PRODUCT   | ANGER  | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> AUTOHAUS AUTOMOTIVE, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>718</p> <p><b>SUMMARY:</b> Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by autohaus automotive, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by autohaus automotive, Inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> BENEFIT AUTO SERV. CORP.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>2,900</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by benefit auto serv. Corp. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us bybenefit auto serv. Corp. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>   |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |  |
|-------------------------------|--|--|--|
| NOTIFYING COUNTRY             | PRODUCT  | DANGER   | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> DEALER WORKS INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 947</p> <p><b>SUMMARY:</b> Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by dealer works, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us bydealer works, inc.] By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll -free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> CAROLINA RESTYLING</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 390</p> <p><b>SUMMARY:</b> Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by carolina restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Carolina restyling by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll -free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |  |
|-------------------------------|--|--|--|
| NOTIFYING COUNTRY             | PRODUCT  | DANGER   | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> AUTO OPTIONS, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 224</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by [auto options, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto options, inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>    |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> M &amp; M AUTOMOTIVE</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 8</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by m &amp; m automotive on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by m &amp; m automotive] by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |   |
|-------------------------------|--|--|---|
| NOTIFYING COUNTRY             | PRODUCT  | DANGER   | MEASURES ADOPTED  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> E&amp;G CLASSICS, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 1,304</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by e&amp;g classics, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                   | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by e&amp;g classics, inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>           |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> MARK FARIES TOP &amp; TRIM, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 173</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by mark faries top &amp; trim, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by mark faries top &amp; trim, inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |  |
|-------------------------------|--|--|--|
| NOTIFYING COUNTRY             | PRODUCT  | ANGER  | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> HAMS UPHOLSTERY</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 140</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by hams upholstery on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                 | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us byhams upholstery by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll -free at 1-888-749-8632.</p>         |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> E&amp;G CLASSICS, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 1,304</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by e&amp;g classics, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by e&amp;g classics, inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll -free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |  |  |
|-------------------------------|---|--|--|
| NOTIFYING COUNTRY             | PRODUCT   | DANGER   | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> CHUCKS TOPS &amp; TRIM, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 262</p> <p><b>SUMMARY:</b> Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by chuck's tops &amp; trim, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by chuck's tops &amp; trim, inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> TOP COVERAGE</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 2,257</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by top coverage on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                                | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by top coverage by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>                  |



| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |   |
|-------------------------------|--|--|---|
| NOTIFYING COUNTRY             | PRODUCT  | ANGER  | MEASURES ADOPTED  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> MARK FARIES TOP &amp; TRIM, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 173</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by mark faries top &amp; trim, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by mark faries top &amp; trim, inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> HAMS UPHOLSTERY</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 140</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by hams upholstery on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                                   | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us byhams upholstery by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>                   |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |  |   |
|-------------------------------|---|--|---|
| NOTIFYING COUNTRY             | PRODUCT   | DANGER   | MEASURES ADOPTED  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> AUTO INTERIOR DECORATORS, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 31</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by auto interior decorators, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto interior decorators, Inc. By clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> ATD OF SIOUXLAND</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 93</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by atd of siouxland on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                             | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by atd of siouxland by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>               |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |  |  |
|-------------------------------|---|--|--|
| NOTIFYING COUNTRY             | PRODUCT   | ANGER  | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> SOFT N' CUSHY AUTO UPHOLSTERY &amp; ACCESSOR</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 350</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by soft n' cushy auto upholstery on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by soft n' cushy auto upholstery by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> DON RITACCO &amp; CO. LTD</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 1,042</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by [don ritacco &amp; co., ltd on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                    | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by don ritacco &amp; co., ltd by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>    |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |  |
|-------------------------------|--|--|--|
| NOTIFYING COUNTRY             | PRODUCT  | ANGER  | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> AUTOXTRAS, LLC</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 210</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by autoxtras, llc on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by autoxtras, llc by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>                      |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> WEBSTER'S ULTIMATE PERFORMANCE, LLC</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 5</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by Webster's ultimate performance, llc on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by webster's ultimate performance, llc by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |  |
|-------------------------------|--|--|--|
| NOTIFYING COUNTRY             | PRODUCT  | DA NGER  | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> TEXAS AUTO TOPS OF AUSTIN</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 424</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by texas auto tops of austin on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by texas auto tops of austin by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> CC TOPS</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 548</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by [installer name] on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                            | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by [installer name] by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>          |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |   |   |
|-------------------------------|--|---|---|
| NOTIFYING COUNTRY             | PRODUCT  | DANGER  | MEASURES ADOPTED  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>H-D / SECURITY SYSTEM KIT</p> <p><b>MANUFACTURER:</b> HARLEY-DAVIDSON MOTOR COMPANY</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 805</p> <p><b>SUMMARY:</b> Harley-davidson is recalling certain accessory security system kits sold as part number 41000021 for installation on model year 2011 softtail motorcycles. These accessory kits contain body control module (bcm) part number 69993-11. The bcm has a case that may not have been properly sealed during production. An improper seal may allow water intrusion into the bcm which may cause engine stall.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>An engine stall while in traffic can result in a crash, which could lead to injury or death to the rider.</p>              | <p><b>REMEDY</b></p> <p>Harley-davidson will notify owners and dealers will replace the bcm free of charge. The safety recall is expected to begin on or about February 21, 2011. Owners may contact harley-davidson at 1-414-343-4056</p>  |
| USA                           | <p><b>TIRE BRAND NAME / TIRE LINE / TIRE SIZE:</b></p> <p>NITTO / TERRA GRAPPLER ALL TERRAIN / 255/55 R18 1093</p> <p>TOYO / OPEN COUNTRY ALL TERRAIN / LT285/70 R17 121S</p> <p>TOYO / TOUREVO LS II / 245/45 R18 96V</p> <p>TOYO / VERSADO CUV / P255/65 R18 109S</p> <p>TOYO / VERSADO CUV / 235/55 R18</p> <p>TOYO / VERSADO CUV / P235/55 R20 102T</p> <p>TOYO / VERSADO CUV / P245/55 R19</p> <p>TOYO / VERSADO LX II / 215/60 R16 95V</p> <p><b>MANUFACTURER:</b> TOYO TIRE HOLDINGS OF AMERICAS INC.</p> <p><b>COMPONENT:</b> TIRES:TREAD/BELT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 4,891</p> <p><b>SUMMARY:</b> TOYO TIRE is recalling certain toyo brand tires, models versado cuv p245/55 r19 103t, versado cuv p235/55 r20 102t, versado cuv 235/55 r18 100v, versado cuv p255/65 r18 109s, versado lx ii 215/60 r16 95v, open country all terrain lt285/70 r17 121s, and tourevo ls ii 245/45 r18 96v; and nitto brand terra grappler all terrain 255/55r18 109s, produced from september 19, 2010, through october 2, 2010. The rubber chemical mixture used in some of the recalled tires does not meet toyo's specification for these tires.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>Sections of the tread may become detached, potentially causing loss of vehicle control, possibly resulting in a crash.</p> | <p><b>REMEDY</b></p> <p>TOYO will notify owners and replace the tires free of charge, including mounting, balancing and taxes. The safety recall is expected to begin on or about february 18, 2011. Owners may contact toyo toll-free at 1-800-442-8696 (6:30 am to 5:00pm pacific time) or nitto at 1-888-529-8200 (8am to 5pm pacific time).</p> |

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[Product.Recalls@sgs.com](mailto:Product.Recalls@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2011 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

