

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 MARCH 2011

CONTENTS

AUTOMOTIVE

Pages 1 to 33




[Motor Vehicle \(57\)](#)

[Child Safety Seat \(1\)](#)



[Motor Vehicle Equipment \(11\)](#)


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Grande Punto – Punto EVO"</p> <p>BRAND: FIAT</p> <p>TYPE/NUMBER OF MODEL: Fiat Grande Punto, Punto EVO, all models (Recall Campaign 5521) and Fiat Grande Punto Van, Punto EVO Van, all models (Recall Campaign 5523).</p> <p>DESCRIPTION: The recall affects Fiat Grande Punto, Punto EVO cars whose chassis numbers range between 0510151 and 0635349 and between 1487461 and 1624852, and Fiat Grande Punto Van, Punto EVO Van cars, whose chassis numbers range between 0540644 and 635228 and between 1487467 and 1624710.</p> <p>COUNTRY OF ORIGIN: Italy</p> <p>No picture available</p>	<p>FIRE</p> <p>The product poses a risk of fire because the correct path of the wiring to the ABS could be pinched under the battery tray holding bracket and get damaged over time.</p>	Voluntary recall from consumers and corrective action by the importer.
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car RX</p> <p>BRAND: Lexus</p> <p>TYPE/NUMBER OF MODEL: RX300, RX330, RX350 and RX400h. Years: 2003 – 2006; left hand drive models.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because on the affected vehicles, if the forward retention clip, used to secure the floor carpet cover located in front of the centre console, is not installed properly, the cover may lean sideways and interfere with the accelerator pedal. If this occurs, the accelerator pedal may temporarily become stuck in a partially depressed position when returning to the idle position.</p>	Voluntary corrective action taken by the manufacturer.
EU/IRELAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Defender"</p> <p>BRAND: Land Rover</p> <p>TYPE/NUMBER OF MODEL: P022, models manufactured between 2007 and 2011.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: United Kingdom</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the parking brake may not hold the vehicle stationary on a gradient as a result of oil contamination from the transfer box to the brake shoes.</p>	Voluntary corrective action by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SWEDEN	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Snowmobiles</p> <p>BRAND: Arctic Cat</p> <p>TYPE/NUMBER OF MODEL: Arctic Cat model Z1, TZ1, F, Bearcat, M and CF. Model year 2010</p> <p>DESCRIPTION: Arctic Cat snowmobiles in variations of colour and model features. The model name is indicated on the side of vehicle, in the registration materials and owner's manual.</p> <p>COUNTRY OF ORIGIN: United States</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries because the front lower suspension arm can crack during use which could lead to loss of control.</p>	Voluntary corrective action.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car Corsa D</p> <p>BRAND: Opel</p> <p>TYPE/NUMBER OF MODEL: The recall concerns 2011 and 2012 model year Corsa D vehicles, with VINs from B 4 185570 to C 4 000027.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Spain</p> <p>No picture available</p>	<p>INJURIES</p> <p>The passenger airbag cover may become loose or detached from the instrument panel if the airbag is deployed.</p>	Voluntary corrective action taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Suzuki—GSX-R600, GSX-R750, GSF650, GSF1250, GSX650F, GSX1300BK, GSX1300R, GSR600, VLR1800, VLR1500, VL800, SFV650, AN400, AN250, DL1000, and LT-Z400</p> <p>PRODUCT DESCRIPTION</p> <p>All 2008-2009 Suzuki motorcycles with the following model numbers: GSX-R600, GSX-R750, GSF650, GSF1250, GSX650F, GSX1300BK, GSX1300R, GSR600, VLR1800, VLR1500, VL800, SFV650, AN400, AN250, DL1000, and LT-Z400</p> <p>IDENTIFYING FEATURES</p> <p>Target Number: 8795 Campaign Number: SRC11-02</p> <p>SUPPLIER</p> <p>Suzuki Australia Pty Ltd No picture available.</p>	<p>HAZARDS</p> <p>The battery may discharge and can lead to the engine stalling or a non-start condition.</p> <p>DEFECTS</p> <p>Some regulator/rectifier assemblies were produced with insufficient adhesion between the power module and the rectifier case. Due to the insufficient adhesion, heat generated from the power module can cause it to lift from the case. This condition can cause excessive heat in the module which can result in insufficient charge being provided to the battery.</p>	<p>CONSUMERS ACTION</p> <p>Suzuki will write to owners of affected vehicles.</p> <p>Owners are advised to contact their authorised Suzuki dealership for inspection and replacement of the regulator/rectifier with a modified unit.</p>
AUSTRALIA	<p>Peugeot—307, 308, 407, and Expert Vehicles—Engine Vacuum Pump</p> <p>PRODUCT DESCRIPTION</p> <p>307, 308, 407, and Expert vehicles manufactured between December 2006 and September 2009.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign: YWY Target Number: 7,051</p> <p>SUPPLIER</p> <p>Sime Darby Automobiles Pty Ltd t/as Peugeot Automobiles Australia No picture available.</p>	<p>HAZARDS</p> <p>In time the defect could alter the braking assistance.</p> <p>DEFECTS</p> <p>The valve on the vacuum pump in the brake assistance circuit may have a manufacturing non-conformity.</p>	<p>CONSUMERS ACTION</p> <p>A registered letter is being sent to all owners contactable by Peugeot Automobiles Australia within the affected VIN range.</p>
AUSTRALIA	<p>Honda—2006 Civic Hybrid Sedan</p> <p>PRODUCT DESCRIPTION</p> <p>2006 Civic Hybrid Sedan</p> <p>IDENTIFYING FEATURES</p> <p>Identification Plate Number 35111 VIN Range: JHMFD36206S200005 - JHMFD36206S204877 Campaign Number: 5JC Target Number: 816</p> <p>SUPPLIER</p> <p>Honda Australia Pty Ltd No picture available.</p>	<p>HAZARDS</p> <p>The short circuit could blow the main fuse causing the engine to stall and not restart.</p> <p>DEFECTS</p> <p>A rectifier diode used in the DC-DC converter may have been damaged during manufacture which could lead to an internal short circuit during customer usage.</p>	<p>CONSUMERS ACTION</p> <p>Owners of affected vehicles will be contacted by mail.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Peugeot—308, 3008, and RCZ Vehicles—Fuel Return Pipe</p> <p>PRODUCT DESCRIPTION</p> <p>Peugeot 308, 3008, and RCZ vehicles manufactured between March 2010 to October 2010.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: YYW Target Number: 424</p> <p>SUPPLIER</p> <p>Sime Darby Automobiles Pty Ltd t/as Peugeot Automobiles Australia</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>In some instances the fuel return pipe might wear through and cause a leak.</p> <p>DEFECTS</p> <p>Possible contact between the fuel return pipe and the fuel filter support bracket.</p>	<p>CONSUMERS ACTION</p> <p>A registered letter is being sent to all owners contactable by Peugeot Automobiles Australia within the affected VIN range.</p>
AUSTRALIA	<p>Holden—VE Series II Sportwagon—Rear Seat Striker</p> <p>PRODUCT DESCRIPTION</p> <p>Holden VE Series II Sportwagon models</p> <p>IDENTIFYING FEATURES</p> <p>VIN Range: 6G1E#8E###L520543 TO 6G1E#8E###L533854 (The hash (#) represents an alpha or numeric character not relevant to determining affected vehicles)</p> <p>Campaign Number: 11-H-02 Target Number: 768</p> <p>SUPPLIER</p> <p>GM Holden Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>In the event of emergency braking or vehicle collision the rear seat backrest may unlatch, increasing the likelihood of injury to passengers.</p> <p>DEFECTS</p> <p>The rear seat backrest may not remain in the latched position (upright) during vehicle motion.</p>	<p>CONSUMERS ACTION</p> <p>Owners of affected vehicles will be contacted by letter.</p>
AUSTRALIA	<p>Peugeot—207—Rear Brake Calliper Flexible Hose</p> <p>PRODUCT DESCRIPTION</p> <p>Peugeot 207 vehicles manufactured between October 2010 to November 2010.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: YYS Target Number: 234</p> <p>SUPPLIER</p> <p>Sime Darby Automobiles Pty Ltd t/as Peugeot Automobiles Australia</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Wearing of the rear brake calliper hose could result in a loss of brake fluid, causing the low brake fluid warning message to appear on the multifunction display.</p> <p>DEFECTS</p> <p>It is possible for the rear brake calliper hose to come into contact with the rear suspension spring which, over time, could wear the hose.</p>	<p>CONSUMERS ACTION</p> <p>A registered letter is being sent to all owners contactable by Peugeot Automobiles Australia within the affected VIN range.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
USA	<p>UNITS: About 1,350</p> <p>MANUFACTURER: Suzuki Motor Corporation</p> <p>DISTRIBUTORS: American Suzuki Motor Corp., of Brea, California; Montgomery Motors Ltd., of Honolulu, Hawaii; Suzuki del Caribe Inc., of Rio Piedras, Puerto Rico</p> <p>DESCRIPTION: This recall affects all 2009 LT-Z400 and LT-Z400Z QuadSport ATVs. The words "QuadSport" and the model number are written on the front left fender of the ATV.</p> <p>MANUFACTURED IN: Japan</p> 	<p>HAZARD</p> <p>The regulator/rectifier circuit board can fail and cause the engine to stall during riding due to an insufficient battery charge, increasing the risk of a crash.</p> <p>INCIDENTS/INJURIES</p> <p>American Suzuki has received 11 reports of regulator/rectifier failure. No injuries have been reported.</p>	Voluntary recall
USA	<p>NAME OF PRODUCT: Suzuki KingQuad ATVs</p> <p>Units: About 29,000</p> <p>MANUFACTURER: Suzuki Manufacturing of America Corporation</p> <p>DISTRIBUTORS: American Suzuki Motor Corp., of Brea, California; Montgomery Motors Ltd., of Honolulu, Hawaii; Suzuki del Caribe Inc., of Rio Piedras, Puerto Rico</p> <p>DESCRIPTION: This recall is for the following Suzuki KingQuad models: all 2008 to 2010 LT-A450X models, all 2009 to 2010 LT-A500X models, all 2008 to 2010 LT-A750X models and 2011 LT-A500X and LT-A750X models manufactured before December 11, 2010. The words "Suzuki KingQuad" are on the left and right sides of the fuel tank housing. Model numbers are on the left and right lower side panels above the footrests.</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD</p> <p>Some KingQuad ATV's plastic fuel tanks were improperly manufactured and can develop a fuel leak, posing a fire hazard.</p> <p>INCIDENTS/INJURIES</p> <p>American Suzuki has received 19 reports of fuel leaking from the recalled ATVs. No injuries have been reported.</p>	Voluntary recall

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Dirt Bikes</p> <p>UNITS: About 4,300</p> <p>IMPORTER: Baja Inc., d/b/a Baja Motorsports, of Anderson, S.C.</p> <p>DESCRIPTION: This recall involves all model DR50 and DR70 Baja dirt bikes with VIN numbers beginning with "L98." The model number and VIN are located on the product data plate, which is located on the side of the "goose neck" (where the handle bars meet the body of the bike).</p> <p>MANUFACTURED in: China</p> <p>Model# & VIN located here</p>  <p>Model# & VIN located here</p>	<p>HAZARD</p> <p>Fuel can leak from the fuel tank, posing a fire and burn hazard to consumers.</p> <p>INCIDENTS/INJURIES</p> <p>The firm has received six reports of fires from fuel leakage including one report of minor burns to a consumer's legs.</p>	Voluntary recall
USA	<p>VEHICLE MAKE / MODEL</p> <p>TOYOTA / FJ CRUISER- 2008-2011 TOYOTA / LAND CRUISER- 2008-2011 TOYOTA / SEQUOIA- 2008-2011 TOYOTA / TACOMA- 2008-2011 TOYOTA / TUNDRA- 2008-2011</p> <p>MANUFACTURER: TOYOTA MOTOR NORTH AMERICA, INC.</p> <p>COMPONENT: TIRES:PRESSURE MONITORING AND REGULATING SYSTEMS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 22,000</p> <p>SUMMARY: TOYOTA is recalling certain model year 2008 through 2011 fj cruiser, land cruiser, tacoma, sequoia and tundra vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 138, "tire pressure monitoring system (tpms)." the tire pressure monitoring systems were not re-calibrated correctly and therefore do not start illuminating the low tire pressure warning telltale at the required minimum activation pressure</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Failure to warn of tire deflations is a non-compliance with fmvss 138 and could lead to tire failure increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will re-initialize the tire pressure monitoring system free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Toyota at 1-800-331-4331.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL VOLKSWAGEN / ROUTAN- 2010</p> <p>MANUFACTURER: VOLKSWAGEN OF AMERICA, INC</p> <p>COMPONENT: ELECTRICAL SYSTEM:IGNITION:SWITCH</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 12,612</p> <p>SUMMARY: Volkswagen is recalling certain model year 2010 routan vehicles manufactured from October 2009 through June 2010. Some vehicles may experience inadvertent ignition key displacement from the run to accessory position while driving causing the engine to shut off.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An engine shutting off suddenly while driving could increase the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will replace the win module free of charge. The safety recall is expected to begin during April 2011. Owners may contact Volkswagen at 1-800-822-8987.</p>
USA	<p>VEHICLE MAKE / MODEL AMERICAN HAULER / FALCON XC- 2010 AMERICAN HAULER / NIGHTHAWK-2010</p> <p>MANUFACTURER: AMERICAN HAULER</p> <p>COMPONENT: WHEELS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 47</p> <p>SUMMARY: AMERICAN HAULER is recalling certain model year 2010 trailers equipped with 15" x 6" white spoke or modular design steel wheels with a six hole bolt pattern. Some of the wheels may have inadequate weld penetration between the outer ring and the center plate due to improper plate alignment.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>There could be a potential wheel failure and wheel loss increasing the risk of a crash, or personal injury.</p>	<p>REMEDY</p> <p>Dealers will inspect the wheels on the suspect vehicles and repair the trailers free of charge. The safety recall is expected to begin on or about March 10, 2011. Owners may contact trans texas tire at 1-800-289-8667.</p>
USA	<p>VEHICLE MAKE / MODEL TIMPTE / TDH- 2006</p> <p>MANUFACTURER: TIMPTE, INC.</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2</p> <p>SUMMARY: TIMPTE is recall certain model year 2006 tdh vehicles manufactured from September 8, 2005, through September 9, 2005, and equipped with arvinmeritor axles. Insufficient torque may have been applied on the spindle nut on the arvinmeritor TI series trailer axles installed in these van trailers where the stake washer for the nut is staked in a single location as opposed to multiple locations.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>LOW and/or no torque on the nut can result in excessive end-play in the wheel-end system and could progress to a wheel separation which could result in a crash.</p>	<p>REMEDY</p> <p>Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Please see arvinmeritor defect report 10e-058. The safety recall is expected to begin during March 2011. Owners may contact arvinmeritor at 1-248-273-4641.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>MCI / E4500 -2011 MCI / J4500- 2011 MCI / J4500C - 2011</p> <p>MANUFACTURER: MOTOR COACH INDUSTRIES, INC</p> <p>COMPONENT: VISIBILITY:REAR WINDOW WIPER/WASHER:MOTOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 144</p> <p>SUMMARY: MCI is recalling certain model year 2011 mci j4500, e4500, and j4500c motor coaches manufactured from May 1, 2010 through January 31, 2011, and equipped with doge windshield wipers. Certain wires may have been incorrectly installed by mci at the factory which could result in the windshield wipers failing to operate.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The driver's field of view may be reduced, which in turn could result in a crash or otherwise cause personal injury or property damage.</p>	<p>REMEDY</p> <p>Dealers will inspect the windshield wipers and connect any wires that were improperly installed. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owners may contact mci customer service at 1-800-241-2947.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>TRIPLE E RV / EMPRESS-2007 TRIPLE E RV / TOPAZ-2008</p> <p>MANUFACTURER: TRIPLE E RECREATIONAL VEHICLES</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2</p> <p>SUMMARY: TRIPLE E is recalling certain model year 2007 empres and model year 2008 topaz motor homes equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>TRIPLE E is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall began on February 28, 2011. Owners may contact norcold at 1-800-767-9101.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL FOREST RIVER / TSUNAMI -2000-2006</p> <p>MANUFACTURER: FOREST RIVER, INC.</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 38</p> <p>SUMMARY: FOREST RIVER is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>FOREST RIVER is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall is expected to begin on or before March 14, 2011. Owners may contact norcold at 1-800-767-9101.</p>
USA	<p>VEHICLE MAKE / MODEL VOLKSWAGEN / ROUTAN -2010</p> <p>MANUFACTURER: VOLKSWAGEN OF AMERICA, INC</p> <p>COMPONENT: ELECTRICAL SYSTEM:IGNITION:SWITCH</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 12,612</p> <p>SUMMARY: VOLKSWAGEN is recalling certain model year 2010 routan vehicles manufactured from October 2009 through june 2010. Some vehicles may experience inadvertent ignition key displacement from the run to accessory position while driving causing the engine to shut off.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An engine shutting off suddenly while driving could increase the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will replace the win module free of charge. The safety recall is expected to begin during April 2011. Owners may contact Volkswagen at 1-800-822-8987.</p>
USA	<p>VEHICLE MAKE / MODEL HEARTLAND / NORTH COUNTRY- 2010-2011</p> <p>MANUFACTURER: HEARTLAND RECREATIONAL VEHICLES, LLC</p> <p>COMPONENT: EQUIPMENT: RECREATIONAL VEHICLE:LPG SYSTEMS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 589</p> <p>SUMMARY: Heartland is recalling certain model year 2010-2011 north trail travel trailers. The suspension can come in contact with the LP pipe mounted on the frame under the trailer above the equalizer arm. Continued contact could cause a leak to develop.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This occurrence could have a potential for a fire which could result in serious bodily injury and/or property damage.</p>	<p>REMEDY</p> <p>Dealers will correct the vehicles as necessary free of charge. The safety recall is expected to begin during March 2011. Owners may contact heartland at 1-877-262-8032.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL FORD / E-350- 2005-2011</p> <p>MANUFACTURER: BRAUN CORPORATION</p> <p>COMPONENT: EQUIPMENT:ELECTRICAL:AIR CONDITIONER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 185</p> <p>SUMMARY: BRAUN is recalling certain model year 2005 through 2011 paratransit vans built on ford e-350 chassis from april 27, 2005, through july 29, 2010, equipped with carrier genv em-1 evaporator units (em-1) manufactured from january 1, 2006 through december 2010, containing a delphi pack-con iii fuse holder in an allied motion motor assembly; em-1 unit part numbers 77-62112-xx and 77-62512-xx, starting with serial number knt90890232 to serial number nne91230058. due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire.</p>	<p>REMEDY</p> <p>BRAUN will notify owners and instruct them to contact either carrier or a Braun dealer to obtain the free remedy. The safety recall is expected to begin during March 2011. Owners may contact carrier at 1-800-793-4741 or Braun at 1-800-the-lift (1-800-843-5438).</p>
USA	<p>VEHICLE MAKE / MODEL FREIGHTLINER / CASCADIA- 2006-2011 FREIGHTLINER / CENTURY- 2006-2011 FREIGHTLINER / COLUMBIA- 2006-2011 FREIGHTLINER / FLD- 2006-2011 FREIGHTLINER / M2- 2006-2011 STERLING / 9500- 2006-2011 WESTERN STAR / 4900- 2006-2011</p> <p>MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1,978</p> <p>SUMMARY: DAIMLER TRUCKS (DTNA) is recalling certain model year 2006 through 2011 freightliner, cascadia, century, columbia fld, and m2, sterling 9500, and western star 4900 heavy trucks manufactured from march 20, 2006, through june 30, 2010, equipped with specific mbe4000 epa07 model engines. The intake air grid heater may short circuit and fail due to excessive internal temperatures.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A short circuited grid heater could result in a vehicle fire and injury to vehicle occupants.</p>	<p>REMEDY</p> <p>DTNA will notify owners of the recall during March 2011. Another notification will be issued once the remedy is released. Dtna expects the remedy to be available by May 31, 2011. Repairs will be performed by dtna dealers free of charge. Owners may contact dtna toll-free at 1-800-547-0712. This recall is associated with a previous recall, campaign number 10v-341.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL HONDA / CIVIC HYBRID- 2006-2007</p> <p>MANUFACTURER: HONDA (AMERICAN HONDA MOTOR CO.)</p> <p>COMPONENT: ELECTRICAL SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 36,656</p> <p>SUMMARY: HONDA is recalling certain model year 2006-2007 Honda civic hybrid vehicles. There is a potential for the voltage converter that relays power from the integrated motor assist (ima) system to the vehicle's electrical components to fail.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This failure will cause the headlights to turn off, the engine to stall, and prevent the vehicle from being restarted, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will replace the voltage converter free of charge. The safety recall is expected to begin on or before March 18 2011. Owners may contact Honda customer service at 1-800-999-1009 a select option 4.</p>
USA	<p>VEHICLE MAKE / MODEL MCI / J4500- 2010</p> <p>MANUFACTURER: MOTOR COACH INDUSTRIES, INC</p> <p>COMPONENT: EQUIPMENT ADAPTIVE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 27</p> <p>SUMMARY: MCI is recalling certain model year 2010 j4500 motor coaches manufactured from October 2009 through august 2010, and equipped with Braun wheelchair lifts. The electrical and hydraulic lines that service the wheelchair lifts may be routed or clamped in a way that could result in the lines being pinched during lift operation.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This could result in a fire causing personal injury or property damage.</p>	<p>REMEDY</p> <p>MCI will improve the routing and clamping of the hydraulic and electrical lines servicing the Braun wheelchair lifts. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owners may contact mci customer service at 1-800-241-2947.</p>
USA	<p>VEHICLE MAKE / MODEL JEEP / WRANGLER—2010-2011</p> <p>MANUFACTURER: CHRYSLER GROUP LLC</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 20,459</p> <p>SUMMARY: CHRYSLER is recalling certain model year 2010-2011 jeep wrangler vehicles manufacturer from July 12, 2010, through September 10, 2010. Some vehicles may experience a degradation of fastener torque for various front and rear axle attachments to the chassis module.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This could result in noise, or ultimately, degradation in steering and handling characteristics which could lead to loss of directional control of the vehicle increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will re-torque all nineteen fasteners to the maximum residual torque values. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owners may contact Chrysler at 1-800-853-1403.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>CHAMPION / AMERICAN COACH- 2009 CHAMPION / AMERICAN CRUSADER -2010 CHAMPION / CHALLENGER -2007-2011 CHAMPION / CRUSADER -2008-2011 CHAMPION / CTS -2008-2009 CHAMPION / DEFENDER -2008-2010 CHAMPION / EZ-TRANS -2010 CHAMPION BUS / DEFENDER -2011</p> <p>MANUFACTURER: CHAMPION BUS, INC.</p> <p>COMPONENT: EQUIPMENT:ELECTRICAL:AIR CONDITIONER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 974</p> <p>SUMMARY: CHAMPION BUS is recalling certain vehicles equipped with carrier genv em-1 evaporator units. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire.</p>	<p>REMEDY</p> <p>CHAMPION BUS will notify owners and provide information on how to obtain the retrofit kit from carrier along with repair instructions. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owner may contact carrier at 1-800-793-4741 or champion bus at 1-810-724-6474.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>BUICK / LACROSSE- 2011 CADILLAC / SRX- 2011</p> <p>MANUFACTURER: GENERAL MOTORS CORP.</p> <p>COMPONENT: VISIBILITY:DEFROSTER/ DEFOGGER SYSTEM:WINDSHIELD:CONTROLS/WIRING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 10,179</p> <p>SUMMARY: GENERAL MOTORS is recalling certain model year 2011 buick lacrosse and cadillac srx vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 103, "windshield defrosting and defogging systems". On these vehicles, the software in the electronic climate control (ecc) module may disable the ability to adjust the heating, ventilation, and air conditioning (hvac) system settings. If this happens, the driver will not be able to control the heating, cooling, and ventilation for the vehicle.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If this condition affects the defrost system when it is required, it may decrease the driver's visibility, and could result in a crash.</p>	<p>REMEDY</p> <p>Dealers will reprogram the ecc module free of charge. The safety recall is expected to begin on or before March 11, 2011. Owners may contact Buick at 1-866-608-8080, Cadillac at 1-866-982-2339 or at the owner center at www.gmownercenter.com.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL NEW HORIZONS / FIFTH WHEEL TRAILER—2005</p> <p>MANUFACTURER: NEW HORIZONS RV CORPORATION</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1</p> <p>SUMMARY: NEW HORIZONS is recalling one model year 2005 fifth wheel trailer equipped with a 1200-series norcold refrigerator. The refrigerator being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>NEW HORIZONS is working with norcold to identify and notify the affected owner. The owner will be instructed to contact a norcold dealer to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p>
USA	<p>VEHICLE MAKE / MODEL BLUE BIRD / SCHOOL BUS- 2009</p> <p>MANUFACTURER: TRUCK SERVICES, INC.</p> <p>COMPONENT: EQUIPMENT:ELECTRICAL:AIR CONDITIONER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 5</p> <p>SUMMARY: TRUCK SERVICES is recalling certain model year 2009 school buses built on blue bird chassis from january 2009 through december 2009 and equipped with carrier genv em-1 evaporator units (em-1) manufactured from january 1, 2006 through december 2010, containing a delphi pack-con iii fuse holder in an allied motion motor assembly; em-1 unit part numbers 77-62112-xx and 77-62512-xx, starting with serial number knt90890232 to serial number nne91230058. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire.</p>	<p>REMEDY</p> <p>TRUCK SERVICES will notify owners and instruct them to contact either carrier or a truck services dealer to obtain the free remedy. The safety recall is expected to begin during March 2011. Owners may contact carrier at 1-800-793-4741 or truck services at 1-317-248-5606.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL STERLING / L-LINE- 2005-2007</p> <p>MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT: FUEL SYSTEM, OTHER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2,117</p> <p>SUMMARY: DAIMLER TRUCKS is recalling certain model year 2005-2007 sterling l-line vehicles configured with car hauler bodies and chassis, and equipped with epa04 mbe4000 engines with a fuel filter mounted at the rear of the engine, manufactured from September 13, 2004, through October 10, 2007. the lower low pressure fuel lines between the primary fuel pump and the engine mounted fuel filter, and the upper low pressure fuel line between the engine mounted fuel filter and the engine block may develop a substantial diesel fuel leak from cracking, or from abrasion due to contact with other components.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Fuel leak onto the roadway could cause a slippery road surface that could result in a crash.</p>	<p>REMEDY</p> <p>Dealers will replace the upper and lower low pressure fuel lines with a more robust fuel lines. This service will be performed free of charge. Dtna will notify owners of the recall during March 2011. Another notification will be issued once the remedy is released. Owners may contact Daimler trucks at 1-800-547-0712.</p>
USA	<p>VEHICLE MAKE / MODEL CHRYSLER / TOWN&COUNTRY- 2010 DODGE / GRAND CARAVAN- 2010 DODGE / JOURNEY AWD- 2010</p> <p>MANUFACTURER: CHRYSLER GROUP LLC</p> <p>COMPONENT: ELECTRICAL SYSTEM:IGNITION</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 154,388</p> <p>SUMMARY: CHRYSLER is recalling certain model year 2010 dodge journey, grand caravan, and chrysler town & country vehicles manufacturer from august 3, 2009, through june 17, 2010. Some vehicles may experience inadvertent ignition key displacement from the run to accessory position while driving causing the engine to shut off.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Engine shut off while driving could increase the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will replace the win modules free of charge. The safety recall is expected to begin during april 2011. owners may contact chrysler at 1-800-853-1403.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL BUICK / LACROSSE- 2011 CADILLAC / SRX- 2011</p> <p>MANUFACTURER: GENERAL MOTORS CORP.</p> <p>COMPONENT: VISIBILITY:DEFROSTER/ DEFOGGER SYSTEM:WINDSHIELD:CONTROLS/ WIRING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 10,179</p> <p>SUMMARY: GENERAL MOTORS is recalling certain model year 2011 buick lacrosse and cadillac srx vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 103, "windshield defrosting and defogging systems". On these vehicles, the software in the electronic climate control (ecc) module may disable the ability to adjust the heating, ventilation, and air conditioning (hvac) system settings. If this happens, the driver will not be able to control the heating, cooling, and ventilation for the vehicle.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If this condition affects the defrost system when it is required, it may decrease the driver's visibility, and could result in a crash.</p>	<p>REMEDY</p> <p>Dealers will reprogram the ecc module free of charge. The safety recall is expected to begin on or before March 11, 2011. Owners may contact Buick at 1-866-608-8080, Cadillac at 1-866-982-2339 or at the owner center at www.gmownercenter.com.</p>
USA	<p>VEHICLE MAKE / MODEL FORD / E-350- 2005-2011</p> <p>MANUFACTURER: BRAUN CORPORATION</p> <p>COMPONENT: EQUIPMENT:ELECTRICAL:AIR CONDITIONER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 185</p> <p>SUMMARY: Braun is recalling certain model year 2005 through 2011 paratransit vans built on ford e-350 chassis from april 27, 2005, through july 29, 2010, equipped with carrier genv em-1 evaporator units (em-1) manufactured from january 1, 2006 through december 2010, containing a delphi pack-con iii fuse holder in an allied motion motor assembly; em-1 unit part numbers 77-62112-xx and 77-62512-xx, starting with serial number knt90890232 to serial number nne91230058. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire.</p>	<p>REMEDY</p> <p>Braun will notify owners and instruct them to contact either carrier or a Braun dealer to obtain the free remedy. The safety recall is expected to begin during March 2011. Owners may contact carrier at 1-800-793-4741 or Braun at 1-800-the-lift (1-800-843-5438).</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MAZDA / MAZDA6 -2009-2010</p> <p>MANUFACTURER: MAZDA MOTOR CORP</p> <p>COMPONENT: FUEL SYSTEM, GASOLINE:STORAGE:TANK ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 52,000</p> <p>SUMMARY: MAZDA is recalling certain model year 2009-2010 mazda6 vehicles manufactured from april 8, 2008, through february 8, 2010. a certain type of spider may weave a web in the evaporative canister vent line and this may cause a restriction in the line. If this occurs, the fuel tank pressure may become excessively negative when the emission control system works to purge the vapors from the canister.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>As the canister is purged repeatedly during normal operation, the stress on the fuel tank may eventually result in a crack, potentially leading to fuel leakage and an increased risk of fire.</p>	<p>REMEDY</p> <p>Dealers will inspect and clean up the canister vent Lin, and install a spring to prevent this type of spider from entering the vent line. This service will be performed free of charge. The safety recall is expected to begin on or before March 25, 2011. Owners may contact mazda customer assistance center at 1-800-222-5500.</p>
USA	<p>VEHICLE MAKE / MODEL GOSHEN / EUROSHUTTLE-2006-2007 GOSHEN / G-FORCE -2010-2011 GOSHEN / GC II - 2006-2011 GOSHEN / PACER II -2006-2011 GOSHEN / SENTINEL -2006-2011</p> <p>MANUFACTURER: GOSHEN COACH</p> <p>COMPONENT: EQUIPMENT:ELECTRICAL:AIR CONDITIONER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2,017</p> <p>SUMMARY: GOSHEN COACH is recalling certain model year 2006-2011 buses equipped with carrier genv em-1 evaporator units. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire.</p>	<p>REMEDY</p> <p>GOSHEN COACH will notify owners and provide information on how to obtain the retrofit kit from carrier along with repair instructions. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owners may contact carrier's hotline at 1-800-793-4741.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MONACO RV / RIPTIDE- 2011</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: VISIBILITY:WINDSHIELD WIPER/WASHER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 52</p> <p>SUMMARY: NAVISTAR is recalling certain model year 2011 riptide recreational vehicles. The porous metal castings may cause cracking of the wiper arm at the mounting to the pivot shaft. Material cracking at the pivot shaft could result in the wiper arm being disabled without warning which could lead to reduced driver visibility.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Decreased drivers visibility may increase the risk of a crash possibly resulting in property damage, personal injury, or death.</p>	<p>REMEDY</p> <p>Dealers will replace the drivers and passengers side wiper arms free of charge. The safety recall is expected to begin on or before march 14, 2011. owners may contact navistar at 1-800-448-7825.</p>
USA	<p>VEHICLE MAKE / MODEL INTERNATIONAL / DURASTAR- 2009-2011</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: POWER TRAIN:MANUAL TRANSMISSION:SHIFT PATTERN INDICATOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2,101</p> <p>SUMMARY: NAVISTAR is recalling certain model year 2009-2011 international durastar trucks. The park pawl in the vehicle's transmission may not engage when the shift lever in the vehicle cab is placed in the "park" position.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This condition may allow the vehicle to move unexpectedly and without warning possibly resulting in property damage, personal injury, or death.</p>	<p>REMEDY</p> <p>Dealers will install a retaining bar on the end of the transmission's idler shaft to permanently prevent the shaft from moving. This service will be performed free of charge. The safety recall is expected to begin on or before March 18, 2011. Owners may contact navistar at 1-800-448-7825.</p>
USA	<p>VEHICLE MAKE / MODEL UTILITY / VS2DX -2008 UTILITY / VS2RA - 2007-2009</p> <p>MANUFACTURER: UTILITY TRAILER MANUFACTURING COMPANY</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 224</p> <p>SUMMARY: UTILITY TRAILER is recalling certain model year 2007-2009 vs2ra and model year 2008 vs2dx refrigerated and dry vans equipped with arvinmeritor axles. Insufficient torque may have been applied on the spindle nut on the arvinmeritor tl series trailer axles installed in these van trailers where the stake washer for the nut is staked in a single location as opposed to multiple locations.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>LOW AND/OR no torque on the nut can result in excessive end-play in the wheel-end system and could progress to a wheel separation which could result in a crash.</p>	<p>REMEDY</p> <p>Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Please see arvinmeritor defect report 10e-058. The safety recall is expected to begin during march 2011. Owners may contact arvin meritor at 1-248-273-4641.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL CADILLAC / XLR- 2004-2009 CHEVROLET / MALIBU- 2004-2007 SAAB / 9-3- 2003-2011</p> <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: TIGAS / TU303 TIGAS / TU456</p> <p>MANUFACTURER: TI GROUP AUTOMOTIVE SYSTEMS, LLC</p> <p>COMPONENT: FUEL SYSTEM, GASOLINE: DELIVERY:FUEL PUMP</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 4,887</p> <p>SUMMARY: TI automotive is recalling certain fuel pumps, part numbers tu456 and tu303, sold under various brand names as aftermarket and replacement equipment for the motor vehicles listed above. The defective fuel pump may seize, stopping the fuel flow to the engine creating a stalling condition.</p> <p>No picture available.</p>	<p>CONSEQUENCE A vehicle crash could occur should the engine stall while in use.</p>	<p>REMEDY TI Automotive will notify owners of record and will replace any defective fuel pump with a new or reworked fuel pump free of charge. The safety recall is expected to begin during March 2011. Owners may contact ti automotive at 1-888-867-3759 or log on to www.recallresponse.com.</p>
USA	<p>VEHICLE MAKE / MODEL JAYCO / EAGLE SUPER LITE- 2011</p> <p>MANUFACTURER: JAYCO, INC.</p> <p>COMPONENT: EQUIPMENT:OTHER:LABELS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 9</p> <p>SUMMARY: JAYCO is recalling certain model year 2011 eagle superlite fifth-wheels manufactured from November 15, 2010, through February 9, 2011. Due to a typographical error, the size of the tire as indicated on the federal id label is incorrectly identified. These vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 120, "tire selection and rims for motor vehicles other than passenger cars."</p> <p>No picture available.</p>	<p>CONSEQUENCE A misprinted label could lead to selection of an improperly sized replacement tire.</p>	<p>REMEDY Owners will be provided with corrected labels free of charge. The safety recall is expected to begin during March 2011. Owners may contact jayco at 1-574-825-0608.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>FREIGHTLINER / CASCADIA- 2006-2011 FREIGHTLINER / CENTURY- 2006-2011 FREIGHTLINER / COLUMBIA- 2006-2011 FREIGHTLINER / FLD- 2006-2011 FREIGHTLINER / M2- 2006-2011 STERLING / 9500- 2006-2011 WESTERN STAR / 4900- 2006-2011</p> <p>MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1,978</p> <p>SUMMARY: DAIMLER TRUCKS (DTNA) is recalling certain model year 2006 through 2011 freightliner, cascadia, century, columbia fld, and m2, sterling 9500, and western star 4900 heavy trucks manufactured from march 20, 2006, through june 30, 2010, equipped with specific mbe4000 epa07 model engines. The intake air grid heater may short circuit and fail due to excessive internal temperatures.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A short circuited grid heater could result in a vehicle fire and injury to vehicle occupants.</p>	<p>REMEDY</p> <p>DTNA will notify owners of the recall during March 2011. Another notification will be issued once the remedy is released. Dtna expects the remedy to be available by May 31, 2011. Repairs will be performed by dtna dealers free of charge. Owners may contact dtna toll-free at 1-800-547-0712. This recall is associated with a previous recall, campaign number 10v-341.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>TIMPTE / TDH- 2006</p> <p>MANUFACTURER: TIMPTE, INC.</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2</p> <p>SUMMARY: TIMPTE is recall certain model year 2006 tdh vehicles manufactured from September 8, 2005, through September 9, 2005, and equipped with arvinmeritor axles. Insufficient torque may have been applied on the spindle nut on the arvinmeritor TI series trailer axles installed in these van trailers where the stake washer for the nut is staked in a single location as opposed to multiple locations.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>LOW AND/OR no torque on the nut can result in excessive end-play in the wheel-end system and could progress to a wheel separation which could result in a crash.</p>	<p>REMEDY</p> <p>Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Please see arvinmeritor defect report 10e-058. The safety recall is expected to begin during march 2011. Owners may contact arvinmeritor at 1-248-273-4641.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL KIA / OPTIMA- 2006-2008</p> <p>MANUFACTURER: HYUNDAI-KIA AMERICA TECHNICAL CENTER INC</p> <p>COMPONENT: POWER TRAIN:AUTOMATIC TRANSMISSION:LEVER AND LINKAGE:COLUMN SHIFT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 70,115</p> <p>SUMMARY: KIA is recalling certain model year 2006-2008 optima vehicles manufactured from September 29, 2005, through June 13, 2007. There is a possibility that the shift cable may have been installed incorrectly, causing tension in the cable. If present, this condition could cause the cable to detach from the shifter assembly's dowel pin preventing the transmission from being shifted. The shift lever can then be moved into the park (p) position while the vehicle's transmission is still in the last used gear before detachment.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the driver leaves the vehicle without engaging the parking brake, there is a possibility that the vehicle can roll injure a person in its path or cause a crash.</p>	<p>REMEDY</p> <p>Dealers will inspect the shift cable and reinstall if necessary free of charge. The safety recall is expected to begin during March 2011. Owner may contact kia at 1-800-333-4542.</p>
USA	<p>VEHICLE MAKE / MODEL MCI / E4500 -2011 MCI / J4500 -2011 MCI / J4500C -2011</p> <p>MANUFACTURER: MOTOR COACH INDUSTRIES, INC</p> <p>COMPONENT: VISIBILITY:REAR WINDOW WIPER/WASHER:MOTOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 144</p> <p>SUMMARY: MCI is recalling certain model year 2011 mci j4500, e4500, and j4500c motor coaches manufactured from May 1, 2010 through January 31, 2011, and equipped with doge windshield wipers. Certain wires may have been incorrectly installed by mci at the factory which could result in the windshield wipers failing to operate.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The driver's field of view may be reduced, which in turn could result in a crash or otherwise cause personal injury or property damage.</p>	<p>REMEDY</p> <p>Dealers will inspect the windshield wipers and connect any wires that were improperly installed. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owners may contact mci customer service at 1-800-241-2947.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>FORD / EDGE- 2011 FORD / F-150- 2011 FORD / F-250- 2011 FORD / F-350 - 2011 FORD / F-450 - 2011 FORD / F-550 - 2011 LINCOLN / MKX -2011</p> <p>MANUFACTURER: FORD MOTOR COMPANY</p> <p>COMPONENT: ELECTRICAL SYSTEM: SOFTWARE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 8,022</p> <p>SUMMARY: FORD is recalling certain model year 2011 ford f-150, f-250, f-350, f-450, f-550, edge, and Lincoln mkx trucks manufactured from october 25, 2010, through november 20, 2010. These vehicles were inspected using integrated diagnostic system (ids) that had a custom software routine to read the suspect body control module (bcm) serial number. Based on the serial number the bcm was either not affected or replaced. The custom software routine was not reading the correct set of characters, and was not able to identify a bcm that required replacement affected bcms may have the potential for an internal short.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If an electrical short develops, an overheating condition may occur which could result in a vehicle fire.</p>	<p>REMEDY</p> <p>Dealer will inspect the body control module and if necessary replace it free of charge. The safety recall began on March 7, 2011. Owners may contact ford motor company customer relationship center at 1-866-436-7332.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>INTERNATIONAL / DURASTAR -2011-2012 INTERNATIONAL / WORKSTAR - 2011-2012</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: SERVICE BRAKES, AIR:SLACK ADJUSTERS:AUTOMATIC</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 33</p> <p>SUMMARY: NAVISTAR is recall certain model year 2011 and 2012 international durastar and workstar commercial trucks manufactured from October 19, 2010, and February 3, 2011, equipped with gunite automatic slack adjusters. Due to an incomplete "knitting" of the iron at the time of casting, inadequate structural integrity of the slack adjuster housing can occur, which could cause the housing to break at the handle under normal operating loads.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the slack adjuster housing were to break, the wheel brake to which the slack adjuster is attached would no longer function, reducing braking capacity and, in some cases, causing the vehicle to pull to one side. Reduced braking performance and/ or loss of steering control increases the risk of a crash.</p>	<p>REMEDY</p> <p>Navistar will notify owners and dealers will replace the subject slack adjusters free of charge. The safety recall is expected to begin on or about April 1, 2011. Owners may contact navistar at 1-800-448-7825.</p>


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL PREVOST / H3-45- 2010-2011 PREVOST / VIP-45—2011 PREVOST / X3-45—2011</p> <p>MANUFACTURER: PREVOST CARS, INC.</p> <p>COMPONENT: FUEL SYSTEM, OTHER:STORAGE:TANK ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 48</p> <p>SUMMARY: Prevost is recalling certain model year 2010 h3-45, model year 2011 vip-45 and x3-45 motor coaches manufactured from october 2010 through february 2011. The welding on the fuel tank supports is insufficient and could leading to the metal supports contacting the ground.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Should the metal supports contacting the ground underneath the vehicle could result in an undercarriage fire.</p>	<p>REMEDY</p> <p>Dealers will inspect and add redesigned support breaks free of charge. The safety recall is expected to begin during March 2011. Owners may contact prevost at 418-883-2888</p>
USA	<p>VEHICLE MAKE / MODEL SUMMIT / AD40—2006</p> <p>MANUFACTURER: SUMMIT TRAILER SALES, INC.</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 3</p> <p>SUMMARY: SUMMIT TRAILER is recall certain model year 2006 ad-40 vehicles manufactured from September 1, 2006, through September 15, 2006, and equipped with arvinmeritor axles. Insufficient torque may have been applied on the spindle nut on the arvinmeritor tl series trailer axles installed in these van trailers where the stake washer for the nut is staked in a single location as opposed to multiple locations.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Low and/or no torque on the nut can result in excessive end-play in the wheel-end system and could progress to a wheel separation which could result in a crash.</p>	<p>REMEDY</p> <p>Arvinmeritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. Please see arvinmeritor defect report 10e-058. The manufacturer has not yet provided an owner notification schedule. Owners may contact arvin meritor at 1-248-273-4641.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>KENWORTH / C500 -2011-2012 KENWORTH / T270 -2011-2012 KENWORTH / T370 -2011-2012 KENWORTH / T440 -2011-2012 KENWORTH / T470 -2011-2012 KENWORTH / T660 -2011-2012 KENWORTH / T800 -2011-2012 KENWORTH / W900 -2011-2012</p> <p>MANUFACTURER: PACCAR INCORPORATED COMPONENT: SERVICE BRAKES, AIR:SLACK ADJUSTERS POTENTIAL NUMBER OF UNITS AFFECTED: 280</p> <p>SUMMARY: PACCAR is recalling certain model year 2011-2012 kenworth t270/370, t440/t470, t800, t660, w900 and c500 vehicles manufactured between October 18, 2010, and January 28, 2011. Certain cast iron slack adjuster housings, which transmit braking force from the brake chamber push rod to the brake cam tube, may include a flow notch in the handle portion of the housing due to an error during the casting process. A flow notch in the handle portion may reduce the effective cross section structure and cause the slack adjuster housing to fracture.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the slack adjuster housing were to fracture, the wheel brake to which the slack adjuster housing is attached would no longer function, which could increase vehicle stopping distances, and if mounted on the steer axle, could cause the vehicle to pull to one side during braking, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will inspect and replace the slack adjuster housing as necessary. This service will be performed free of charge. The safety recall is expected to begin during April 2011. Owners may contact kenworth at 425-828-5440.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>ITASCA / ELLIPSE- 2011 WINNEBAGO / TOUR- 2011</p> <p>MANUFACTURER: WINNEBAGO INDUSTRIES, INC. COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE:LPG TANK ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 25</p> <p>SUMMARY: WINNEBAGO is recalling certain model year 2011 tour and Itasca ellipse motor homes manufactured from august 9, 2010 through January 21, 2011. These vehicles have the potential for a lp hose connection to be damaged when the slideout room is operated. If the lp hose makes contact with the slideout ram, it could be disconnected. If this were to happen, a leak would occur when the lp tank is opened.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The leaking lp then has the potential to ignite, which could result in personal injury or death.</p>	<p>REMEDY</p> <p>Dealers will inspect the hose and relocate a pipe clamp as well as adding a second clamp to the hose to ensure clearance is maintained during the operation of the slideroom. This service will be performed free of charge. The safety recall is expected to begin during March 2011. Owner may contact Winnebago at 641-585-6939.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>KENWORTH / T2000 - 2007-2012 KENWORTH / T660 -2007-2012 KENWORTH / T700 -2007-2012 KENWORTH / T800 -2007-2012 KENWORTH / W900 - 2007-2012 PETERBILT / 365-2007-2012 PETERBILT / 367-2007-2012 PETERBILT / 384 -2007-2012 PETERBILT / 386 -2007-2012 PETERBILT / 387-2007-2012 PETERBILT / 388-2007-2012 PETERBILT / 389 -2007-2012 PETERBILT / 587-2007-2012</p> <p>MANUFACTURER: PACCAR INCORPORATED COMPONENT: FUEL SYSTEM, OTHER:STORAGE:TANK ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 4,664</p> <p>SUMMARY: PACCAR is recalling certain model year 2008-2012 kenworth t2000, t660, t700, t800, and w900, as well as model year 2009-2012 peterbilt 365, 367, 384, 386, 387, 388, 389, and 587 trucks equipped with paccar mx engines. The oil module centrifugal spinner filter cap in the paccar mx engine may become loose, possibly allowing the cap to come off and engine oil to partially discharge from the oil module onto exhaust components.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The discharge of engine oil onto exhaust components which are hot, such as when the engine is under significant load, may cause a fire.</p>	<p>REMEDY</p> <p>Dealers will re-torque the oil module filter cap and install a secondary retention device on the secondary centrifugal spinner filter cap. This service will be performed free of charge. the safety recall is expected to begin during march 2011. Owners may contact kenworth at 1-425-828-5440 and peterbilt at 1-940-591-4196.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>FORD / RANGER—2010</p> <p>MANUFACTURER: FORD MOTOR COMPANY COMPONENT: FUEL SYSTEM, GASOLINE:DELIVERY:HOSES, LINES/PIPING, AND FITTINGS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 23,688</p> <p>SUMMARY: FORD is recalling certain model year 2010 ford ranger trucks manufactured from October 15, 2009, through may19, 2010. The engine fuel line in the area of the throttle body shield may not have a protective convolute (cover) properly installed. If the protective convolute on the fuel line is not assembled in the proper position, the edge of the shield may contact the fuel line. Over time this contact may chafe the fuel line, resulting in a fuel odor and a potential fuel leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A sufficient fuel leak in the presence of an ignition source may result in a fire.</p>	<p>REMEDY</p> <p>Dealers will trim the throttle body shield away from the fuel line and inspect the fuel line for wear, and replace the line if necessary free of charge. The safety recall began on March 4, 2011. Owners may contact the ford motor company customer relationship center at 1-866-436-7332.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL TRIPLE E RV / EMPRESS- 2007 TRIPLE E RV / TOPAZ -2008</p> <p>MANUFACTURER: TRIPLE E RECREATIONAL VEHICLES</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2</p> <p>SUMMARY: TRIPLE E is recalling certain model year 2007 empress and model year 2008 topaz motor homes equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>Triple e is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall began on February 28, 2011. Owners may contact norcold at 1-800-767-9101.</p>
USA	<p>VEHICLE MAKE / MODEL FOREST RIVER / TSUNAMI- 2000-2006</p> <p>MANUFACTURER: FOREST RIVER, INC</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 38.</p> <p>SUMMARY: FOREST RIVER is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>FOREST RIVER is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The safety recall is expected to begin on or before March 14, 2011. Owners may contact norcold at 1-800-767-9101.</p>

AUTO: CHILD SAFETY SEAT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ PORTUGAL	<p>CATEGORY: Childcare articles and children's equipment</p> <p>PRODUCT: Shell car seat Child restraint System in car (Cadeira G0+ integrada no Conjunto de Rua da marca Zippy Safe)</p> <p>BRAND: ZIPPY.</p> <p>TYPE/NUMBER OF MODEL: Article 19583832 and Article 19583842.</p> <p>DESCRIPTION: Shell car seat with a carrying handle for small children (till 13 kg). The product was distributed between February and March 2010.</p> <p>COUNTRY OF ORIGIN: Portugal</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries because the handle is not correctly fitted and could detach when used in the carrying function.</p>	Voluntary withdrawal from the market and corrective action taken by the retailer.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: INTEGRITY CUSTOMS</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 95</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by [installer name] on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by [installer name] by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTOCRAFT RESTYLING</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 75</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVS 900 series sunroofs installed as original equipment by autocraft restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Consequence: In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by autocraft restyling by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTO R VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: BLAINES AUTO ACCESSORIES</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 34</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by Blaine auto accessories on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Consequence: In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by [installer name] by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO TRIM DESIGN OF UTAH</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY Potential Number of Units Affected: 49</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by auto trim design of utah on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto trim design of Utah by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: GUNITE / AUTOMATIC SLACK ADJUSTER</p> <p>MANUFACTURER: ACCURIDE CORPORATION</p> <p>COMPONENT: SERVICE BRAKES, AIR:SLACK ADJUSTERS:AUTOMATIC</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 37,474</p> <p>SUMMARY: ACCURIDE is recalling certain gunite automatic slack adjusters manufactured from October 15, 2010, through January 31, 2011, sold for use as aftermarket equipment and sold and installed as original equipment in various heavy trucks. Due to an incomplete "knitting" of the iron at the time of casting, inadequate structural integrity of the slack adjuster housing can occur, which could cause the housing to break at the handle under normal operating loads. No picture available.</p>	<p>CONSEQUENCE</p> <p>If the slack adjuster housing were to break, the wheel brake to which the slack adjuster is attached would no longer function, causing the vehicle to have reduced braking capacity and, if mounted on the steer axle, the vehicle could pull to one side, possibly resulting in a crash.</p>	<p>REMEDY</p> <p>Accuride will notify owners of record for the aftermarket equipment and dealers will replace any affected slack adjusters free of charge. Accuride is working with the vehicle manufacturers to identify and notify vehicle owners of the recall. The safety recall is expected to begin during March 2011. Owners may contact their vehicle manufacturer or accuride at 1-812-962-5000.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: CATERPILLAR / C15</p> <p>MANUFACTURER: CATERPILLAR INC.</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 6,176</p> <p>SUMMARY: CATERPILLAR is recalling certain c15 diesel engines manufactured from april 24, 2006, through march 27, 2009, sold and installed as original equipment for various heavy trucks. Degradation of a combustion tube weld can result radial heat impingement on the body which may burn through certain bodies used on c15 engines. No picture available.</p>	<p>CONSEQUENCE</p> <p>This could result in a fire.</p>	<p>REMEDY</p> <p>Caterpillar will notify owners and repair the vehicles free of charge. Owners will be notified of the recall by the end of April 2011. Another notification will be issued once the remedy is released. Caterpillar expects the remedy to be available late July 2011. Owners may contact caterpillar toll-free at 1-800-447-4986.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: COACH AUTO RESTYLER</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 893</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by coach auto restyler on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us bycoach auto restyler by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: KEY AUTO SERVICE</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 30</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by key auto service on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by key auto service by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO TRIM DESIGN OF ND</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 67</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by auto trim design of nd on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto trim design of nd by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: KAR PRODUCTS INC.</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1,077</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by kar products inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by kar products inc. By clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: VOGUE TYRE & RUBBER CO.</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 270</p> <p>SUMMARY: WEBASTO PRODUCT NORTH AMERICA, INC. (WEBASTO) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by vogue tyre & rubber co. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>WEBASTO, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by vogue tyre & rubber co. By clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2011 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

