

# PRODUCT RECALLS

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01– 15 MAY 2011

## CONTENTS

### AUTOMOTIVE

Pages 1 to 13



- [Motor Vehicle \(26\)](#)
- Child Safety Seat (0)
- [Motor Vehicle Equipment \(2\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<b>VEHICLE MAKE / MODEL</b> CROSSROADS / RUSHMORE -2011 CROSSROADS / SEVILLE -2011 <b>MANUFACTURER:</b> CROSSROADS RV <b>COMPONENT:</b> ELECTRICAL SYSTEM <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 12 <b>SUMMARY:</b> CROSSROADS RV is recalling certain model year 2011 rushmore and Seville recreational vehicles manufactured from June 21, 2010, through December 15, 2010. The electrical transfer switch wire was installed incorrectly and the transfer switch could send 220 volt current instead of 110 volt current through the trailer's electrical system. No picture available.	<b>CONSEQUENCE</b> This voltage increase could lead to overheating of the electrical system resulting in a fire or property damage.	<b>REMEDY</b> CROSSROADS will inspect and if necessary rewire the transfer switch to the correct specification, free of charge. The safety recall is expected to begin on or before May 16, 2011. Owners may contact crossroads RV at 888-226-7496.
USA	<b>VEHICLE MAKE / MODEL</b> JEEP / CHEROKEE- 1994-1996 <b>MANUFACTURER:</b> U.S. DRIVE RIGHT <b>COMPONENT:</b> EXTERIOR LIGHTING:BRAKE LIGHTS <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 987 <b>SUMMARY:</b> U.S. drive right is recalling certain model year 1994-1996 jeep cherokee vehicles imported from january 2007, through april 2011 for failing to comply with federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment," for the high mount brake lamp assembly. The vehicles are not equipped with the required third brake lamp. No picture available.	<b>CONSEQUENCE</b> Inadequate lighting could reduce visibility of vehicle, increasing the risk of a crash.	<b>REMEDY</b> U.S. drive right will notify owners and mail kits along with instructions to have the vehicle repaired by a qualified mechanic of their choice, free of charge. The safety recall is expected to begin on or before June 11, 2011. Owners may contact U.S. drive right at 1-888-632-5936.
USA	<b>VEHICLE MAKE / MODEL</b> TRIUMPH / THUNDERBIRD- 2010 <b>MANUFACTURER:</b> TRIUMPH MOTORCYCLES AMERICA LTD <b>COMPONENT:</b> EQUIPMENT <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1,955 <b>SUMMARY:</b> TRIUMPH is recalling certain model year 2010 thunderbird and thunderbird abs motorcycles manufactured from September 2009 through august 2010. These motorcycles were built with an incompatible thread locker/screw combination at the front fender mounting. No picture available.	<b>CONSEQUENCE</b> The screws may work loose and the screw heads can contact the side wall of the front tire, leading to tire deflation, increasing the risk of a crash.	<b>REMEDY</b> Dealers will install new screws, free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact triumph customer service department at 1-678-539-8782.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> HAULMARK / MOTOR COACH- 2003-2010</p> <p><b>MANUFACTURER:</b> HAULMARK MOTOR COACH</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 668</p> <p><b>SUMMARY:</b> HAULMARK is recalling certain recreational vehicles equipped with 1200 series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p><b>REMEDY</b></p> <p>HAULMARK is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact norcold at 1-800-767-9101.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> ELGIN / MEGAWIND-MX- 2010-2011</p> <p><b>MANUFACTURER:</b> ELGIN SWEEPER COMPANY</p> <p><b>COMPONENT:</b> ENGINE AND ENGINE COOLING:COOLING SYSTEM:FAN</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 19</p> <p><b>SUMMARY:</b> Elgin sweeper is recalling certain model year model 2010-2011 megawind sweepers with tier- iii john Deere auxiliary engines manufactured from February 2010 through April 2011. Under heavy operating conditions and high auxiliary engine speed, the fans may fail and the fan blades could separate from the base of the fan and the blades or debris from the blades could leave the fan housing.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Small pieces of fan debris could exit the vehicle in 2 openings in the exterior of the vehicle. A person performing a repair could be injured.</p>	<p><b>REMEDY</b></p> <p>Elgin sweeper will notify owners and install a new radiator fan on a belt-driven pulley and new mounting hardware. This service will be performed free of charge. The safety recall is expected to begin on or before May 26, 2011. Owners may contact Elgin customer service department at 1-877-342-5374.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> CHEVROLET / COLORADO -2011 GMC / CANYON -2011</p> <p><b>MANUFACTURER:</b> GENERAL MOTORS LLC</p> <p><b>COMPONENT:</b> VISIBILITY:WINDSHIELD WIPER/WASHER:MOTOR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 4,674</p> <p><b>SUMMARY:</b> GENERAL MOTORS is recalling certain model year 2011 chevrolet colorado and gmc canyon vehicles manufactured from september 22, 2010, through november 5, 2010. Some of these vehicles have the condition in which the windshield wiper motor crank arm nut may not be tightened to specification. When the wipers are operated with a build-up of snow or ice, or if the wipers are operated on a dry windshield, the nut could loosen. If there is sufficient loosening of the nut, the wipers could become inoperative.</p> <p>No picture available.</p>	<b>CONSEQUENCE</b>  Driver visibility could be reduced increasing the risk of a crash.	<b>REMEDY</b>  Dealers will secure the wiper motor crank arm nut free of charge. The safety recall is expected to begin on or before May 11, 2011. Owners may contact Chevrolet at 1-800-630-2438, gmc at 1-866-996-9463 or <a href="http://www.gmownercenter.com">www.gmownercenter.com</a> .
USA	<p><b>VEHICLE MAKE / MODEL</b> MICRO BIRD / MB II -2010-2011</p> <p><b>MANUFACTURER:</b> CORP. MICRO BIRD, INC.</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM: INSTRUMENT PANEL</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 9</p> <p><b>SUMMARY:</b> MICRO BIRD is recalling certain model year 2010 and 2011 micro bird mb ii multipurpose vans manufactured from January 13, 2010, through March 22, 2011, equipped with a wheelchair lift platform at the right rear door. The wheelchair lift door is not linked to an alarm visible to the driver which would activate when the door is not fully closed. These vans fail to conform to the requirements of federal motor vehicle safety standard no. 206, "door locks and door retention components."</p> <p>No picture available.</p>	<b>CONSEQUENCE</b>  The driver could move the vehicle unaware that the wheelchair lift door is not fully closed. The door could become fully open while the vehicle is in operation and this situation may cause injury to nearby pedestrians or damages to other vehicles.	<b>REMEDY</b>  Micro bird will notify owners and dealers will install a green telltale in the control panel that will illuminate when the wheelchair lift door is not fully closed. The repair will be performed free of charge. The safety recall is expected to begin by mid June 2011. Owners may contact micro bird at 1-819-477-2012.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<b>VEHICLE MAKE / MODEL</b> CHEVROLET / EXPRESS 1500 - 2011 GMC / SAVANA 1500- 2011 <b>MANUFACTURER:</b> GENERAL MOTORS LLC <b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC:FOUNDATION COMPONENTS:HOSES, LINES/PIPING, AND FITTINGS <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 7,593 <b>SUMMARY:</b> General motors is recalling certain model year 2011 chevrolet express and gmc savana vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 135, "passenger car brake systems." some of these vehicles may have been built with a clearance condition in which the right rear brake hose may contact the tire or wheel rim. If the brake hose repeatedly contacts the tire or wheel rim, a hole could be worn in the brake hose. No picture available.	<b>CONSEQUENCE</b> A damaged brake hose may reduce the effectiveness of the rear brakes and increase the distance required to stop the vehicle. An increased braking distance may increase the risk of a crash.	<b>REMEDY</b> Dealers will secure the right rear brake hose to ensure sufficient clearance. This service will be performed free of charge. The safety recall is expected to begin on or before May 13, 2011. Owners may contact Chevrolet at 1-800-630-2438, gmc at 1-866-996-9463 or <a href="http://www.gmownercenter.com">www.gmownercenter.com</a> .
USA	<b>VEHICLE MAKE / MODEL</b> MACK / CHU- 2011-2012 MACK / CXU -2011-2012 MACK / GU-2011-2012 MACK / LEU -2011-2012 MACK / MRU -2011-2012 <b>MANUFACTURER:</b> MACK TRUCKS, INC <b>COMPONENT:</b> SERVICE BRAKES, AIR:SLACK ADJUSTERS:AUTOMATIC <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 329 <b>SUMMARY:</b> MACK TRUCKS is recalling certain model year 2011-2012 Chu, cxu, gu, leu and mru trucks manufactured from october 15, 2010, through january 31, 2011, and equipped with gunite automatic slack adjusters. Due to an incomplete "knitting" of the iron at the time of casting, inadequate structural integrity of the slack adjuster housing can occur, which could cause the housing to break at the handle under normal operating loads. No picture available.	<b>CONSEQUENCE</b> Slack adjusters with this flow notch could crack under normal braking conditions causing loss of braking which could result in a vehicle crash.	<b>REMEDY</b> MACK TRUCKS will notify owners and dealers will replace the subject slack adjusters free of charge. The safety recall is expected to begin on or before July 1, 2011. Owners may contact mack trucks at 1-800-528-6586.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> CHEVROLET / CRUZE- 2011</p> <p><b>MANUFACTURER:</b> GENERAL MOTORS LLC</p> <p><b>COMPONENT:</b> POWER TRAIN:AUTOMATIC TRANSMISSION:GEAR POSITION INDICATION (PRNDL)</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 100,308</p> <p><b>SUMMARY:</b> GENERAL MOTORS is recalling certain model year 2011 chevrolet cruze vehicles manufactured from october 6, 2009, through april 27, 2011 and equipped with an automatic transmission for failing to comply with federal motor vehicle safety standard no. 102, 'transmission shift lever sequence, starter interlock, and transmission braking effect,' and federal motor vehicle safety standard no. 114, 'theft protection.' these vehicles may have been built with a transmission shift linkage that is not properly installed. If the linkage is not properly installed, the prndl shift lever may not accurately reflect the position of the transmission gear. With this condition, the driver could move the shifter to park and remove the ignition key, but the transmission gear may not be in park.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The driver may not be able to restart the vehicle and the vehicle could roll away after the driver has exited the vehicle, resulting in a possible crash without prior warning.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect the transmission shift linkage for correct installation and adjust the shift linkage system free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Chevrolet at 1-800-630-2438, or <a href="http://www.gmownercenter.com">www.gmownercenter.com</a>.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> CHEVROLET / CRUZE -2011</p> <p><b>MANUFACTURER:</b> GENERAL MOTORS LLC</p> <p><b>COMPONENT:</b> STEERING:GEAR BOX:SHAFT SECTOR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 128,911</p> <p><b>SUMMARY:</b> GENERAL MOTORS is recalling certain model year 2011 chevrolet cruze vehicles manufactured from october 2, 2009, through april 21, 2011. The bolt attaching the intermediate steering shaft to the steering gear input shaft may not have been properly installed.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could allow the shafts to separate, resulting in the loss of steering. Loss of steering control may increase the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect, and if required, repair the intermediate shaft/steering gear assembly to assure the bolt is fully seated and the shaft properly assembled. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Chevrolet at 1-800-630-2438, or <a href="http://www.gmownercenter.com">www.gmownercenter.com</a>.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<b>VEHICLE MAKE / MODEL</b> AUDI / A6 -2001-2004 AUDI / RS6 -2003 AUDI / S6 -2002-2003 <b>MANUFACTURER:</b> VOLKSWAGEN OF AMERICA, INC <b>COMPONENT:</b> FUEL SYSTEM, OTHER:STORAGE:TANK ASSEMBLY <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 5,992 <b>SUMMARY:</b> VOLKSWAGEN is recalling certain model year 2001-2004 audi a6, model year 2002-2003 s6 and model year 2003 rs6 vehicles equipped with 4.2l engines and manufactured from June 19, 2001, through June 8, 2004. The aging of the plastic material in the fuel tank rollover valve combined with bending stress from the aluminum ventilation line to the rollover valve nipple may lead to cracking of the nipple. If this happens, a fuel leak may result. No picture available.	<b>CONSEQUENCE</b> A fuel leak in the presence of an ignition source could lead to a vehicle fire.	<b>REMEDY</b> Dealers will reinforce the nipple on the rollover valve to prevent leakage or repair the cracking at the nipple. The recall is expected to begin during June 2011. Owners may contact audi at 1-800-822-2834.
USA	<b>VEHICLE MAKE / MODEL</b> FORD / F-650 - 2011 FORD / F-750 -2011 <b>MANUFACTURER:</b> FORD MOTOR COMPANY <b>COMPONENT:</b> SERVICE BRAKES, AIR:ANTILOCK:CONTROL UNIT/MODULE <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 93 <b>SUMMARY:</b> FORD is recalling certain model year 2011 f-650 and f-750 trucks, equipped with air brakes and a trailer package or tractor package, for an incorrectly programmed abs module. As such, these vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 121, "air brake systems (abs)." No picture available.	<b>CONSEQUENCE</b> An affected vehicle may not display a trailer abs fault in the cab of the truck warning the driver of an existing trailer abs failure. Such an abs failure may result in trailer brake lock-up, increasing the risk of a crash.	<b>REMEDY</b> Dealers will notify owners and replace the abs module free of charge. The safety recall is expected to begin on or before May 16, 2011. Owners may contact ford motor company customer relationship center at 1-866-436-7332.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>ACURA / CL-2003 ACURA / TL-2002-2003 HONDA / ACCORD- 2001-2002 HONDA / CIVIC -2001-2002 HONDA / CR-V -2002-2003 HONDA / ODYSSEY -2002</p> <p><b>MANUFACTURER:</b> HONDA (AMERICAN HONDA MOTOR CO.)</p> <p><b>COMPONENT:</b> AIR BAGS:FRONTAL:DRIVER SIDE INFLATOR MODULE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 2,430</p> <p><b>SUMMARY:</b> HONDA is recalling certain model year 2001-2002 honda accord, and civic 2-door and 4-door, model year 2002-2003 cr-v, model year 2002 odyssey, model year 2003 acura cl, and model year 2002-2003 acura tl vehicles. This recall is related to a series of recalls on these vehicles in which Honda is replacing the inflators within the driver's side air bag to address a defective condition. This recall addresses approximately 2,430 air bags that may have been installed as replacement service parts in the event, for one example, a covered vehicle had been in a crash necessitating the replacement of the driver's air bag, and the replacement air bag installed was one that may have contained a defective inflator.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a crash necessitating deployment of the driver's air bag, the inflator could produce excessive internal pressure that could cause the inflator to rupture with metal fragments striking and injuring the driver or other occupants.</p>	<p><b>REMEDY</b></p> <p>Owners of all vehicles on which a replacement service air bag may have been installed will be notified. Dealers will inspect vehicles, and where a defective air bag inflator is identified, the inflator will be replaced, free of charge. The safety recall is expected to begin on or about june 27, 2011. Owners may contact Honda at 1-800-999-1009. This safety recall campaign is related to recalls 08v-593, 09v-259, and 10v-041.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>VERMEER / BC1200XL - 2009-2011</p> <p><b>MANUFACTURER:</b> VERMEER MANUFACTURING COMPANY</p> <p><b>COMPONENT:</b> WHEELS:LUGS/NUTS/BOLTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 140</p> <p><b>SUMMARY:</b> VERMEER is recalling certain model year 2009-2011 bc1200xl single axle brush chipper trailers manufactured from July 24, 2009, through February 14, 2011. During the assembly process the incorrect lug nuts were installed on wheels for the 285/75/r16 flotation tire option. These incorrect lug nuts may loosen, since the lug nuts do not match the countersink holes in the wheel disc.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Loose lug nuts can damage the wheel disc and result in wheel separation from the trailer, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will replace the lug nuts free of charge. The safety recall is expected to begin on or about June 1, 2011. Owners may contact Vermeer at 1-641-628-3141.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>            VOLVO / VHD-2011-2012            VOLVO / VNL -2011-2012            VOLVO / VNM -2012</p> <p><b>MANUFACTURER:</b> VOLVO TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> SERVICE BRAKES, AIR:SLACK ADJUSTERS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 151</p> <p><b>SUMMARY:</b> VOLVO TRUCKS is recalling certain model year 2011-2012 vhd, vnl, and model year 2012 vnm trucks manufactured from October 15, 2010, through January 31, 2011, and equipped with gunite automatic slack adjusters. Due to an incomplete "knitting" of the iron at the time of casting, inadequate structural integrity of the slack adjuster housing can occur, which could cause the housing to break at the handle under normal operating loads.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b>            Slack adjusters with this flow notch could crack under normal braking conditions causing loss of braking which could result in a vehicle crash.</p>	<p><b>REMEDY</b>            VOLVO TRUCKS will notify owners and dealers will replace the subject slack adjusters free of charge. The safety recall is expected to begin on or before July 1, 2011. Owners may contact volvo trucks at 1-800-528-6586.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>            HYUNDAI / SANTA FE- 2010</p> <p><b>MANUFACTURER:</b> HYUNDAI MOTOR COMPANY</p> <p><b>COMPONENT:</b> POWER TRAIN:DRIVELINE:DRIVESHAFT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 6,169</p> <p><b>SUMMARY:</b> HYUNDAI is recalling certain model year 2010 Santa Fe 2wd vehicles equipped with automatic transmissions and 2.4l engines manufactured from October 15, 2009 through march 5, 2010. the intermediate shaft may suffer from noise and excessive wear due to a misalignment of the intermediate shaft with the right side output gear. Continuing to drive the vehicle in this condition leads to the development of a whirring/whining noise and can eventually cause damage to the automatic transmission.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b>            Damage to the transmission may cause loss of motive power, increasing the risk of a crash.</p>	<p><b>REMEDY</b>            Dealers will replace the right side output gear and intermediate shaft free of charge. The safety recall is expected to begin during June 2011. Owners may contact hyundai's customer assistance center at 1-800-633-5151.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/PORTUGAL	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car "Fluence"</p> <p><b>BRAND:</b> Renault</p> <p><b>TYPE/NUMBER OF MODEL:</b> Production period: since production began up to 23/08/2010; Fabrication numbers: C043118 to R048083.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Turkey</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries as a possible malfunction of the airbag computer may occur. As a consequence, in the event of a frontal impact, the driver's airbag may fail to deploy and/or the passenger airbag may deploy even though it has been deactivated.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle F4 1000</p> <p><b>BRAND:</b> MV Agusta</p> <p><b>TYPE/NUMBER OF MODEL:</b> This recall applies to certain 2010 F4 model motorcycles, built from 27.10.2009 through 07.09.2010.</p> <p><b>COUNTRY OF ORIGIN:</b> Italy</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries because the upper fixture points of the rear sub-frame are not sufficiently robust, which may cause the sub-frame to break during normal use. If this occurs, the stability of the rider and the passenger would be comprised and there could be a risk of a crash.</p>	Voluntary corrective actions taken by the manufacturer.
AUSTRALIA	<p>Suzuki Australia—GSX-R600, GSXR750, GSF650, GSF1250, GSX650F, GSX1300BK Motorcycles</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>All 2008-2009 Models with the following model numbers: GSX-R600, GSXR750, GSF650, GSF1250, GSX650F, GSX1300BK.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign Number: SRC11-02</p> <p>Target Number: 8795</p> <p><b>SUPPLIER</b></p> <p>Suzuki Australia</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>If problem occurs it may cause discharging of the battery and can lead to engine stalling or non-start condition.</p> <p><b>DEFECTS</b></p> <p>Some regulator/rectifier assemblies were produced with insufficient adhesion between the power module and the rectifier case. Due to the insufficient adhesion, heat generated from the power module can cause the power module to lift from the case. This condition can cause excessive heat on the module which can result in insufficient charge current being provided to the battery.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Letters have been sent out to customers in relation this recall.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p><b>Volvo—S60 and XC60</b></p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Volvo S60 and XC60 vehicles MY 2011, fitted with either a 2.0 litre petrol turbo engine or a 3.2 litre normally aspirated petrol engine.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>2.0 LitreTurbo Engine Code 47 - B4204T7 3.2 Litre Normally Aspirated Engine Code 95 - B63204S5 Vin Ranges: XC60 - 193110 to 193764 S60 - 032029 to 032502 Campaign Number: R29219 Target Number: 22</p> <p><b>SUPPLIER</b></p> <p>Volvo Car Australia Pty Ltd No picture available.</p>	<p><b>HAZARDS</b></p> <p>If the condition occurs, the pressure line will be missing an O-ring, which could lead to fuel seepage in sub-zero temperatures and the customer noticing a fuel smell.</p> <p><b>DEFECTS</b></p> <p>The connectors for the fuel pressure line and the purge line may have been switched during production.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Owners of affected vehicles will be contacted by letter.</p>
AUSTRALIA	<p><b>Ducati—Multistrada 1200 and Ducati Diavel motorcycles</b></p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Ducati MTS 1200 motorcycle, MY 2010-2011 and Ducati Diavel MY 2011.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign Number: 830/11 Target Number: 369</p> <p><b>SUPPLIER</b></p> <p>Ducati Motor Holding No picture available.</p>	<p><b>HAZARDS</b></p> <p>There is a chance the engine can be started while the electronic steering lock is still activated.</p> <p><b>DEFECTS</b></p> <p>Under some special conditions of use, upon instrument panel switch-on, the hands free control unit could cause the failed disengagement of the electronic steering lock.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Ducati will write to owners of affected vehicles.</p>
AUSTRALIA	<p><b>Holden—JG Cruze</b></p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Holden JG Cruze models</p> <p><b>IDENTIFYING FEATURES</b></p> <p>VIN Range: KL3J#69#JAK764180 to KL3J#69#JAK771326 (Hash (#) represents an alpha or numeric character not relevant to determining affected vehicles.) Campaign Number: 11-H-03 Target Number: 4, 236</p> <p><b>SUPPLIER</b></p> <p>GM Holden Ltd No picture available.</p>	<p><b>HAZARDS</b></p> <p>In affected vehicles, passengers seated in the driver's side rear or centre seat may not be restrained properly.</p> <p><b>DEFECTS</b></p> <p>There is a potential condition of unsafe operation concerning part of the rear seat belt anchor and buckle assemblies.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Owners of affected vehicles will be contacted by letter.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Triumph Motorcycle Company Ltd—Thunderbird and Thunderbird ABS</p> <p><b>PRODUCT DESCRIPTION</b> Thunderbird and Thunderbird ABS motorcycles.</p> <p><b>IDENTIFYING FEATURES</b> VIN range up to 466489 Campaign Number: 423 Target Number: 678</p> <p><b>SUPPLIER</b> Triumph Motorcycle Company Ltd No picture available.</p>	<p><b>HAZARDS</b> Failure to remove the screws could lead to tyre deflation.</p> <p><b>DEFECTS</b> The screws used to fix the front mudguard fitted on Thunderbird and Thunderbird ABS motorcycles may have a potential problem.</p>	consumers action  Triumph Motorcycle Ltd will contact owners of all affected motorcycles.
AUSTRALIA	<p>PACCAR Australia Pty Ltd—DAF Euro 5 CF85 Trucks</p> <p><b>PRODUCT DESCRIPTION</b> DAF Euro 5 CF85 trucks imported into Australia between March 2010 and March 2011.</p> <p><b>IDENTIFYING FEATURES</b> VIN Range: XLRAD85MCAE881184 to XLRTT85MCAE890204 Campaign Number: DAF11-01 Target Number: 51</p> <p><b>SUPPLIER</b> PACCAR Australia Pty Ltd No picture available.</p>	<p><b>HAZARDS</b> Possible engine oil leakage into the engine bay and onto road surfaces</p> <p><b>DEFECTS</b> Possible loosening of the centrifugal engine oil filter assembly</p>	consumers action  PACCAR Australia Pty Ltd will be notifying customers via Registered Mail.
AUSTRALIA	<p>Volvo—S60 and XC60</p> <p><b>PRODUCT DESCRIPTION</b> Volvo S60 and XC60 vehicle MY 2011, fitted with a 2.0 litre petrol turbo engine.</p> <p><b>IDENTIFYING FEATURES</b> Engine Code 47 - B4204T7 Vin Ranges: XC60 - 192616 to 195006 S60 - 031679 to 033476 Campain Number: R29218 Target Number: 55</p> <p><b>SUPPLIER</b> Volvo Car Australia Pty Ltd</p>	<p><b>HAZARDS</b> The driver may notice a fuel smell. In a worst case scenario a fuel line connection may completely detach and the engine may stall without any prior warning due to no fuel supply. This may occur suddenly and without prior warning to the driver which poses an unreasonable risk to motor vehicle safety.</p> <p><b>DEFECTS</b> A fuel line supply line may be incorrectly manufactured which may lead to a fuel leakage.</p>	<b>CONSUMERS ACTION</b>  Owners of affected vehicles will be contacted by letter.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> AUTOMOTIVE CONCEPTS</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1,781</p> <p><b>SUMMARY:</b> WEBASTO PRODUCT North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by automotive concepts on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b> In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p><b>REMEDY</b> Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by automotive concepts by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>
EU/ GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle top box</p> <p><b>BRAND:</b> Honda</p> <p><b>TYPE/NUMBER OF MODEL:</b> Vehicle models concerned: CBF1000F, MJ 2010/11, SC64, e4*2002/24*2395*00; CBF1000, MJ 2009/10, SC58, e3*2002/24*0373*00; Transalp, MJ 2009, RD13, e9*2002/24*0223*00; Ab MJ 2010: RD15, e9*2001/24*0426*00; CBF600, MJ 2009-11, PC43, e3*2002/24*0490*00; Varadero, , MJ2009, SD02, e9*92/61*0059*00; Ab MJ 2010: SD03, e9*2002/24*0421*00.</p> <p><b>DESCRIPTION:</b> Top box which is an accessory for certain Honda motorcycles. The motorcycles concerned are <b>2009-2011 MODELS</b>.</p> <p><b>COUNTRY OF ORIGIN:</b> Germany</p> 	<p><b>INJURIES</b> The product poses a risk of injuries because the top box mountings may break, with the result that it could fall off whilst the motorcycle is moving.</p>	Voluntary corrective actions taken by the manufacturer.

GCSC has compiled the below sources:

### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

### **FOR ENQUIRIES**

[Product.Recalls@sgs.com](mailto:Product.Recalls@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2011 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

