

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 31 MAY 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 21



[Motor Vehicle \(36\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(5\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	HAZARDS	MEASURES ADOPTED
AUSTRALIA	<p>Ford—Certain Territory Genuine Ford Accessory Carpet Mats</p> <p>PRODUCT DESCRIPTION</p> <p>The affected Ford Genuine Accessory Carpet Mat set can be identified by its black colour, silver "TERRITORY" embossing and rubber spike type backing material. It has a Ford part number 5R7J A13002 AA and has been sold through Authorised Ford Dealers since June 2009.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: S1008</p> <p>TARGET NUMBER: 4990</p> <p>SUPPLIER</p> <p>Ford Motor Company of Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The Driver's carpet mat may interfere with the accelerator pedal and could potentially result in the engine not returning to idle.</p> <p>DEFECTS</p> <p>The affected carpet mat in the driver's footwell may interfere with the accelerator pedal.</p>	<p>CONSUMERS ACTION</p> <p>Owners of affected mats should, as soon as possible, arrange with an Authorised Ford Dealer for the driver's mat to be replaced. Until the Safety Recall Service is complete the driver's carpet mat should be removed from the driver's footwell area. For further information, contact any Authorised Ford Dealer or Ford's Customer Relationship Centre on 1800 503 672.</p>
AUSTRALIA	<p>Lamborghini—MY 2007-2008 Murciélago Coupé and Roadster (version LP640)</p> <p>PRODUCT DESCRIPTION</p> <p>Model Year 2006 and Model Year 2008 Lamborghini Murciélago (Version LP640)</p> <p>IDENTIFYING FEATURES</p> <p>Vin Range: ZHWBE37S07LA02104-ZHWBE37M08LA03202</p> <p>TARGET NUMBER:19</p> <p>Campaign Numbers: Murciélago- L824-R.01.10 Murciélago Roadster - L825-R.01.10</p> <p>SUPPLIER</p> <p>Automobili Lamborghini S.p.A</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Vehicle Malfunction</p> <p>DEFECTS</p> <p>In rare cases, stress generated by the back and forth movement of gasoline inside the fuel tank during lateral and longitudinal accelerations, accompanied by vertical vibration could cause detachment of one or more spot welds holding the fuel pump support inside the fuel tank. A slow fuel leak could develop at the detached spot weld.</p>	<p>CONSUMERS ACTION</p> <p>Please contact an authorized Lamborghini Dealer or Service Point without delay to arrange an appointment.</p> <p>If you detect the fuel odour or fuel on the ground, please contact your Lamborghini dealer to get your vehicle towed.</p> <p>Lamborghini will replace the fuel tank and this operation will take maximum 2 business days. This work will be carried out at no charge to you.</p>
AUSTRALIA	<p>Mitsubishi—Triton vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>All Triton vehicles manufactured between October 2006 and 20 January 2009.</p> <p>The manufactured date of early vehicles can be found on the vehicle data plate attached to the drivers side of the firewall in the engine bay and on later vehicles an adhesive label is attached to the B pillar of the passenger door opening.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: 010051</p> <p>Target Number: 42,525</p> <p>SUPPLIER</p> <p>Mitsubishi Motors Australia Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Bolts may become loose in service resulting in excessive suspension noise (knocking) and in the worst case the ball joint may become detached from the suspension arm resulting in the vehicle being unable to be driven.</p> <p>DEFECTS</p> <p>During Manufacture the bolts attaching the ball joints to the front suspension upper arms on either side of the vehicle may not have been installed with sufficient tightening torque.</p>	<p>CONSUMERS ACTION</p> <p>Mitsubishi will be contacting all owners via mail on 11 June 2010 at their last known address. Owners will be requested to contact their authorised Mitsubishi dealer for inspection and retensioning of the ball joint retaining bolts.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	HAZARDS	MEASURES ADOPTED
AUSTRALIA	<p>Toyota—LEXUS LS460 and LS600hL—Steering Control ECU Replacement</p> <p>PRODUCT DESCRIPTION</p> <p>LEXUS LS460 and LS600hL</p> <p>IDENTIFYING FEATURES</p> <p>Target Number: 37</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Vehicle malfunction</p> <p>DEFECTS</p> <p>On certain Lexus LS460 and LS600hL vehicles the Steering Control ECU programming for the Variable Gear Ratio Steering (VGRS) system can result in the steering wheel becoming off-centre by a maximum of up to 90 degrees under certain limited driving conditions such as when conducting a U-Turn or accelerating quickly following a sharp turn. If the driver has fully turned the steering wheel to full lock and then very quickly attempts to turn it back to the centre position, the steering wheel may temporarily become off-centred before automatically returning to the centre position within 1-5 seconds.</p>	<p>CONSUMERS ACTION</p> <p>All owners of affected vehicles will be contacted initially by phone to explain the situation. All vehicles involved in this campaign will have the affected steering control computer (ECU) replaced. Additionally all owners of affected vehicles will receive a personal visitation from a Lexus representative to explain the condition and as well as the driving conditions under which the condition may occur. This customer visitation will commence on Monday 24th May 2010.</p>
AUSTRALIA	<p>Ford—Ford Focus TDCi—Exhaust Heat Shield Fitment</p> <p>PRODUCT DESCRIPTION</p> <p>Certain Ford Focus TDCi models fitted with a Diesel engine and built from March 28, 2007 to August 17, 2009 inclusive.</p> <p>IDENTIFYING FEATURES</p> <p>Target Number: 2891 Campaign Number: S1001</p> <p>SUPPLIER</p> <p>Ford Motor Company of Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Non-fitment of an exhaust heat shield could result in heat related durability issues.</p> <p>DEFECTS</p> <p>There may be some Focus TDCi vehicles equipped with the DW10 (Diesel) engine that may not have had an exhaust heat shield fitted.</p>	<p>CONSUMERS ACTION</p> <p>Ford will write to owners of affected vehicles at their last known address. For further information, contact any authorised Ford Dealer or Ford's Customer Relationship Centre on 1800 503 672.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Fiat - Punto</p> <p>TYPE/NUMBER OF MODEL: 199, EC type approval e3*2001/116*0217*00</p> <p>DESCRIPTION: The affected vehicles were manufactured in 2009.</p> <p>COUNTRY OF ORIGIN: Italy</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because, owing to an electronic problem, the deactivated passenger airbag can be reactivated.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Citroen C4</p> <p>TYPE/NUMBER OF MODEL: e2*2001/116*0302*19</p> <p>DESCRIPTION: The vehicles in question were manufactured in 2009. The vehicle identification numbers are between: VF7LA5FWC9Y518802 and VF7LCRHRJ9Y523410</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because a non-compliant part obstructing the main brake cylinder may cause the brakes to not work properly.</p>	Voluntary corrective actions taken by the importer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Fiat - 500 Abarth</p> <p>TYPE/NUMBER OF MODEL: 500 Abarth with 1.4 Turbo petrol engine, chassis numbers between 0458151 and 0508171.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Italy</p> <p>No picture available</p>	<p>INJURIES</p> <p>The fixing screws for the clutch control hydraulic pump could break leading to the impossibility of engaging the gears which could cause a road accident.</p>	Voluntary corrective actions taken by the manufacturer.
EU/France	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Snowmobile - SKANDIC</p> <p>BRAND: SKI-DOO</p> <p>TYPE/NUMBER OF MODEL: SKANDIC SWT V-800 (2009-2010), GSX 1200 (2010), GTX 1200 (2010), MXZ 1200 (2010) and Renegade 1200 (2010)</p> <p>DESCRIPTION: Snowmobile</p> <p>COUNTRY OF ORIGIN: Canada</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because some elements of the drive pulley may break suddenly causing objects or debris to fly off the snowmobile towards passengers or bystanders.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>NEWMAR / DUTCH AIRE DIESEL 2010 PUSHER</p> <p>NEWMAR / DUTCH STAR DIESEL 2010-2011 PUSHER</p> <p>NEWMAR / ESSEX DIESEL PUSHER 2010-2011</p> <p>NEWMAR / KING AIRE DIESEL 2010 PUSHER</p> <p>NEWMAR / MOUNTAIN AIRE DP 2010-2011</p> <p>NEWMAR / VENTANA DIESEL 2010-2011 PUSHER</p> <p>MANUFACTURER: NEWMAR CORPORATION</p> <p>COMPONENT: ELECTRICAL SYSTEM: BATTERY:CABLES</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 152</p> <p>SUMMARY: Newmar is recalling certain model year 2010-2011 motor homes manufactured from october 13, 2009 through april 12, 2010. These motor homes may contain a defective crimp connection in the auxiliary battery cable assembly. The defective connection may result in an inadequate electrical connection or disengagement of the cable. Resultant electrical arcing and overheating may generate sufficient heat for ignition of surrounding materials.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Failure of the connection may result in a vehicle fire.</p>	<p>REMEDY</p> <p>The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact newmar at 574-773-7791.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>AMERICAN LAFRANCE / EAGLE 2010</p> <p>MANUFACTURER: AMERICAN LAFRANCE LLC</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 11</p> <p>SUMMARY: American lafrance is recalling certain model year 2010 heavy-duty class 8 eagle emergency vehicles manufactured from february 3, 2009 through March 16, 2010, and equipped with detroit diesel series 60 engines. The software on these engines may cause the engine to shut down unexpectedly when a diesel particulate filter over-temperature condition is detected.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Unexpected emergency vehicle engine shutdown could hamper rescue operations and put first responders and or the public at risk.</p>	<p>REMEDY</p> <p>American lafrance will notify owners and detroit diesel will repair the vehicles free of charge by reprogramming the engine motor control module. Please see daimler trucks/ detroit diesel's defect report 10e-005. The safety recall is expected to begin on or about June 1, 2010. Owners may contact detroit diesel at 1-800-547-0712 or on line http://www.detroitdiesel.com/supportnetwork.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>CHEVROLET / 2500 2009 FORD / E150 2008-2009 FORD / E250 2008-2009 FORD / E350 2008-2009</p> <p>MANUFACTURER: MOBILITY WORKS</p> <p>COMPONENT: EQUIPMENT ADAPTIVE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 74</p> <p>SUMMARY: Mobility works is recalling certain model year 2008 and 2009 conversion vans built on ford e150, e250, and e350 chassis and Chevrolet 2500 chassis after november 2007 and fitted with certain ricon s series and k series I-model wheelchair lifts. Due to a problem in the software that controls the lift's "up" function, should the "up" button be released before the floor level limit switch is activated, the lift may continue its upward travel and may overrun the floor level cut off point.</p> <p>No picture available.</p>		<p>CONSEQUENCE</p> <p>When the platform overruns the vehicle floor level and stops at an angle from 15-20 degrees, it is possible for a person in a wheelchair to tip over and for someone standing on the platform to fall, possibly resulting in injuries.</p>	<p>REMEDY</p> <p>Mobility works will notify owners and the repairs will be performed by authorized ricon dealers free of charge. A software solution for this safety defect is under investigation. Until the software solution is available, ricon will provide owners with a bulletin outlining proper wheelchair lift operation and will ship owners a dvd-based training aid to promote proper lift operation at no cost. The safety recall is expected to begin during May 2010. Owners may contact ricon at 1-818-267-3000 or mobility works at 1-800-769-8267.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>NEWELL / MOTOR HOME 2010-2011</p> <p>MANUFACTURER: NEWELL COACH CORP.</p> <p>COMPONENT: STRUCTURE:BODY:DOOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 18</p> <p>SUMMARY: Newell is recall certain model year 2010-2011 motor coaches manufactured from March 12, 2009 through March 29, 2010. The entry door may suddenly open due to a wiring short.</p> <p>No picture available.</p>		<p>CONSEQUENCE</p> <p>IF this occurred during travel it could cause driver distraction, and/or allowing someone who is not seated to fall out of the coach causing injury or death.</p>	<p>REMEDY</p> <p>Dealers will add a safety interlock system that removes all electrical power to the door when the parking brake is released. This service will be performed free of charge. The safety recall is expected to begin during May 2010. Owners may contact newell at 1-888-963-9355.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) KENWORTH / C500 2009-2011</p> <p>MANUFACTURER: PACCAR INCORPORATED</p> <p>COMPONENT: SERVICE BRAKES, AIR:DRUM:CHAMBER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 10</p> <p>SUMMARY: Kenworth is recalling certain model year 2009 through 2011 c500 trucks manufactured from October 24, 2008 through January 13, 2010. During maneuvers with certain combinations of wheel turn, articulation, and bump, the brake chamber can contact the rear hood support.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The contact can damage the brake chamber leading to a loss of braking function at the affected wheel end, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Kenworth will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin during June 2010. Owners may contact kenworth at 1-425-828-5440.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) LAMBORGHINI / MURCIELAGO 2007-2008 LAMBORGHINI / MURCIELAGO ROADSTER 2007-2008</p> <p>MANUFACTURER: AUTOMOBILI LAMBORGHINI</p> <p>COMPONENT: FUEL SYSTEM, GASOLINE:STORAGE:TANK ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 428</p> <p>SUMMARY: Lamborghini is recalling certain model year 2007-2008 murcielago and murcielago roadster vehicles. The welds holding the fuel pump support inside the fuel tank could detach. This situation may result in a fuel leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Fuel leakage, in the presence of an ignition source, could result in a fire.</p>	<p>REMEDY</p> <p>Dealers will replace the fuel tank free of charge. The safety recall is expected to begin during June 2010. Owners may contact lamborghini at 1-912-409-5634 or 1-508-808-9562.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) E-ONE / CYCLONE II 2008-2009 E-ONE / QUEST 2008-2009</p> <p>MANUFACTURER: E-ONE, INC.</p> <p>COMPONENT: ENGINE AND ENGINE COOLING:EXHAUST SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 20</p> <p>SUMMARY: E-ONE is recalling certain model year 2008-2009 quest and cyclone ii fire trucks equipped with detroit diesel series 60 engines manufactured from march 13, 2008 through september 27, 2009. There is a software problem in the engine control computer that may cause unexpected engine shut down under certain operating conditions.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Unexpected shut down of the engine may prevent the operation of equipment on the vehicle during rescue operation putting the public and fire fighters at risk.</p>	<p>REMEDY</p> <p>Detroit diesel is handling the owner notification schedule and remedy for this campaign. The motor control module will have a new software installed free of charge. Owners may contact Detroit diesel at 313-592-3708.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR</p> <p>FLEETWOOD / ENCOUNTER 2010</p> <p>FLEETWOOD / JAMBOREE 2010</p> <p>FLEETWOOD / JAMBOREE SPORT 2009-2010</p> <p>FLEETWOOD / TIOGA 2010</p> <p>FLEETWOOD / TIOGA RANGER 2010</p> <p>MANUFACTURER: FLEETWOOD RV, INC.</p> <p>COMPONENT: EQUIPMENT: RECREATIONAL VEHICLE: LPG FURNACE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 114</p> <p>SUMMARY: Fleetwood rv is recalling certain model year 2009 jamboree sport and model year 2010 jamboree, jamboree sport, tioga and tioga ranger model 31n and encounter model 32h class a & c motor homes manufactured april 23, 2009 through march 17, 2010. The LPG supply lines for the water heater and furnace that are routed through a hole in the floor may become damaged by sharp edges if unprotected.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The damage LPG supply lines may result in a propane gas leak and could result in a fire.</p>	<p>REMEDY</p> <p>Dealers will inspect the LPG supply lines, and install wire looms and secure the supply lines as necessary free of charge. The safety recall is expected to begin during May 2010. Owners may contact fleetwood at 800-509-3418.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR</p> <p>CADILLAC / SRX 2010</p> <p>MANUFACTURER: GENERAL MOTORS CORP.</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 547</p> <p>SUMMARY: General Motors is recalling certain model year 2010 Cadillac srx equipped with a 2.8l v6 engine. If low octane (regular) fuel is used in the vehicle instead of the required high octane (premium) fuel as stated in the owner manual and on the fuel filler door, the combination of regular fuel usage and aggressive driving maneuvers may induce pre-ignition. If pre-ignition occurs, you may hear a pinging or knocking sound from the engine.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the vehicle continues to be driven after the onset of this noise, a connecting rod or piston may break, resulting in engine damage, and perhaps engine failure, which would disable the vehicle increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will reprogram the engine control module free of charge. The safety recall is expected to begin on or before June 11, 2010. Owners may contact the Cadillac customer assistance center at 1-866-982-2339 or at the owner center at www.gmownercenter.com.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DA	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL	MODEL YEAR	CONSEQUENCE	REMEDY
	EZ LOADER / EZB	2010	This occurrence could result in a crash without prior warning.	Dealers will have repair teams to come to where the trailer is located and make the necessary repairs or, owners may have the trailer transported to a dealer or another repair facility capable of performing the repairs. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact ez loader at 800-398-5623.
	EZ LOADER / EZR	2010		
	EZ LOADER / EZSCB	2010		
	EZ LOADER / EZWB	2010		
	EZ LOADER / STCB	2010		
	MANUFACTURER: EZ LOADER ADJUSTABLE BOAT TRAILERS, INC COMPONENT: POWER TRAIN:AXLE ASSEMBLY SUMMARY: EZ loader is recalling certain model year 2010 ez loader single axle boat trailers. There is a potential for the spindle to separate from the axle causing the tire and wheel to separate from the trailer while underway. No picture available.			
USA	VEHICLE MAKE / MODEL	MODEL YEAR	CONSEQUENCE	REMEDY
	IC BUS / CE	2011	Without the reinforcement rod, the strength of the seat may be compromised, increasing the risk of personal injury or death in the event of a crash.	Navistar will notify owners and dealers will repair the seats free of charge. The safety recall is expected to begin on or about July 16, 2010. Owners may contact navistar at 1-800-448-7825 .
	IC BUS / RE	2011		
	MANUFACTURER: NAVISTAR, INC			
	COMPONENT: SEATS			
	POTENTIAL NUMBER OF UNITS AFFECTED: 129			
	SUMMARY: Navistar is recalling certain model year 2011 ic ce and re model school buses manufactured from february 22 through march 16, 2010 equipped with passenger flip seats. The weld that retains a reinforcement rod inside the seat back frame tube may fail allowing the rod to fall out of the frame. The seats fail to conform to the requirements of federal motor vehicle safety standard no. 222, "school bus passenger seating and crash protection." No picture available.			

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	CONSEQUENCE	CORRECTIVE ACTION
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>IC BUS / CE 2011</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: SEATS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>2</p> <p>SUMMARY: Navistar is recalling certain model year 2011 ic ce transit buses manufactured from february 22 through march 16, 2010 equipped with passenger flip seats. The weld that retains a reinforcement rod inside the seat back frame tube may fail allowing the rod to fall out of the frame. The seats fail to conform to the requirements of federal motor vehicle safety standard no. 222, "school bus passenger seating and crash protection."</p> <p>No picture available.</p>	without the reinforcement rod, the strength of the seat may be compromised, increasing the risk of personal injury or death in the event of a crash.	navistar will notify owners and dealers will repair the seats free of charge. The safety recall is expected to begin on or about July 16, 2010. Owners may contact navistar at 1-800-448-7825.
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR</p> <p>IC BUS / CE 2011</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: STEERING:HYDRAULIC POWER ASSIST:HOSE, PIPING, AND CONNECTIONS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>154</p> <p>SUMMARY: Navistar is recalling certain model year 2011 IC CE school buses manufactured from January 19 through January 21, 2010 equipped with international maxxforce dt engines. The high pressure power steering hose may have been routed incorrectly possibly causing the hose to chafe on the power steering reservoir bracket potentially resulting in a power steering fluid leak in the engine compartment.</p> <p>No picture available.</p>	A high pressure power steering fluid leak in the engine compartment may cause a fire possibly resulting in property damage, personnel injury, or death.	Navistar will notify owners and dealers will repair the buses free of charge. The safety recall is expected to begin on or about June 4, 2010. Owners may contact navistar at 1-800-448-7825.

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL	MODEL YEAR	CONSEQUENCE	REMEDY
	TOYOTA / 4RUNNER	2005-2010		
	TOYOTA / AVALON	2005-2010		
	TOYOTA / CAMRY	2005-2011		
	TOYOTA / COROLLA	2006-2010		
	TOYOTA / FJ CRUISER	2007-2010		
	TOYOTA / HIGHLANDER	2006-2010		
	TOYOTA / LAND CRUISER	2005-2010		
	TOYOTA / MATRIX	2006 2010		
	TOYOTA / PRIUS	2005-2010		
	TOYOTA / RAV4	2005-2010		
	TOYOTA / SCION TC	2006-2010		
	TOYOTA / SCION XA	2005-2006		
	TOYOTA / SCION XB	2006-2010		
	TOYOTA / SCION XD	2008-2010		
	TOYOTA / SEQUOIA	2005-2008 2010		
	TOYOTA / SIENNA	2004-2011		
	TOYOTA / TACOMA	2005-2010		
	TOYOTA / TUNDRA	2005-2010		
	TOYOTA / VENZA	2009-2010		
	TOYOTA / YARIS	2007-2010		
	MANUFACTURER: SOUTHEAST TOYOTA DISTRIBUTORS, LLC			
	COMPONENT: EQUIPMENT:OTHER:LABELS			
	POTENTIAL NUMBER OF UNITS AFFECTED: 153418			
	SUMMARY: Southeast Toyota is recalling certain model year 2006-2009 sienna passenger vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 110, "tire selection and rims." these vehicles were sold between September 1, 2005 and June 2, 2008 without the requisite load carrying capacity modification labels.			
	No picture available.			

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL	MODEL YEAR	CONSEQUENCE	REMEDY
	TOYOTA / 4RUNNER	2005-2010		
	TOYOTA / AVALON	2007-2010		
	TOYOTA / CAMRY	2005-2010		
	TOYOTA / CELICA	2005		
	TOYOTA / COROLLA	2006 2009-2010		
	TOYOTA / FJ CRUISER	2007-2010		
	TOYOTA / HIGHLANDER	2005-2010		
	TOYOTA / LAND CRUISER	2009-2010		
	TOYOTA / MATRIX	2006-2010		
	TOYOTA / PRIUS	2009-2010		
	TOYOTA / RAV4	2005-2010		
	TOYOTA / SCION TC	2005-2010		
	TOYOTA / SCION XB	2005-2006 2008-2010		
	TOYOTA / SCION XD	2006 2008-2010		
	TOYOTA / SEQUOIA	2008-2010		
	TOYOTA / SIENNA	2005-2011		
	TOYOTA / SOLARA	2006 2008		
	TOYOTA / TACOMA	2005-2010		
	TOYOTA / TUNDRA	2005-2010		
	TOYOTA / VENZA	2009-2010		
	MANUFACTURER: GULF STATES TOYOTA, INC.			
COMPONENT: EQUIPMENT:OTHER:LABELS				
POTENTIAL NUMBER OF UNITS AFFECTED: 271417				
SUMMARY: Gulf states toyota is recalling certain model year 2005-2010 vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 110, "tire selection and rims." these vehicles were sold between september 1, 2005 and june 2, 2008 without the requisite load carrying capacity modification labels.				
No picture available.				

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) FLEETWOOD / DISCOVERY 2010</p> <p>MANUFACTURER: FLEETWOOD RV, INC.</p> <p>COMPONENT: SEAT BELTS: FRONT: ANCHORAGE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 47</p> <p>SUMMARY: Fleetwood rv is recalling certain model year 2010 discovery model 40g and 40x class a motor homes manufactured from november 25, 2009 through january 8, 2010 for failing to comply with the requirements of federal motor vehicle safety standard no. 210, "seat belt assembly anchorages." the seat belts located on the sofa bed may not be adequately mounted for effective occupant restraint.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Lack of adequate seat belt protection increases the risk of personal injury in the event of a crash.</p>	<p>REMEDY</p> <p>Dealers will inspect the sofa bed seat belt mountings and if necessary reinstall them to a floor-mounted location. This service will be performed free of charge. The recall is expected to begin during may 2010. Owners may contact fleetwood rv at 800-509-3418.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) SPARTAN / DIAMOND 2008 SPARTAN / FURION 2008-2009 SPARTAN / GLADIATOR 2008-2009 SPARTAN / METROSTAR 2008-2010</p> <p>MANUFACTURER: SPARTAN CHASSIS, INC.</p> <p>COMPONENT: ELECTRONIC STABILITY CONTROL</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 243</p> <p>SUMMARY: Spartan is recalling certain model year 2008 through 2010 gladiator, metrostar, furion, and diamond fire apparatus and ambulance chassis manufactured from January 29, 2008 through january 25, 2010, equipped with meritor wabco electronic stability control systems (esc). In certain cases, the esc may inadvertently interpret vehicle instability, even though the vehicle may be stable, which would require intervention of brake activation to a selected wheel.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Inadvertent brake application to a selected wheel may cause the driver to try and over correct, possibly resulting in a vehicle crash.</p>	<p>REMEDY</p> <p>Spartan has not provided the agency with a remedy plan or a notification schedule. Owners may contact spartan at 1-517-543-6400.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>CHEVROLET / EXPRESS 2008-2009</p> <p>GMC / SAVANA 2008-2009</p> <p>MANUFACTURER: MAIN MOBILITY, INC.</p> <p>COMPONENT: EQUIPMENT ADAPTIVE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 133</p> <p>SUMMARY: Main mobility is recalling certain model year 2008 and 2009 conversion vans built on chevrolet express and gmc savana chassis from october 2007 through may 2010 and fitted with certain ricon s series and k series l-model wheelchair lifts. Due to a problem in the software that controls the lift's "up" function, should the "up" button be released before the floor level limit switch is activated, the lift may continue its upward travel and may overrun the floor level cut off point.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>When the platform overruns the vehicle floor level and stops at an angle from 15-20 degrees, it is possible for a person in a wheelchair to tip over and for someone standing on the platform to fall, possibly resulting in injuries.</p>	<p>REMEDY</p> <p>Main mobility will notify owners and the repairs will be performed by authorized ricon dealers free of charge. A software solution for this safety defect is under investigation. Until the software solution is available, ricon will provide owners with a bulletin outlining proper wheelchair lift operation and will ship owners a dvd-based training aid to promote proper lift operation at no cost. The safety recall is expected to begin during may 2010. Owners may contact ricon at 1-818-267-3000 or main mobility at 1-716-759-6811.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>FREIGHTLINER / CASCADIA 2008-2011</p> <p>FREIGHTLINER / CENTURY 2008-2011</p> <p>FREIGHTLINER / COLUMBIA 2008-2011</p> <p>FREIGHTLINER / CORONADO 2008-2011</p> <p>FREIGHTLINER / M2 2008-2011</p> <p>MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT: FUEL SYSTEM, OTHER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 36995</p> <p>SUMMARY: Daimler trucks is recalling certain model year 2008 through 2011 freightliner columbia, cascadia, coronado, century, m2, sterling 9500, and western star 4900 vehicles equipped with dd 13 and dd15/dd16 engines and manufactured from january 1, 2007 through april 5, 2010. Should the fuel filter become restricted, the low pressure fuel flange may develop a crack resulting in a fuel leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Fuel leaking onto the roadway may result in vehicle crash.</p>	<p>REMEDY</p> <p>The low pressure fuel flange will be replaced with a more robust component. This service will be performed free of charge. The safety recall is expected to begin on or before june 30, 2010. Owners may contact daimler trucks at 1-800-547-0712.</p>

AUTO: MOTOR VEHICLE EQUIPMENT																		
NOTIFYING COUNTRY	PRODUCT		ANGER	MEASURES ADOPTED														
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: PUROLATOR / F65277</p> <p>MANUFACTURER: UFI FILTERS USA</p> <p>COMPONENT: FUEL SYSTEM, OTHER:FUEL FILTER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 18540</p> <p>SUMMARY: UFI filters USA is recalling certain aftermarket fuel filters sold under the purolator brand name, p/n f65277, shipped from March 11 through April 27, 2010, for use on various passenger vehicles. Due to incorrect design, the quick connectors may not function properly.</p> <p>No picture available.</p>		CONSEQUENCE If this condition occurs while attempting to start the vehicle, a no-start condition may result and fuel may be pumped out onto the ground and if an ignition source is present, a fire can occur. If this condition occurs while the vehicle is in motion, the engine may stop due to inadequate fuel supply and this could result in a loss of power steering assist or a loss of brake power assist, possibly resulting in a vehicle crash.	REMEDY UFI will notify owners and replace the filters free of charge. The recall is expected to begin during May 2010. Owners may contact ufi filters usa at 1-888-787-1740.														
USA	<table><tr><th>VEHICLE MAKE / MODEL</th><th>MODEL YEAR</th></tr><tr><td>INFINITI / QX56</td><td>2004-2010</td></tr><tr><td>NISSAN / ARMADA</td><td>2004-2010</td></tr><tr><td>NISSAN / FRONTIER</td><td>2005-2010</td></tr><tr><td>NISSAN / PATHFINDER</td><td>2005-2010</td></tr><tr><td>NISSAN / TITAN</td><td>2004-2010</td></tr><tr><td>NISSAN / XTERRA</td><td>2005-2010</td></tr></table> <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: NISSAN / LOWER LINK</p> <p>MANUFACTURER: NISSAN NORTH AMERICA, INC.</p> <p>COMPONENT: SUSPENSION: FRONT: CONTROL ARM:LOWER ARM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1873</p> <p>SUMMARY: Nissan is recalling certain front and rear lower links, p/nos. 54501zq00a, 54500zq00a, 551a1zq00a, 551a0zq00a , 54501ea00a, 54500ea00a, 551a1ea500, 551a0ea500, 54501zr00a, and 54500zr00a, sold between november 25, 2009 and may 14, 2010 as replacement parts for model year 2004 through 2010 titan, armada, and qx56, and model years 2005 through 2010 frontier, xterra, and pathfinder vehicles. The lower control link assembly has two cylindrical collars forming the inboard attachment points to the chassis. Due to an improper welding process some collars may contain welds that do not meet strength specifications.</p> <p>No picture available.</p>		VEHICLE MAKE / MODEL	MODEL YEAR	INFINITI / QX56	2004-2010	NISSAN / ARMADA	2004-2010	NISSAN / FRONTIER	2005-2010	NISSAN / PATHFINDER	2005-2010	NISSAN / TITAN	2004-2010	NISSAN / XTERRA	2005-2010	CONSEQUENCE If the collar weld separates, the vehicle handling will deteriorate, possibly resulting in a vehicle crash.	REMEDY Nissan will notify owners and dealers will replace any affected lower link free of charge. The safety recall is expected to begin during June 2010. Owners may contact nissan at 1-800-647-7261.
VEHICLE MAKE / MODEL	MODEL YEAR																	
INFINITI / QX56	2004-2010																	
NISSAN / ARMADA	2004-2010																	
NISSAN / FRONTIER	2005-2010																	
NISSAN / PATHFINDER	2005-2010																	
NISSAN / TITAN	2004-2010																	
NISSAN / XTERRA	2005-2010																	

AUTO: MOTOR VEHICLE EQUIPMENT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>BMW / 740I 1995-2001 BMW / 740IL 1995-2001 BMW / 750IL 1995-2001</p> <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: FCP / STEERING CENTER DRAG LINK</p> <p>MANUFACTURER: FCP GROTON, LLC</p> <p>COMPONENT: STEERING: LINKAGES: LINK: DRAG:CONNECTION</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 150</p> <p>SUMMARY: FCP groton is recalling certain steering center drag links, p/n 32 21 1 096 057, sold from December 1, 2009 through April 9, 2010 as replacement equipment for model year 1995 through 2001 bmw 740i, 740il, and 750il passenger vehicles. The shaft of the steering center tie rod may shear off.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>this condition would result, without warning, in immediate and complete loss of vehicle control, possibly resulting in serious injury or death.</p>	<p>REMEDY</p> <p>FCP groton will notify owners and the tie rod will be replaced free of charge. The safety recall is expected to begin on or about June 1, 2010. Owners may contact fcp groton toll-free at 1-877-634-0063.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>THULE / DOMESTIQUE</p> <p>MANUFACTURER: THULE, INC.</p> <p>COMPONENT: EQUIPMENT: MECHANICAL: CARRIER/RACK</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 4457</p> <p>SUMMARY: Thule, inc. is recalling certain model domestique, p/n 513, aftermarket rooftop bicycle carriers. The fork head boss may fail while tightening it to the front mounting plate of the carrier.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The bike may separate from the vehicle, increasing the risk of a crash or personal injury.</p>	<p>REMEDY</p> <p>Thule will provide a repair kit containing a new boss head free of charge. The safety recall is expected to begin on or about June 4, 2010. Owners may contact Thule at 1-800-848-5322.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>KUSTOM FIT / DRIVER/PASSENGER SEAT</p> <p>MANUFACTURER: VILLA INTERNATIONAL</p> <p>COMPONENT: SEATS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 36</p> <p>SUMMARY: Kustom fit, a division of villa furniture mfg co. Inc. Is recalling certain driver and passenger seats, part no. 5564, sold and installed as original equipment for rexhall motorhomes. The seat's slide tracks fail to conform to the static pull test of federal motor vehicle safety standard nos. 207, "seating systems," and 210, "seat belt assembly anchorages."</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a crash, the seat's slide tracks can separate, possibly resulting in injury.</p>	<p>REMEDY</p> <p>Kustom fit is working with rexhall to notify owners and the seats in the motorhomes will be repaired free of charge. Repairs will be performed by authorized dealers. The safety recall is expected to begin during june 2010. Owners may contact kustom fit at 1-323-564-4481.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS