

PRODUCT RECALLS

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 30 NOVEMBER 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 22





[Motor Vehicle \(49\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(1\)](#)

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Cub Cadet Volunteer utility vehicles</p> <p>UNITS: About 200</p> <p>MANUFACTURER: MTD Consumer Group Inc., of Cleveland, Ohio</p> <p>DESCRIPTION: This recall involves four-wheel drive Cub Cadet Volunteer gasoline-powered utility vehicle. Model numbers included in the recall are 37BB475H710, 37BC465D710, 37BC466D710, 37BK466D710, 37BK46GD710, 37BM466D710, 37BM467D710 and 37BM46GD710. The serial number range is 1C290Z50001 through 1D280Z50007. Serial numbers included in the recall have a "C" or "D" in the second position and a "0" as the fifth digit. Model and serial numbers are printed on a plate located under the driver's seat. "Cub Cadet" is printed on the hood.</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD</p> <p>The front lower ball joint can detach and cause a loss of steering control. This poses a crash hazard for consumers.</p> <p>INCIDENTS/INJURIES: None reported.</p>	Voluntary recall
USA	<p>PRODUCTS: Ski-Doo® Snowmobiles</p> <p>UNITS: About 1,000</p> <p>IMPORTER: BRP US Inc., of Sturtevant, Wisconsin</p> <p>DESCRIPTION: This recall involves Ski-Doo® model names listed below. Model names are located on the side panel.</p> <p>MANUFACTURED IN: Finland</p> 	<p>HAZARD</p> <p>Electrostatic charges can accumulate and spark in the fuel tank when the engine is left idling, posing an explosion hazard that could result in serious injuries or death.</p> <p>INCIDENTS/INJURIES</p> <p>The firm has received three reports of explosions, one involving minor burns to face and hands.</p>	Voluntary recall

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - iQ</p> <p>BRAND: Toyota</p> <p>TYPE/NUMBER OF MODEL: Model year: 2008 to 2010.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because under certain specific driving conditions, the electric power steering warning light may come on and the required effort to turn the steering wheel may increase.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - SX4 and Swift</p> <p>BRAND: Suzuki</p> <p>TYPE/NUMBER OF MODEL: SX4 2WD 1.6L (RW416) and Swift 1.3L (RS413) (Recall Campaign 99-SK)</p> <p>DESCRIPTION: The recall concerns vehicles produced between 31 May 2007 and 22 September 2009 (SX4) and 28 February 2008 and 17 September 2009 (Swift), with VINs from JSAGYA21S0000107882 to JSAGYA21S00207083 (SX4, Greece only).</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because securing screws of the outside rear view mirrors assembly on the mirror base may be loosened as the screws do not have stopper, when the excessive vibration and/or bending stress applied onto the threads during use. In worst case, the outside rear view mirrors may be come out from the base, if the vehicle used continuously even after the screws are loosened.</p>	Voluntary corrective actions taken by the importer.
EU/IRELAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - Citroen C5</p> <p>BRAND: Citroen</p> <p>TYPE/NUMBER OF MODEL: e2*2001/116*0360*07</p> <p>DESCRIPTION: Unknown</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries (road accident) due to the loss of efficiency of the parking brake noted by an absence of force when using the parking brake lever.</p>	Voluntary corrective actions taken by the importer.
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - Insignia</p> <p>BRAND: Opel.</p> <p>TYPE/NUMBER OF MODEL: Insignia Model year: 2011.</p> <p>DESCRIPTION: Light passenger vehicle. Fabrication numbers: from B 1 017475 to B 1 051478.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the "Driver Airbag Module" may separate from the horn plate of the steering wheel in case of deployment.</p>	Voluntary corrective actions taken by the importer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - Astra and Insignia</p> <p>BRAND: OPEL</p> <p>TYPE/NUMBER OF MODEL: Models Astra J and Insignia (recall campaign 10-C-046)</p> <p>DESCRIPTION: The recall concerns 2010 and 2011 model year OPEL Astra J vehicles, with VINs from B 8 023030 to B 8 023938 (factory: Ellesmere Port) and from A G 091656 to B G 041791 (factory: Gliwice) and Insignia vehicles, with VINs from B 1 055991 to B 1 060051 (factory: Ruesselsheim).</p> <p>COUNTRY OF ORIGIN: UK/Poland/Germany</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because of anti-pinch malfunction on front door window regulator right side (RH) that might appear. As a result, the hand or fingers of the passengers might entrap during the function of closing the window.</p>	Voluntary corrective actions taken by the importer.
EU/SPAIN	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Electric passenger vehicle - City</p> <p>BRAND: Think</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Electric passenger car.</p> <p>COUNTRY OF ORIGIN: Norway</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the water tightness of the brake vacuum pump may become reduced, allowing water to seep in when the cars are washed and potentially resulting in a loss of braking power and a risk of accident.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycle - PCX125</p> <p>BRAND: Honda</p> <p>TYPE/NUMBER OF MODEL: WW125EX2A, model code JF28</p> <p>DESCRIPTION: The recall concerns certain 2010 model year units, with VINs in the range: MLHJF28A*A5000007 - MLHJF28A*A5012777</p> <p>COUNTRY OF ORIGIN: Thailand</p> <p>No picture available</p>	<p>FIRE</p> <p>The product poses a risk of fire because an acidic mixture of battery electrolyte and water may drip from the drain hole of the battery box on to the top of the fuel pump, leading to cracks around the fuel pump hose connector area. As result, fuel will leak from the fuel pump while starting or riding the vehicle.</p>	Voluntary corrective actions taken by the manufacturer.
EU/SWEDEN	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - 9-3</p> <p>BRAND: Saab</p> <p>TYPE/NUMBER OF MODEL: Saab 9-3 Cabriolet. MY 2010. VINs of the affected vehicles: YS3FH76Y8A6000005-YS3FF76W9A6000194</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Sweden</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the right-hand side, front seat recliner may fail, with the result that the user cannot move the backrest into the locking position after it has been tilted forward. If this happens and the vehicle is involved in a crash, the seatbelt which is integrated into the seat structure will not restrain the occupant as designed.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
EU/SWEDEN	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - 9-5</p> <p>BRAND: Saab</p> <p>TYPE/NUMBER OF MODEL: Saab 9-5 Sedan. MY 2011. VINs of the affected vehicles: YS3GP4ML9B4000587-YS3GP4AZ8B4002579</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Sweden</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because, in the event of an accident and airbag deployment, the steering wheel airbag module may detach from the steering wheel.</p>	Voluntary corrective actions taken by the manufacturer.
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - XC60</p> <p>BRAND: Volvo.</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Passenger car. Model years: 2009-2011. See attached list of VIN numbers</p> <p>COUNTRY OF ORIGIN: Sweden</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The inflatable curtain airbags (IC) may not have been correctly mounted and, in the case of an accident the inflatable airbags may not deploy as intended.</p>	Voluntary corrective actions taken by the manufacturer.
AUSTRALIA	<p>Volvo—S80, S60, V70, XC70 and XC60 MY 2011</p> <p>PRODUCT DESCRIPTION</p> <p>S80, S60, V70, XC70 and XC60 vehicles MY 2011, fitted with a 6 cylinder petrol engine</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: R29159 Target Number: 629 VIN range: S80 - 134112 to 141219 S60 - 000194 to 012895 V70 - 167118 to 183187 XC70 - 094133 to 102176 XC60 - 135074 to 165252</p> <p>SUPPLIER</p> <p>Volvo Car Australia Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>During city driving and when the driver is braking and/or releasing the accelerator pedal, the engine idle speed may drop resulting in a sudden engine stop. If this condition occurs, the driver will be able to restart the vehicle and continue to drive. However, when the driver tries to restart the engine and puts the gear shifter in 'D' or 'R', the driver must depress the accelerator pedal further than normal in order to put the vehicle in motion. During this time, the driver might find the gear engagement harsh and the operation of the transmission noisy.</p> <p>DEFECTS</p> <p>The software calibration for fuel cut-off functionality in the engine control module (ECM) and the transmission control module (TCM) is too sensitive.</p>	CONSUMERS ACTION Contact your authorised Volvo dealer to have an upgraded software package downloaded into the Engine Control Module (ECM).

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAINGER	MEASURES ADOPTED
AUSTRALIA	<p>Toyota—Coaster Bus HZB50, BB50—Front Windscreen Wiper Switch</p> <p>PRODUCT DESCRIPTION</p> <p>Toyota Coaster Bus HZB50, BB50 vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Target Number: 2,168 Campaign Number: TMP 2010/046</p> <p>SUPPLIER</p> <p>Toyota Motor Corporation Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>In the worst case scenario, there is a possibility of smoke emission from the front windscreen wiper switch assembly.</p> <p>DEFECTS</p> <p>Frequent operation of the intermittent wiper circuit may cause the relay contact points to separate from the contact arm, resulting in an electrical short circuit and the wipers being inoperative.</p>	<p>CONSUMERS ACTION</p> <p>Owners are advised not to use the intermittent wiper function until the recall action is complete. All vehicles affected by the recall will have the front wiper switch replaced with an improved one.</p>
AUSTRALIA	<p>Jaguar—XJ—Wiper Arm Durability</p> <p>PRODUCT DESCRIPTION</p> <p>Jaguar XJ MY2010 and certain XJ 2011 vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: J019 Target Number: 69 VIN Range: V00001 to V14247</p> <p>SUPPLIER</p> <p>Jaguar Australia</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Through torque relaxation, the securing nut could become loose, allowing the wiper arms to lose synchronisation, clash and potentially detach from their spindles.</p> <p>DEFECTS</p> <p>The manufacturing process to attach the wiper arm to the spindle was insufficiently controlled such that the specified torque was imparted on the fixing.</p>	<p>CONSUMERS ACTION</p> <p>Contact your authorised Jaguar dealership to have the wiper arm inspected and if necessary re-torqued.</p>
AUSTRALIA	<p>Volvo—XC60 MY 2009 to MY 2011</p> <p>PRODUCT DESCRIPTION</p> <p>Volvo XC60 vehicles MY 2009 to MY 2011</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: R89152 Target Number: 7 VIN Range: 003297 to 138358</p> <p>SUPPLIER</p> <p>Volvo Car Australia Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If an inflatable curtain is not correctly assembled and an accident occurs, where the deployment of the inflatable curtain is required, it may not deploy as intended.</p> <p>DEFECTS</p> <p>The inflatable curtains in some of these vehicles may have been incorrectly assembled.</p>	<p>CONSUMERS ACTION</p> <p>Contact your authorised Volvo dealership to have the assembly of the inflatable curtains inspected and, if necessary, adjusted.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAINGER	MEASURES ADOPTED
AUSTRALIA	<p>Mercedes-Benz—Atego trucks fitted with 180L plastic fuel tanks\</p> <p>PRODUCT DESCRIPTION</p> <p>Atego trucks fitted with 180L plastic fuel tanks</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: RC851 Target Number: 186 Chassis Range: 2K 900466 to 993972 2L 000507 to 342738</p> <p>SUPPLIER</p> <p>Mercedes-Benz Australia/Pacific Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>In extreme circumstances the support rail may break allowing the tank to partially dislodge and come in contact with the road.</p> <p>DEFECTS</p> <p>It is possible that cracks may occur in the front fuel tank support rails.</p>	<p>CONSUMERS ACTION</p> <p>Letters will be sent to affected owners.</p> <p>Owners are advised to contact their authorised Mercedes-Benz dealership to have the reinforcement brackets fitted free of charge</p>
AUSTRALIA	<p>Mercedes-Benz—Sedan and Coupe (model 204, 212 & 207)—Check Power Steering Pump Connection</p> <p>PRODUCT DESCRIPTION</p> <p>Sedan and Coupe (model 204, 212 & 207) cars manufactured between June 1, 2009 and February 28, 2010</p> <p>IDENTIFYING FEATURES</p> <p>Target Number: 4833 Campaign Number: RC856</p> <p>SUPPLIER</p> <p>Mercedes-Benz Australia/Pacific Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Higher than normally required steering forces, particularly during parking manoeuvres.</p> <p>DEFECTS</p> <p>It is possible that a loss of fluid may develop at the connection between the high pressure line and the power steering pump. The gradual loss of fluid is generally followed by a whining noise from the pump, and can lead to higher than normally required steering forces, particularly during parking manoeuvres.</p>	<p>CONSUMERS ACTION</p> <p>Letters will be sent to affected owners.</p> <p>Owners are advised to contact their authorised Mercedes-Benz dealer to have the connection checked, and repaired if required, free of charge.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>ENC / EZ-RIDER II 2006-2011</p> <p>MANUFACTURER: ELDORADO NATIONAL - CALIFORNIA, INC.</p> <p>COMPONENT: STEERING: LINKAGES: LINK:DRAG:CONNECTION</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1084</p> <p>SUMMARY: Eldorado national - California is recalling certain model year 2006-2011 ez rider ii buses manufactured from April 1, 2006, through November 30, 2010, with a defective steering drag link. The drag links are not of sufficient strength for the duty cycle in which they are operating. The drag links have experienced fatigue failure at their rear adjustment point.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A drag link failure could result in steering failure and a loss of control of the vehicle increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Eldorado national - California will inspect and insure that they have the defective drag link and if found it will be replaced with a new one. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact eldorado national - California at 937-596-6111.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
<p>USA</p>	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>HOLIDAY RAMBLER / ENDEAVOR 2010-2011 HOLIDAY RAMBLER / NEPTUNE 2010-2011 MONACO / CAMELOT 2010 MONACO / KNIGHT 2009 MONACO COACH / CAYMAN 2009-2011 MONACO COACH / DIPLOMAT 2010-2011 MONACO RV / ADMIRAL 2010-2011 MONACO RV / MONARCH 2009-2011 SAFARI COACH / SIMBA DIESEL 2008</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 85</p> <p>SUMMARY: NAVISTAR is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>NAVISTAR is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during november 2010. owners may contact norcold at 1-800-767-9101.</p>
<p>USA</p>	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>KEYSTONE / FUZION 2010-2011 KEYSTONE / MONTANA 2007-2011 KEYSTONE / MONTANA HIGH COUNTRY 2010-2011 KEYSTONE / MONTANA-BIG SKY 2007-2011 KEYSTONE / RAPTOR 2011</p> <p>MANUFACTURER: KEYSTONE RV COMPANY</p> <p>SUMMARY: KEystone is recalling certain recreational vehicles and fifth wheel trailers equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>Keystone is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during November 2010. Owners may contact norcold at 1-800-767-9101 or keystone at 866-425-4369.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) AASV / SPIRIT OF MOBILITY 2009-2010</p> <p>MANUFACTURER: ALL AMERICAN SPECIALTY VEHICLES, LLC</p> <p>COMPONENT: ELECTRICAL SYSTEM: ALTERNATOR/GENERATOR/REGULATOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 28</p> <p>SUMMARY: All american specialty vehicles is recalling certain model year 2009 and 2010 spirit of mobility transit buses manufactured from january 1, 2009, through april 11, 2010, and equipped with penn tex 200 amp alternators. These vehicles have the positive cable from the rear of the alternator routed over the transmission dipstick tube to the positive battery terminal and can become pinched between the blower motor housing and the transmission dipstick tube. The pinching may cause the cables protective convolute and insulation to wear through to the wire. This cable is always "hot" (carrying electrical current).</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An exposed cable carrying electrical current could generate sufficient heat to ignite the transmission fluid within the tube which could result in a fire.</p>	<p>REMEDY</p> <p>Dealers will perform the necessary repairs free of charge. The safety recall is expected to begin during November 2010. Owners may contact all american specialty vehicles customer service at 1-866-953-5555.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) INTERNATIONAL / 7300 2011 INTERNATIONAL / 7400 2011 INTERNATIONAL / 7500 2011</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: STEERING:GEAR BOX:SHAFT SECTOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 46</p> <p>SUMMARY: Navistar is recalling certain model year 2011 international 7300, 7400, and 7500 vehicles manufactured from June 30, 2010, through October 13, 2010. These vehicles were built with an incorrect steering system draglink.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Drivers may experience degraded steering feel and control, increasing the risk of a crash possibly resulting in property damage, personal injury, or death.</p>	<p>REMEDY</p> <p>Dealers will replace the steering draglink and pitman arm and will also inspect the steering arm for damage and replace if necessary. This service will be performed free of charge. The safety recall is expected to begin on or before November 30, 2010. Owners may contact navistar at 1-800-448-7825.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED	
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>BISON / STRATUS 2011 BISON / STRATUS EXPRESS 2011 MCKENZIE / ION 2011 MONACO RV / MONARCH 2011 MONACO RV / RIPTIDE 2011 R-VISION / TRAIL SPORT 2011</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: EQUIPMENT Potential Number of Units Affected: 16</p> <p>SUMMARY: NAVISTAR is recalling certain motor coach and recreational vehicles equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.</p> <p>No picture available.</p>	CONSEQUENCE	REMEDY	
		A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.	NAVISTAR is working with atwood and will replace or repair the stoves free of charge. The safety recall is expected to begin during november 2010. owners may contact atwood at 1-574-266-4749.	
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>LAND ROVER / LR2 2010-2011</p> <p>MANUFACTURER: JAGUAR LAND ROVER NORTH AMERICA, LLC</p> <p>COMPONENT: AIR BAGS:FRONTAL</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2956</p> <p>SUMMARY: Land rover is recalling certain model year 2010-2011 lr2 vehicles manufactured from November 12, 2009, through august 23, 2010. The shorting bar in the clock spring may become disconnected when the driver's air bag module connector is installed.</p> <p>No picture available.</p>	CONSEQUENCE	REMEDY	
		The driver's frontal airbag may not deploy as intended or at all and therefore will not be able to properly protect the driver, increasing the risk of injury.	Dealers will install a spacer into the driver's airbag clock spring harness connector. This service will be performed free of charge. The safety recall is expected to begin on or before December 13, 2010. Owners may contact land rover at 800-637-6837.	
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>VANGUARD / COOL GLOBE 2011</p> <p>MANUFACTURER: VANGUARD NATIONAL TRAILER CORPORATION</p> <p>COMPONENT: SUSPENSION</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 30</p> <p>SUMMARY: Vanguard is recalling certain model year 2011 cool globe trailers equipped with arvin meritor suspension systems. The suspect systems may have missing welds at the interface of the lower seat bracket and axle beam.</p> <p>No picture available.</p>	CONSEQUENCE	REMEDY	
		Missing welds could allow the axle to roll out of position and potentially impact the handling of the trailer such that a driver may lose control of the vehicle, increasing the risk of a crash.	Vanguard is working with arvin meritor to identify owners with the affect suspension systems. The affected vehicles will be repaired free of charge. Owners may contact arvin meritor at 1-248-435-0896.	

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) VOLVO / S60 2011 VOLVO / S80 2011 VOLVO / XC60 2011 VOLVO / XC70 2011</p> <p>MANUFACTURER: VOLVO CARS OF N.A. LLC. COMPONENT: ENGINE AND ENGINE COOLING POTENTIAL NUMBER OF UNITS AFFECTED: 6046</p> <p>SUMMARY: Volvo is recalling certain model year 2011, s80, s60, xc70 and xc60 vehicles. The software calibration for the fuel cut-off functionality in the engine control module (ECM) is too sensitive. No picture available.</p>	<p>CONSEQUENCE</p> <p>Sudden engine stall could occur increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will update the ECM and tcm with new software free of charge. The safety recall is expected to begin on or before December 10, 2010. Owners may contact Volvo at 1-800-458-1552 or at customercare@volvoforlife.com.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) CHEVROLET / COLORADO 2004-2011 GMC / CANYON 2004-2011 ISUZU / I-280/I-350 2006 ISUZU / I-290/I-370 2007-2008</p> <p>MANUFACTURER: GENERAL MOTORS CORP. COMPONENT: CHILD SEAT POTENTIAL NUMBER OF UNITS AFFECTED: 192676</p> <p>SUMMARY: GM is recalling certain model year 2004-2011, chevrolet colorado, gmc canyon, model year 2006, isuzu i-280/i-350, and model year 2007-2008, i-290/i-370, regular cab vehicles and extended cab vehicles without a rear seat and equipped with a front 60/40 split bench seat. These vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 225, "child restraint anchorage systems." the top tether anchor for the front center seat is not accessible and the owner manual does not include instructions regarding how to use the top tether. No picture available.</p>	<p>CONSEQUENCE</p> <p>Both nhtsa and gm discourage placement of a child in a front seat. Nevertheless, there are individual circumstances that may require placement of a child in a restraint in the front center seating position of this vehicle that does not offer a rear seat. lack of access to the top tether anchor and a lack of instructions as to how to use it, may result in improper installation of a child restraint. Improper installation of a child restraint can result in a reduction in the restraint's performance in the event of a crash and an increased risk of injury or death to the child seated in the restraint.</p> <p>Remedy:</p>	<p>Dealers will cut a hole into the back panel trim cover to allow access to the top tether anchor for the front center seat position and will provide supplemental information as to use in the owner's manual. The manufacturer has not yet provided an owner notification schedule for this campaign. Owners may contact Chevrolet at 1-800-630-2438, gmc at 1-866-996-9463, isuzu at 1-800-255-6727 or visit gm's website at www.gmownercenter.com.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) JAGUAR / XJ 2010-2011 MANUFACTURER: JAGUAR LAND ROVER NORTH AMERICA, LLC COMPONENT: VISIBILITY:WINDSHIELD WIPER/WASHER POTENTIAL NUMBER OF UNITS AFFECTED: 6475 SUMMARY: Jaguar is recalling certain model year 2010-2011 xj vehicles manufactured from july 28, 2009, through november 3, 2010. The front wiper arms to spindle fixings were not torqued to specification during manufacturing. As a result, the securing nuts could fail to perform as intended, resulting in a loss of wiper arm synchronization and a clash of the wiper arms. No picture available.	CONSEQUENCE If the wiper arms lose synchronization and clash, they could detach from the vehicle, reducing a driver's visibility and increasing the risk of crash.	REMEDY Dealers will ensure the wiper arms are fitted securely onto the spindle and the securing nuts will be tightened to the correct torque. This service will be performed free of charge. The safety recall is expected to begin on or before December 13, 2010. Owners may contact jaguar at 800-637-6837.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) FLEETWOOD / TERRA 2011 MANUFACTURER: FLEETWOOD RV, INC. COMPONENT: EXTERIOR LIGHTING: HEADLIGHTS:HIGH/LOW BEAM DIMMER SWITCH POTENTIAL NUMBER OF UNITS AFFECTED: 84 SUMMARY: Fleetwood rv is recalling certain model year 2011 terra class a motor homes manufactured from june 6, 2010, through october 4, 2010, for failing to comply with the requirements of federal motor vehicle safety standard no. 218, "lamps, reflective devices, and associated equipment." the high-beam and low-beam headlights are not in the correct positions as specified by fmvss 108. No picture available.	CONSEQUENCE Incorrect positioning of the high and low-beams on headlights could result in glare to oncoming drivers and/or reduced visibility of the motor home increasing the risk of a crash with the motor home.	REMEDY Dealers will remove the existing high-beam and low-beam headlights and replace them with different low-beam and high-beam headlights in order to comply with the applicable standards of fmvss108. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact fleetwood at 800-509-3418.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) VOLVO / XC60 2010 MANUFACTURER: VOLVO CARS OF N.A. LLC. COMPONENT: AIR BAGS POTENTIAL NUMBER OF UNITS AFFECTED: 58 SUMMARY: Volvo is recalling certain model year 2010 xc60 vehicles. The curtain air bags may have been mis-assembled during the manufacturing process. This may cause an air bag to not deploy or not deploy as intended. No picture available.	CONSEQUENCE If the curtain air bag does not perform as intended in the event of a vehicle crash necessitating deployment of that air bag, it may not properly protect the occupant, increasing the risk of injuries.	REMEDY: Dealers will inspect the left and right curtain air bag assembly and adjust if necessary. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Volvo at 1-800-458-1552 or at customercare@volvoforlife.com .

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>VOLVO / VHD 2007 2009</p> <p>VOLVO / VN 2006-2010</p> <p>VOLVO / VT 2007-2009</p> <p>MANUFACTURER: VOLVO TRUCKS NORTH AMERICA</p> <p>COMPONENT: SERVICE BRAKES, AIR:SUPPLY:QUICK RELEASE VALVE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 6187</p> <p>SUMMARY: Volvo trucks is recalling certain model year 2007 and 2009 vhd, model year 2006 through 2010 vn, and model year 2007 through 2009 vt trucks manufactured from november 7, 2005, through october 30, 2009, with an air release fifth wheel. The inversion valve on the frame may be orientated where contaminants can enter the valve through the exhaust port. As a result, the brake valve may corrode.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Corrosion of the valve can cause it to malfunction, thereby adversely affecting braking performance and increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will inspect the inversion valve and replace as required. This service will be performed free of charge. The safety recall is expected to begin on or before January 10, 2010. Owners may contact Volvo trucks at 1-800-528-6586.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>TIFFIN / ALLEGRO 2007-2010</p> <p>TIFFIN / PHAETON 2007-2010</p> <p>TIFFIN / ZEPHYR 2007-2010</p> <p>MANUFACTURER: TIFFIN MOTORHOMES, INC.</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2717</p> <p>SUMMARY: Tiffin is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>Tiffin is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during December 2010. Owners may contact norcold at 1-800-767-9101 or tiffin at 1-256-356-8661.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>ITASCA / ELLIPSE 1996-2011 ITASCA / HORIZON 1996-2011 ITASCA / MERIDIAN 1996-2011 ITASCA / SUNCRUISER 1996-2011 ITASCA / SUNFLYER 1996-2011 ITASCA / SUNOVA 1996-2011 ITASCA / SUNRISE 1996-2011 ITASCA / SUNSTAR 1996-2011 WINNEBAGO / ADVENTURER 1996-2011 WINNEBAGO / BRAVE 1996-2011 WINNEBAGO / CHIEFTAIN 1996-2011 WINNEBAGO / JOURNEY 1996-2011 WINNEBAGO / JOURNEY DL 1996-2011 WINNEBAGO / LUXOR 1996-2011 WINNEBAGO / SIGHTSEER 1996-2011 WINNEBAGO / ULTIMATE ADVANTAGE 1996-2011 WINNEBAGO / ULTIMATE FREEDOM 1996-2011 WINNEBAGO / VECTRA 1996-2011 WINNEBAGO / VECTRA GRAND TOUR 1996-2011 WINNEBAGO / VISTA 1996-2011</p> <p>MANUFACTURER: WINNEBAGO INDUSTRIES, INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 18461</p> <p>SUMMARY: Winnebago is recalling certain recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>Winnebago is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during December 2010. Owners may contact norcold at 1-800-767-9101 or Winnebago at 1-641-585-3535.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) KEYSTONE / MONTANA 2011 MANUFACTURER: KEYSTONE RV COMPANY COMPONENT: STRUCTURE:FRAME AND MEMBERS POTENTIAL NUMBER OF UNITS AFFECTED: 576 SUMMARY: Keystone is recalling certain 2010-2011 Montana fifth wheel trailers manufactured from September 3, 2009, through September 28, 2010. Under certain side load stress conditions the frame exhibits excessive flexing at the area of the center axle spring hangers. No picture available.</p>	<p>CONSEQUENCE This flexing in extreme circumstances can result in extensive frame damage, leading to an increased risk of property damage and/or vehicle crash.</p>	<p>REMEDY Keystone will install a cross member between the center spring hangers free of charge. The safety recall is expected to begin on or about November 22, 2010. Owners may contact keystone customer service at 1-866-425-4369.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) GULF STREAM / ATRIUM 2002-2005 GULF STREAM / AZTEC 2010 GULF STREAM / CANYON TRAIL 2002-2006 2008-2010 GULF STREAM / FRIENDSHIP 1997-2007 GULF STREAM / INDEPENDENCE 2000-2010 GULF STREAM / MAKO 2001-2010 GULF STREAM / PRAIRIE SCHOONER 2000-2010 GULF STREAM / SCENIC CRUISER 1997-2005 GULF STREAM / SUN VOYAGER 2003-2010 GULF STREAM / TOURMASTER 2001-2002 2005-2008 GULF STREAM / TOURMASTER ELITE 2000-2001 GULF STREAM / YELLOWSTONE 2000-2010 MANUFACTURER: GULF STREAM COACH, INC. COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE POTENTIAL NUMBER OF UNITS AFFECTED: 1328 SUMMARY: Gulf Stream is recalling certain recreational vehicles and fifth wheel trailers equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. No picture available.</p>	<p>CONSEQUENCE The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY Gulf Stream is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during December 2010. Owners may contact norcold at 1-800-767-9101 or Gulf Stream at 1-574-773-7761.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) FEATHERLITE / TRAILER 2000 2004 2006 2009 MANUFACTURER: FEATHERLITE, INC. COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE POTENTIAL NUMBER OF UNITS AFFECTED: 4 SUMMARY: Featherlite trailers is recalling certain trailers equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. No picture available.		CONSEQUENCE The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.	REMEDY Featherlite trailers is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during December 2010. Owners may contact norcold at 1-800-767-9101 or featherlite trailers at 1-877-903-1444.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) IC BUS / CE 2011 IC BUS / HC 2011 INTERNATIONAL / 4300 2011 INTERNATIONAL / 4400 2011 MANUFACTURER: NAVISTAR, INC COMPONENT: ENGINE AND ENGINE COOLING POTENTIAL NUMBER OF UNITS AFFECTED: 2309 SUMMARY: Navistar is recalling certain model year 2011 international commercial trucks models 4300 and 4400 and 2011 IC bus models ce and hc commercial buses manufactured from february 25, 2010, through september 20, 2010. The engine turbo oil supply line may rub on the frame rail possibly causing an oil leak in the engine compartment. No picture available.		CONSEQUENCE An oil leak in the engine compartment may cause a fire.	REMEDY Navistar will notify owners and international dealers will repair the buses free of charge. The safety recall is expected to begin on or about January 1, 2011. Owners may contact navistar 1-800-448-7825.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) SHOWTIME / CLASSIC 1999-2000 SHOWTIME / HORSE TRAILER 2007 SHOWTIME / SHOWHAULER 2001-2002 2004 SHOWTIME / WILDSIDE 2006</p> <p>MANUFACTURER: SHOWTIME CONVERSIONS COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE POTENTIAL NUMBER OF UNITS AFFECTED: 10</p> <p>SUMMARY: Showtime conversions is recalling certain model year 2001, 2002, and 2004 showhauler recreational vehicles; 1999 and 2000 classic car trailers; 2006 wildside recreational vehicles; and 2007 showtime horse trailers, equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>Showtime is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for more information. The recall is expected to begin during November or early December 2010. Owners may contact norcold at 1-800-767-9101 or showtime conversions at 1-574-534-8340.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) FORETRAVEL / U320 1998-1999 2001-2002</p> <p>MANUFACTURER: FORETRAVEL, INC. COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE POTENTIAL NUMBER OF UNITS AFFECTED: 4</p> <p>SUMMARY: Foretravel is recalling certain model year 1998, 1999, 2001, and 2002 model u320 coaches equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>Foretravel is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during December 2010. Owners may contact norcold at 1-800-767-9101 or foretravel at 1-936-564-8367.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) DUTCHMEN / GRAND JUNCTION 2008-2011 DUTCHMEN / VOLTAGE 2011</p> <p>MANUFACTURER: DUTCHMEN MANUFACTURING, INC.</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 455</p> <p>SUMMARY: Dutchmen is recalling certain model year 2008-2011 grand junction and 2011 voltage recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>the sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>Dutchmen is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during November or early December 2010. Owners may contact norcold at 1-800-767-9101 or Dutchmen at 1-574-537-0700.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) DAMON / ASTORIA PACIFIC 2005-2009 DAMON / ESSENCE 2008 DAMON / TUSCANY 2005-2009 FOUR WINDS / MANDALAY 2004-2009 FOUR WINDS / PRESIDIO 2004-2008 FOUR WINDS / SERRANO 2009-2011 FOUR WINDS / VALENCIA 2006-2007 FOUR WINDS / WINDSPORT 2006-2007</p> <p>MANUFACTURER: THOR MOTOR COACH</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 3488</p> <p>SUMMARY: Tmc is recalling certain model year 2004-2011 damon and four winds recreational vehicles equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak, may not shut-off in sufficient time to prevent a fire.</p>	<p>REMEDY</p> <p>TMC is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The recall is expected to begin during November or early December 2010. Owners may contact norcold at 1-800-767-9101 or Thor motor coach at 1-877-855-2867.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>VOLVO / C30 2007-2010 VOLVO / C70 2006-2010 VOLVO / S40 2004-2010 VOLVO / S60 2001-2009 VOLVO / S80 2000-2010 VOLVO / V50 2005-2010 VOLVO / V70 2001-2010 VOLVO / XC70 2001-2010 VOLVO / XC90 2003-2010</p> <p>MANUFACTURER: VOLVO CARS OF N.A. LLC.</p> <p>COMPONENT: EQUIPMENT: ELECTRICAL: NAVIGATIONAL SYSTEM(GLOBAL POSITIONING SYSTEM)</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 416</p> <p>SUMMARY: Volvo is recalling certain vehicles equipped with garmin 760 portable global positioning system (gps) units because the batteries on those units may overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An overheated battery could lead to a fire.</p>	<p>REMEDY</p> <p>Volvo advises owners to please stop using the garmin portable gps device immediately, and visit the garmin website to determine if their unit is affected. The unit's battery will be replaced with a new battery and a spacer will be inserted on top of the battery next to the PCB. This service will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact garmin at 866-957-1981 or visit garmin's website at www.garmin.com/nuvibatterypcbrecall.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>K-Z / NEW VISION 2005-2006 K-Z / SPORTSMEN 2002-2004 K-Z / STONERIDGE 2009 KZRV / ESCALADE 2005 2008-2009 KZRV / MONTEGO BAY 2008-2009 KZRV / SPORTSTER 2009</p> <p>MANUFACTURER: KZRV, L.P.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 552</p> <p>SUMMARY: KZRV is recalling certain recreational vehicles equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This could result in a fire.</p>	<p>REMEDY</p> <p>KZRV is working with dimplex and will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during November 2010. Owners may contact dimplex North America customer service at 1-888-346-7539.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) IC BUS / CE 2011</p> <p>MANUFACTURER: NAVISTAR, INC</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 416</p> <p>SUMMARY: Navistar is recalling certain model year 2011 IC bus ce school buses manufactured from february 25, 2010, through september 20, 2010. The engine turbo oil supply line may rub on the frame rail possibly causing an oil leak in the engine compartment.</p> <p>No picture available.</p>	CONSEQUENCE An oil leak in the engine compartment may cause a fire.	REMEDY IC bus will notify owners and ic bus dealers will repair the buses free of charge. The safety recall is expected to begin on or about January 1, 2011. Owners may contact IC bus at 1-800-448-7825.
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) ROGUE / S/A TRAILER 2008-2010 ROGUE / T/A TRAILER 2008-2010</p> <p>MANUFACTURER: ROGUE INDUSTRIES, INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 442</p> <p>SUMMARY: Rogue industries is recalling certain model year 2008-2010 rogue model s/a and t/a boat trailers equipped with cequent 3x3" and 3x4" fulton swing tongue units. The pivot bolt can shear allowing the trailer tongue to swing allowing the trailer and boat to come forward and hit the towing vehicle.</p> <p>No picture avaiable.</p>	CONSEQUENCE Should the boat/trailer hit the towing vehicle, the driver may loose control of the vehicle possibly resulting in a crash.	REMEDY Rogue will notify owners and the trailers will be repaired free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact rogue industries at 541-830-6930.
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) JAYCO / JAY FEATHER SELECT 2011</p> <p>MANUFACTURER: JAYCO, INC.</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE:LPG LINES AND FITTINGS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 35</p> <p>SUMMARY: Jayco is recalling certain model year 2011 jay feather select travel trailers series 29l, manufactured from June 1, 2010, through September 10, 2010. During the course of a routine inspection, it was discovered that the stove in the exterior kitchen had not been tested for liquid propane (LP) leaks.</p> <p>No picture available.</p>	CONSEQUENCE An LP leak in the presence of an ignition source could result in a fire, injury, or death.	REMEDY Jayco will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin during November 2010. Owners may contact jayco at 1-800-283-8267.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>STARTRANS / CANDIDATE 2006-2007 STARTRANS / CANDIDATE II 2006-2007 STARTRANS / PRESIDENT 2006-2007 STARTRANS / SENATOR 2006-2007 STARTRANS / SENATOR HD 2006-2007 STARTRANS / SENATOR II 2006-2007 STARTRANS / TROLLEY 2006-2007</p> <p>MANUFACTURER: STARTRANS BUS CORPORATION</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2393</p> <p>SUMMARY: Startrans is recalling certain model year 2006 and 2007 candidate, candidate ii, senator hd, trolley, president, senator, and senator ii transit buses equipped with trans/air ta73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire.</p>	<p>REMEDY</p> <p>Trans/air, in cooperation with startrans, will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during December 2010 or early January 2011. Owners may contact trans/air warranty and service center at 1-800-673-2446.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>STARTRANS / MFSAB 2003-2007</p> <p>MANUFACTURER: STARTRANS BUS CORPORATION</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 53</p> <p>SUMMARY: Startrans is recalling certain model year 2003-2007 mfsab school activity buses equipped with trans/air ta73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire.</p>	<p>REMEDY</p> <p>Trans/air, in cooperation with startrans, will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during December 2010 or early January 2011. Owners may contact trans/air warranty and service center at 1-800-673-2446.</p>

AUTO: MOTOR VEHICLE EQUIPMENT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: MURRAY / CIRCUIT BREAKER SIEMENS / CIRCUIT BREAKER</p> <p>MANUFACTURER: SIEMENS CORPORATION</p> <p>COMPONENT: ELECTRICAL SYSTEM:FUSES AND CIRCUIT BREAKERS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 20000</p> <p>SUMMARY: Siemens is recalling certain murray and siemens circuit breakers manufactured in june 2010, date code "0610", and in addition, some circuit breakers manufactured within the subject period stamped with a date code for july 2010, "0710". These circuit breakers were sold and installed as original equipment for various rv manufacturers. The spring clip within the circuit breaker can break.</p> <p>No picture available</p>	<p>CONSEQUENCE</p> <p>If the spring clip breaks, it could result in a loose connection of the breaker to the stab. Over time, this condition could lead to excessive temperature, arcing or thermal damage at the connection point which could result in a fire.</p>	<p>REMEDY</p> <p>Siemens is working with the rv manufacturers to identify and notify owners who may have had the affected circuit breakers installed in their vehicle. The affected circuit breakers will be replaced free of charge. The safety recall began on september 7, 2010. owners may contact siemens at 1-800-756-6996.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www.odn.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

