

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 OCTOBER 2010

## CONTENTS

### AUTOMOTIVE

Pages 1 to 28



[Motor Vehicle \(43\)](#)


[Child Safety Seat \(1\)](#)

[Motor Vehicle Equipment \(12\)](#)

**SGS**

**AUTO: MOTOR VEHICLE**

| <b>NOTIFYING COUNTRY</b> | <b>PRODUCT</b>  | <b>DANGER</b>  | <b>MEASURES ADOPTED</b>  |
|--------------------------|---|--|--|
| <b>AUSTRALIA</b>         | <p>Citroën—C3 Pluriel 1.6L, C3 1.6L HDi , C3 1.4L, C3 1.6L, C2 1.6L &amp; Dispatch Vehicles</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>C3 Pluriel 1.6L, C3 1.6L HDi , C3 1.4L, C3 1.6L, C2 1.6L and Dispatch Vehicles</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Various VIN's<br/>Target Number: 741</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Citroën Dealers</p> <p><b>SUPPLIER</b></p> <p>Ateco Automotive Pty Ltd<br/>No picture available.</p>  | <p><b>HAZARDS</b></p> <p>Lamps may go out on affected vehicles without being requested to by the driver.</p> <p><b>DEFECTS</b></p> <p>The position of the lighting control ring is incorrectly detected by the lighting management system.</p>   | <p><b>CONSUMERS ACTION</b></p> <p>Citroën will contact all customers advising them to bring their vehicles into the dealerships for inspection and downloading of a new software version.</p>                                |
| <b>AUSTRALIA</b>         | <p>Aston Martin—V8 Vantage, DB9, and DBS Sports Cars</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Certain V8 Vantage, DB9 and DBS vehicles manufactured between March and September 2007.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>See attached VIN list.<br/>Campaign Number: RA-04-0014<br/>Target Number: 95</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Aston Martin Melbourne, Aston Martin Sydney, Babagallo Aston Martin, Solitaire Aston Martin Adelaide and Sunshine Aston Martin</p> <p><b>SUPPLIER</b></p> <p>Aston Martin Lagonda Limited</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://astonmartin.com">http://astonmartin.com</a></p> <p>No picture available.</p> | <p><b>HAZARDS</b></p> <p>It is possible that these bolts could crack and cause the steering and handling of the vehicle to be affected and can cause a knocking noise from the front suspension.</p> <p><b>DEFECTS</b></p> <p>These vehicles have been equipped with front bottom suspension arm cam-bolts that may be out of specification.</p> | <p><b>CONSUMERS ACTION</b></p> <p>Aston Martin will write to all affected owners. Owners will be advised to contact their local Dealer as soon as possible to have the necessary replacements carried out, free of cost.</p> |

| AUTO: MOTOR VEHICLE |   |  |   |
|---------------------|---|--|---|
| NOTIFYING COUNTRY   | PRODUCT   | DA NGER  | MEASURES ADOPTED  |
| <b>AUSTRALIA</b>    | <p>Mercedes-Benz—Mitsubishi Fuso Canter (FE8) Trucks—Renew ABS Unit Ground Harness</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Mitsubishi Fuso Canter FE83D, FE84D and FE85D trucks built between March 2008 and January 2010.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign Number: RC0210FEABSHARN<br/>Target Number: 3,333</p> <p><b>SUPPLIER</b></p> <p>Mercedes-Benz Australia Pacific Pty Ltd<br/>No picture available.</p>   | <p><b>HAZARDS</b></p> <p>The defect may cause an electrical short.</p> <p><b>DEFECTS</b></p> <p>Due to the improper location of the ABS hydraulic unit ground wiring harness on affected trucks, water may infiltrate resulting in corrosion within the wiring connector.</p>  | <p><b>CONSUMERS ACTION</b></p> <p>Contact your authorised Mercedes-Benz dealership to have the wiring harness replaced with a modified version free of charge.</p> <p>If you have any questions regarding the recall, please contact your selling dealer (see attached supporting documentation for a list of authorised dealerships) or Tony Culvenor of Fuso Truck &amp; Bus Service Dept. on (03) 9566 6228.</p> |
| <b>AUSTRALIA</b>    | <p>BRP Australia Pty Ltd—Can-Am Spyder Roadster (this replaces recall PRA 2009/10953)</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Can-Am Spyder Roadster RS, RT and GS.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>All models except those listed in the excluded vehicles list (see supporting documentation)<br/>Target Number: 547</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>BRP Australia Can-Am Spyder Dealers, in all states of Australia, New Zealand, Pacific Islands and through distributors in Asia.</p> <p><b>SUPPLIER</b></p> <p>BRP Australia Pty Ltd</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://www.brp.com">http://www.brp.com</a></p>  | <p><b>HAZARDS</b></p> <p>If the defect occurs the vehicle may steer out of lane, which increases the possibility of a crash with other traffic or of the vehicle leaving the road.</p> <p><b>DEFECTS</b></p> <p>A situation may occur where the rider may need to exert a force greater than expected to turn the handlebar in order to correct the vehicle's trajectory. At this increased level of force the handlebar may be turned more than the rider had intended.</p> | <p><b>CONSUMERS ACTION</b></p> <p>Contact a BRP Spyder dealer as soon as possible to arrange to have the vehicle repaired, free of cost.</p>  |

| AUTO: MOTOR VEHICLE |   |  |   |  |
|---------------------|---|--|---|--|
| NOTIFYING COUNTRY   | PRODUCT   | ANGER  | MEASURES ADOPTED  |  |
| EU/GERMANY          | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Ford Ranger</p> <p><b>BRAND:</b> Ford</p> <p><b>TYPE/NUMBER OF MODEL:</b> J97</p> <p><b>DESCRIPTION:</b> Pick-up truck. The vehicles in question were manufactured between 15 May 2007 and 25 July 2008 with type approval numbers 022A1011V...20V and POCC DE.MT02.E03777.</p> <p><b>COUNTRY OF ORIGIN:</b> Thailand</p> <p>No picture available</p>   | <p><b>INJURIES</b></p> <p>The bracket of the automatic gearbox lever may break and as a result gear changes might not occur. If the gears were actually in "neutral" when the lever was in the "parking" position, the vehicle could roll away unexpectedly if the handbrake was not on and the vehicle was on an incline.</p> | Voluntary corrective actions taken by the manufacturer.   |  |
| EU/SPAIN            | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Legacy/Outback</p> <p><b>BRAND:</b> Subaru</p> <p><b>TYPE/NUMBER OF MODEL:</b> 2010 model, 2.0R, 2.5 CVT, 3.6R and 2.0D.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Japan</p> <p>No picture available</p>  | <p><b>INJURIES</b></p> <p>Under certain circumstances, there is a possibility that the driver's airbag will not deploy in the event of an accident.</p>  | Voluntary corrective actions taken by the manufacturer.   |  |
| EU/ITALY            | <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Ferrari 458 Italia</p> <p><b>BRAND:</b> Ferrari</p> <p><b>TYPE/NUMBER OF MODEL:</b> VIN range 170463 to 175763</p> <p><b>DESCRIPTION:</b> Coupé manufactured in 2010, with a direct injection V8 engine.</p> <p><b>COUNTRY OF ORIGIN:</b> Italy</p> <p>No picture available</p>   | <p><b>FIRE</b></p> <p>The product poses a risk of fire because the wheel-arch assembly and its heat shield can deform, bringing it too close to the exhaust. Under specific conditions of high ambient temperature and vehicle use, this can lead to a fire occurring.</p>   | Voluntary corrective actions taken by the manufacturer.   |  |
| USA                 | <p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b></p> <p>DODGE / RAM                                      2010</p> <p><b>MANUFACTURER:</b> CHRYSLER GROUP LLC</p> <p><b>COMPONENT:</b> QUIPMENT: OTHER: LABELS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>840</p> <p><b>SUMMARY:</b> Chrysler is recalling certain model year 2010 dodge ram d2, dj, and ds-body vehicles for failing to comply with the requirements of part 567, "certification." some vehicles have been built with certification and/or supplemental tire pressure information labels printed with incorrect weight or seating capacity information.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The misinformation on these labels could lead to, among other things, failure to follow proper vehicle loading specifications that could increase the risk of a crash.</p>  | <p><b>REMEDY</b></p> <p>Owners will be provided with replacement certification and/or supplemental tire pressure information labels. At the customer's option, they may take their vehicle to a chrysler dealer for installation. This service will be performed free of charge. The safety recall is expected to begin during october 2010. Owners may contact chrysler at 1-800-853-1403.</p> |  |

| AUTO: MOTOR VEHICLE |   |  |  |
|---------------------|---|--|--|
| NOTIFYING COUNTRY   | PRODUCT   | ANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>INTERNATIONAL / 7300                      2011<br/> INTERNATIONAL / 7400                      2011<br/> INTERNATIONAL / 7500                      2011</p> <p><b>MANUFACTURER:</b> NAVISTAR, INC</p> <p><b>COMPONENT:</b> EXTERIOR LIGHTING: HEADLIGHTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>43</p> <p><b>SUMMARY:</b> Navistar is recalling certain model year 2011 international 7300, 7400, 7500, vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 108,ds"lamps, reflective devices, and associated equipment." these vehicles are installed with improper headlight height of 55.5 inches and the correct height should be 54 inches.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>Improper height on the headlights may not fully illuminate the road surface or may inhibit the ability of motorists to see vehicles which can increase the risk of a crash.</p>   | <p><b>REMEDY</b></p> <p>Dealers will install the correct headlights free of charge. The safety recall is expected to begin on or before December 1, 2010. Owners may contact navistar at 1-800-448-7825.</p>   |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>FOREST RIVER / SANDPIPER                      2011<br/> FOREST RIVER / SIERRA                      2011</p> <p><b>MANUFACTURER:</b> FOREST RIVER, INC.</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>92</p> <p><b>SUMMARY:</b> Forest River is recalling certain model year 2011 sandpiper and sierra trailers equipped with dexter axles. On some axles, cracks could appear in the spindle weld.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard and/or compromising the driver's control of the vehicle, increasing the risk of a vehicle crash.</p> | <p><b>REMEDY</b></p> <p>Forest River is working with dexter axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin during November 2010. Owners may contact Forest River's warranty department at 1-574-534-3167 or dexter axle at 1-800-2164.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>MERCEDES BENZ / C                      2010<br/> MERCEDES BENZ / E                      2010-2011</p> <p><b>MANUFACTURER:</b> MERCEDES-BENZ USA, LLC.</p> <p><b>COMPONENT:</b> STEERING:HYDRAULIC POWER ASSIST:PUMP</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>85078</p> <p><b>SUMMARY:</b> Mercedes Benz is recalling certain model year 2010 c-class, model 204, e-class, model 212, and model year 2010-2011 e-class coupe/cabriolet model 207 vehicles. The power steering system in the subject vehicles may fail due to the loss of power steering fluid.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>Owners may not have sufficient control of the vehicle in areas, such as parking lots, where maximum power steering is required, increasing the risk of a vehicle crash.</p>   | <p><b>REMEDY</b></p> <p>Dealers will check and retorquer the connection fitting free of charge. The safety recall is expected to begin during October 2010. Owners may contact mercedes-benz at 1-800-367-6372.</p>  |

**AUTO: MOTOR VEHICLE**

| NOTIFYING COUNTRY               | PRODUCT   | DANGER                      | MEASURES ADOPTED     |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
|---------------------------------|---|-----------------------------|----------------------|----------------------|------|--|---|-------------------|------|-------------------|------|-------------------|------|--------------------|------|-------------------|------|-------------------|------|--------------------|------|---------------------------------|------|------------------------|------|--------------------|------|---------------------|------|-------------------|------|----------------------|------|--------------------|------|-----------------------|------|---------------------|------|-----------------------|------|---|--|
| <p><b>USA</b></p>               | <table border="0"> <tr> <td><b>VEHICLE MAKE / MODEL</b></td> <td><b>MODEL YEAR(S)</b></td> </tr> <tr> <td>KEYSTONE / AVALANCHE</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / BULLET</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / COUGAR</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / ENERGY</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / FUZION</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / HIDEOUT</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / HORNET</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / LAREDO</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / MONTANA</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / MONTANA HIGH COUNTRY</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / MOUNTAINEER</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / OUTBACK</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / PASSPORT</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / RAPTOR</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / RESIDENCE</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / RETREAT</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / SPRINGDALE</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / SPRINTER</td> <td>2011</td> </tr> <tr> <td>KEYSTONE / SUMMERLAND</td> <td>2011</td> </tr> </table> <p><b>MANUFACTURER:</b> KEYSTONE RV COMPANY<br/> <b>COMPONENT:</b> EQUIPMENT<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 5459<br/> <b>SUMMARY:</b> Keystone is recalling certain model year 2011 recreational vehicles equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.<br/> No picture available.</p> | <b>VEHICLE MAKE / MODEL</b> | <b>MODEL YEAR(S)</b> | KEYSTONE / AVALANCHE | 2011 | KEYSTONE / BULLET  | 2011  | KEYSTONE / COUGAR | 2011 | KEYSTONE / ENERGY | 2011 | KEYSTONE / FUZION | 2011 | KEYSTONE / HIDEOUT | 2011 | KEYSTONE / HORNET | 2011 | KEYSTONE / LAREDO | 2011 | KEYSTONE / MONTANA | 2011 | KEYSTONE / MONTANA HIGH COUNTRY | 2011 | KEYSTONE / MOUNTAINEER | 2011 | KEYSTONE / OUTBACK | 2011 | KEYSTONE / PASSPORT | 2011 | KEYSTONE / RAPTOR | 2011 | KEYSTONE / RESIDENCE | 2011 | KEYSTONE / RETREAT | 2011 | KEYSTONE / SPRINGDALE | 2011 | KEYSTONE / SPRINTER | 2011 | KEYSTONE / SUMMERLAND | 2011 | <p><b>CONSEQUENCE</b></p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p> | <p><b>REMEDY</b></p> <p>Dealers will isolate and perform a drop pressure test on the oven supply tube and if the tube leaks it will be replaced free of charge. The safety recall is expected to begin during october 2010. Owner may contact keystone customer service at 1-866-425-4369.</p> |
| <b>VEHICLE MAKE / MODEL</b>     | <b>MODEL YEAR(S)</b>  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / AVALANCHE            | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / BULLET               | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / COUGAR               | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / ENERGY               | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / FUZION               | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / HIDEOUT              | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / HORNET               | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / LAREDO               | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / MONTANA              | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / MONTANA HIGH COUNTRY | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / MOUNTAINEER          | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / OUTBACK              | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / PASSPORT             | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / RAPTOR               | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / RESIDENCE            | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / RETREAT              | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / SPRINGDALE           | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / SPRINTER             | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| KEYSTONE / SUMMERLAND           | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| <p><b>USA</b></p>               | <table border="0"> <tr> <td><b>VEHICLE MAKE / MODEL</b></td> <td><b>MODEL YEAR(S)</b></td> </tr> <tr> <td>HEARTLAND / CALIBER</td> <td>2011</td> </tr> </table> <p><b>MANUFACTURER:</b> HEARTLAND RECREATIONAL VEHICLES, LLC<br/> <b>COMPONENT:</b> SUSPENSION<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 161<br/> <b>SUMMARY:</b> Heartland is recalling certain model year 2011 caliber travel trailers manufactured from July 21, 2010, through September 15, 2010. These vehicles have the potential for the suspension to contact the liquid propane (LP) pipe under trailer. This contact can cause damage to the LP pipe which could result in a gas leak.<br/> No picture available.</p>   | <b>VEHICLE MAKE / MODEL</b> | <b>MODEL YEAR(S)</b> | HEARTLAND / CALIBER  | 2011 | <p><b>CONSEQUENCE</b></p> <p>A gas leak in the presence of an ignition source could cause a fire which could result in serious bodily injury and/or property damage.</p> | <p><b>REMEDY</b></p> <p>Dealers will move the LP pipe away from the suspension to prevent contact and replace any damaged pipe. This service will be performed free of charge. The recall is expected to begin during October 2010. Owners may contact warranty/service department by email at parts@heartlandrvs.com, or by phone at 877-262-8032.</p> |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| <b>VEHICLE MAKE / MODEL</b>     | <b>MODEL YEAR(S)</b>  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |
| HEARTLAND / CALIBER             | 2011  |                             |                      |                      |      |  |   |                   |      |                   |      |                   |      |                    |      |                   |      |                   |      |                    |      |                                 |      |                        |      |                    |      |                     |      |                   |      |                      |      |                    |      |                       |      |                     |      |                       |      |   |  |

**AUTO: MOTOR VEHICLE**

| NOTIFYING COUNTRY | PRODUCT   | DANGER  | MEASURES ADOPTED  |
|-------------------|---|---|---|
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>DOUBLE TREE / ELITE                      2003-2004<br/>           DOUBLE TREE / MOBILE                      2003-2004<br/>           DOUBLE TREE / SELECT SUITE                      2003-2004</p> <p><b>MANUFACTURER:</b> DOUBLETREE RV<br/> <b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>           290</p> <p><b>SUMMARY:</b> DRV is recalling certain recreational vehicles equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>An overheated receiver could cause a fire.</p>   | <p><b>REMEDY</b></p> <p>DRV is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>ITASCA / SUNOVA                              2005-2009<br/>           WINNEBAGO / SIGHTSEER                              2005-2009</p> <p><b>MANUFACTURER:</b> WINNEBAGO INDUSTRIES, INC.<br/> <b>COMPONENT:</b> SEAT BELTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p><b>SUMMARY:</b> Winnebago is recalling certain model year 2005 through 2009 winnebago sightseer and itasca sunova motor homes because the dinette area seat belt restraints on those vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 210, "seat belt assembly anchorages." in a collision, the generated crash forces can cause the restraint's attachment to tear and allow the anchor to separate from the body of the vehicle.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>If the restraint separates from the vehicle during a crash, the belt will not properly restrain the seat occupant, increasing the risk of injury or death to the occupant.</p> | <p><b>REMEDY</b></p> <p>Winnebago has not yet provided a remedy and an owner notification schedule for this campaign. Owners may contact Winnebago at 1-800-537-1885.</p>   |

**AUTO: MOTOR VEHICLE**

| NOTIFYING COUNTRY | PRODUCT   | DANGER  | MEASURES ADOPTED   |
|-------------------|---|---|--|
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b></p> <p>FOREST RIVER / BERKSHIRE 2007<br/>           FOREST RIVER / CARDINAL 2001-2005<br/>           FOREST RIVER / CEDAR CREEK 2003-2006<br/>           2009<br/>           FOREST RIVER / CHARLESTON 2004-2005<br/>           2007<br/>           FOREST RIVER / FLAGSTAFF 2005 2007<br/>           FOREST RIVER / GEORGETOWN 2001-2005<br/>           FOREST RIVER / ROCKWOOD 2005 2007<br/>           FOREST RIVER / SALEM 2004 2007<br/>           FOREST RIVER / SALEM LE 2007<br/>           FOREST RIVER / SANDPIPER 2004<br/>           FOREST RIVER / SIERRA 2004<br/>           FOREST RIVER / WILDWOOD LE 2007</p> <p><b>MANUFACTURER:</b> FOREST RIVER, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>2207</p> <p><b>SUMMARY:</b> Forest River is recalling certain recreational vehicles equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>An overheated receiver could cause a fire.</p>   | <p><b>REMEDY</b></p> <p>Forest River is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p>   |
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b></p> <p>TESLA / ROADSTER2 2010</p> <p><b>MANUFACTURER:</b> TESLA MOTORS, INC</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM:BATTERY:CABLES</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>439</p> <p><b>SUMMARY:</b> Tesla is recalling certain model year 2010 roadster 2.0 and 2.5 vehicles equipped with a 12v auxiliary cable. The 12v auxiliary cable for the low voltage back up power system may be improperly routed. If the wire is improperly routed, and trapped against the wheel well cover, the wire may abrade against the edge of the carbon fiber armature and, over time, expose the wire. Contact between the bare wire and carbon fiber may cause a short-circuit leading to possible electrical arching.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>Short circuit and electrical arcing could lead to a fire in the right front headlamp area.</p> | <p><b>REMEDY</b></p> <p>Tesla motors will check the routing of the 12v auxiliary cable and install a protective sleeve over the wire free of charge. This will prevent misrouting and pinching by the wheel well cover. The safety recall is expected to begin during October 2010. Owners may contact tesla customer service at 877-888-3752.</p> |



| AUTO: MOTOR VEHICLE |   |   |  |
|---------------------|---|---|--|
| NOTIFYING COUNTRY   | PRODUCT   | ANGER   | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>KENWORTH / T660                      2011<br/> KENWORTH / T700                      2011<br/> KENWORTH / T800                      2011<br/> KENWORTH / W900                      2011<br/> PETERBILT / 365                         2011<br/> PETERBILT / 367                         2011<br/> PETERBILT / 384                         2011<br/> PETERBILT / 386                         2011<br/> PETERBILT / 387                         2011<br/> PETERBILT / 388                         2011</p> <p><b>MANUFACTURER:</b> PACCAR INCORPORATED<br/> <b>COMPONENT:</b> ENGINE AND ENGINE COOLING:EXHAUST SYSTEM:EMISSION CONTROL:GAS RECIRCULATION VALVE (EGR VALVE)<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 384<br/> <b>SUMMARY:</b> Paccar is recalling certain model year kenworth and peterbilt vehicles. A manufacturing defect in the seal supplied by a component manufacturer installed on the output shaft of the exhaust gas recirculation (egr) valve actuator may cause eventual delamination of the seal. Delamination of the seal may allow engine oil to leak from the egr valve onto exhaust components.<br/> No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The leaking of engine oil onto hot exhaust components, such as when the engine is under significant load, may create the possibility of a fire.</p>          | <p><b>REMEDY</b></p> <p>Dealers will replace the egr valve assembly on the subject vehicles equipped with the paccar mx engine. This service will be performed free of charge. Owners may contact kenworth at 425-828-5440 and peterbilt at Consequence:<br/> The leaking of engine oil onto hot exhaust components, such as when the engine is under significant load, may create the possibility of a fire.<br/> 940-591-4196.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>KENWORTH / C500                      2011<br/> KENWORTH / T440                      2011<br/> KENWORTH / T470                      2011<br/> KENWORTH / T660                      2011<br/> KENWORTH / T800                      2011<br/> KENWORTH / W900                      2011</p> <p><b>MANUFACTURER:</b> PACCAR INCORPORATED<br/> <b>COMPONENT:</b> EXTERIOR LIGHTING<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 3040<br/> <b>SUMMARY:</b> Kenworth is recalling certain model year 2011 t660, t800, w900, c500, t440, and t470 vehicles manufactured from April 1, 2009, through august 30, 2010. One of the four harness spade terminal connections to the chassis load center may become completely unseated. A completely unseated connection may result in a power loss to a portion of the vehicle's exterior lighting.<br/> No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>Power loss of the vehicle's exterior lighting may reduce the visibility of the vehicle to other drivers increasing the risk of a crash with the vehicle.</p> | <p><b>REMEDY</b></p> <p>Dealers will inspect the harness and re-seating the female connectors on the male spade terminals. This service will be performed free of charge. The safety recall is expected to begin during October 2010. Owners may contact kenworth at 1-425-828-5440.</p>   |

**AUTO: MOTOR VEHICLE**

| <b>NOTIFYING COUNTRY</b> | <b>PRODUCT</b>  | <b>DANGER</b>   | <b>MEASURES ADOPTED</b>   |
|--------------------------|---|---|---|
| <p><b>USA</b></p>        | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>                     CADILLAC / SRX 2010<br/> <b>MANUFACTURER:</b> GENERAL MOTORS CORP.<br/> <b>COMPONENT:</b> STEERING:HYDRAULIC POWER ASSIST:POWER STEERING FLUID<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>                     3459<br/> <b>SUMMARY:</b> General motors is recalling certain model year 2010 cadillac srx vehicles equipped with 2.8l gas engines (lau) or 3.0l gas engines (lf1). Some of these vehicles have a condition in which processing of the crimp during manufacture of the power steering pressure line may have damaged the line. If the line was damaged, a power steering fluid leak may develop. If there is a sufficient amount of fluid loss, the driver will hear noise from the power steering pump and increased effort may be required for steering.<br/>                     No picture available.</p> | <p><b>CONSEQUENCE</b><br/>                     If power steering fluid sprays onto hot engine parts, an engine compartment fire could occur.</p>  | <p><b>REMEDY</b><br/>                     Dealers will inspect and if necessary replace the power steering line free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Cadillac at 1-866-982-2339.</p>  |
| <p><b>USA</b></p>        | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>                     ASTON MARTIN / DB9 2007-2008<br/>                     ASTON MARTIN / DBS 2007-2008<br/>                     ASTON MARTIN / V8 VANTAGE 2007-2008<br/> <b>MANUFACTURER:</b> ASTON MARTIN<br/> <b>COMPONENT:</b> USPENSION:FRONT:CONTROL ARM:LOWER ARM<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>                     1090<br/> <b>SUMMARY:</b> Aston martin is recalling certain model year 2007-2008 db9 coupe, db9 volante, v8 vantage coupe, v8 vantage roadster, and dbs coupe vehicles. The front bottom suspension arm cam bolt could crack along its shank allowing the lower control arm to move.<br/>                     No picture available.</p>  | <p><b>CONSEQUENCE</b><br/>                     Movement of the lower control arm will influence the driver's control of the steering of the vehicle increasing the risk of a crash.</p> | <p><b>REMEDY</b><br/>                     Dealers will replace the front suspension lower control arm cam bolts. This service will be performed free of charge. The safety recall is expected to begin on or before October 18, 2010. Owners may contact Aston martin customer service at 1-888-923-9988.</p> |

| AUTO: MOTOR VEHICLE |  |   |   |
|---------------------|--|---|---|
| NOTIFYING COUNTRY   | PRODUCT  | ANGER   | MEASURES ADOPTED  |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>           NU WA / CUSTOM CAMPERS HH II 2006<br/>           NU WA / CUSTOM CAMPERS LS 2006-2007</p> <p><b>MANUFACTURER:</b> NU WA INDUSTRIES, INC.</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>230</p> <p><b>SUMMARY:</b> Nu WA is recalling certain model year 2006 custom campers hh ii, and model year 2006-2007, custom camper's ls travel trailers, equipped with lippert axles components. These vehicles may contain mis-located welds attaching the axle spindle to the axle tube. If the welds are mis-located, the spindle may partially or completely separate from the axle tube and the wheel and hub assembly may come off the vehicle.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>A separated tire and wheel assembly could strike other vehicles and/or pedestrians, risking injury or death, and/or cause significant damage property.</p>   | <p><b>REMEDY</b></p> <p>Nu WA is working with lippert to inspect and replace if an axle is found to be defective on a vehicle free of charge. The safety recall began September 18, 2010. Owners may contact lippert components, inc.'s axle service &amp; warranty department at 1-877-870-4900.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>           ROLLS-ROYCE / PHANTOM 2003-2006 2008-2010</p> <p><b>MANUFACTURER:</b> ROLLS-ROYCE MOTORS, INC.</p> <p><b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC:POWER ASSIST:VACUUM</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>2552</p> <p><b>SUMMARY:</b> Rolls-royce is recalling certain model year 2003-2010 phantom, model year 2007-2010 phantom drophead coupe, and model year 2008-2010 phantom coupe vehicles. A check valve of the brake vacuum pump may leak a small amount of lubricating oil. Over time this could result in contamination of the brake booster.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>Power assist braking performance could be adversely affected. In extreme cases there could be a complete loss of power assist braking. An unexpected reduction or loss in power braking assist may increase the risk of a crash.</p> | <p><b>REMEDY</b></p> <p>The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact bmw at 1-800-525-7417.</p>   |

| AUTO: MOTOR VEHICLE |   |   |  |
|---------------------|---|---|--|
| NOTIFYING COUNTRY   | PRODUCT   | ANGER   | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>BMW / 5 SERIES                      2004-2009<br/> BMW / 5-SERIES                      2010<br/> BMW / 6 SERIES                      2004-2010<br/> BMW / 7 SERIES                      2002-2008</p> <p><b>MANUFACTURER:</b> BMW OF NORTH AMERICA, LLC</p> <p><b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC:POWER ASSIST:VACUUM</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>198352</p> <p><b>SUMMARY:</b><br/>BMW is recalling certain model year 2004-2010 5-series, 6-series, and model year 2002-2008 7-series vehicles. A check valve of the brake vacuum pump may leak a small amount of lubricating oil. Over time this could result in contamination of the brake booster.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>Power assist braking performance could be adversely affected. In extreme cases there could be a complete loss of power assist braking. An unexpected reduction or loss in power braking assist may increase the risk of a crash.</p> | <p><b>REMEDY</b></p> <p>The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact bmw at 1-800-525-7417.</p>  |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>NEWMAR / CYPRESS                      2006-2008<br/> NEWMAR / ESSEX                      2006-2007<br/> NEWMAR / KOUNTRY AIRE      2004-2005 2008-2009<br/> NEWMAR / KOUNTRY STAR              2004-2005<br/> NEWMAR / MOUNTAIN AIRE              2002-2005<br/> NEWMAR / MOUNTAIN AIRE DIESEL<br/> PUSH                      2006<br/> NEWMAR / TORREY PINE              2006-2009</p> <p><b>MANUFACTURER:</b> NEWMAR CORPORATION</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>435</p> <p><b>SUMMARY:</b> Newmar is recalling certain recreational trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>An overheated receiver could cause a fire.</p>   | <p><b>REMEDY</b></p> <p>Newmar is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |

**AUTO: MOTOR VEHICLE**

| NOTIFYING COUNTRY | PRODUCT  | DANGER   | MEASURES ADOPTED  |
|-------------------|--|--|---|
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>                     NU WA / DISCOVERY SERIES 2010<br/> <b>MANUFACTURER:</b> NU WA INDUSTRIES, INC.<br/> <b>COMPONENT:</b> EQUIPMENT Potential Number of Units Affected: 1<br/> <b>SUMMARY:</b> NU WA is recalling one model year 2010 discovery series motor home equipped with suburban gas cook stoves with sealed burners. The units involved use an aluminum tube to carry liquid propane gas from the oven control valve to the gas orifice which supplies gas to the burner. This can cause the tube to break resulting in a gas leak when the oven burner attempts to light.<br/>                     No picture available.</p>   | <p><b>CONSEQUENCE</b><br/>                     A gas leak occurring in the area of the oven pilot can cause a "flash" when the gas ignites, and would cause a fire if the oven valve is not promptly turned off.</p>   | <p><b>REMEDY</b><br/>                     One vehicle is affected for this recall campaign and in Nu Wa's possession therefore, owner notification will not be necessary. For further information Nu Wa can be reached at 1-620-431-2088.</p>   |
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>                     FREIGHTLINER / M2 2009-2010<br/> <b>MANUFACTURER:</b> FONTAINE MODIFICATION<br/> <b>COMPONENT:</b> SERVICE BRAKES, AIR:SUPPLY:HOSES, LINES/PIPING, AND FITTINGS<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 308<br/> <b>SUMMARY:</b> Fontaine modification is recalling certain model year 2009-2010 freightliner m2 vehicles built on freightliner chassis and equipped with duel steering components. The routing of the air hoses, within the air brake system, that control the brakes on the right hand side of the truck may have been done improperly.<br/>                     No picture available.</p> | <p><b>CONSEQUENCE</b><br/>                     The air hoses routed very close to the turbo outlet can cause the lines to blister, then melt and develop air leaks that may lead to brake lock up increasing the risk of a crash.</p>  | <p><b>REMEDY</b><br/>                     Dealers will install new hoses and heat protective thermal wrap free of charge. The safety recall is expected to begin during October 2010. Owners may contact fontaine modification at 704-409-1613.</p>   |
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>                     HYUNDAI / SONATA 2011<br/> <b>MANUFACTURER:</b> HYUNDAI CARIBBEAN-PUERTO RICO<br/> <b>COMPONENT:</b> STEERING:GEAR BOX:SHAFT SECTOR<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 60<br/> <b>SUMMARY:</b> Hyundai is recalling certain model year 2011 sonata vehicles manufactured from december 11, 2009, through september 10, 2010. on some of these vehicles the steering column intermediate shaft universal joint connections may have been either improperly assembled or insufficiently tightened.<br/>                     No picture available.</p>   | <p><b>CONSEQUENCE</b><br/>                     Improper assembly or insufficient tightening of the connections could result in a complete separation or compromised attachment of the connections, such that the driver could experience a loss of, or reduction in, steering capability increasing the risk of a crash.</p> | <p><b>REMEDY</b><br/>                     Dealers will inspect the steering column intermediate shaft universal joint connections for proper assembly and torque. In addition dealers will update the power steering software free of charge. The safety recall is expected to begin during October 2010. Owners may contact hyundai customer service center at 787-999-3333.</p> |

| AUTO: MOTOR VEHICLE |   |  |  |
|---------------------|---|--|--|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER   | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>ALTEC / WC126                      2008-2009<br/> ALTEC / WC126A                    2009-2010<br/> ALTEC / WC166                      2008-2009<br/> ALTEC / WC166A                    2009-2010</p> <p><b>MANUFACTURER:</b> ALTEC INDUSTRIES INC.<br/> <b>COMPONENT:</b> STRUCTURE:FRAME AND MEMBERS<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 686</p> <p><b>SUMMARY:</b> Altec is recalling certain model year 2008-2009 wc126 and wc166, model year 2009-2010 wc126a and wc166a wood chipper utility vehicles built from january 2008 through may 2010. It was discovered cracks may develop in the frame rails of wood chippers due to concentrated loads on the frame rail flange at the axle mount.<br/> No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>While loading the frame could brake increasing the risk of property damage and personal injury.</p> | <p><b>REMEDY</b></p> <p>Dealers will inspect and repair or replace as necessary free of charge. The safety recall is expected to begin during october 2010. Owners may contact altec at 1-877-462-5832.</p>  |
| USA                 | <p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>COACHMEN / CROSS COUNTRY            2011<br/> COACHMEN / ENCOUNTER                    2011<br/> COACHMEN / MIRADA                         2011<br/> COACHMEN / PATHFINDER                    2011</p> <p><b>MANUFACTURER:</b> COACHMEN RV COMPANY, LLC<br/> <b>COMPONENT:</b> ELECTRICAL SYSTEM:FUSES AND CIRCUIT BREAKERS<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 80</p> <p><b>SUMMARY:</b> Coachmen is recalling certain model year 2011 mirada, encounter, cross country, and pathfinder travel trailers manufactured from June 28, 2010, through august 26, 2010, and manufacturer with siemens and murray brand one inch plug-in circuit breakers, single and double pole, 15 through 50 amps, manufactured between June 23 and july 2, 2010. The house type circuit breakers may be faulty and heat up and cause a fire.<br/> No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>This could lead to a fire, property damage, or personal injury.</p>                                 | <p><b>REMEDY</b></p> <p>Dealers will remove all breakers from the distribution panel and inspect each breaker and remove and/or replace with a new breaker free of charge. The recall is expected to begin during October 2010. Owners may contact coachmen RV customer service at 1-800-453-6064.</p> |

**AUTO: MOTOR VEHICLE**

| NOTIFYING COUNTRY | PRODUCT   | DANGER  | MEASURES ADOPTED  |
|-------------------|---|---|---|
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b></p> <p>FCCC / S2 2007-2010<br/>           FREIGHTLINER / BUSINESS CLASS M2 2007-2010<br/>           FREIGHTLINER / MT45 2007-2010<br/>           STERLING / ACTERRA 2007-2010</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> ENGINE AND ENGINE COOLING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>62</p> <p><b>SUMMARY:</b> Daimler trucks is recalling certain model year 2007 through 2010 freightliner business class m2, custom chassis mt45, s2 chassis, and steering acterra vehicles manufactured from october 5, 2006, through may 24, 2010, equipped with epa 2007 mbe 900 detroit diesel engines. Engine software may not react properly to certain aftermarket treatment device fault codes. The software may unnecessarily shutdown a vehicle or may fail to shutdown a vehicle with an aftermarket device over-temp fault.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>Unexpected shutdown of a vehicle may increase the risk of a crash. Overheating of the aftertreatment device without engine shutdown may result in a fire.</p>                  | <p><b>REMEDY</b></p> <p>Daimler trucks will notify owners and repairs will be performed by detroit diesel free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact daimler trucks at 1-800-547-0712.</p> |
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b></p> <p>ITASCA / SUNCRUISER 2009-2011<br/>           ITASCA / SUNRISE 2008<br/>           WINNEBAGO / ADVENTURER 2009-2011<br/>           WINNEBAGO / VOYAGE 2008</p> <p><b>MANUFACTURER:</b> WINNEBAGO INDUSTRIES, INC.</p> <p><b>COMPONENT:</b> SEAT BELTS</p> <p><b>SUMMARY:</b> Winnebago is recalling certain model year 2008 winnebago voyage and, itasca sunrise and, model year 2009-2011 winnebago adventurer and, itasca suncruiser motor homes because the dinette area seat belt restraints on those vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 210, "seat belt assembly anchorages." in a collision, the generated crash forces can cause the restraint's attachment to tear and allow the anchor to separate from the body of the vehicle.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>If the restraint separates from the vehicle during a crash, the belt will not properly restrain the seat occupant, increasing the risk of injury or death to the occupant.</p> | <p><b>REMEDY</b></p> <p>Winnebago has not yet provided a remedy and an owner notification schedule for this campaign. Owners may contact winnebago at 1-800-537-1885.</p>   |

| AUTO: MOTOR VEHICLE |  |   |  |
|---------------------|--|---|--|
| NOTIFYING COUNTRY   | PRODUCT  | ANGER   | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>           JAYCO / PINNACLE 2011<br/> <b>MANUFACTURER:</b> JAYCO, INC.<br/> <b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 9<br/> <b>SUMMARY:</b> Jayco is recalling certain model year 2011 pinnacle fifth wheel trailers equipped with dexter axles. On some axles, cracks could appear in the spindle weld.<br/>           No picture available.</p>  | <p><b>CONSEQUENCE</b><br/>           These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle increasing the risk of a vehicle crash.</p> | <p><b>REMEDY</b><br/>           Jayco is working with dexter axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin during october 2010. Owners may contact jayco at 1-800-283-8267 and dexter axle at 1-800-2164.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>           ITASCA / NAVION 2006-2011<br/>           WINNEBAGO / VIEW 2006-2011<br/> <b>MANUFACTURER:</b> WINNEBAGO INDUSTRIES, INC.<br/> <b>COMPONENT:</b> SEAT BELTS<br/> <b>SUMMARY:</b> Winnebago is recalling certain model year 2006 through 2011 winnebago view and itasca navion motor homes because the dinette area seat belt restraints on those vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 210, "seat belt assembly anchorages." in a collision, the generated crash forces can cause the restraint's attachment to tear and allow the anchor to separate from the body of the vehicle.<br/>           No picture available.</p> | <p><b>CONSEQUENCE</b><br/>           If the restraint separates from the vehicle during a crash, the belt will not properly restrain the seat occupant, increasing the risk of injury or death to the occupant.</p>   | <p><b>REMEDY</b><br/>           Winnebago has not yet provided a remedy and an owner notification schedule for this campaign. Owners may contact winnebago at 1-800-537-1885.</p>  |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>           MONACO RV / ADMIRAL 2010-2011<br/>           MONACO RV / MONARCH 2009-2011<br/> <b>MANUFACTURER:</b> NAVISTAR, INC<br/> <b>COMPONENT:</b> VISIBILITY:WINDSHIELD WIPER/WASHER:LINKAGES<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 70<br/> <b>SUMMARY:</b> Navistar is recalling certain model year 2009-2011 monaco monarch and model year 2010-2011 holiday rambler admiral recreational vehicles manufactured from june 4, 2009, through june 26, 2010. The windshield wiper system may become inoperable without warning resulting in reduced driver visibility.<br/>           No picture available.</p>   | <p><b>CONSEQUENCE</b><br/>           Decreased driver visibility may increase the risk of a crash possibly resulting in property damage, personal injury or death.</p>  | <p><b>REMEDY</b><br/>           Dealers will inspect and correct if necessary the windshield wiper system free of charge. The safety recall is expected to begin during october 2010. Owners may contact navistar at 1-800-448-7825.</p>   |



**AUTO: MOTOR VEHICLE**

| NOTIFYING COUNTRY | PRODUCT  | DANGER  | MEASURES ADOPTED   |
|-------------------|--|---|--|
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b><br/>                     HEARTLAND / BIG COUNTRY                    2011<br/>                     HEARTLAND / BIG HORN                        2011<br/>                     HEARTLAND / CYCLONE                        2011<br/>                     HEARTLAND / LANDMARK                       2011<br/>                     HEARTLAND / ROAD WARRIOR                 2011</p> <p><b>MANUFACTURER:</b> HEARTLAND<br/>                     RECREATIONAL VEHICLES, LLC</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE<br/>                     ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>                     48</p> <p><b>SUMMARY:</b> Heartland is recalling certain model year 2011 fifth wheel trailers equipped with dexter axles. On some axles, cracks could appear in the spindle weld.<br/><br/>                     No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle increasing the risk of a vehicle crash.</p> | <p><b>REMEDY</b></p> <p>Heartland is working with dexter axle and will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin during november 2010. Owners may contact heartland warranty service department at 877-262-8032 or dexter axle at 1-800-2164.</p> |
| <p><b>USA</b></p> | <p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b><br/>                     THOMAS BUILT BUSES / SAF-T-LINER<br/>                     C2     2008-2011<br/>                     THOMAS BUILT BUSES / SAF-T-LINER<br/>                     HDX    2008-2011</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> ENGINE AND ENGINE COOLING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>                     2935</p> <p><b>SUMMARY:</b> Daimler trucks is recalling certain model year 2008 through 2011 saf-t-liner c2 and saf-t-liner hdx school buses manufactured from october 5, 2006 through may 24, 2010, equipped with epa 2007 mbe 900 detroit diesel engines. Engine software may not react properly to certain aftermarket treatment device fault codes. The software may unnecessarily shutdown a vehicle or may fail to shutdown a vehicle with an aftermarket device over-temp fault.<br/><br/>                     No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>Unexpected shutdown of a vehicle may increase the risk of a crash. Overheating of the aftertreatment device without engine shutdown may result in a fire.</p>  | <p><b>REMEDY</b></p> <p>Daimler trucks will notify owners and repairs will be performed by detroit diesel free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact daimler trucks at 1-800-547-0712.</p>  |

| AUTO: MOTOR VEHICLE |   |   |  |
|---------------------|---|---|--|
| NOTIFYING COUNTRY   | PRODUCT   | DANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b><br/> THOMAS BUILT BUSES / HDX                      2010-2011<br/> THOMAS BUILT BUSES / MVP-EF                2010-2011<br/> <b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA<br/> <b>COMPONENT:</b> SEATS<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 6<br/> <b>SUMMARY:</b> Daimler trucks is recalling certain thomas built mvp-ef and hdx non school buses manufactured from march 17, 2009, through december 7, 2009, equipped with stabilus bloc-o-lift, p/n 5561ed, driver seats. The weld which holds the mounting tab to the shock body was improperly welded and can break.<br/> No picture available.</p>  | <p><b>CONSEQUENCE</b><br/> The seat could drop unexpectedly with out prior warning and could cause momentary loss of steering control, possibly resulting in a crash.</p>                                 | <p><b>REMEDY</b><br/> Daimler trucks will notify owners and repairs will be performed by authorized thomas built buses service facilities free of charge. The safety recall is expected to begin on or about december 10, 2010. Owners may contact daimler trucks at 1-800-547-0712.</p>         |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b><br/> ITASCA / SUNOVA                                      2005-2009<br/> WINNEBAGO / SIGHTSEER                        2005-2009<br/> <b>MANUFACTURER:</b> WINNEBAGO INDUSTRIES, INC.<br/> <b>COMPONENT:</b> SEAT BELTS<br/> <b>SUMMARY:</b> Winnebago is recalling certain model year 2005 through 2009 winnebago sightseer and itasca sunova motor homes because the dinette area seat belt restraints on those vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 210, "seat belt assembly anchorages." in a collision, the generated crash forces can cause the restraint's attachment to tear and allow the anchor to separate from the body of the vehicle.<br/> No picture available.</p> | <p><b>CONSEQUENCE</b><br/> If the restraint separates from the vehicle during a crash, the belt will not properly restrain the seat occupant, increasing the risk of injury or death to the occupant.</p> | <p><b>REMEDY</b><br/> Winnebago has not yet provided a remedy and an owner notification schedule for this campaign. Owners may contact winnebago at 1-800-537-1885.</p>  |
| USA                 | <p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b><br/> NEW HORIZONS / MAJESTIC                      2009<br/> <b>MANUFACTURER:</b> NEW HORIZONS RV CORPORATION<br/> <b>COMPONENT:</b> EQUIPMENT<br/> <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 2<br/> <b>SUMMARY:</b> New horizons is recalling certain model year 2009 majestic 5th wheel trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.<br/> No picture available.</p>  | <p><b>CONSEQUENCE</b><br/> An overheated receiver could cause a fire.</p>   | <p><b>REMEDY</b><br/> New horizons is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |

| AUTO: MOTOR VEHICLE |  |  |  |
|---------------------|--|--|--|
| NOTIFYING COUNTRY   | PRODUCT  | ANGER  | MEASURES ADOPTED   |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>ALTEC / ALTEC 2009-2010</p> <p><b>MANUFACTURER:</b> ALTEC INDUSTRIES INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>598</p> <p><b>SUMMARY:</b> Altec is recalling certain model year 2009-2010 altec digger derricks built from april 2009 through may 2010. The turntable devices on these vehicles have used high strength fasteners that may fail due to stress corrosion and cracking.</p> <p>No picture available.</p>  | <p><b>CONSEQUENCE</b></p> <p>Failure of a fastener could cause the pedestal to separate from the turntable and may cause an occupant to fall from the vehicle and suffer injury.</p> | <p><b>REMEDY</b></p> <p>Dealers will replace the fasteners free of charge. The safety recall is expected to begin during october 2010. Owners may contact altec at 1-877-462-5832.</p>   |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>CHEVROLET / IMPALA 2009-2010</p> <p><b>MANUFACTURER:</b> GENERAL MOTORS CORP.</p> <p><b>COMPONENT:</b> SEAT BELTS: FRONT: ANCHORAGE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>303100</p> <p><b>SUMMARY:</b> Gm is recalling certain model year 2009-2010 chevrolet impalas for failing to comply with the requirements of federal motor vehicle safety standard no. 210, ¿seat belt assembly anchorages.¿ the front safety belt webbing may not have been properly secured to the lap belt anchor pretensioner mounted to the side of the seat nearest the door.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>The safety belt may not restrain the occupant as intended during a crash, which could result in injury to the occupant.</p>                             | <p><b>REMEDY</b></p> <p>Dealers will inspect both front safety belts for proper installation of the anchors to the pretensioners and, if necessary, reinstall the anchors. This service will be performed free of charge. The safety recall is expected to begin on or before october 26, 2010. Owners may contact chevrolet at 1-800-630-2438 or at the owner center at <a href="http://www.gmownercenter.com">www.gmownercenter.com</a>.</p> |
| USA                 | <p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b><br/>THOMAS BUILT BUSES / HDX 2010-2011<br/>THOMAS BUILT BUSES / MVP-EF 2010-2011<br/>THOMAS BUILT BUSES / SAF-T-LINER C2 2010-2011</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> SEATS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>294</p> <p><b>SUMMARY:</b> Daimler trucks is recalling certain thomas built mvp-ef, hdx, and saf-t-liner c2 school buses manufactured from march 17, 2009, through december 7, 2009, equipped with stabilis bloc-o-lift, p/n 5561ed, driver seats. The weld which holds the mounting tab to the shock body was improperly welded and can break.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>The seat could drop unexpectedly without prior warning and could cause momentary loss of steering control, possibly resulting in a crash.</p>           | <p><b>REMEDY</b></p> <p>Daimler trucks will notify owners and repairs will be performed by authorized thomas built buses service facilities free of charge. The safety recall is expected to begin on or about december 10, 2010. Owners may contact daimler trucks at 1-800-547-0712.</p>   |

**AUTO: CHILD SAFETY SEAT**

| <b>NOTIFYING COUNTRY</b> | <b>PRODUCT</b>  | <b>DANGER</b>   | <b>MEASURES ADOPTED</b>   |
|--------------------------|---|---|---|
| <b>USA</b>               | <p><b>CHILD RESTRAINT BRAND NAME / MODEL OR MODEL NO.:</b> EVENFLO / 310 (MAESTRO)<br/><b>MANUFACTURER:</b> EVENFLO COMPANY, INC.<br/><b>COMPONENT:</b> CHILD SEAT<br/><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 13792<br/><b>SUMMARY:</b> Evenflo is recalling certain maestro child restraint systems with model numbers beginning with 310 and built from november 24, 2009, through april 9, 2010. These seats fail to conform to the structural integrity requirements of federal motor vehicle safety standard no. 213, "child restraint systems."<br/>No picture available.</p> | <p><b>CONSEQUENCE</b><br/>In the event of a crash, a crack may form at the front of the seat adjacent to the harness adjuster causing the child not to be adequately restrained, increasing the risk of injury.</p> | <p><b>REMEDY</b><br/>Evenflo will provide owners and care givers a reinforcement plate along with repair instructions free of charge. The safety recall is expected to begin during october 2010. Owners may contact evenflo toll-free at 1-800-233-5921.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |  |   |
|-------------------------------|---|--|---|
| NOTIFYING COUNTRY             | PRODUCT   | ANGER  | MEASURES ADOPTED  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> STEGALL AUTO ACCESSORIES</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 1356</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by stegall auto accessories on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by stegall auto accessories by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/> WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> TERRY POE AUTOMOTIVE</p> <p><b>COMPONENT:</b> VISIBILITY:SUN ROOF ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 1026</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by terry poe automotive on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>         | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during October 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by terry Poe automotive by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>     |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |  |   |
|-------------------------------|---|--|---|
| NOTIFYING COUNTRY             | PRODUCT   | DANGER   | MEASURES ADOPTED  |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> AUTO OUTFITTERS</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 176</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by auto outfitters on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>                   | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto outfitters by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>          |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> GOLDWORKS &amp; GRAPHICS</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/> 354</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by goldworks &amp; graphics on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by goldworks &amp; graphics by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT |  |  |  |
|-------------------------------|--|--|--|
| NOTIFYING COUNTRY             | PRODUCT  | DANGER   | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> TRUCK &amp; AUTO ELEGANCE</p> <p><b>COMPONENT:</b> EQUIPMENTPotential Number of Units Affected: 79</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by truck &amp; auto elegance on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by truck &amp; auto elegance by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> CAROLINA RESTYLING</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 390</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by carolina restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by carolina restyling by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p>        |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |  |  |
|-------------------------------|---|--|--|
| NOTIFYING COUNTRY             | PRODUCT   | ANGER  | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> COACH AUTOMOTIVE RESTYLING</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 4200</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by coach automotive restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.<br/> No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by coach automotive restyling by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>.<br/> You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>WEBASTO / HOLLANDIA 600<br/> WEBASTO / HOLLANDIA 700<br/> WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> SKIP'S SUNROOFS</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1200</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by skip's sunroofs on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.<br/> No picture available.</p>                       | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by skip's sunroofs by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>.<br/> You can also call webasto toll-free at 1-888-749-8632.</p>            |



**AUTO: MOTOR VEHICLE EQUIPMENT**

| NOTIFYING COUNTRY | PRODUCT  | DANGER   | MEASURES ADOPTED   |
|-------------------|--|--|--|
| <p><b>USA</b></p> | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/>                     WEBASTO / HOLLANDIA 600<br/>                     WEBASTO / HOLLANDIA 700<br/>                     WEBASTO / HOLLANDIA TVS 900</p> <p><b>MANUFACTURER:</b> SKIP'S SUNROOFS</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p>Potential Number of Units Affected: 1200</p> <p><b>SUMMARY:</b> Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by skip's sunroofs on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during october 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by skip's sunroofs by clicking on the hyperlink <a href="#">affected vehicle list</a> or you may visit webasto's website at <a href="http://www.sunroofcheck.com">www.sunroofcheck.com</a>. You can also call webasto toll-free at 1-888-749-8632.</p> |
| <p><b>USA</b></p> | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b><br/>                     ATWOOD / RA2135<br/>                     ATWOOD / RV1735<br/>                     ATWOOD / RV2135</p> <p><b>MANUFACTURER:</b> ATWOOD MOBILE PRODUCTS</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b><br/>                     10480</p> <p><b>SUMMARY:</b> Atwood is recall certain range/oven combo cooking ranges, models rv1735, rv2135, and ra2135 manufactured from July 2010 through September 20, 2010, installed as original equipment in various recreational vehicles and sold as after market equipment. The gas supply line to the oven box may be fractured. Gas can leak through the wall of the fractured gas line leading to a potential build up of gas in the rv.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>In the presence of an ignition source, this leak may lead to a fire. This condition may also pose a risk of asphyxiation.</p>   | <p><b>REMEDY</b></p> <p>Atwood is working with the rv manufacturers to identify owners and the units will be replaced free of charge. Atwood will notify owners of record that purchased the affected units as aftermarket equipment. The safety recall began on October 4, 2010. Owners may contact atwood at 1-574-266-4749.</p>   |

| AUTO: MOTOR VEHICLE EQUIPMENT |   |   |  |
|-------------------------------|---|---|--|
| NOTIFYING COUNTRY             | PRODUCT   | DANGER  | MEASURES ADOPTED   |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>NORCOLD / 1200<br/> NORCOLD / 1201<br/> NORCOLD / 1210<br/> NORCOLD / 1211</p> <p><b>MANUFACTURER:</b> NORCOLD INC.</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>SUMMARY:</b> Norcold is recalling certain gas absorption refrigerators which are sold for application in recreational vehicles. Norcold has recalled models 1200ac, 1200acim, 1200lr, 1200lr, 1200lr, and 1201lr under previously issued recalls identified as 02e-045, 08e-030, 09e-026, and 09e-027. These recalls covered cooling units installed on the 1200 series product manufactured from december 1996 through december 2002. Recalls 08e-030, 09e-026, and 09e-027 involved the installation of a thermal switch on the cooling units manufactured from december 1996 through december 2002. with the action taken with this recall campaign, norcold is extending a recall of all 1200, 1201, 1210, and 1211 models to include units produced from january 1, 2003, to october 6, 2010, with serial numbers from 700000 to 13085759, non consecutively. The population of refrigerators being addressed contains either a sensing algorithm or a thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. Norcold has now decided the response times of the sensor algorithm and thermal switch devices to stop power are not sufficient.</p> <p>No picture available.</p> | <p><b>CONSEQUENCE</b></p> <p>An insufficient response time can result in power not being shut-off in sufficient time to prevent a fire.</p>   | <p><b>REMEDY</b></p> <p>Norcold will notify recreational vehicle manufacturers, distributors, dealers, service centers, and vehicle owners of the hazard and offer a free remedy to prevent temperature elevation that could allow a fire. The remedy is to affix a thermocouple, with a faster response time, to all refrigerators with a sensing algorithm or a thermal switch. The manufacturer has not yet provided a notification schedule. Owners may contact norcold at 1-937-497-3080 or their vehicle manufacturer.</p> |
| USA                           | <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>DEXTER AXLE / AXLE ASSEMBLY</p> <p><b>MANUFACTURER:</b> DEXTER AXLE COMPANY</p> <p><b>COMPONENT:</b> POWER TRAIN: AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 685</p> <p><b>SUMMARY:</b> Dexter axle is recalling certain trailer axle assemblies manufactured from august 15, 2010, through august 30, 2010. on some axles, cracks could appear in the spindle weld.</p> <p>No picture available.</p>   | <p><b>CONSEQUENCE</b></p> <p>These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle increasing the risk of a vehicle crash.</p> | <p><b>REMEDY</b></p> <p>Dexter axle is working with the vehicle manufacturers to identify the owners who may have the affected axles installed on their vehicle. The affected axle assemblies will be replaced free of charge. Owners may contact dexter axle at 1-800-400-2164 or their vehicle manufacturer.</p>   |

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[Product.Recalls@sgs.com](mailto:Product.Recalls@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

**SGS**