

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 SEPTEMBER 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 16



[Motor Vehicle \(31\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(2\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) SUZUKI / EQUATOR 2009-2010 SUZUKI / GRAND VITARA 2010 SUZUKI / SX4 2008-2010</p> <p>MANUFACTURER: AMERICAN SUZUKI MOTOR CORP.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 20692</p> <p>SUMMARY: SUZUKI is recalling certain model year 2008 through 2010 sx4, 2010 grand vitara, and 2009 through 2010 equator vehicles that were equipped with a garmin nuvi model 750, 760, and 765 navigation system. The batteries contained in the affected gps units can overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Overheated batteries could result in a fire.</p>	<p>REMEDY</p> <p>SUZUKI will notify owners and the repairs will be performed by garmin technicians by replacing the battery and inserting a spacer on top of the battery free of charge. The safety recall is expected to begin during September 2010. Owners may contact garmin directly at 1-866-957-1981 or Suzuki at 1-887-697-8985. Owners may also visit garmin's website at www.garmin.com/nuvibatterypcbrecall.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) ADVENTURE / SUBURBAN 2011</p> <p>MANUFACTURER: ADVENTURE MANUFACTURING</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 328</p> <p>SUMMARY: ADVENTURER is recalling certain model year 2011 adventurer motor homes and truck campers equipped with suburban gas cook stoves with sealed burners. The units involved use an aluminum tube to carry liquid propane gas from the oven control valve to the gas orifice which supplies gas to the burner. This can cause the tube to break resulting in a gas leak when the oven burner attempts to light.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A gas leak occurring in the area of the oven pilot can cause a "flash" when the gas ignites, and would cause a fire if the oven valve is not promptly turned off.</p>	<p>REMEDY</p> <p>A replacement gas line will be sourced and tested to insure that the defect which created the stress point has been eliminated. This service will be performed free of charge. The safety recall is expected to begin during September 2010. Owners may contact adventure LP at 423-775-7005.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL THOMAS BUILT BUSES / MINOTOUR</p> <p>MODEL YEAR(S) 2004-2010</p> <p>MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT: ELECTRICAL SYSTEM:BATTERY:CABLES</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 4041</p> <p>SUMMARY: Daimler trucks is recalling certain model year 2004 through 2010 school buses built on ford chassis manufactured from may 6, 2004 through february 2, 2010. On affected vehicles, main body power cables were routed in the area of an unprotected edge on the passenger's side inner-fender. Under certain conditions a power cable may contact the sharp edge. If undetected, continued contact could wear through the power cable's insulation potentially resulting in a short circuit.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A short circuited power cable could result in a vehicle fire and injury to vehicle occupants.</p>	<p>REMEDY</p> <p>Daimler trucks will notify owners and the buses will be repaired by Thomas built dealers free of charge. The manufacturer has not yet provided the agency with a notification schedule.</p> <p>Owners may contact Daimler trucks toll-free at 1-800-547-0712.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) THE AUTO MOTO / XY150ZK 2009-2010</p> <p>MANUFACTURER: ZHEJIANG XINGYUE VEHICLE CO., LTD</p> <p>COMPONENT: SERVICE BRAKES, AIR:CONTROLS:FOOT CONTROL</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 305</p> <p>SUMMARY: Xingyue is recalling certain model year 2009 and 2010 motor scooters manufactured from March 2009 through June 2010. The rear brake control is actuated by the driver's right foot and not the left hand as required by federal motor vehicles safety standard no. 123, "motorcycle controls and displays."</p> <p>No picture available.</p>	<p>CONSEQUENCE:</p> <p>The motorcycles do not meet the minimum requirements of the braking standard.</p>	<p>REMEDY:</p> <p>Xingyue will notify owners and replace the rear brake system free of charge. The safety recall is expected to begin during January 2011.</p> <p>Owners may contact nst, Inc. At 1-310-601-7220.</p>



AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>CHEVROLET / AVALANCHE 2010 CHEVROLET / SILVERADO 2010 CHEVROLET / SUBURBAN 1500 2010 CHEVROLET / SUBURBAN 2500 2010 CHEVROLET / TAHOE 2010 FORD / ESCAPE 2006-2010 FORD / EXPLORER 2006-2010 GMC / SIERRA 2010 GMC / YUKON 2010 GMC / YUKON XL 1500 2010 GMC / YUKON XL 2500 2010 JEEP / COMPASS FWD 2007-2010 JEEP / PATRIOT FWD 2007-2010 NISSAN / FRONTIER 2009-2010 NISSAN / XTERRA 2009-2010 TOYOTA / FJ CRUISER 2008-2010</p> <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: MARATHON / SUPERHIDES</p> <p>MANUFACTURER: MARATHON SEAT COVERS, INC.</p> <p>COMPONENT: EQUIPMENTPotential Number of Units Affected: 294</p> <p>SUMMARY: Marathon is recalling certain seat covers, brand superhides with part numbers 593, 594, 578, 960, 228, 228-09, 267-08, 333, 625, and 630, sold for use as aftermarket equipment for various passenger vehicles. These seat covers are made of heavier thread and are not compatible with seats containing side airbags. The heavier seat cover could interfere with full deployment of the airbag in the event of a crash.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An improperly deployed airbag could result in serious injury.</p>	<p>REMEDY</p> <p>Marathon will notify owners of record and replace the seat cover free of charge. The safety recall is expected to begin during September 2010. Owners may contact marathon at 1-800-735-2769.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>FORD / F-650 SD 2008-2009 FORD / F-750 SD 2008-2009</p> <p>MANUFACTURER: FORD MOTOR COMPANY</p> <p>Component: FUEL SYSTEM, OTHER:FUEL INJECTION SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 3469</p> <p>SUMMARY: Ford is recalling certain model year 2008-2009 f-650 and f-750 trucks equipped with caterpillar c7 engine. The #5 and #6 fuel lines may crack at the fastening point to the common fuel rail and cause a fuel leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A fuel leak, in the presence of an ignition source, can result in a vehicle fire.</p>	<p>REMEDY</p> <p>Ford is working with caterpillar to notify owners and repairs will be performed by authorized caterpillar dealers free of charge. Owners may contact caterpillar toll-free at 1-800-447-4986 or ford at 1-866-436-7332.</p>

AUTO: MOTOR VEHICLE EQUIPMENT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) THOMAS BUILT BUSES / MVP-EF 2009-2011</p> <p>MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 56</p> <p>SUMMARY: Daimler trucks is recalling certain model year 2009 through 2011 mvp-ef non school buses manufactured from september 12, 2008 through july 16, 2010, equipped with the megafuse junction box. On affected vehicles the megafuse junction box is located in an area exposed to excessive road splash and spray. In some applications the cable connections may corrode rapidly. If undetected, extreme corrosion may cause a power cable to become separated from the power source resulting in an unexpected engine shutdown or loss of vehicle lighting and windshield wipers.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Unexpected engine shutdown or a loss of vehicle lighting and windshield wipers in certain traffic conditions could increase the risk of a vehicle crash.</p>	<p>REMEDY</p> <p>Daimler trucks will notify owners and the repairs will be made by Thomas built repair facilities. A final remedy and notification schedule has not yet been determined. Owners may contact Daimler trucks at 1-800-547-0712.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S) THOMAS BUILT BUSES / MVP-EF 2009-2011</p> <p>MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT: ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1117</p> <p>SUMMARY: Daimler trucks is recalling certain model year 2009 through 2011 mvp-ef thomas built school buses manufactured from september 12, 2008 through july 16, 2010, equipped with the megafuse junction box. On affected vehicles the megafuse junction box is located in an area exposed to excessive road splash and spray. In some applications the cable connections may corrode rapidly. If undetected, extreme corrosion may cause a power cable to become separated from the power source resulting in an unexpected engine shutdown or loss of vehicle lighting and windshield wipers.</p> <p>No picture available.</p>	<p>CONSEQUENCE:</p> <p>Unexpected engine shutdown or a loss of vehicle lighting and windshield wipers in certain traffic conditions could increase the risk of a vehicle crash.</p>	<p>REMEDY:</p> <p>Daimler trucks will notify owners and the repairs will be made by Thomas built repair facilities. A final remedy and notification schedule has not yet been determined. Owners may contact Daimler trucks at 1-800-547-0712.</p>


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
EU/F RANCE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Sun roof - Hollandia</p> <p>BRAND: Webasto</p> <p>TYPE/NUMBER OF MODEL: 700 (H700) and TSV 900 (H900). Manufactured from 1 January 2002 to 19 May 2009.</p> <p>H700: Serial numbers from 6000000 to 6396298 H900: Serial numbers unknown</p> <p>DESCRIPTION: Opening/sliding sunroof to be fitted in the roof of motor vehicles.</p> <p>COUNTRY OF ORIGIN: Italy</p> 	<p>INJURIES</p> <p>Due to a defect in the adhesive seal which joins the glass panel of the sunroof to its metal frame, there is a possibility that the glass panel may detach from the frame.</p>	<p>Voluntary stop of sales and recall from consumers by the manufacturer.</p>
AUSTRALIA	<p>Jayco—Motor Homes</p> <p>PRODUCT DESCRIPTION</p> <p>Selected Jayco motor homes.</p> <p>IDENTIFYING FEATURES</p> <p>Selected chassis numbers between M90023 & M90271 Campaign Number: JC0024 Target Number: 72</p> <p>SUPPLIER</p> <p>Jayco Corporation Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.jayco.com.au No picture available.</p>	<p>HAZARDS</p> <p>The gas pipe could be damaged by the vehicle's suspension.</p> <p>DEFECTS</p> <p>The gas pipe may have been fitted in the wrong area and may need to be moved.</p>	<p>CONSUMERS ACTION</p> <p>Contact your nearest authorised Jayco Dealer or Service Agent for inspection and replacement of any damaged gas pipes to the hot water service.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
<p>AUSTRALIA</p>	<p>Kia—Soul</p> <p>PRODUCT DESCRIPTION Kia Soul Vehicles produced between 7 September 2009 and 8 June 2010</p> <p>IDENTIFYING FEATURES Campaign Number: 101060R0 Target Number: 27</p> <p>SUPPLIER Kia Motors Australia</p> 	<p>HAZARDS The wiring may become heat affected.</p> <p>DEFECTS There is an issue with the wiring that controls the illumination of the speaker.</p>	<p>CONSUMERS ACTION Arrange an appointment with your nearest Kia service dealer to arrange inspection and replacement of the illumination wiring.</p>
<p>AUSTRALIA</p>	<p>Kia—Sorento</p> <p>PRODUCT DESCRIPTION Kia Sorento vehicles produced between September 2009 to June 2010</p> <p>IDENTIFYING FEATURES Campaign Number: 101060R3 Target Number: 1,029 Affected Vehicle VIN Range: KNAKU813MA5050763 to KNAKU813MA5050767 KNAKU814SA5026243 to KNAKU814SA5108829</p> <p>SUPPLIER Kia Motors Australia</p> 	<p>HAZARDS The wiring may short and cause heat damage.</p> <p>DEFECTS There is a design flaw with the wiring to the door trim illumination.</p>	<p>CONSUMERS ACTION Arrange an appointment with your nearest Kia service dealer to arrange inspection and replacement of the wiring loom for the door trim illumination on all four doors.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/IRELAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - Yaris</p> <p>BRAND: Toyota</p> <p>TYPE/NUMBER OF MODEL: Manufactured from 24 January 2001 to 30 May 2001.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the inflator body of the passenger side front airbag may break when the airbag is activated, possibly causing injuries to the passenger.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>
AUSTRALIA	<p>Jayco—Motor Homes</p> <p>PRODUCT DESCRIPTION</p> <p>Selected Jayco motor homes.</p> <p>IDENTIFYING FEATURES</p> <p>Selected chassis numbers between M90023 & M90271</p> <p>Campaign Number: JC0024</p> <p>Target Number: 72</p> <p>SUPPLIER</p> <p>Jayco Corporation Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.jayco.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The gas pipe could be damaged by the vehicle's suspension.</p> <p>DEFECTS</p> <p>The gas pipe may have been fitted in the wrong area and may need to be moved.</p>	<p>CONSUMERS ACTION</p> <p>Contact your nearest authorised Jayco Dealer or Service Agent for inspection and replacement of any damaged gas pipes to the hot water service.</p>
AUSTRALIA	<p>Kia—Soul</p> <p>PRODUCT DESCRIPTION</p> <p>Kia Soul Vehicles produced between 7 September 2009 and 8 June 2010</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: 101060R0</p> <p>Target Number: 27</p> <p>See supporting documentation for the VIN list of affected vehicles.</p> <p>SUPPLIER</p> <p>Kia Motors Australia</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The wiring may become heat affected.</p> <p>DEFECTS</p> <p>There is an issue with the wiring that controls the illumination of the speaker.</p>	<p>CONSUMERS ACTION</p> <p>Arrange an appointment with your nearest Kia service dealer to arrange inspection and replacement of the illumination wiring.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAINGER	MEASURES ADOPTED
AUSTRALIA	<p>Toyota—Hilux - No:4 Crossmember Bracket</p> <p>PRODUCT DESCRIPTION</p> <p>Hilux 4x4 vehicles produced from 29 January 2005 to 20 February 2010.</p> <p>IDENTIFYING FEATURES</p> <p>Please see attached supporting documentation for the VIN Range of affected vehicles.</p> <p>Target Number: 116,507 Campaign Number: 0531H</p> <p>SUPPLIER</p> <p>TOYOTA MOTOR CORPORATION Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>In the worst case scenario, the propeller shaft could detach from the vehicle.</p> <p>DEFECTS</p> <p>When the vehicle is frequently accelerated and decelerated quickly on severely corrugated roads that specifically feature large numbers of cattle grid crossings, the rear tailshaft centre bearing brackets may detach.</p>	<p>CONSUMERS ACTION</p> <p>All owners of affected vehicles will receive a Recall Notification Letter.</p> <p>Owners are advised to contact their authorised Toyota Dealership for inspection and rectification.</p>
AUSTRALIA	<p>Ford— PJ Ranger—Automatic Transmission Shift Cable Bracket</p> <p>PRODUCT DESCRIPTION</p> <p>PJ Ranger models fitted with automatic transmission built from 15 May 2007 to 25 July 2008.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: S1005 Target Number: 4110</p> <p>SUPPLIER</p> <p>Ford Motor Company of Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>High shift efforts or no shift for selected gears, may result.</p> <p>DEFECTS</p> <p>The Automatic Transmission Shift Cable Bracket fitted to affected vehicles may not meet specification. This may result in the bracket cracking or breaking.</p>	<p>CONSUMERS ACTION</p> <p>Ford will write to owners of all affected vehicles at their last known address. For further information, contact any authorised Ford Dealer or Ford's Customer Relationship Centre on 1800 503 672</p>
AUSTRALIA	<p>Ford—PJ and PK Ranger—Bonnet Striker Replacement</p> <p>PRODUCT DESCRIPTION</p> <p>Ford PJ and PK Ranger models.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: S1006 Recall Number: 30,465</p> <p>SUPPLIER</p> <p>Ford Motor Company of Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Whilst a secondary safety hook will retain the bonnet in the event of a striker failure, continued use in severe road conditions may cause the secondary safety hook to fail which may result in the bonnet opening while driving, hindering the visibility of the driver.</p> <p>DEFECTS</p> <p>There is the possibility that after extended periods of driving in severe road conditions, the bonnet striker may develop a fatigue fracture.</p>	<p>CONSUMERS ACTION</p> <p>Ford will write to owners of all affected vehicles at their last known address. For further information, contact any authorised Ford Dealer or Ford's Customer Relationship Centre on 1800 503 672</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Ateco Automotive Pty Ltd—Ferrari 458</p> <p>PRODUCT DESCRIPTION</p> <p>Ferrari 458</p> <p>Identifying features</p> <p>Target Number: 22</p> <p>Campaign: 51</p> <p>SUPPLIER</p> <p>Ateco Automotive Pty Ltd</p> 	<p>HAZARDS</p> <p>The adhesive used in the assembly may overheat and produce smoke; or it may ignite in particularly high ambient and operating temperature conditions.</p> <p>DEFECTS</p> <p>There is a possible non-conformity in the assembly of the wheelhouse and its repective heat shield.</p>	<p>CONSUMERS ACTION</p> <p>Ferrari have contacted all owners.</p>
AUSTRALIA	<p>Mazda—BT-50 Automatic Transmission Shift Cable Bracket</p> <p>PRODUCT DESCRIPTION</p> <p>Mazda BT-50 with Automatic Transmission</p> <p>IDENTIFYING FEATURES</p> <p>VIN Range:</p> <p>MM0 UNY0E3 00641775—MM0 UNY0E3 00694613 (Pre-facelift Model)</p> <p>MM0 UNY0E4 00804848—MM0 UNY0E4 00812666 (Facelift Model)</p> <p>Target Number: 1, 150</p> <p>Campaign Number: R201002</p> <p>SUPPLIER</p> <p>Mazda Australia Pty Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Should the defect occur, high shift efforts or no shift for selected gears may result.</p> <p>DEFECTS</p> <p>There is a possibility that the Automatic Transmission Shift Cable Bracket fitted to the affected vehicles may have unnecessary welding and may not meet specification. This weld could lead to cracking/breakage of the bracket.</p>	<p>CONSUMERS ACTION</p> <p>Owners of affected vehicles will be contacted by mail and requested to present their vehicle to a Mazda Dealer for repair. Consumers may obtain further information by contacting any Mazda dealer or free-call 1800 034 411 (10:00am to 4:00pm, Eastern Standard Time, Monday—Friday) to speak to Mazda Customer Service Representatives.</p>

AUTO: MOTOR VEHICLE EQUIPMENT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>TIRE BRAND NAME / TIRE LINE / TIRE SIZE DUNLOP / SP193 / 295/75R22.5</p> <p>MANUFACTURER: GOODYEAR TIRE & RUBBER COMPANY</p> <p>COMPONENT: TIRES:TREAD/BELT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 11994</p> <p>SUMMARY: GOODYEAR is recalling certain Dunlop sp193 commercial trailer tires, size 295/75r22.5, produced from January 24 through may 29, 2010. These tires could experience air loss and if gone undetected, the tire could be driven while under inflated.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Driving a vehicle with under inflated tires increases the risk of a crash.</p>	<p>REMEDY</p> <p>GOODYEAR will notify owners of record and will visually inspect the tires for the defect. If the defect is present, Goodyear dealers will replace the tires free of charge. If the defect is not present at the time of inspection, the tire is ok and will not need to be replaced. The safety recall is expected to begin on or about September 30, 2010. Owners may contact goodyear at 1-800-321-2136.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: KUAT / NV 2</p> <p>MANUFACTURER: KUAT INNOVATIONS LLC</p> <p>COMPONENT: QUIPMENT:MECHANICAL:CARRIER/RACK</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 445</p> <p>SUMMARY: Kuat innovations, llc is recalling certain NV 2 model hitch mounted bicycle carriers manufactured from July 21 through September 15, 2009, sold for use as aftermarket equipment on various passenger vehicles. The support arm which attaches to the front bicycle wheel during tow can shear possibly allowing the bicycle to be dragged behind the vehicle or completely fall off the vehicle.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Should this occur while the vehicle is in motion, it may result in a vehicle crash.</p>	<p>REMEDY</p> <p>Kuat will notify owners and provide a free repair kit. The safety recall is expected to begin during September 2010. Owners may contact kuat toll free at 1-877-822-5828.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS