

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 30 SEPTEMBER 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 21




[Motor Vehicle \(32\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(13\)](#)

| AUTO: MOTOR VEHICLE | | | |
|---------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | DAINGER | MEASURES ADOPTED |
| AUSTRALIA | <p>Isuzu—F, C & E Series—Outer Steering Bolt</p> <p>PRODUCT DESCRIPTION</p> <p>Isuzu F, C & E Series vehicles produced in Japan between November 2005 and February 2006.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: 10-Z-06 Target Number: 41</p> <p>SUPPLIER</p> <p>Isuzu Australia Limited (IAL)</p> <p>No picture available.</p> | <p>HAZARDS</p> <p>The bolt could potentially fail, dislodging the steering arm and in the worst case scenario, disable the vehicle's steering ability.</p> <p>DEFECTS</p> <p>The outer steering arm bolt, that secures the steering arm to the knuckle, did not receive sufficeint heat treatment during the manufacture process.</p> | <p>CONSUMERS ACTION</p> <p>Contact your authorised Isuzu dealership in order to have the outer bolt replaced free of charge.</p> |
| AUSTRALIA | <p>Volvo—C30 MY 2011</p> <p>PRODUCT DESCRIPTION</p> <p>Volvo C30 MY 2011, fitted with a 2.5 litre turbo petrol.</p> <p>IDENTIFYING FEATURES</p> <p>VIN range: 220053 to 221407 Campaign Number: R29124 Target Number: 4</p> <p>SUPPLIER</p> <p>Volvo Car Australia Pty Ltd</p> <p>No picture available.</p> | <p>HAZARDS</p> <p>The defect may lead to boiling in the engine cooling system and the owner may notice reduced engine performance. In the worst case scenario, this may appear very rapidly and result in engine damages and/or engine break down. In these cars there is no warning of low coolant level, and the engine temperature warning may not alert the driver as the coolant boiling temperature is decreased under the threshold for warning, due to the air leakage into the cooling system.</p> <p>DEFECTS</p> <p>The engine coolant bleeder hoses quick connectors may not sufficiently seal towards the spigot on the coolant expansion tank, potentially resulting in loss of engine coolant and/or air leakage into the engine cooling system.</p> | <p>CONSUMERS ACTION</p> <p>Volvo will be sending letters to all affected owners. Owners will be advised to contact their authorised Volvo dealership for inspection and replacement of the expansion tank and bleeder hoses.</p> |

| AUTO: MOTOR VEHICLE | | | |
|---------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | DAANGER | MEASURES ADOPTED |
| AUSTRALIA | <p>Yamaha—XT1200Z Base Box</p> <p>PRODUCT DESCRIPTION</p> <p>Yamaha XT1200Z</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: BB/XT1200 Target Number: TBA VIN Range: XT1200ZDP014000002 to XT1200ZDP014000354</p> <p>SUPPLIER</p> <p>Yamaha Motor Australia Pty Ltd</p>  | <p>HAZARDS</p> <p>The top case may become completely detached from the motorcycle.</p> <p>DEFECTS</p> <p>When the motorcycle is ridden with either the Genuine Yamaha Accessory Aluminium Top Case (23P-W0754-00) or a similar aftermarket product, the Base box may develop a crack and eventually break.</p> | <p>CONSUMERS ACTION</p> <p>Yamaha will write to all affected owners.</p> <p>Owners are advised to cease using any type of Top Case until further notice from Yamaha Motor Australia. When the revised base box is available Yamaha will contact owners to advise how to have the new part fitted free of cost.</p> <p>If you no longer own the unit, please advise Yamaha motor Australia on 1300 593 600</p> |
| AUSTRALIA | <p>Bentley—Arnage Family—Flying 'B' Mascot Fails to Retract</p> <p>PRODUCT DESCRIPTION</p> <p>Arnage T, Arnage R, Arnage RL, Arnage Final Series, Azure and Brooklands cars manufactured between October 2006 and March 2009.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: RE10/04</p> <p>WHERE THE PRODUCT WAS SOLD</p> <p>National</p> <p>SUPPLIER</p> <p>Bentley Motors Limited</p> <p>No picture available.</p> | <p>HAZARDS</p> <p>Additional injury in the event of a pedestrian impact.</p> <p>DEFECTS</p> <p>On the vehicles affected there is the potential for the retractable 'B' mechanism to become corroded. In extreme cases, this may lead to flying 'B' mascot not retracting when struck.</p> | <p>CONSUMERS ACTION</p> <p>Written notification will be provided to owners of affected vehicles. Owners will be requested to return the car to one of Bentley's official dealers for the mascot mechanism to be replaced with one of later design, free of charge.</p> |

| AUTO: MOTOR VEHICLE | | | |
|---------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | DAANGER | MEASURES ADOPTED |
| AUSTRALIA | <p>Mercedes-Benz—Sprinter Van, type 906</p> <p>PRODUCT DESCRIPTION</p> <p>Sprinter Van, type 906</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: RC846 Target Number: 14 Model: 906. ###2N as of 306253 up to 520968 906. ###2S sd of 100535 up to 414364</p> <p>SUPPLIER</p> <p>Mercedes-Benz Australia/Pacific Pty Ltd No picture available.</p> | <p>HAZARDS</p> <p>If incorrect lights were installed the direction of the light may be hazardous to other drivers</p> <p>DEFECTS</p> <p>DURING MANUFACTURE incorrect headlights (left hand drive version) may have been fitted to the vehicle.</p> | <p>CONSUMERS ACTION</p> <p>Contact your authorised Mercedes-Benz dealership to have replacement headlight installed free of charge.</p> |
| EU/IRELAND | <p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Van - Dispatch III</p> <p>BRAND: Citroen</p> <p>TYPE/NUMBER OF MODEL: Years 2006-2008, VF7 ***** 64017392 - VF7 ***** 64231947.</p> <p>DESCRIPTION: Van</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available</p> | <p>INJURIES</p> <p>The product poses a risk of injuries because if water leaks into the brake drum, the brake linings could deteriorate prematurely leading to altered braking performance of the rear wheels.</p> | <p>Voluntary corrective actions taken by the manufacturer.</p> |
| EU/IRELAND | <p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - C4 Picasso</p> <p>BRAND: Citroen</p> <p>TYPE/NUMBER OF MODEL: 2009 Model. Type approval number: e2*2001/116*0345*09. Build dates: 28/11/09 – 02-12-09. VF7 ***** 9J337584 - VF7 ***** 9J343180</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available</p> | <p>INJURIES</p> <p>The product poses a risk of injuries because in very rare cases and under certain conditions of impact, the operation of the front seat belt buckles and the restraining of passengers may be affected.</p> | <p>Voluntary corrective actions taken by the manufacturer.</p> |
| EU/GERMANY | <p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - Jeep Commander</p> <p>BRAND: Chrysler / Jeep</p> <p>TYPE/NUMBER OF MODEL: Jeep Commander (XH) e4*2001/116*0095*05 to e4*2001/116*0095*12</p> <p>DESCRIPTION: Vehicles from model years 2007-2010 without a sliding roof are affected.</p> <p>COUNTRY OF ORIGIN: United States</p> <p>No picture available</p> | <p>INJURIES</p> <p>It is possible that the side airbags are not correctly positioned and that, in the event of an accident and under certain circumstances, the side airbags could open behind the B-pillar trim increasing the risk of injury for the occupant.</p> | <p>Voluntary corrective actions taken by the manufacturer.</p> |

AUTO: MOTOR VEHICLE

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR</p> <p>DUTCHMEN / COLORADO 2003-2004 DUTCHMEN / FIFTH AVENUE 2001-2002 DUTCHMEN / LITE 2002 DUTCHMEN / SIGNATURE 2001-2002</p> <p>MANUFACTURER: DUTCHMEN MANUFACTURING, INC.</p> <p>COMPONENT: EQUIPMENT Potential Number of Units Affected: 1494</p> <p>SUMMARY: Dutchmen is recalling certain model year 2001-2002 fifth avenue, signature, and model year 2003-2004 colorado recreational vehicles equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>Dutchmen is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR</p> <p>NRC / FREIGHTLINER COLUMBIA 2003</p> <p>MANUFACTURER: NRC MODIFICATIONS, INC.</p> <p>COMPONENT: EQUIPMENT Potential Number of Units Affected: 4</p> <p>SUMMARY: NRC is recalling certain model year 2003 freightliner trucks equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>NRC is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>MCI / D4005 2009-2010 MCI / D4505 2009-2010</p> <p>MANUFACTURER: MOTOR COACH INDUSTRIES, INC</p> <p>COMPONENT: SEATS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 105</p> <p>SUMMARY: MCI is recalling certain model year 2009-2010 d4005 and d4505 motor coaches equipped with a national seating company driver's seat containing a stabilus bloc-o-lift shock. The driver's seat shock damper may break allowing the driver's seat to unexpectedly drop to the floor without warning.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event this should occur while the bus is in operation, the driver may lose control of the vehicle, possibly resulting in a crash.</p> | <p>REMEDY</p> <p>MCI will notify owners and replace the seat shock as necessary free of charge. The safety recall is expected to begin during September 2010. Owners may contact mci customer service at 1-800-241-2947.</p> |

| AUTO: MOTOR VEHICLE | | | |
|---------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>PIERCE / CUSTOM CONTENDER 2010 PIERCE / SABER 2010</p> <p>MANUFACTURER: PIERCE MANUFACTURING COMPONENT: ELECTRICAL SYSTEM:BATTERY POTENTIAL NUMBER OF UNITS AFFECTED: 55</p> <p>SUMMARY: Pierce is recalling certain model year 2010 saber and custom contender fire apparatus vehicles manufactured from March 25, 2010, through June 22, 2010. The battery switch positive electrical post may come in contact with the driver seat base reinforcement.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>If this happens, a short circuit may result in a fire.</p> | <p>REMEDY</p> <p>Pierce will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin during October 2010. Owners may contact pierce at 1-920-832-3000.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR</p> <p>PIERCE / ARROW XT 1998-2008 PIERCE / DASH 1998-2008 PIERCE / ENFORCER 1998-2008 PIERCE / IMPEL 1998-2008 PIERCE / LANCE 1998-2008 PIERCE / VELOCITY 1998-2008</p> <p>MANUFACTURER: PIERCE MANUFACTURING COMPONENT: STEERING POTENTIAL NUMBER OF UNITS AFFECTED: 2652</p> <p>SUMMARY: Pierce is recalling certain model year 1998 through 2008 arrow xt, lance, velocity, enforcer, impel, and dash custom fire apparatus vehicles manufactured from may 30, 1998 through november 25, 2008. The steering gear bracket may fracture and break. If this occurs the steering gear may detach from the vehicle.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>Detachment of the steering gear will result in a loss of steering control that could cause a crash.</p> | <p>REMEDY</p> <p>Pierce will notify owners and dealers will install a new steering gear mounting bracket free of charge. The notification schedule has not yet been determined. Owners may contact pierce at 1-920-832-3000.</p> |
| USA | <p>VEHICLE MAKE / MO MODEL YEAR</p> <p>HEARTLAND / LANDMARK 2005</p> <p>MANUFACTURER: HEARTLAND RECREATIONAL VEHICLES, LLC COMPONENT: EQUIPMENTPotential Number of Units Affected: 30</p> <p>SUMMARY: Heartland is recalling certain model year 2005 landmark fifth wheel golden gate recreational trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>Heartland is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |

AUTO: MOTOR VEHICLE

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) HYUNDAI / SONATA 2011</p> <p>MANUFACTURER: HYUNDAI MOTOR COMPANY</p> <p>COMPONENT: STEERING:GEAR BOX:SHAFT SECTOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 139500</p> <p>SUMMARY: HYUNDAI is recalling certain model year 2011 sonata vehicles manufactured from December 11, 2009, through September 10, 2010. On some of these vehicles the steering column intermediate shaft universal joint connections may have been either improperly assembled or insufficiently tightened.</p> <p>No picture available</p> | <p>CONSEQUENCE</p> <p>Improper assembly or insufficient tightening of the connections could result in a complete separation or compromised attachment of the connections, such that the driver could experience a loss of, or reduction in, steering capability increasing the risk of a crash.</p> | <p>REMEDY</p> <p>Dealers will inspect the steering column intermediate shaft universal joint connections for proper assembly and torque. In addition dealers will update the power steering software free of charge. The safety recall is expected to begin during October 2010.</p> <p>Owners may contact hyundai customer assistance center at 1-800-633-5151.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) CUSTOM CAMPERS / LS 2005-2009 NU WA / CHAMPAGNE EDITION 2000-2004 2007 2009-2010 NU WA / DISCOVERY SERIES 2000 2003-2010 NU WA / PREMIER 2000 2003-2006 NU WA / SNOWBIRD SE102 2000-2002 NU WA / SNOWVILLA 2004 NU WA / SWNOVILLA 2003</p> <p>MANUFACTURER: NU WA INDUSTRIES, INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 562</p> <p>SUMMARY: NU WA is recalling certain model year 2000-2010 recreational trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available</p> | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>NU WA is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |

AUTO: MOTOR VEHICLE

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) SUTPHEN / CHASSIS 2006-2008 MANUFACTURER: SUTPHEN CORPORATION COMPONENT: ENGINE AND ENGINE COOLING POTENTIAL NUMBER OF UNITS AFFECTED: 54 SUMMARY: Sutphen is recalling certain model year 2006-2008 aerials and model year 2007-2008 pumper fire trucks equipped with Detroit diesel series 60 engines. The software on these engines may cause the engine to shut down unexpectedly when a diesel particulate filter over-temperature condition is detected. No picture available.</p> | <p>CONSEQUENCE Unexpected emergency vehicle engine shutdown increases the risk of a crash and could hamper rescue operations and put the transported passenger at risk.</p> | <p>REMEDY Sutphen will notify owners and Detroit diesel will repair the vehicles free of charge by reprogramming the engine motor control module. Please see Daimler trucks/detroit diesel's defect report 10e-005. The safety recall is expected to begin on or about June 1, 2010. Owners may contact Detroit diesel at 1-800-547-0712 or on line http://www.detroitdiesel.com/supportnetwork.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) ENTEGRA / ANTHEM 2010-2011 ENTEGRA / CORNERSTONE 2010-2011 MANUFACTURER: ENTEGRA COACH COMPONENT: ELECTRICAL SYSTEM POTENTIAL NUMBER OF UNITS AFFECTED: 35 SUMMARY: Entegra is recalling certain model year 2010 and 2011 anthem and cornerstone class a motorhomes manufactured from June 3, 2009, through august 27, 2010. There may be an improper electrical connection at the buss bar on the affected transfer switches. No picture available.</p> | <p>CONSEQUENCE This improper connection may lead to overheating and melting of the transfer switch and may result in a fire.</p> | <p>REMEDY Entegra will notify owners and dealers will replace the transfer switch free of charge. The safety recall is expected to begin during september 2010. owners may contact entegra at 1-800-945-4787.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) CADILLAC / CTS 2009-2010 CADILLAC / CTS-V 2009-2010 MANUFACTURER: GENERAL MOTORS CORP. COMPONENT: EQUIPMENTPotential Number of Units Affected: 20224 SUMMARY: GM is recalling certain model year 2009-2010 cadillac cts all wheel drive and cts-v vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 208, "occupant crash protection." No picture available.</p> | <p>CONSEQUENCE In the event of a crash, the front passenger may be at an increased risk of leg injury.</p> | <p>REMEDY Dealers will replace the glove compartment assembly and, in some vehicles modify the instrument panel structure. This service will be performed free of charge. The safety recall is expected to begin on or before October 20, 2010. Owners may contact cadillac at 1-866-982-2339.</p> |

| AUTO: MOTOR VEHICLE | | | |
|---------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>BENTLEY / BENTLEY T2 1975-1980 BENTLEY / SHADOW II 1975-1980 BENTLEY / SILVER SHADOW 1975-1980</p> <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: BENTLEY / RH14071</p> <p>MANUFACTURER: BENTLEY MOTORS, INC.</p> <p>COMPONENT: SERVICE BRAKES, HYDRAULIC:FOUNDATION COMPONENTS:HOSES, LINES/PIPING, AND FITTINGS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 12</p> <p>SUMMARY: Bentley is recalling certain service brake hoses, part number rh14071, sold for use as replacement equipment for model year 1975 through 1980 Bentley and Rolls Royce silver shadow, shadow ii, and Bentley t2 model vehicles. The brake hose has been incorrectly manufactured using a nitrile rubber which is not tolerant of glycol ether based brake fluid.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>This could lead to hose failure which would result in partial brake failure, increasing the risk of a crash.</p> | <p>REMEDY</p> <p>Bentley will notify owners and dealers will replace the hose free of charge. The safety recall is expected to begin on or about September 30, 2010. Owners may contact Bentley at 1-617-488-8500.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>KEYSTONE / ALPINE 2011 KEYSTONE / AVALANCHE 2011 KEYSTONE / FUZION 2011 KEYSTONE / LAREDO 2011 KEYSTONE / MONTANA 2011 KEYSTONE / MOUNTAINEER 2011</p> <p>MANUFACTURER: KEYSTONE RV COMPANY</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 322</p> <p>SUMMARY: Keystone is recalling certain 2011 alpine, avalanche, fuzion, laredo, montana, and mountaineer fifth wheel trailers manufactured from August 19, 2010 through September 1, 2010, equipped with dexter axles. On some axles, cracks could appear in the spindle weld.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>These cracks can propagate and cause the spindle to detach from the axle tube, resulting in the separation of the wheel end from the vehicle, creating a road hazard that increases the risk of a crash to other vehicles, and compromises the driver's control of the vehicle increasing the risk of a vehicle crash.</p> | <p>REMEDY</p> <p>Keystone will notify owners and dealers will inspect the axle serial number and replace it if it falls within the serial number range. Replacement of the axle will be performed free of charge. The safety recall is expected to begin on or about September 23, 2010. Owners may contact keystone customer service at 1-866-425-4369.</p> |

AUTO: MOTOR VEHICLE

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>TIFFIN / BAY 2002-2004 TIFFIN / BUS 2003-2004</p> <p>MANUFACTURER: TIFFIN MOTORHOMES, INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 136</p> <p>SUMMARY: Tiffin is recalling certain model year 2002-2004 36 lb bay and model year 2003-2004 40 tgp buses equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>Tiffin will notify owners and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule.</p> <p>Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>AIRSTREAM / CLASSIC 2001-2004</p> <p>MANUFACTURER: AIRSTREAM, INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 16</p> <p>SUMMARY: Airstream is recalling certain model year 2001-2004 34" classic travel trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>Airstream will notify owners and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule.</p> <p>Owners may contact dimplex North America customer service at 1-888-346-7539 or airstream at 937-596-6111.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>HYUNDAI / SONATA 2011</p> <p>MANUFACTURER: HYUNDAI MOTOR COMPANY</p> <p>COMPONENT: STEERING:GEAR BOX:SHAFT SECTOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 139500</p> <p>SUMMARY: HYUNDAI is recalling certain model year 2011 sonata vehicles manufactured from December 11, 2009, through September 10, 2010. On some of these vehicles the steering column intermediate shaft universal joint connections may have been either improperly assembled or insufficiently tightened.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>Improper assembly or insufficient tightening of the connections could result in a complete separation or compromised attachment of the connections, such that the driver could experience a loss of, or reduction in, steering capability increasing the risk of a crash.</p> | <p>REMEDY</p> <p>Dealers will inspect the steering column intermediate shaft universal joint connections for proper assembly and torque. In addition dealers will update the power steering software free of charge. The safety recall is expected to begin during October 2010.</p> <p>Owners may contact hyundai customer assistance center at 1-800-633-5151.</p> |

| AUTO: MOTOR VEHICLE | | | |
|---------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) BENTLEY / ARNAGE 2007-2009 BENTLEY / AZURE 2007-2009 BENTLEY / BROOKLANDS 2007-2009</p> <p>MANUFACTURER: BENTLEY MOTORS LTD COMPONENT: STRUCTURE:BODY:HOOD POTENTIAL NUMBER OF UNITS AFFECTED: 596</p> <p>SUMMARY: Bentley is recalling certain model year 2007-2009 arnager, arnaget, arnage rl, brooklands, and azure vehicles. There is a potential for the "b" hood ornament's retracting mechanism to become corroded. This may lead to the "b" hood ornament not retracting as intended when a vehicle is involved in a crash. No picture available.</p> | <p>CONSEQUENCE</p> <p>If the hood ornament does not retract, it could increase the risk of injury to a pedestrian in the event of a crash between the vehicle and the pedestrian.</p> | <p>REMEDY</p> <p>Dealers will replace the retractable "b" mechanism free of charge. The safety recall is expected to begin on or before September 27, 2010. Owners may contact Bentley at 1-617-488-8500.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(s) INTERNATIONAL / LONESTAR 2010-2011</p> <p>MANUFACTURER: NAVISTAR, INC COMPONENT: WHEELS POTENTIAL NUMBER OF UNITS AFFECTED: 32</p> <p>SUMMARY: Navistar is recalling certain model year 2010 and 2011 international lonestar heavy trucks manufactured from June 11, 2008 through June 14, 2010, equipped with styled aluminum wheels, feature code 27drs or 27drt. On some vehicles, the wheels may develop cracks in the spokes. The cracks may progress over time to the point of wheel failure possibly resulting in wheel separation from the vehicle. No picture available.</p> | <p>CONSEQUENCE</p> <p>Wheel separation increases the risk of a crash which may result in property damage, personal injury, or death.</p> | <p>REMEDY</p> <p>Navistar will notify owners and dealers will replace the affected wheels free of charge. The safety recall is expected to begin on or about October 29, 2010. Owners may contact navistar at 1-800-448-7825.</p> |

AUTO: MOTOR VEHICLE

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) DUTCHMEN / GRAND JUNCTION 2006-2007</p> <p>MANUFACTURER: DUTCHMEN MANUFACTURING, INC.</p> <p>COMPONENT: POWER TRAIN:AXLE ASSEMBLY Potential Number of Units Affected: 39</p> <p>SUMMARY: Dutchmen is recalling certain model year 2006-2007 grand junction fifth wheel travel trailers manufactured from april 27, 2006 through may 2, 2006, and equipped with lippert axles components. These vehicles may contain mis-located welds attaching the axle spindle to the axle tube. If the welds are mis-located, the spindle may partially or completely separate from the axle tube and the wheel and hub assembly may come off the vehicle.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>A separated tire and wheel assembly could strike other vehicles and/or pedestrians, risking injury or death, and/or cause significant damage property.</p> | <p>REMEDY</p> <p>Dutchmen is working with lippert to inspect and replace if an axle is found to be defective on a vehicle free of charge. Owners may contact lippert componets, inc.'s axle service & warranty department at 1-877-870-4900 or Dutchmen warranty service department at 866-869-1109.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S) DAMON / CHALLENGER 2007-2011 DAMON / INTRUDER 2005-2007</p> <p>MANUFACTURER: DAMON CORPORATION</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE:LPG TANK ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 271</p> <p>SUMMARY: Damon is recalling certain model year 2007-2011 challenger, model year 2005-2007 intruder motor homes. These motor homes do not have the proper clearance between the rear suspension leaf spring and the vehicle liquid propane fuel tank. As the suspension travels it is possible for the leaf spring shackle bolt to come in contact with the tank. This potentially could puncture the tank and result in a fire or explosion.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a fire or explosion, there is a potential for property damage, personal injury or death.</p> | <p>REMEDY</p> <p>Damon will inspect to see if the proper clearance between the shackle bolt and the tank exists. If it is found there is not enough clearance, the tank will be relocated to provide the proper clearance. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Damon warranty service department at 877-855-2867.</p> |

AUTO: MOTOR VEHICLE

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED | | | | | | | | | | | | | | | | |
|---------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------|-------------------------|----------------------|-----------|-------------------------|-----------|-----------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|-----------|--------------------------------|-----------|-------------------|-----------|--------------------------|-----------|-----------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <table border="0" style="width: 100%;"> <tr> <td style="width: 60%;">VEHICLE MAKE / MODEL</td> <td style="width: 40%;">MODEL YEAR</td> </tr> <tr> <td>JAYCO / DESIGNER</td> <td>2005</td> </tr> <tr> <td>JAYCO / LEGACY</td> <td>2004</td> </tr> </table> <p>MANUFACTURER: JAYCO, INC. COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 207 SUMMARY: Jayco is recalling certain model year 2004 legacy and model year 2005 designer fifth wheel trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. No picture available.</p> | VEHICLE MAKE / MODEL | MODEL YEAR | JAYCO / DESIGNER | 2005 | JAYCO / LEGACY | 2004 | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>Jayco is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during October 2010. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> | | | | | | | | | | |
| VEHICLE MAKE / MODEL | MODEL YEAR | | | | | | | | | | | | | | | | | | |
| JAYCO / DESIGNER | 2005 | | | | | | | | | | | | | | | | | | |
| JAYCO / LEGACY | 2004 | | | | | | | | | | | | | | | | | | |
| USA | <table border="0" style="width: 100%;"> <tr> <td style="width: 60%;">VEHICLE MAKE / MODEL</td> <td style="width: 40%;">MODEL YEAR</td> </tr> <tr> <td>BRECKENRIDGE / 102'S</td> <td>2002-2010</td> </tr> <tr> <td>BRECKENRIDGE / BAYRIDGE</td> <td>2002-2010</td> </tr> <tr> <td>BRECKENRIDGE / FINELIFE COTTAGE</td> <td>2002-2010</td> </tr> <tr> <td>BRECKENRIDGE / LE</td> <td>2002-2010</td> </tr> <tr> <td>BRECKENRIDGE / PERFECT COTTAGE</td> <td>2002-2010</td> </tr> <tr> <td>BRECKENRIDGE / SE</td> <td>2002-2010</td> </tr> <tr> <td>BRECKENRIDGE / XTENDABLE</td> <td>2002-2010</td> </tr> </table> <p>MANUFACTURER: BRECKENRIDGE COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 960 SUMMARY: Breckenridge is recalling certain model year 2002-2010 travel trailers manufactured from may 15, 2001, through july 31, 2010 and equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. No picture available.</p> | VEHICLE MAKE / MODEL | MODEL YEAR | BRECKENRIDGE / 102'S | 2002-2010 | BRECKENRIDGE / BAYRIDGE | 2002-2010 | BRECKENRIDGE / FINELIFE COTTAGE | 2002-2010 | BRECKENRIDGE / LE | 2002-2010 | BRECKENRIDGE / PERFECT COTTAGE | 2002-2010 | BRECKENRIDGE / SE | 2002-2010 | BRECKENRIDGE / XTENDABLE | 2002-2010 | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>Breckenridge is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |
| VEHICLE MAKE / MODEL | MODEL YEAR | | | | | | | | | | | | | | | | | | |
| BRECKENRIDGE / 102'S | 2002-2010 | | | | | | | | | | | | | | | | | | |
| BRECKENRIDGE / BAYRIDGE | 2002-2010 | | | | | | | | | | | | | | | | | | |
| BRECKENRIDGE / FINELIFE COTTAGE | 2002-2010 | | | | | | | | | | | | | | | | | | |
| BRECKENRIDGE / LE | 2002-2010 | | | | | | | | | | | | | | | | | | |
| BRECKENRIDGE / PERFECT COTTAGE | 2002-2010 | | | | | | | | | | | | | | | | | | |
| BRECKENRIDGE / SE | 2002-2010 | | | | | | | | | | | | | | | | | | |
| BRECKENRIDGE / XTENDABLE | 2002-2010 | | | | | | | | | | | | | | | | | | |

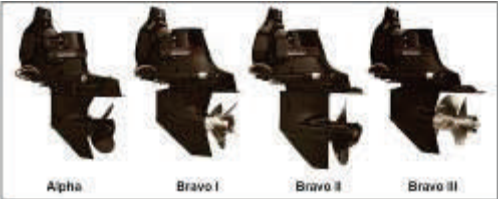
AUTO: MOTOR VEHICLE

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>EXCEL / LIMITED 2011 EXCEL / WILD CARGO 2010-2011 EXCEL / WINSLOW 2010-2011</p> <p>MANUFACTURER: PETERSON INDUSTRIES, INC.</p> <p>COMPONENT: EQUIPMENT Potential Number of Units Affected: 52</p> <p>SUMMARY: Peterson industries is recalling certain model year 2010 and 2011 excel winslow, limited, and wild cargo motor homes equipped with suburban gas cook stoves with sealed burners. The units involved use an aluminum tube to carry liquid propane gas from the oven control valve to the gas orifice which supplies gas to the burner. This can cause the tube to break resulting in a gas leak when the oven burner attempts to light. No picture available.</p> | <p>CONSEQUENCE</p> <p>A gas leak occurring in the area of the oven pilot can cause a "flash" when the gas ignites, and would cause a fire if the oven valve is not promptly turned off.</p> | <p>REMEDY</p> <p>Peterson industries will notify owners and dealers will install a replacement gas line that has been sourced and tested to insure that the defect which created the stress point has been eliminated. This service will be performed free of charge. The safety recall is expected to begin during October 2010. Owners may contact Peterson industries at 1-785-282-6825.</p> |
| USA | <p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>JAYCO / DESIGNER 2005 JAYCO / LEGACY 2004</p> <p>MANUFACTURER: JAYCO, INC.</p> <p>COMPONENT: EQUIPMENT Potential Number of Units Affected: 207</p> <p>SUMMARY: Jayco is recalling certain model year 2004 legacy and model year 2005 designer fifth wheel trailers equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat. No picture available.</p> | <p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p> | <p>REMEDY</p> <p>Jayco is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during October 2010. Owners may contact dimplex North America customer service at 1-888-346-7539.</p> |

AUTO: MOTOR VEHICLE EQUIPMENT

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p>AUSTRALIA</p> | <p>Marine Power International Pty Ltd—Mercury MerCruiser Production Engines, Remanufactured MerCruiser Engines and Certified Pre Owned MerCruiser Engines</p> <p>PRODUCT DESCRIPTION</p> <p>MerCruiser Power Steering Models 4-cylinder, V-6, V-8 petrol, Mercury 357 & 383 Mag Reman Engines</p> <p>IDENTIFYING FEATURES</p> <p>MERCUISER PRODUCTION ENGINES Serial Number Range: 1A350037 - 1A350511 & 1A601377 - 1A608988</p> <p>MERCUISER REMANUFACTURED ENGINE Serial Number Range: 1G400659 - 1G401328</p> <p>MERCUISER CPO (Certified Pre Owned) ENGINE Serial Number Range: 1G480598 - 1G480761</p> <p>SUPPLIER</p> <p>Marine Power International Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://mercurymarine.com.au</p> <div data-bbox="316 1137 826 1310" style="text-align: center;"> <p>4 Cyl Engine V6 Engine V8 Engine</p> </div> | <p>HAZARDS</p> <p>A breakage of the tube which carries seawater into the cooler may allow seawater to be discharged into the boat, cause the engine to overheat and put the boat at risk of swamping.</p> <p>DEFECTS</p> <p>The tube which carries seawater into the power steering fluid cooler may break.</p> | <p>CONSUMERS ACTION</p> <p>Stop using boat and contact MerCruiser dealer to arrange for boat to be inspected and, if necessary, rectified.</p> |

AUTO: MOTOR VEHICLE EQUIPMENT

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p>AUSTRALIA</p> | <p>Marine Power International Pty Ltd—Mercury MerCruiser Stern Drive Packages (power boat engines)</p> <p>PRODUCT DESCRIPTION</p> <p>MerCruiser 4-cylinder, V-6, V-8 petrol and 4-cylinder, 6-cylinder diesel engine Stern Drive models supplied with Alpha & Bravo Transom Assemblies</p> <p>IDENTIFYING FEATURES</p> <p>ALPHA ENGINE Engine Serial Number Range: 1A602571 - 1A621587 Transom Serial Number Range: 1A194127 - 1A68107</p> <p>BRAVO ENGINE Engine Serial Number Range: 1A350418 - 1A621253 Transom Serial Number Range: 1A437945 - 1A444913</p> <p>LOOSE TRANSOMS (Spare Parts) Transom Serial Number Range: ALPHA 1A194127 - 1A468107 BRAVO 1A437945 - 1A444913 MC1 0A845988 - 0A846138</p> <p>SUPPLIER</p> <p>Marine Power International Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://mercurymarine.com.au</p>  | <p>HAZARDS</p> <p>Loss of gear control (forward, neutral, reverse)</p> <p>DEFECTS</p> <p>The core fitting of the intermediate gearshift cable of the engine may become detached from the core wire.</p> | <p>CONSUMERS ACTION</p> <p>Stop using boat and contact MerCruiser dealer to arrange for boat to be inspected and, if necessary, rectified.</p> |

AUTO: MOTOR VEHICLE EQUIPMENT

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: VIP DISTRIBUTING CO.</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1109</p> <p>SUMMARY: webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by vip distributing co. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could cause a road hazard that results in a vehicle crash or could strike a trailing vehicle.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by vip distributing co. By clicking on the hyperlink "affected vehicle list" or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO UPGRADE OF N.E., INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 21</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by auto upgrade of n.e., inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto upgrade by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT | | | |
|-------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | ANGER | MEASURES ADOPTED |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: LUND CADILLAC</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 321</p> <p>SUMMARY: Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by lund cadillac on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by Lund Cadillac by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: SOLAR VISION</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 575</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by solar vision on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by solar vision by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT | | | |
|-------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO IMAGE</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 649</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by auto image on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto image by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTOMOTIVE IMPROVEMENTS</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 14</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by automotive improvements on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by automotive improvements by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |

AUTO: MOTOR VEHICLE EQUIPMENT

| NOTIFYING COUNTRY | PRODUCT | DANGER | MEASURES ADOPTED |
|-------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: COFFMAN AUTO GLASS COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 420</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by coffman auto glass on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by coffman auto glass by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: FINISH LINE COMPONENT: EQUIPMENTPotential Number of Units Affected: 351</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by finish line on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p> | <p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall is expected to begin during September 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by finish line by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p> |

| AUTO: MOTOR VEHICLE EQUIPMENT | | | |
|-------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| NOTIFYING COUNTRY | PRODUCT | ANGER | MEASURES ADOPTED |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: YAKIMA / RACK AND ROLL</p> <p>MANUFACTURER: YAKIMA PRODUCTS, INC.</p> <p>COMPONENT: WHEELS:LUGS/NUTS/BOLTS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1511</p> <p>SUMMARY: Yakima is recalling certain model year 2009 rack and roll equipment trailers, part numbers 8008106 and 8008107, size 66"/250 lb and 78"/300 lb. The trailer's wheel(s) can separate from the trailer while driving.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>Separation of the wheel would cause the trailer to become unstable which could result in a vehicle crash.</p> | <p>REMEDY</p> <p>Yakima will notify owners and will provide a trailer axle upgrade kit free of charge. The safety recall is expected to begin during September 2010. Owners may contact yakima customer service at 1-888-925-4621.</p> |
| USA | <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>LIPPERT / 6000 (AXLE)</p> <p>LIPPERT / 7000 (AXLE)</p> <p>MANUFACTURER: LIPPERT COMPONENTS, INC.</p> <p>COMPONENT: POWER TRAIN:AXLE</p> <p>ASSEMBLYPotential Number of Units Affected: 438</p> <p>SUMMARY: Lippert is recalling certain trailer axles, models 6000 and 7000, installed as original equipment for certain nuwa trvael trailers. The weld joining the axle tube to the spindle may be mislocated.</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>The spindle may partially or completely separate from the axle tube and the wheel and the hub assembly may come off the vehicle, possibly resulting in a crash.</p> | <p>REMEDY</p> <p>Lippert is working with nuwa to identify owners and the vehicles will be inspected for mislocated welds and, if necessary, the axles will be replaced free of charge. The safety recall is expected to begin on or about august 16, 2010. Owners may contact lippert's axle service & warranty department at 1-877-870-4900.</p> |
| USA | <p>TIRE BRAND NAME / TIRE LINE / TIRE SIZE:</p> <p>CARLISLE / LRD USA TRAIL / 20.5/8.0-10</p> <p>MANUFACTURER: CARLISLE TIRE AND WHEEL</p> <p>COMPONENT: TIRES:MARKINGS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 202</p> <p>SUMMARY: Certain carlisle tire and wheel company (cets) lrd usa trail tires, size 20.5/8.0-10, fail to conform to the requirements of federal motor vehicle safety standard no. 109, "new pneumatic tires." the tires were marked improperly on the opposite side as load range "e" on one sidewall side, when they should have been marked load range "d."</p> <p>No picture available.</p> | <p>CONSEQUENCE</p> <p>The incorrect load range markings may lead to an owner purchasing a tire that is not appropriate for their particular vehicle application. Using incorrectly sized tires on a vehicle could leading to vehicle overloading or other consequences that could increase the risk of a tire failure that could lead to a vehicle crash.</p> | <p>REMEDY</p> <p>Cets will replace the noncompliant tires free of charge. The safety recall is expected to begin during September 2010. Owners may contact cets at 1-315-477-9107.</p> |

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS