

PRODUCT RECALLS

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16– 31 AUGUST 2012

CONTENTS

AUTOMOTIVE

Pages 1 to 23



[Motor Vehicle \(43\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(3\)](#)

SGS


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/MALTA	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car / van</p> <p>BRAND: Peugeot</p> <p>NAME:</p> <p>1. 807</p> <p>2. Expert</p> <p>TYPE/NUMBER OF MODEL:</p> <p>Type Approval No.:</p> <p>1. e*98/14*0253*27</p> <p>2. e*2001/116*0349*16; e*2007/46*0046*03; e*2007/46*0046*04</p> <p>Chassis No.:</p> <p>1. VF3EBRHD8CZ004758 to VF3EBRHH8CZ005798</p> <p>2. VF3XZAHZ8CZ004200 to VF3XDAHZ8CZ005947</p> <p>DESCRIPTION: Passenger car / van</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The front left tyre could be damaged and could consequently fail during use leading to loss of control of the vehicle. This could lead to an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Jeep</p> <p>NAME: LIBERTY, CHEROKEE</p> <p>TYPE: KJ</p> <p>EC type approval: e4*98/14*0058</p> <p>Recall concerns vehicles built between 3.07.2003 and 14.07.2005.</p> <p>Batch number/Bar code: Unknown</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: United States</p> <p>No picture available.</p>	<p>INJURIES</p> <p>Corrosion may cause the lower suspension arms on the rear axle to break. This can cause the vehicle to react in an unexpected manner, which may lead to the driver losing control.</p>	<p>Compulsory measures:</p> <p>Recall of the product from end users</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycle</p> <p>BRAND: DUCATI</p> <p>NAME: 1199 Panigale</p> <p>TYPE/NUMBER OF MODEL:</p> <p>The recall affects 1199 PANIGALE motorcycles (all versions) MY2012 and MY2013, with VINs from ZDMH800ABBB000030 to ZDMH800ABCB007709 and from ZDMH801AACB000283 to ZDMH801ABCB007697.</p> <p>DESCRIPTION: Motorcycle</p> <p>COUNTRY OF ORIGIN: Italy</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The purpose of the recall is to replace and/or re-assembly various components:</p> <ul style="list-style-type: none"> a) the exhaust butterfly valve bowden cable support; b) the steering damper head uniball bearing ("S" and "S Tricolore" versions only); c) the steering damper retaining screws (all versions); d) the swinging arm shafts; e) the front brake master cylinder fluid reservoir connection tube. <p>Each of the problems with the above components could potentially lead to an accident, causing injuries to the rider of the motorcycle.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
AUSTRALIA	<p>Ford—PJ & PK Ranger</p> <p>PRODUCT DESCRIPTION</p> <p>Certain PJ and PK Ranger XLT and Wildtrak models equipped with factory fitted tow bar and built from September 18, 2006 through June 17, 2011</p> <p>IDENTIFYING FEATURES</p> <p>PJ and PK Ranger XLT and Wildtrak models</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Ford dealers.</p> <p>SUPPLIER</p> <p>Ford Motor Company of Australia Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Fracturing of the tow bar tongue welding can affect safe operation and handling when an affected vehicle is towing, presenting a potential traffic hazard to the driver and/or other road users.</p> <p>DEFECTS</p> <p>The tow bar assembly fitted to affected vehicles may develop weld fracturing around the towbar tongue.</p>	<p>Consumers should not use the tow bar. Owners are advised to contact their nearest Ford dealership for inspection and rectification.</p> <p>For further information contact Ford's Customer Relationship Centre on 1800 503 672.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/MALTA	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Peugeot</p> <p>NAME: 207</p> <p>TYPE/NUMBER OF MODEL:</p> <p>Type Approval No.: e*2001/116*0340*21; e*2001/116*0340*23; e*2007/46*0072*02</p> <p>Chassis No.: VF3WC8HR0AE091863 to VF3WC8HR0BW037173</p> <p>Type Approval No.: e*2001/116*0340*21; e*2001/116*0340*22; e*2001/116*0340*23; e*2007/46*0072*01; e*2007/46*0072*02.</p> <p>Chassis No.: VF3WC8FP0AE091096 to VF3WC8FP0CW000445</p> <p>Type Approval No.: e*2001/116*0340*21; e*2001/116*0340*23; e*2007/46*0072*01; e*2007/46*0072*02.</p> <p>Chassis No.: VF3WA8HZCAE091379 to VF3WAKFT0CW000434</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The battery earth cable on the gearbox could break leading to the engine cutting out. The engine cutting out during use could lead to loss of control of the vehicle which could lead to an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
AUSTRALIA	<p>Kawasaki Motors Pty Ltd—ZX1000JBF and ZX1000KBF/KCF Motorcycles</p> <p>PRODUCT DESCRIPTION</p> <p>Kawasaki ZX1000JBF and ZX1000KBF/KCF model motorcycles</p> <p>IDENTIFYING FEATURES</p> <p>See attached VIN ranges.</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Kawasaki dealers.</p> <p>Supplier</p> <p>Kawasaki Motors Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.kawasaki.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the defect is present, oil may leak onto the rear tyre posing a crash hazard to the rider.</p> <p>DEFECTS</p> <p>Some engine crankcases may have a casting flaw which could allow engine oil to leak.</p>	<p>Consumers should contact their nearest Kawasaki dealer to arrange for the defect to be rectified.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Kawasaki Motors Pty Ltd—ZG1400A/C Motorcycles</p> <p>PRODUCT DESCRIPTION Kawasaki ZG1400A/C motorcycles</p> <p>IDENTIFYING FEATURES See attached VIN ranges.</p> <p>TRADERS WHO SOLD THIS PRODUCT Authorised Kawasaki Dealers.</p> <p>SUPPLIER Kawasaki Motors Pty Ltd</p> <p>SUPPLIER'S WEB SITE http://www.kawasaki.com.au</p> <p>No picture available.</p>	<p>HAZARDS Collected debris may result in overheating of the rear brake, potentially resulting in loss of steering control.</p> <p>DEFECTS Due to the gap between the rear brake pedal and the guard, small stones or other road debris may become trapped between the brake pedal and the guard.</p>	<p>Consumers should contact their nearest Kawasaki dealer to arrange for the defect to be rectified.</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycles</p> <p>BRAND: KAWASAKI</p> <p>NAME: 1400 GTR and 1400 GTR ABS</p> <p>TYPE/NUMBER OF MODEL: Models: ZG1400A8/A9/CA/CB/CC, 1400GTR, 1400GTR ABS</p> <p>The recall affects motorcycles with serial numbers:</p> <ol style="list-style-type: none"> 1. ZG1400A8: from JKBZGT40AAA005009 to JKBZGT40AAA015140 2. ZG1400A9: from JKBZGT40AAA019001 to JKBZGT40AAA022802 3. ZG1400CA: from JKBZGT40CCA000036 to JKBZGT40CCA003557 4. ZG1400CB: from JKBZGT40CCA006032 to JKBZGT40CCA009994 5. ZG1400CC: from JKBZGT40CCA013002 to JKBZGT40CCA017411 <p>DESCRIPTION: Motorcycle</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES Small stones or other road debris can become trapped between the rear brake pedal and guard and prevent the pedal from fully releasing. This can cause overheating potentially leading to rear brake damage and lock up or failure of the rear brake. On 1400GTR ABS models with K-ACT the front brake may also be affected because it is linked with rear brake operation.</p>	<p>Voluntary measures: Recall of the product from end users</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>IVECO Trucks Australia Limited—IVECO ACCO E5</p> <p>PRODUCT DESCRIPTION</p> <p>ACCO Euro 5 Series Dual Control Truck fitted with Continental Accelerator Pedal (LHS pedal only)</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: A55 Target Number: 488 Production Date Range: 22 Nov 2010 to 16 Jul 2012</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised IVECO dealers</p> <p>SUPPLIER</p> <p>IVECO Trucks Australia Limited</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.iveco.com.au</p> <p>No picture is available.</p>	<p>HAZARDS</p> <p>The LHS accelerator pedal may stick during vehicle operation. This may lead to an accident or pose a hazard to other road users.</p> <p>DEFECTS</p> <p>Defective secondary spring on the pedal return mechanism.</p>	<p>IVECO Trucks Australia will contact owners of affected vehicles.</p> <p>If further information is required contact your IVECO Dealer or IVECO Trucks Australia Limited on 03 9238 2200.</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: OPEL</p> <p>NAME: Zafira C</p> <p>TYPE/NUMBER OF MODEL: Zafira C</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Passenger car. The recall concerns vehicles with VINs from C 2 015615 to C 2 038907 and from C 2 042773 to C 2 046502.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because if an accident occurs with deployment of the passenger airbag, the airbag flap may not open correctly. In worst cases, parts of the airbag flap may become detached by the airbag deployment.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users.</p>
EU/ PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycle</p> <p>BRAND: Kawasaki</p> <p>NAME: Ninja ZX</p> <p>TYPE/NUMBER OF MODEL:</p> <p>ZX1000JBF, Ninja ZX-10R; ZX1000KBF, Ninja ZX-10R ABS; ZX1000JCF, Ninja ZX-10R; ZX1000KCF, Ninja ZX-10R ABS.</p> <p>Batch number/Barcode: 87115000000008.</p> <p>DESCRIPTION: Motorcycle.</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The engine crankcases may have a casting flaw which allows engine oil to leak at the starter motor mounting area and collect on the crankcase surface. Continued use in this condition can allow oil to get onto the rear tyre and could lead to an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Teryx4 Recreational Off-Highway Vehicles</p> <p>UNITS: About 7,000</p> <p>DISTRIBUTOR: Kawasaki Motors Corp. USA, of Irvine, Calif.</p> <p>DESCRIPTION: The recalled vehicles are 2012 Kawasaki Teryx4 4x4 recreational off-highway vehicles in the following styles: 750, 750 EPS and 750 EPS LE. The four-wheel drive recreational off-highway vehicles have side-by-side seating for four people and automobile style controls. The vehicles are sold in red, camouflage, green, blue and yellow colors. The model name "Teryx4" appears on the driver's side of the hood. The style name does not appear on the 750 version. For all colors of the 750 EPS except camouflage, "EPS" appears on the driver and passenger side cowling near the top front corner of the doors. On the 750 EPS LE, "EPS" appears on the driver and passenger side cowling near top front corner of the doors and "LE" appears on the hood on the driver's side.</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD: The steering gear assembly and front brakes can fail, resulting in the loss of steering and braking, posing a risk of injury or death.</p> <p>INCIDENTS/INJURIES: None</p>	Voluntary recall.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycles</p> <p>BRAND: KAWASAKI</p> <p>NAME: Ninja ZX-10R and Ninja ZX-10R ABS</p> <p>TYPE/NUMBER OF MODEL: Models ZX1000J/K, Ninja ZX-10R/Ninja ZX-10R ABS</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: The recall affects motorcycles with serial numbers:</p> <ol style="list-style-type: none"> ZX1000JBF: from JKAZXT00JJA000064 to JKAZXT00JJA006446 ZX1000JCF: from JKAZXT00JJA010008 to JKAZXT00JJA012894 ZX1000KBF: from JKAZXT00JKA001192 to JKAZXT00JKA006404 ZX1000KCF: from JKAZXT00JKA010038 to JKAZXT00JKA012900 <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The engine crankcase may have a casting flaw which allows engine oil to leak at the starter motor mounting area and collect on the crankcase surface. Continued use in this condition could allow oil to get onto the rear tyre which may cause an accident, leading to injuries for the rider.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	<p>Western Star Trucks—DD13 DD15 and DD16</p> <p>PRODUCT DESCRIPTION</p> <p>Western Star Trucks EPA07/10 DD platform high pressure fuel feed lines</p> <p>IDENTIFYING FEATURES</p> <p>Please see attached table.</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Western Star Trucks dealers</p> <p>SUPPLIER</p> <p>Western Star Trucks</p> <p>No picture available.</p>	<p>DEFECTS</p> <p>Incorrect torque applied to the damper p-clip fasteners may have damaged the fasteners, allowing the p-clips to become loose.</p> <p>HAZARDS</p> <p>If the fuel line cracks and leaks, it may create a fire hazard.</p>	<p>Consumers should contact their nearest Western Star Trucks dealer to arrange for an inspection and repair.</p>
AUSTRALIA	<p>Holden—Captiva—Electronic Brake Control Module</p> <p>PRODUCT DESCRIPTION</p> <p>Holden Captiva Electronic Brake Control Module (EBCM)</p> <p>IDENTIFYING FEATURES</p> <p>Captiva 2007-2010 KL3CD###J#B012509- KL3CD###J#B012293</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Holden dealers</p> <p>SUPPLIER</p> <p>Holden Ltd</p> <p>No picture available.</p>	<p>DEFECTS</p> <p>The vehicle may suffer reduced brake performance and/or a spongy low brake pedal due to a sticky valve within the Electronic Brake Control Module (EBCM).</p> <p>HAZARDS</p> <p>If the defect occurs, the braking performance of the vehicle will be reduced, which poses a potential crash hazard.</p>	<p>If you believe your vehicle may be affected or if you require any further information, please contact your nearest Holden Dealer or call the Holden Recall and Rework Assistance Line on 1800 632 826. This service operates 8am to 7pm EST Monday to Friday and 9am to 1pm EST Saturdays except National Public Holidays.</p>
EU/ PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger cars</p> <p>BRAND: TOYOTA</p> <p>NAME: 1. Avensis 2. Auris 3. RAV 4</p> <p>TYPE/NUMBER OF MODEL: 1.Avensis (Country of origin: United Kingdom), 2.Auris (Country of origin: Turkey and United Kingdom) 3. RAV 4 (Country of origin: Japan)</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Passenger cars. VIN Range of the affected vehicles in Europe attached.</p> <p>Year: 2005 – 2011.</p> <p>COUNTRY OF ORIGIN: Japan, United Kingdom, Turkey</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The product poses a risk of injuries due to a potential problem with a Rear Suspension Arm. In affected vehicles, if nuts for adjusting the rear wheel alignment are improperly tightened, backlash may develop at the thread portion of the arm (shaft and turn-buckle), followed by formation of rust. If this occurs, threads may wear, causing the arm to separate, which could result in loss of vehicle control.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Holden—Barina—Electronic Brake Control Module</p> <p>PRODUCT DESCRIPTION</p> <p>Holden Barina Electronic Brake Control Module (EBCM)</p> <p>IDENTIFYING FEATURES</p> <p>Barina 2009-2010 KL3S####1#B253789 - KL3S####1#B112341</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Holden dealers</p> <p>SUPPLIER</p> <p>Holden Ltd</p> <p>No picture available.</p>	<p>DEFECTS</p> <p>The vehicle may suffer reduced brake performance and/or a spongy low brake pedal due to a sticky valve within the Electronic Brake Control Module (EBCM).</p> <p>HAZARDS</p> <p>If the defect occurs, the braking performance of the vehicle will be reduced and poses a potential crash hazard.</p>	<p>If you believe your vehicle may be affected or if you require any further information, please contact your nearest Holden Dealer or call the Holden Recall and Rework Assistance Line on 1800 632 826. This service operates 8am to 7pm EST Monday to Friday and 9am to 1pm EST Saturdays except National Public Holidays.</p>
AUSTRALIA	<p>Holden—Viva—Electronic Brake Control Module</p> <p>PRODUCT DESCRIPTION</p> <p>Holden Viva Electronic Brake Control Module (EBCM)</p> <p>IDENTIFYING FEATURES</p> <p>Viva 2007-2008 KL3N####BJ#K485878- KL3N####BJ#K977652</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Holden dealers.</p> <p>SUPPLIER</p> <p>Holden Ltd</p> <p>No picture available.</p>	<p>DEFECTS</p> <p>The vehicle may suffer reduced brake performance and/or a spongy low brake pedal due to a sticky valve within the Electronic Brake Control Module (EBCM).</p> <p>HAZARDS</p> <p>If the defect occurs, the braking performance of the vehicle will be reduced, which poses a potential crash hazard.</p>	<p>If you believe your vehicle may be affected or if you require any further information, please contact your nearest Holden dealer or call the Holden Recall and Rework Assistance Line on 1800 632 826. This service operates 8am to 7pm EST Monday to Friday and 9am to 1pm EST Saturdays except National Public Holidays.</p>
AUSTRALIA	<p>Holden—Epica—Electronic Brake Control Module</p> <p>PRODUCT DESCRIPTION</p> <p>Holden Epica Electronic Brake Control Module (EBCM)</p> <p>IDENTIFYING FEATURES</p> <p>Epica 2008-2010 KL3LA####J#B112086 - KL3LA####J#B011772</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Holden dealers</p> <p>SUPPLIER</p> <p>Holden Ltd</p> <p>No picture available.</p>	<p>DEFECTS</p> <p>The vehicle may suffer reduced brake performance and/or a spongy low brake pedal due to a sticky valve within the Electronic Brake Control Module (EBCM).</p> <p>HAZARDS</p> <p>If the defect occurs, the braking performance of the vehicle will be reduced, which poses a potential crash hazard.</p>	<p>If you believe your vehicle may be affected or if you require any further information, please contact your nearest Holden dealer or call the Holden Recall and Rework Assistance Line on 1800 632 826. This service operates 8am to 7pm EST Monday to Friday and 9am to 1pm EST Saturdays except National Public Holidays.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL INFINITI / JX35-2013</p> <p>MANUFACTURER NISSAN NORTH AMERICA, INC.</p> <p>COMPONENT FUEL SYSTEM, GASOLINE:STORAGE:TANK ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 7,842</p> <p>SUMMARY Nissan is recalling certain model year 2013 Infiniti JX35 vehicles manufactured from February 15, 2012, through June 22, 2012. Due to an assembly issue, the fuel transfer tube may be misrouted inside the fuel tank. As a result, the fuel level float may be prevented from dropping as the fuel is consumed and the fuel guage may read a fuel level higher than actually exists. No picture available.</p>	<p>CONSEQUENCE If the fuel guage does not accurately show when the tank is becoming empty, the vehicle may run out of gas unexpectedly, stalling, and increasing the risk of a crash.</p>	<p>REMEDY Nissan will notify owners, and dealers will inspect and re-route the fuel transfer tube and install a new O-ring, free of charge. The recall is expected to begin September 4, 2012. Owners may contact Nissan customer service at 1-800-647-7261.</p>
USA	<p>VEHICLE MAKE / MODEL DUCATI / 1199 PANIGALE-2012-2013</p> <p>MANUFACTURER DUCATI NORTH AMERICA</p> <p>COMPONENT SERVICE BRAKES, HYDRAULIC:FOUNDATION COMPONENTS:MASTER CYLINDER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2,411</p> <p>SUMMARY Ducati is recalling certain model year 2012-2013 1199 Panigale motorcycles manufactured from March 16, 2012, through July 12, 2012. The front brake master cylinder reservoir hose might interfere with the threading end of the reservoir retaining screw. No picture available.</p>	<p>CONSEQUENCE The front brake master cylinder reservoir hose might interfere with the threading end of the reservoir of the retaining screw causing damage to the hose, which could lead to a front brake system failure, increasing the risk of a crash.</p>	<p>REMEDY Ducati will notify owners, and authorized dealers will install a cap nut and a washer at the end of the reservoir retaining screw, free of charge. Ducati has not provided a notification schedule. Owners may contact Ducati at 1-800-231-6696 or through their website at www.ducati.com.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL SUZUKI / FORENZA-2004-2006 SUZUKI / RENO-2005-2006</p> <p>MANUFACTURER AMERICAN SUZUKI MOTOR CORP.</p> <p>COMPONENT ELECTRICAL SYSTEM:WIRING:INTERIOR/ UNDER DASH</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 101,688</p> <p>SUMMARY Suzuki is recalling certain model year 2004-2006 Forenza and model year 2005-2006 Reno vehicles manufactured from September 23, 2003, through March 7, 2006. Increased resistance due to poor contact between the terminals of certain wires can generate heat that can melt the splice pack used to connect the power circuit wires for the headlamps. This can result in intermittent or total loss of low/high beam headlamp function. No picture available.</p>	<p>CONSEQUENCE If the headlamps fail to function, this will lead to reduced driver visibility, increasing the risk of a crash.</p>	<p>REMEDY Suzuki will notify owners, and Suzuki dealers will reconnect the affected wires with two heat-shrink crimps, free of charge. The safety recall is expected to begin during September 2012. Owners may contact Suzuki at 1-714-996-7040.</p>
USA	<p>VEHICLE MAKE / MODEL DUCATI / 1199 PANIGALE-2012-2013</p> <p>MANUFACTURER DUCATI NORTH AMERICA</p> <p>COMPONENT SUSPENSION:REAR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2,411</p> <p>SUMMARY Ducati is recalling certain model year 2012-2013 1199 Panigale motorcycles manufactured from March 16, 2012, through July 12, 2012. The right and left swingarm shaft pivots can loosen. No picture available.</p>	<p>CONSEQUENCE The swingarm shaft pivots can loosen from the swingarm which can lead to loss of control of the motorcycle, increasing the risk of personal injury.</p>	<p>REMEDY Ducati will notify owners, and authorized dealers will tighten the right and left swingarm shaft pivots to the proper torque settings, free of charge. Ducati has not provided a notification schedule. Owners may contact Ducati at 1-800-231-6696 or through their website at www.ducati.com.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL BUICK / RAINIER-2006-2007 CHEVROLET / TRAILBLAZER-2006-2007 GMC / ENVOY-2006-2007 ISUZU / ASCENDER-2006-2007 SAAB / 9-7X-2006-2007</p> <p>MANUFACTURER General Motors LLC</p> <p>COMPONENT VISIBILITY:POWER WINDOW DEVICES AND CONTROLS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 249,260</p> <p>SUMMARY General Motors (GM) is recalling certain model year 2006 Chevrolet Trailblazer EXT and GMC Envoy XL and 2006-2007 Chevrolet Trailblazer, GMC Envoy, Buick Rainier, SAAB 9-7x, and Isuzu Ascender vehicles, originally sold or currently registered in Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin, and the District of Columbia. Fluid may enter the driver's door module, causing corrosion that could result in a short in the circuit board. A short may cause the power door lock and power window switches to function intermittently or become inoperative. The short may also cause overheating, which could melt components of the door module, producing odor, smoke, or a fire.</p> <p>No picture available.</p>	<p>CONSEQUENCE A short in the circuit board could lead to a fire, increasing the risk of personal injury.</p>	<p>REMEDY The remedy plan is still being finalized. A notification schedule has not been determined yet. Buick, Chevrolet, and GMC owners will be notified by GM. Buick owners may contact the owner center at 1-800-521-7300, Chevrolet owners at 1-866-694-6546, and GMC owners at 1-866-996-9463. Isuzu owners will be notified by Isuzu Motors. Owners may contact Isuzu customer service at 1-800-255-6727. SAAB owners will be notified by SAAB Cars North America and for inquiries, owners may call SAAB customer service at 1-855-880-0808.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL DUCATI / 1199 PANIGALE-2012-2013</p> <p>MANUFACTURER DUCATI NORTH AMERICA</p> <p>COMPONENT STEERING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2,411</p> <p>SUMMARY Ducati is recalling certain model year 2012-2013 1199 Panigale motorcycles manufactured from March 16, 2012, through July 12, 2012 . Due to an incorrect assembly tolerance, the Uniball bearing on the damper rod eyelet could slip out of its seat on the Ohlins steering damper. No picture available.</p>	<p>CONSEQUENCE The steering damper can detach from its mounting point which can lead to loss of control of the motorcycle, increasing the risk of a crash.</p>	<p>REMEDY Ducati will notify owners, and authorized dealers will install a special washer at the steering damper's mounting point, free of charge. Ducati has not provided a notification schedule. Owners may contact Ducati at 1-800-231-6696 or through their website at www.ducati.com.</p>
USA	<p>VEHICLE MAKE / MODEL BOATWHEELS / PB27-TH1200-2011 BOATWHEELS / PB36-RS2100-2011</p> <p>MANUFACTURER ALUMINA, INC</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2</p> <p>SUMMARY Alumina, Inc., dba Boatwheels, is recalling a model year 2011 PB27-TH1200 and a 2011 PB36-RS2100 trailer each equipped with a Dexter Axle brand electric/hydraulic (E/H) brake actuator pump. These pumps may not have been properly heat treated. This condition can cause premature wear of some critical components in these pumps which can render the unit inoperable. No picture available.</p>	<p>CONSEQUENCE The E/H brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY Alumina will notify owners, and Alumina dealers will replace the actuators, free of charge. The recall began in early August 2012. Owners may contact Alumina, Inc. at 1-419-433-2300.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL HAUL-RITE / ABT66-HD-2012 HAUL-RITE / ABT66-TDM-2012 HAUL-RITE / ABT78-HD-2012 HAUL-RITE / ABT78-TDM-2012 HAUL-RITE / TRN63-HD-2012</p> <p>MANUFACTURER B & M MANUFACTURING COMPANY</p> <p>COMPONENT WHEELS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 18</p> <p>SUMMARY B & M Manufacturing Company (B & M) is recalling certain model year 2012 boat trailers equipped with Carlisle Transport Products brand wheels installed as original equipment. These wheels were manufactured with machine dimensions for the application of a center cap and the application of steel lug inserts that were not controlled to the required specifications. As a result, the wheel may not be tightened to the proper torque during the mounting process. No picture available.</p>	<p>CONSEQUENCE If the wheels are not tightened to the proper torque, the wheels could loosen, leading to wheel separation, possibly resulting in a vehicle crash. A detached wheel also becomes a road hazard.</p>	<p>REMEDY B & M will notify owners, and dealers will repair or replace affected wheels free of charge. The recall is expected to begin on August 24, 2012. Owners may contact B & M Manufacturing Company at 1-573-346-7246.</p>
USA	<p>VEHICLE MAKE / MODEL DUCATI / 1199 PANIGALE-2012-2013</p> <p>MANUFACTURER DUCATI NORTH AMERICA</p> <p>COMPONENT ENGINE AND ENGINE COOLING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2,411</p> <p>SUMMARY Ducati is recalling certain model year 2012-2013 1199 Panigale motorcycles manufactured from March 16, 2012, through July 12, 2012. The exhaust butterfly valve bowden cable cover could melt or burn due to excess heat of the catalytic converter. No picture available.</p>	<p>CONSEQUENCE Melting and burning of the bowden cable cover could lead to smoke and/or fire.</p>	<p>REMEDY Ducati will notify owners, and authorized dealers will the replace old exhaust butterfly valve bowden cable cover with a new one, free of charge. Ducati has not provided a notification schedule. Owners may contact Ducati at 1-800-231-6696 or through their website at www.ducati.com.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL DUCATI / 1199 PANIGALE-2012-2013</p> <p>MANUFACTURER DUCATI NORTH AMERICA</p> <p>COMPONENT STEERING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2,411</p> <p>SUMMARY Ducati is recalling certain model year 2012-2013 1199 Panigale motorcycles manufactured from March 16, 2012, through July 12, 2012. Screws that secure the steering damper to the steering head could fall out due to an insufficient amount of Loctite applied to the threads. No picture available.</p>	<p>CONSEQUENCE The steering damper can detach from the steering head which can lead to loss of control of the motorcycle, increasing the risk of a crash.</p>	<p>REMEDY Ducati will notify owners, and authorized dealers will remove both screws, clean the threads, apply the proper amount of Loctite, and tighten to the proper torque settings, free of charge. Ducati has not provided a notification schedule. Owners may contact Ducati at 1-800-231-6696 or through their website at www.ducati.com.</p>
USA	<p>VEHICLE MAKE / MODEL BMW / 1 SERIES-2008-2011 BMW / 3 SERIES-2206-2011 BMW / 5 SERIES-2000-2009 BMW / 6 SERIES-2004-2005 BMW / 7 SERIES-2006-2007</p> <p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: VALEO / ENGINE COOLING FAN</p> <p>MANUFACTURER Valeo</p> <p>COMPONENT ENGINE AND ENGINE COOLING:COOLING SYSTEM:FAN</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 585</p> <p>SUMMARY Valeo is recalling certain engine cooling fans, part numbers 696121, 696273, and 696275, used as service replacement parts for model year 2008-2011 BMW 1-Series, 2006-2011 BMW 3-Series, 2000-2009 BMW 5-Series, 2004-2005 BMW 6-Series, and 2006-2007 BMW 7-Series vehicles. A metal-oxide semiconductor may overheat due to insufficient screwing of the semiconductor on the aluminum heat sink. This primary failure could cause adjacent components on the fan assembly motor circuit board to overheat and short. No picture available.</p>	<p>CONSEQUENCE This condition could cause the fan motor to become inoperative, or cause the motor circuit board in the assembly to overheat, potentially leading to a fire in the engine compartment.</p>	<p>REMEDY Valeo will notify owners and replace the fans free of charge. The safety recall is expected to begin during August 2012. This recall is being conducted by Valeo, not by BMW. For further information, owners may contact Valeo at 1-888-718-2536.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL ROADTREK / 21PC-2011-2012 ROADTREK / 21VC-2010-2012</p> <p>MANUFACTURER ROADTREK MOTORHOMES INC.</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 145</p> <p>SUMMARY Roadtrek is recalling certain model year 2011 and 2012 Roadtrek 21PC Popular and 21VC Versatile model class "B" motorhomes built from October 1, 2010, through November 12, 2011. On some motorhomes, the rivets may fail that secure the awning brackets to the motorhome side wall, allowing the bracket and Thule awning to come off the motor home while operating the awning. No picture available.</p>	<p>CONSEQUENCE If the awning separates from the motor home, the user or people nearby may be injured.</p>	<p>REMEDY Roadtrek will notify owners, and dealers will install an additional stainless steel rivet on each of the awning brackets, free of charge. Roadtrek has not provided a notification schedule. Owners may contact Roadtrek Service Department at 1-888-ROADTREK (762-3873) or 1-519-745-1169.</p>
USA	<p>VEHICLE MAKE / MODEL AUTOCAR / XPEDITOR-2008-2012</p> <p>MANUFACTURER AUTOCAR, LLC</p> <p>COMPONENT SEAT BELTS:FRONT:RETRACTOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 681</p> <p>SUMMARY Autocar is recalling certain model year 2008-2012 Xpeditor heavy-duty class 8 vehicles, manufactured from December 17, 2007, through July 10, 2012 and equipped with a right-hand (passenger-side) Bostrom air-ride seat. The seatbelt and tether intermediate connection point (ICP) located on the seat bracket may interfere with the seatbelt retractor mechanism as the seat is pneumatically adjusted for height. Over time, the interference may cause the retractor mechanism cover to crack, allowing the retractor spring to become loose and inoperable. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection." No picture available.</p>	<p>CONSEQUENCE In the event of a crash, if the seat belt retractor malfunctions, the passenger may not be properly restrained, increasing the risk of personal injury or death.</p>	<p>REMEDY Autocar will notify owners and provide instructions for scheduling the vehicle repair, free of charge. The recall is expected to begin on September 5, 2012. Owners may contact Autocar at 1-765-489-5499.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL DODGE / DURANGO-2013</p> <p>MANUFACTURER CHRYSLER GROUP LLC</p> <p>COMPONENT AIR BAGS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,449</p> <p>SUMMARY Chrysler is recalling certain model year 2013 Dodge Durango vehicles manufactured from April 11, 2012, through July 20, 2012. Some vehicles may have been built with the incorrect airbag occupant restraint control (ORC) module. No picture available.</p>	<p>CONSEQUENCE In the event of a side impact, rearward of the second row seat, the supplemental side air bag inflatable curtain may not deploy as intended, increasing the risk of occupant injury.</p>	<p>REMEDY Chrysler will notify owners, and dealers will replace the ORC module, free of charge. The safety recall is expected to begin during September 2012. Owners may contact Chrysler at 1-800-853-1403.</p>
USA	<p>VEHICLE MAKE / MODEL JAYCO / JAY FLIGHT SWIFT SLX-2012-2013</p> <p>MANUFACTURER JAYCO, INC.</p> <p>COMPONENT SUSPENSION:REAR:AXLE:NON-POWERED AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 300</p> <p>SUMMARY Jayco is recalling certain model year 2012-2013 Jay Flight Swift SLX Travel trailers manufactured from October 24, 2011, through July 3, 2012. These trailers may have oversized bearings installed in the axle. This may cause excessive movement in the wheel hub, causing the bearings to become overheated and worn. No picture available.</p>	<p>CONSEQUENCE Overheated and worn bearings may lead to axle failure while driving, increasing the risk of a crash.</p>	<p>REMEDY Jayco will notify owners, and dealers will replace the axle bearings with proper size bearings, free of charge. The recall is expected to begin in August 2012. Owners may contact Jayco at 1-800-283-8267.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL FISKER / KARMA-2012</p> <p>MANUFACTURER FISKER AUTOMOTIVE, INC.</p> <p>COMPONENT ENGINE AND ENGINE COOLING:COOLING SYSTEM:FAN</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,377</p> <p>SUMMARY Fisker Automotive (Fisker) is recalling certain model year 2012 Fisker Karma passenger cars manufactured from June 15, 2011, through July 9, 2012. A manufacturing defect in the low temperature cooling fan may result in a direct short. No picture available.</p>	<p>CONSEQUENCE A direct short may ignite the fan housing, shroud and surrounding components, causing a vehicle fire.</p>	<p>REMEDY Fisker will notify owners, and dealers will remove the two potentially affected low temperature cooling fans and replace them with one improved low temperature cooling fan, free charge. The safety recall is expected to begin on August 27, 2012. Owners may contact Fisker consumer affairs at 1-855-575-7577, option 2, 6am - 7pm (pst) Monday through Friday.</p>
USA	<p>VEHICLE MAKE / MODEL CHEVROLET / SONIC-2012</p> <p>MANUFACTURER General Motors LLC</p> <p>COMPONENT VISIBILITY:WINDSHIELD WIPER/WASHER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 44,668</p> <p>SUMMARY General Motors LLC (GM) is recalling certain model year 2012 Chevrolet Sonic vehicles manufactured from May 5, 2011, through February 24, 2012. These vehicles fail to conform to Federal Motor Vehicle Safety Standard No. 104, "Windshield Wiping and Washing Systems." The windshield wiper washer hose on these vehicles may separate from the washer fluid reservoir. If this occurs, washer fluid will not be available to the windshield. No picture available.</p>	<p>CONSEQUENCE A lack of washer fluid could impede the driver's view, increasing the risk of a crash.</p>	<p>REMEDY GM will notify owners, and dealers will secure the windshield washer hose to prevent separation, free of charge. The safety recall is expected to begin on, or about, September 7, 2012. Owners may contact the Chevrolet owner center at 1-866-694-6546.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL KENWORTH / T400-2013 KENWORTH / T600-2013 KENWORTH / T700-2013 KENWORTH / T800-2013 KENWORTH / W900-2013</p> <p>MANUFACTURER PACCAR INCORPORATED</p> <p>COMPONENT POWER TRAIN:DRIVELINE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 535</p> <p>SUMMARY Paccar is recalling certain model year 2013 kenworth T400, T600, T700, T800, and W900 vehicles, manufactured from July 18, 2012, through August 10, 2012. Cap screws securing the main driveline to the forward rear axle and cap screws on the inter-axle driveline may not have been properly torqued.</p> <p>No picture available.</p>	<p>CONSEQUENCE Fasteners which are not properly torqued to specification can result in the driveline separating from the vehicle, disabling the vehicle and increasing the risk of a crash. The separated component could also become a road hazard.</p>	<p>REMEDY Paccar will notify owners, and dealers will inspect and re-torque the each of the affected fasteners, free of charge. The safety recall is expected to begin during September 2012. Owners may contact Kenworth at 1-425-828-5440.</p>
USA	<p>VEHICLE MAKE / MODEL CODA / CODA-2012</p> <p>MANUFACTURER Coda Automotive</p> <p>COMPONENT AIR BAGS:SIDE/WINDOW</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 78</p> <p>SUMMARY CODA Automotive (CODA) is recalling certain model year 2012 CODA vehicles. The side curtain airbags may not have been properly installed which could cause them to not deploy as intended.</p> <p>No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the side curtain airbags may fail to deploy as intended, increasing the risk of injury.</p>	<p>REMEDY CODA will notify owners, and dealers will inspect and correct the side curtain airbag installations as needed, free of charge. CODA has not provided a notification schedule. Owners may contact CODA Automotive at 1-855-464-2632.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL FREIGHTLINER / 114SD-2009-2012 FREIGHTLINER / BUSINESS CLASS M2-2009-2012 FREIGHTLINER / CASCADIA-2009-2012 FREIGHTLINER / CORONADO-2009-2012 STERLING / 9500-2009-2012 WESTERN STAR / 4700-2009-2012</p> <p>MANUFACTURER DAIMLER TRUCKS NORTH AMERICA</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,663</p> <p>SUMMARY Daimler Trucks North America (DTNA) is recalling certain model year 2009-2012 Freightliner, Sterling, and Western Star vehicles manufactured from July 7, 2008, through December 15, 2011, and equipped with perpendicular air tank mounting brackets. The air tank mounting brackets may develop cracks which can lead to the air tank brackets separating from the frame rail. The air tanks may also separate from the vehicle. No picture available.</p>	<p>CONSEQUENCE Air tanks that become separated from a moving vehicle may create a road debris hazard, increasing the risk of a crash.</p>	<p>REMEDY DTNA will notify owners, and dealers will replace the air mounting brackets, free of charge. The recall is expected to begin on, or before, October 15, 2012. Owners may contact Daimler Trucks North America toll free at 1-800-547-0712.</p>
USA	<p>VEHICLE MAKE / MODEL TURTLE TOP / FORD ODYSSEY-2006-2010 TURTLE TOP / FORD VAN TERRA-2006-2010 TURTLE TOP / TERRA TRANSPORT-2006-2010</p> <p>MANUFACTURER TURTLE TOP</p> <p>COMPONENT EQUIPMENT ADAPTIVE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 577</p> <p>SUMMARY Turtle Top is recalling certain model year 2006-2010 transit buses equipped with Century-2 and/or Vista-2 wheelchair lifts. Over time with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. No picture available.</p>	<p>CONSEQUENCE A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY Turtle Top will notify owners, and the repairs will be performed by authorized Braun dealers free of charge. The recall is expected to begin during August 2012. Owners may contact Turtle Top at 574-831-4340.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL INTERNATIONAL / DURASTAR-2013 INTERNATIONAL / PROSTAR-2012-2013 INTERNATIONAL / TRANSTAR-2011-2013 INTERNATIONAL / WORKSTAR-2012-2013</p> <p>MANUFACTURER NAVISTAR, INC</p> <p>COMPONENT SERVICE BRAKES, AIR:DISC</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 943</p> <p>SUMMARY Navistar is recalling certain model year 2011-2013 International vehicles manufactured from November 2, 2010 through May 25, 2012, equipped with Bendix air disc brakes. Bolts that fasten the air disc brake caliper to the caliper mounting plate may not have been tightened to their specified torque. This may cause the mounting bolts to become loose and possibly allow the air disc brake caliper to separate from the caliper mounting plate, resulting in an unexpected pull condition during braking application or an unexpected increase in stopping distance.</p> <p>No picture available.</p>	<p>CONSEQUENCE An unexpected pull condition during braking application or an unexpected increase in stopping distance, increases the risk of a crash, leading to property damage, personal injury, or death.</p>	<p>REMEDY Navistar will notify owners, and dealers will replace any missing caliper mounting bolts and tighten caliper mounting bolts, free of charge. The safety recall is expected to begin on October 15, 2012. Owners may contact Navistar at 1-331-332-1590.</p>
USA	<p>VEHICLE MAKE / MODEL KAUFMAN / FLATBED-2011</p> <p>MANUFACTURER KAUFMAN TRAILERS, INC.</p> <p>COMPONENT SUSPENSION:REAR:AXLE:NON-POWERED AXLE ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 302</p> <p>SUMMARY Kaufman Trailers (Kaufman) is recalling certain model year 2011 flatbed trailers equipped with 10,000 lb. electric oil bath axles. The wheel end caps on the oil bath axles can leak due to a cracked cap or a damaged O-ring.</p> <p>No picture available.</p>	<p>CONSEQUENCE The oil may leak out of the wheel end caps and if the condition is not corrected, the loss of oil could result in unexpected wheel bearing failure which may increase the risk of a crash.</p>	<p>REMEDY Kaufman will notify owners and will replace the affected wheel end caps and o-rings free of charge. The recall is expected to begin on September 5, 2012. Owners may contact Kaufman Trailers at 1-866-444-8971.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>TIRE BRAND NAME / TIRE LINE / TIRE SIZE: VOGUE / CUSTOM BUILT / 225/50R17 VOGUE / SIGNATURE V / 245/45R18 VOGUE / SIGNATURE V / 225/50R17 VOGUE / SIGNATURE V / 235/50R18</p> <p>MANUFACTURER VOGUE TYRE & RUBBER CO.</p> <p>COMPONENT TIRES:MARKINGS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 701</p> <p>SUMMARY Certain Vogue Tyre & Rubber Company (Vogue) Custom Built tires, size 225/50R17, and Signature V tires, sizes 225/50R17, 235/50R18, and 245/45R18, produced in the weeks of 0112-3212 (January 1, 2012 through August 11, 2012) fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 139, "New Pneumatic Radial Tires for Light Vehicles." The tires do not have the full tire identification number (TIN) branded on the tire's outboard sidewall, as required by the standard. No picture available.</p>	<p>CONSEQUENCE In the event of a safety recall, tires missing a TIN from the outboard sidewall cannot be readily identified.</p>	<p>REMEDY Vogue will notify owners, and dealers will replace the noncompliant tires free of charge. Vogue has not provided a notification schedule. Owners may contact Vogue at 1-800-323-1466.</p>
USA	<p>TIRE BRAND NAME / TIRE LINE / TIRE SIZE: DYNAMIC TIRE / SAILUN S825 / 385/65R22.5</p> <p>MANUFACTURER DYNAMIC TIRE CORP.</p> <p>COMPONENT TIRES:SIDEWALL</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 44</p> <p>SUMMARY Dynamic Tire Corporation (Dynamic) is recalling certain Sailun S825 commercial application tires, size 385/65R22.5, produced between March and April 2012. The inner-liner thickness may be thinner than specification requirements. No picture available.</p>	<p>CONSEQUENCE The thinner inner-liner thickness may lead to sidewall separation, increasing the risk of a vehicle crash.</p>	<p>REMEDY Dynamic will notify owners, and dealers will replace the tires free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Dynamic at 1-905-595-3593.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. BESI / PRO-TECH III</p> <p>MANUFACTURER BESI, Inc.</p> <p>COMPONENT SEAT BELTS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 3,532</p> <p>SUMMARY BESI, Inc. (BESI) is recalling certain aftermarket child securement systems, model Pro-Tech III, manufactured from October 2011 through May 2012. These child restraints systems are sold as add on equipment for school bus transportation only. One of the two buckles can be pulled out with minimal hand pressure after being clicked. No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the seat occupant may not be properly restrained, possibly resulting in injury.</p>	<p>REMEDY BESI will notify owners and replace the restraint assemblies free of charge. The safety recall is expected to begin during August 2012. Owners may contact BESI at 1-800-543-8222.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

www.sgs.com/regulatorycompliance

© 2012 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

