

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 JULY 2012

## CONTENTS

### AUTOMOTIVE

Pages 1 to 20



[Motor Vehicle \(36\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(4\)](#)

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DAANGER</b>	<b>MEASURES ADOPTED</b>
<b>AUSTRALIA</b>	<p>Toyota—Toyota Hiace Van &amp; Commuter KDH 201/221/223 EGR Pipe &amp; Injectors</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Toyota Hiace Van &amp; Commuter vehicles fitted with 1KD-FTV diesel engine</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Recall Campaign numbers 2530 &amp; 2531 Target number: 19113</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Toyota dealers</p> <p><b>SUPPLIER</b></p> <p>Toyota No picture available.</p>	<p><b>HAZARDS</b></p> <p>(1) Poisonous exhaust gases may enter the cabin of the vehicle. (2) Leaking diesel fuel may pose a hazard to other road users and/or present a fire hazard.</p> <p><b>DEFECTS</b></p> <p>Toyota Hiace Van and Commuter vehicles equipped with the 1KD-FTV diesel engine may have two potential issues:</p> <p>(1) The Exhaust Gas Recirculation (EGR) system pipes may not be able to withstand the stress that occurs when the pipe expands and contracts due to the heat of the exhaust gases. This condition may cause the pipe to fracture and the exhaust gases to leak into the cabin of the vehicle. (2) The fuel injector pipes may have been over-tightened, causing cracking of the injectors. In the worst case, diesel fuel may leak from the crack and cause an engine fire or road hazard.</p>	<p>Owners of the affected vehicles will be notified by mail. Subject to the production dates of the vehicles, one of the following repairs may be required:</p> <p>(1) Replace the injectors and injector pipes; or (2) Replace the EGR pipe This will be performed at NO COST to the vehicle owner.</p>
<b>AUSTRALIA</b>	<p>Toyota—Daihatsu Pyzar G301 &amp; G303 Models</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Daihatsu Pyzar G301 &amp; G303 models</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Recall campaign number: 99201</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Toyota &amp; Daihatsu dealers nationally</p> <p><b>SUPPLIER</b></p> <p>Toyota No picture available.</p>	<p><b>HAZARDS</b></p> <p>The SRS airbag may spontaneously deploy, causing an accident and injury to the occupants and/or other road users.</p> <p><b>DEFECTS</b></p> <p>There is potential for a coolant leak to develop from the heater core. Leaking coolant may enter the ECU and cause a short circuit. In the worst case scenario the SRS airbag could deploy unexpectedly.</p>	<p>Owners of the affected vehicles will be notified by mail. Daihatsu Service Outlets will inspect and check the condition of the heater core for leakage and the SRS airbag ECU connector terminal for contamination.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Western Star Trucks Australia Pty Ltd—Dennis Eagle Elite 2 Steering Wheels</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Steering wheels fitted in some Dennis Eagle Elite 2 vehicles</p> <p><b>IDENTIFYING FEATURES</b></p> <p>See attached <a href="#">VIN list</a>.</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Western Star Trucks dealers</p> <p><b>SUPPLIER</b></p> <p>Western Star Trucks Australia Pty Ltd</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>The steering wheel may detach, resulting in a crash hazard.</p> <p><b>DEFECTS</b></p> <p>The affected vehicles may have been insufficiently arc welded at the steering wheel boss where it connects to the main steering wheel frame.</p>	<p>Contact the nearest authorised Western Star Trucks dealer for inspection and replacement.</p>
EU/UNITED KINGDOM	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car "Defender" (Variants include Defender 90 vehicles 110 Chassis Cab, Truck Cab, Soft Top, Hard Top, Pick Up, High Capacity Pick Up vehicles and 130 Double Cab Pick Up vehicles)</p> <p><b>BRAND:</b> Land Rover</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns certain vehicles built between February 2010 and January 2012. Chassis ranges are:</p> <p>SALLDHWT8BW072831 – SALLDHWR7CK0766, SALLDWNS7BA400000 – SALLDWP7CA416856 and SALLDKWT7BA799521 – SALLDWNS7BA826096.</p> <p><b>DESCRIPTION:</b> Passenger car.</p> <p><b>COUNTRY OF ORIGIN:</b> United Kingdom</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>There is a risk that the seat belt mounting bracket may fail which would give reduced protection to the user.</p>	<p>Recall of the product from end users.</p>
EU/ PORTUGAL	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car X5, M X5, X6, M X6</p> <p><b>BRAND:</b> BMW</p> <p>Type/number of model: X5 and M X5, E70 / X6 M X6, E71 from 20/04/2012 till 04/06/2012. Right-hand drive vehicles are not concerned.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Germany</p> <p>No picture available.</p>	<p><b>FIRE</b></p> <p>A pressure drop could arise in the hydraulic steering system causing a sudden loss of power steering assistance. Under certain circumstances, hydraulic oil could spray on hot components in the engine compartment and ignite.</p>	<p>Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car "Ibiza"</p> <p><b>BRAND:</b> SEAT</p> <p><b>TYPE/NUMBER OF MODEL:</b> Ibiza (6J)</p> <p>The recall concerns 2010 to 2012 model years vehicles, manufactured between 01.04.2010 and 31.11.2011, with VINs: from AR143084 to AR184079, from BR000014 to BR195025 and from CR000001 to CR095811.</p> <p><b>DESCRIPTION:</b> Passenger car.</p> <p><b>COUNTRY OF ORIGIN:</b> Spain</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>The bonnet release lever may rub against the A-pillar housing causing obstruction of the release lever. This could stop the bonnet from closing properly and, as a result, it might open while the vehicle is being driven, leading to an accident.</p>	<p>Recall of the product from end users.</p>
EU/GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car / van "Viano", "Vito"</p> <p><b>BRAND:</b> Mercedes-Benz</p> <p><b>TYPE/NUMBER OF MODEL:</b> Type: 639, model: EC type approval: e1*2007/46*0457, e1*2007/46*0458, e1*2007/46*0459</p> <p>The vehicles in question were manufactured between 2 March 2012 and 6 March 2012.</p> <p><b>DESCRIPTION:</b> Passenger car / van.</p> <p><b>COUNTRY OF ORIGIN:</b> Germany</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>The bolts of the safety belt in the area of the 'B' pillar may not have been tightened with the required torque. In this case, in the event of an accident, the retaining function of the safety belt cannot be completely guaranteed.</p>	<p>Recall of the product from end users.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>prevost / h3-45-2007-2011</p> <p>prevost / x3-45-2009-2011</p> <p><b>MANUFACTURER</b></p> <p>prevost cars, inc.</p> <p><b>COMPONENT</b></p> <p>vehicle speed control: accelerator pedal</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>400</p> <p><b>SUMMARY</b></p> <p>Prevost is recalling certain model year 2007-2011 h3-45 and model year 2009-2011 x3-45 coaches equipped with volvo d13 engines. the accelerator pedal throttle position sensor may be inoperative due to a permanent idle signal.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If this occurs, the vehicle may stop responding to input from the accelerator pedal, and thus become stopped in traffic, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Prevost will notify owners, and dealers will replace the accelerator pedal throttle sensor, free of charge. The recall is expected to begin in July 2012. Owners may contact prevost at 1-418-883-2888.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/IRELAND	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Honda</p> <p><b>NAME:</b> Jazz and Civic</p> <p><b>TYPE/NUMBER OF MODEL:</b></p> <p>Vehicles and production range concerned are as follows:</p> <p>CHAC Jazz 1.4: 2009, 2010, 2011</p> <p>HUM Jazz 1.4: 2009, 2010, 2011</p> <p>Sss Jazz 1.4: 2009, 2010, 2011</p> <p>HUM Civic 5dr 1.4: 2009, 2010, 2011</p> <p>HUM Civic 3dr 1.8: 2009</p> <p>HUM Civic 3dr 1.4: 2009, 2010, 2011</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Passenger car.</p> <p><b>COUNTRY OF ORIGIN:</b> United Kingdom</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>Due to a software error in the transmission control unit, if the vehicle is parked in reverse gear and the engine restarted and neutral or first gear is then selected, the vehicle may not move, may stall or in the worst case may move backwards unexpectedly. This unexpected reverse movement could cause an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users.</p>
EU/GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Opel</p> <p><b>NAME:</b> Zafira</p> <p><b>TYPE/NUMBER OF MODEL:</b> Type: A-H/ Monocab, A-H Monocab/V, P-J/SW. EC type approval: e1*2007/46*0497*01, e1*2007/46*0595*02, e4*2007/46*0204*06</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Passenger car.</p> <p><b>COUNTRY OF ORIGIN:</b> Germany</p> <p>No picture available.</p>	<p><b>FIRE</b></p> <p>On some vehicles, compressed natural gas (CNG) valves have been fitted which, as a result of production variations, have an incorrect internal diameter. This can cause natural gas to escape from the CNG cylinders leading to a fire hazard.</p>	<p>Voluntary measures: Recall of the product from end users.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DAANGER</b>	<b>MEASURES ADOPTED</b>
<b>AUSTRALIA</b>	<p>Chrysler Australia—Jeep Wrangler</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>2010 JK Jeep Wrangler</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign number M22</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Chrysler Jeep Dodge dealerships</p> <p><b>SUPPLIER</b></p> <p>Chrysler Australia</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>If an excessive amount of debris collects in the underbody, the catalytic converter could ignite it, causing an underbody fire without warning.</p> <p><b>DEFECTS</b></p> <p>The transmission skid plate on the 2010 JK Jeep Wrangler may allow debris to collect around the catalytic converter.</p>	<p>Chrysler Australia Pty Ltd will write to owners of all affected vehicles. Alternatively, consumers may contact their nearest authorised Chrysler Jeep Dodge distributor/dealership to schedule a service appointment at their convenience.</p>
<b>USA</b>	<p><b>VEHICLE MAKE / MODEL</b></p> <p>piece / arrow xt-2010-2012</p> <p>piece / contender big block-2010-2012</p> <p>piece / dash cf-2010-2012</p> <p>piece / quantum-2010-2012</p> <p>piece / velocity-2010-2012</p> <p><b>MANUFACTURER</b></p> <p>piece manufacturing</p> <p><b>COMPONENT</b></p> <p>fuel system, diesel</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>313</p> <p><b>SUMMARY</b></p> <p>Pierce is recalling certain model year 2010-2012 vehicles manufactured from august 28, 2010, through March 27, 2012, equipped with detroit diesel dd13 epa 2007 and epa 2010 diesel engines. The pump to rail high pressure fuel line support system used on these engines is sensitive to assembly torque and may be damaged during service work. As a result of other repairs, the line supports may loosen, potentially leading to fuel line cracking and a fuel leak.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A fuel leak in the presence of an ignition source may result in a fire.</p>	<p><b>REMEDY</b></p> <p>Pierce will notify owners, and the high pressure fuel line support system will be replaced by Daimler truck north America (dtna) authorized service facilities, free of charge. The safety recall will begin in July 2012. Owners may contact dtna at 1-800-547-0712 or piece manufacturing, inc. at 1-920-832-3000.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>zero / zero ds-2011-2012</p> <p>zero / zero mxd-2011</p> <p>zero / zero s-2011-2012</p> <p>zero / zero x-2012</p> <p>zero / zero xd-2011</p> <p>zero / zero xu-2011-2012</p> <p><b>MANUFACTURER</b></p> <p>zero motorcycles inc.</p> <p><b>COMPONENT</b></p> <p>exterior lighting: brake lights: switch</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>450</p> <p><b>SUMMARY</b></p> <p>Zero motorcycles, inc. (zero) is recalling certain model year 2011 and 2012 s, xu, and ds motorcycles, model year 2011 mxd, and xd motorcycles and 2012 x motorcycles. The brake light switch at the front brake lever may not activate until significant brake lever travel occurs. No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The brake light may not activate when a moderate amount of front brake is applied. As such, motorists traveling behind the motorcycle may not be alerted when an affected motorcycle is slowing down, which could lead to a possible crash and potential injury or death to the rider.</p>	<p><b>REMEDY</b></p> <p>Zero will notify owners, and dealers will inspect and, if necessary, replace the front brake system brake-light switch free of charge. The safety recall is expected to begin on, or about, July 16, 2012. Owners may contact zero motorcycles at 1-831-438-3500.</p>
AUSTRALIA	<p>Marine Power International Pty Ltd—MerCruiser 8.2L Petrol SternDrive and Inboard Engines</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>8.2 L Petrol SternDrive and inboard marine engines</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Serial numbers 1A350340 - 2A030176</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Mercruiser dealers</p> <p><b>SUPPLIER</b></p> <p>Marine Power International Pty Ltd</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://mercurymarine.com.au">http://mercurymarine.com.au</a></p> <p>No picture is available.</p>	<p><b>HAZARDS</b></p> <p>A fuel leak could result in the boat catching fire.</p> <p><b>DEFECTS</b></p> <p>A fuel leak may occur at the balance hose connection to the fuel rail.</p>	<p>Deliver the boat to an authorised Mercruiser dealer who will replace the balance hose and attaching hardware.</p> <p>For your nearest dealer location, please use the dealer locator feature at <a href="http://www.mercurymarine.com.au">www.mercurymarine.com.au</a></p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> Isuzu / amigo-1998-2001 Isuzu / rodeo sport-2002</p> <p><b>MANUFACTURER</b> Isuzu manufacturing services of America</p> <p><b>COMPONENT</b> suspension: rear</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 11,221</p> <p><b>SUMMARY</b> Isuzu is recalling certain model year 1998-2000 amigo and model year 2001-2002 rodeo sport vehicles, that were originally sold, or are currently registered, in the states of Maine, New Hampshire, Vermont, Massachusetts, Rhode Island, Connecticut, New York, New Jersey, Pennsylvania, Delaware, Maryland, the district of Columbia, west Virginia, Ohio, Indiana, Michigan, Illinois, Wisconsin, Minnesota, Iowa, Missouri, and Kentucky. These vehicles may experience excessive corrosion in the vicinity of the forward mounting point bracket for the left or right rear suspension lower link.  No picture available.</p>	<p><b>CONSEQUENCE</b> Excessive corrosion may result in the left or right rear suspension lower link bracket becoming detached from the frame, which can affect vehicle handling and increase the risk of a crash.</p>	<p><b>REMEDY</b> Dealers will inspect the rear suspension lower link bracket area. for vehicles in which little or no corrosion is found, the area will be treated with an anti-corrosive compound. for vehicles in which corrosion has damaged the rear suspension lower link bracket and affected its connection to the vehicle frame, a reinforcement bracket will be installed. In the rare event the corrosion is so severe that the reinforcement bracket remedy would not be appropriate, Isuzu will offer to repurchase the vehicle for an amount based on the Kelley Blue Book "private party" price. All inspections and remedies will be provided free of charge for vehicles that are 10 years old or less. For vehicles older than 10 years, Isuzu will offer a free remedy, but only if the vehicle is presented to an Isuzu service facility dealer within 12 months of when owner notifications were issued. The recall is expected to begin during late July 2012. Isuzu owners may contact Isuzu at 1-800-255-6727.</p>
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle "1199 Panigale"</p> <p><b>BRAND:</b> Ducati</p> <p><b>TYPE/NUMBER OF MODEL:</b> 1199 Panigale (all versions)</p> <p>The recall affects motorcycles with VINs from ZDM14BPW4CB000448 to ZDMH800ABCB004088.</p> <p><b>DESCRIPTION:</b> Motorcycle.</p> <p><b>COUNTRY OF ORIGIN:</b> Italy</p> <p>No picture available.</p>	<p><b>INJURIES</b> An incorrect screw for retaining the swingarm to the rear suspension linkage may have been fitted. This could cause an accident, injuring the rider.</p>	<p>Recall of a product from end users.</p>



<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> chevrolet / captiva sport-2012</p> <p><b>MANUFACTURER</b> general motors llc</p> <p><b>COMPONENT</b> parking brake</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 2,070</p> <p><b>SUMMARY</b> General motors llc (gm) is recalling certain model year 2012 chevrolet captiva sport passenger vehicles manufactured from April 26, 2012, through May 17, 2012. These vehicles fail to conform to the park brake performance requirements federal motor vehicle safety standard no. 135, "light vehicle brake systems." The park brake cable may not be fully seated in its connector and may separate from the connector. If this occurs, the park brake will become inoperative and will not hold the vehicle. No picture available.</p>	<p><b>CONSEQUENCE</b> If the vehicle is on an uneven surface, this could result in unintended vehicle movement and a crash.</p>	<p><b>REMEDY</b> Gm will notify owners, and dealers will inspect and ensure that the park brake cables are connected and secure free of charge. The safety recall is expected to begin on, or about, July 18, 2012. Owners may contact the chevrolet owner center at 1-866-694-6546.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> prevost / mth xlii-45e-2010 prevost / x3-45-2010</p> <p><b>MANUFACTURER</b> prevost cars, inc.</p> <p><b>COMPONENT</b> wheels: lugs/nuts/bolts</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 2</p> <p><b>SUMMARY</b> Prevost is recalling one model year 2010 x3-45 and one model year 2010 mth xlii-45e coach. Due to improper hardware, the tag axle hub cap screws may loosen, resulting in wheel separation. No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, the driver may lose control of the vehicle, increasing the risk of a crash. Also, a wayward wheel represents a road hazard to other road users.</p>	<p><b>REMEDY</b> Prevost has replaced the tag axle hub cap screws in the affected vehicles. Therefore, owner notifications will not be mailed. Owners may contact prevost at 1-418-883-2888.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>prevost / vip 45-2012 prevost / x3-45-2012 prevost / xlii-2012</p> <p><b>MANUFACTURER</b></p> <p>prevost cars, inc.</p> <p><b>COMPONENT</b></p> <p>steering: gear box (other than rack and pinion)</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>52</p> <p><b>SUMMARY</b></p> <p>Prevost is recalling certain model year 2012 vip45, x3-45, and xlii vehicles. The steering gearbox bolts may be too long to have been sufficiently torqued.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Over time, the steering gearbox bolts may start to loosen, leading to reduced steering function, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Prevost will notify owners and dealers will replace the bolts, free of charge. The safety recall is expected to begin in July 2012. Owners may contact prevost car inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>bmw / active-2011 bmw / z4-2012</p> <p><b>MANUFACTURER</b></p> <p>bmw of north America, llc</p> <p><b>COMPONENT</b></p> <p>steering: electric power assist system</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>162</p> <p><b>SUMMARY</b></p> <p>Bmw is recalling certain model year 2011 1-series active e and model year 2012 z4 vehicles. Variations in electrical current may occur within the electric power steering assistance system, leading to sudden loss of power steering assistance.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Sudden loss of steering assistance may increase the steering effort required to control the direction of a vehicle, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Bmw will notify owners, and dealers will replace the steering assistance module, free of charge. The safety recall is expected to begin during July 2012. Owners may contact bmw customer relations at 1-800-525-7417.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>  glaval / Apollo-2007 2009-2012  glaval / concorde ii-2009-2010  glaval / entourage-2010-2011  glaval / primetime-2008-2010  glaval / sport-2008-2009  glaval / titan-2008-2009  glaval / titan ii-2010-2011  glaval / universal-2006-2011</p> <p><b>MANUFACTURER</b>  glaval bus division</p> <p><b>COMPONENT</b>  equipment adaptive</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b>  381</p> <p><b>SUMMARY</b>  Glaval is recalling certain buses equipped with braun century-2 and/or vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned.  No picture available.</p>	<p><b>CONSEQUENCE</b>  A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p><b>REMEDY</b>  Glaval will notify owners, and the repairs will be performed by authorized braun dealers free of charge. Owners may contact glaval bus at 1-800-347-7440.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>  ford / escape-2013</p> <p><b>MANUFACTURER</b>  ford motor company</p> <p><b>COMPONENT</b>  structure</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b>  8,266</p> <p><b>SUMMARY</b>  Ford is recalling certain model year 2013 escape vehicles manufactured from March 8, 2012 through June 7, 2012. Due to mis-positioned carpet padding the center console trim panel may be pushed outboard of the intended position, reducing clearance relative to the pedal package.  No picture available.</p>	<p><b>CONSEQUENCE</b>  The reduced clearance may result in the driver's foot contacting the side of the brake pedal while transferring the foot from the accelerator pedal to the brake pedal, increasing stopping distances and the risk of a crash.</p>	<p><b>REMEDY</b>  Ford will notify owners, and dealers will remove the carpet padding and left-side console trim panel replaced with a new panel, free of charge. The recall is expected to begin on July 23, 2012. Owners may contact ford at 1-866-436-7332.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> ford / f-650-2012 ford / f-750-2012</p> <p><b>MANUFACTURER</b> ford motor company</p> <p><b>COMPONENT</b> visibility: windshield</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 783</p> <p><b>SUMMARY</b> Ford is recalling certain model year 2012 f-650 and f-750 vehicles manufactured from February 1, 2012 through March 16, 2012. The clear and black primer may be missing on certain windshields which may result in an insufficient bond between the glass and cab structure.  No picture available.</p>	<p><b>CONSEQUENCE</b> An insufficient bond may result in a separation of the windshield from the cab, increasing the risk of personal injury or death.</p>	<p><b>REMEDY</b> Ford will notify owners, and dealers will remove and inspect the windshield for urethane adhesion, and replace or reinstall the windshield as required, free of charge. The recall is expected to begin on July 16, 2012. Owners may contact ford at 1-866-436-7332.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> volvo / s80-2011-2013</p> <p><b>MANUFACTURER</b> volvo cars of n.a. llc.</p> <p><b>COMPONENT</b> power train: automatic transmission: control module (tcm, pcm)</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1,469</p> <p><b>SUMMARY</b> Volvo is recalling certain model year 2011-2013 s80 vehicles. A software error may prevent the transmission from downshifting such as shifting from fifth to fourth gear when coasting.  No picture available.</p>	<p><b>CONSEQUENCE</b> This may result in decreased engine rpms and possible engine stall, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Volvo will notify owners, and dealers will upgrade the software to the transmission control module, free of charge. The safety recall is expected to begin on, or about, July 19, 2012. Owners may contact volvo cars at 1-800-458-1552.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> volvo bus / 9700-2009-2011</p> <p><b>MANUFACTURER</b> prevost cars, inc.</p> <p><b>COMPONENT</b> seats</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 165</p> <p><b>SUMMARY</b> Prevost is recalling certain model year 2009-2011 volvo 9700 transit buses. During production, the passenger seat wall mounting tracks may have not been properly secured to the structure. No picture available.</p>	<p><b>CONSEQUENCE</b> In the event of a crash, there is an increased risk of personal injury to passengers.</p>	<p><b>REMEDY</b> Volvo bus will notify owners and dealers will inspect and repair the passenger seat wall tracks free of charge. Owners may contact prevost car inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> prevost / x3-45-2007-2009</p> <p><b>MANUFACTURER</b> prevost cars, inc.</p> <p><b>COMPONENT</b> electrical system: battery: cables</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 428</p> <p><b>SUMMARY</b> Prevost is recalling certain model year 2007-2009 x3-45 coaches equipped with volvo d13 engines. The jump-start positive terminal block cable may be missing a protective sleeve, which may allow a short-circuit if it contacts other vehicle structures. No picture available.</p>	<p><b>CONSEQUENCE</b> If a short-circuit occurs, there is an increased risk of fire.</p>	<p><b>REMEDY</b> Prevost will notify owners, and dealers will inspect the cable and, as necessary, add protective tubing free of charge. The recall is expected to begin in July 2012. Owners may contact prevost at 1-418-883-2888.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> safari coach / simba diesel-2008</p> <p><b>MANUFACTURER</b> navistar, inc</p> <p><b>COMPONENT</b> service brakes, hydraulic</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1</p> <p><b>SUMMARY</b> Navistar is recalling one model year 2008 safari simba diesel recreational vehicle manufactured on June 29, 2007, equipped with bosch hydraulic brakes. Hydraulic brake equipped motorhome chassis exposed to long periods of time of non-driving may experience diametrical brake caliper piston growth and reduced piston to bore clearance potentially leading to brake drag and overheating resulting in reduced brake performance. No picture available.</p>	<p><b>CONSEQUENCE</b> Reduced brake performance may lead to an increased risk of a crash.</p>	<p><b>REMEDY</b> Navistar will notify the owner, and an authorized daimler trucks North America (dtna) dealer will inspect and, as necessary, replace the brake calipers, free of charge. The safety recall is expected to begin on or before July 20, 2012. Owners may contact dtna at 1-800-547-0712.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> prevost / h3-45-2008-2010 prevost / x3-45-2009-2010 prevost / xlii-45e-2009</p> <p><b>MANUFACTURER</b> prevost cars, inc.</p> <p><b>COMPONENT</b> equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 98</p> <p><b>SUMMARY</b> Prevost is recalling certain model year 2008-2010 h3-45, model year 2009-2010 x3-45, and model year 2009 mth xlii-45e vehicles, all equipped with volvo d13 engines and an automatic fire detection and suppression system (afss) . The afss linear thermal detector may come in contact or rub against brackets or clamps. No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, the afss may activate with no fire present and the stop engine feature will be activated, bringing the vehicle to an unplanned stop, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Prevost will notify owners and dealers will inspect and secure the linear thermal detector, free of charge. The safety recall is expected to begin in July 2012. Owners may contact prevost car inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> mack / chu-2012 mack / cxu-2012 mack / gu-2012</p> <p><b>MANUFACTURER</b> mack trucks, inc</p> <p><b>COMPONENT</b> visibility: windshield wiper/washer: linkages</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1,174</p> <p><b>SUMMARY</b> Mack is recalling certain model year 2012 chu, cxu, and gu vehicles, manufactured from October 10, 2011, through November 17, 2011. Hardware used to secure the windshield wiper linkage to the wiper motor may not be sufficiently torqued, and may cause the windshield wiper linkage to detach from the wiper motor. As a result, the windshield wipers will not function.  No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, under certain driving conditions the driver's visibility will be reduced, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Mack will notify owners, and replace the hardware on affected vehicles, free of charge. The safety recall is expected to begin on or before August 6, 2012. Owners may contact mack trucks at 1-800-866-1177.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> ford / e-350-2010</p> <p><b>MANUFACTURER</b> prime-time specialty vehicles</p> <p><b>COMPONENT</b> equipment adaptive</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1</p> <p><b>SUMMARY</b> Prime-time specialty vehicles (prime-time) is recalling one model year 2010 ford e350 super van equipped with a braun century-2 wheelchair lift. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned.  No picture available.</p>	<p><b>CONSEQUENCE</b> A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p><b>REMEDY</b> Prime-time will notify the owner, and the repairs will be performed by an authorized braun dealer free of charge. Owners may contact prime-time at 1-574-293-9191.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> tiffin / allegro-2006-2010 tiffin / allegro bay-2006-2010</p> <p><b>MANUFACTURER</b> tiffin motorhomes, inc.</p> <p><b>COMPONENT</b> service brakes, hydraulic</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1,304</p> <p><b>SUMMARY</b> Tiffin is recalling certain model year 2006 through 2010 allegro and allegro bay recreational vehicles equipped with bosch hydraulic brakes. Hydraulic brake equipped motorhome chassis exposed to long periods of time of non-driving may experience diametrical brake caliper piston growth and reduced piston to bore clearance potentially leading to brake drag and overheating resulting in reduced brake performance.  No picture available.</p>	<p><b>CONSEQUENCE</b> Reduced brake performance may lead to an increased risk of a crash.</p>	<p><b>REMEDY</b> Tiffin will notify the owners, and authorized daimler trucks north america (dtna) dealers will inspect and, as necessary, replace the brake calipers free of charge. The safety recall is expected to begin on or before July 20, 2012. Owners may contact dtna at 1-800-547-0712.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> entegra / anthem-2011-2013 entegra / aspire-2011-2013 entegra / cornerstone-2012-2013</p> <p><b>MANUFACTURER</b> entegra coach</p> <p><b>COMPONENT</b> visibility: windshield wiper/washer: linkages</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 232</p> <p><b>SUMMARY</b> Entegra is recalling certain model year 2011-2013 anthem and aspire and model year 2012-2013 cornerstone motor homes manufactured from April 19, 2011, through June 22, 2012. The windshield wiper arm can detach from the vehicle.  No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, the driver's visibility can be reduced, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Entegra will notify owners, and dealers will replace the shaft attaching the arm to the wiper linkage, free of charge. The safety recall is expected to begin during July 2012. Owners may contact entegra at 1-800-945-4787.</p>



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>zero / zero ds-2012 zero / zero s-2012 zero / zero x-2012 zero / zero xu-2012 zero / zero xu-lsm-2012</p> <p><b>MANUFACTURER</b></p> <p>zero motorcycles inc.</p> <p><b>COMPONENT</b></p> <p>electrical system: battery</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>254</p> <p><b>SUMMARY</b></p> <p>Zero motorcycles, inc. (zero) is recalling certain model year 2012 s, ds, x, xu, and xu-lsm motorcycles. Insufficient weatherproofing may cause a short circuit of the battery management system when subjected to wet conditions, resulting in the motorcycle inadvertently losing power.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Sudden loss of power can lead to a crash and potential injury or death to the rider.</p>	<p><b>REMEDY</b></p> <p>Zero will notify owners, and dealers will repair the motorcycles free of charge. The safety recall is expected to begin on, or about, July 16, 2012. Owners may contact zero motorcycles, inc. at 1-888-786-9376.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>campagna / v13r-2011-2012</p> <p><b>MANUFACTURER</b></p> <p>campagna motors</p> <p><b>COMPONENT</b></p> <p>seat belts: front: anchorage</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>67</p> <p><b>SUMMARY</b></p> <p>Campagna motors (campagna) is recalling certain model year 2011 and 2012 v13r three wheel vehicles manufactured from august 2010 through June 2012. The seat belt buckle assembly on the vehicle chassis may have been installed improperly. The hardware used to install the buckle on the chassis may have been reversed.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the case of a frontal impact, the seat occupant may not be adequately restrained and could be injured.</p>	<p><b>REMEDY</b></p> <p>Campagna will notify owners, and dealers will inspect and, if necessary, repair the vehicles free of charge. The safety recall is expected to begin during August 2012. Owners may contact campagna at 1-877-641-2112 ext. 222 or 1-450-641-2112 ext. 222.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> prevost / x3-45-2013</p> <p><b>MANUFACTURER</b> prevost cars, inc.</p> <p><b>COMPONENT</b> suspension: front</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 8</p> <p><b>SUMMARY</b> Prevost is recalling certain model year 2013 x3-45 motor coaches, manufactured from may 4, 2012, through July 6, 2012. The front suspension radius rods may not be properly torqued. As a result, the rods could detach. No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, the driver may suddenly lose control of the vehicle, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Prevost will notify owners and dealers will inspect and retorque the front suspension bolts, free of charge. The safety recall is expected to begin in July 2012. Owners may contact prevost car inc., service department toll-free at 1-866-870-2046 or 1-418-831-2046.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> nabi / 45clfw-2003-2011</p> <p><b>MANUFACTURER</b> north american bus industries, inc.</p> <p><b>COMPONENT</b> steering:gear box:shaft pitman</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 331</p> <p><b>SUMMARY</b> North American bus industries (nabi) is recalling certain model year 2003-2011 45clfw transit buses manufactured from July 1, 2003, through December 1, 2011. The vehicles may have a loose connection in the joint between the steering pitman arm and a tapered splined shaft on the steering gear. The splines may wear over time resulting in loss of steering control. No picture available.</p>	<p><b>CONSEQUENCE</b> A loss of steering control could result in a crash, increasing the risk of injury.</p>	<p><b>REMEDY</b> Nabi will inspect and repair vehicles, as necessary, free of charge. Owners may contact nabi at 1-256-831-4296.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</b></p> <p>thunderbird / brake hose</p> <p><b>MANUFACTURER</b></p> <p>thunderbird headquarters</p> <p><b>COMPONENT</b></p> <p>service brakes, hydraulic: foundation components: hoses, lines/piping, and fittings</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>542</p> <p><b>SUMMARY</b></p> <p>Thunderbird headquarters (thunderbird hq) is recalling certain brake hoses, part numbers 2078/9, 2078a, 2282, b2078aa, b2078b, b2078c, b2282a, b2282b, and b2282c sold as service parts for certain model year 1955 through 1966 ford thunderbird vehicles. These hoses fail to conform to the crimping and diameter requirement of federal motor vehicle safety standard no. 106, "brake hoses."</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>These issues can result in a brake fluid leak and loss of braking capability, increasing the risk of a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Thunderbird hq will notify known purchasers of the subject brake hoses and replace any affected hoses with compliant hoses at no charge to the owners. The safety recall is expected to begin during July 2012. Owners may contact thunderbird hq at 1-925-825-9550.</p>
USA	<p><b>TIRE BRAND NAME / TIRE LINE / TIRE SIZE:</b></p> <p>big foot / big o s/t / 235/70r16</p> <p>big foot / big o s/t / 265/70r17</p> <p>mirada / cross tour slx / 235/70r16</p> <p>mirada / cross tour slx / 265/70r17</p> <p><b>MANUFACTURER</b></p> <p>tbc corporation</p> <p><b>COMPONENT</b></p> <p>tires: sidewall</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>72,938</p> <p><b>SUMMARY</b></p> <p>Tbc corporation (tbc) is recalling certain mirada cross tour slx and big foot/big o s/t tires, sizes 235/70r16 and 265/70r17, manufactured from January 2009 through January 2011 (weeks 0409 through 0411). These tires possess a manufacturing anomaly which may result in a crack or separation in the lower sidewall.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If left in service, the crack/separation could grow and rapid air loss may occur, increasing the risk of a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Tbc will notify owners, and dealers will replace the tires free of charge. Free mounting and balancing will also be included, as applicable. The recall is expected to begin on July 20, 2012. Owners may contact tbc at 1-901-363-8030.</p>

<b>AUTO: MOTOR VEHICLE EQUIPMENT</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</b></p> <p>webasto / hollandia 600 webasto / hollandia 700 webasto / hollandia tvs 900</p> <p><b>MANUFACTURER</b></p> <p>columbus car audio</p> <p><b>COMPONENT</b></p> <p>visibility: sun roof assembly</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>333</p> <p><b>SUMMARY</b></p> <p>Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by columbus car audio on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto detailer by clicking on the hyperlink affected vehicle list or you may visit webasto's website at <a href="http://www.sunroofcheck.com">http://www.sunroofcheck.com</a>. you can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</b></p> <p>seer / s1602-nov 01, 2008 - jun 21, 2012 seer / s1602v-nov 01, 2008 - jun 21, 2012 seer / s1608-nov 01, 2008 - jun 21, 2012 seer / s1608v-nov 01, 2008 - jun 21, 2012</p> <p><b>MANUFACTURER</b></p> <p>super seer corporation</p> <p><b>COMPONENT</b></p> <p>equipment: motorcycle: helmets</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>186</p> <p><b>SUMMARY</b></p> <p>Super seer corporation (super seer) is recalling certain motorcycle helmets, models s1602, s1602v, s1608, and s1608v. Only the extra large size helmets are being recalled. These helmets fail to conform to the penetration and retention requirements of federal motor vehicle safety standard no. 218, "motorcycle helmets."</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a crash, the wearer of the helmet may not be adequately protected, possibly resulting in injury or death.</p>	<p><b>REMEDY</b></p> <p>Super seer will notify owners and replace the noncompliant helmets free of charge. The safety recall is expected to begin on, or about, July 15, 2012. Owners may contact super seer customer service at 1-303-674-6663.</p>

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[gcsc@sgs.com](mailto:gcsc@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2012 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

