

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 JUNE 2012

## CONTENTS

### AUTOMOTIVE

Pages 1 to 23



[Motor Vehicle \(40\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(5\)](#)

**SGS**

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
EU/ GERMANY	<p><b>CORRIGENDUM</b></p> <p>Notification below from the PRODUCT RECALLS- Automotive- August 01-15 –2009 has been permanently removed following clarification of the risk assessment by the notifying authorities.</p> <p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Scooter</p> <p><b>BRAND:</b> YiYing</p> <p><b>TYPE/NUMBER OF MODEL:</b> Model YY50QT, EC type approval e4*2002/24*0323*00*05</p> <p><b>DESCRIPTION:</b> The vehicles concerned were manufactured in the period May-June 2008 and have serial numbers in the ranges: LD5TCBPA08C100000 to LD5TCBPA08C103036 and LD5TCBPA08C105002 to LD5TCBPA08C106855</p> <p><b>COUNTRY OF ORIGIN:</b> China</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries because, due to a faulty electrical control unit, the maximum speed substantially exceeds the maximum design speed of 45 kmh.</p>	<p>Voluntary recall from consumers by the manufacturer.</p>
AUSTRALIA	<p>Robert Bosch (Australia) Pty Ltd—Semi-trailer air park-brake controllers</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Semi-trailer air park-brake controllers</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Part numbers: F026A054683YX - SK3012 F026A091343YX - SK2012</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Krueger Transport Equipment</p> <p><b>SUPPLIER</b></p> <p>Robert Bosch (Australia) Pty Ltd</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>The park brake may engage spontaneously while the vehicle is moving, possibly causing an accident.</p> <p><b>DEFECTS</b></p> <p>The park brake may engage by itself on trailers fitted with these parts.</p>	<p>If you have an affected park brake controller, please contact Krueger Transport Equipment on (03) 9366 2133 or email vicsales@kreuger.com.au to organise for a replacement air park-brake controller.</p>
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle GSX-R1000</p> <p><b>BRAND:</b> SUZUKI</p> <p><b>TYPE/NUMBER OF MODEL:</b> Models GSX-R1000 K9/L0/L1</p> <p><b>DESCRIPTION:</b> Motorcycle.</p> <p><b>COUNTRY OF ORIGIN:</b> Japan</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>Under certain conditions, the bolts securing the side stand switch may loosen and come out. If this happens, the switch may become misaligned with the side stand and may not detect that the side stand is retracted.</p>	<p>Recall ordered by the authorities.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
<b>AUSTRALIA</b>	<p>Isuzu Australia Limited—F Series Vehicle</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>F Series vehicle</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Recall campaign number: 12-Z-02 Traget number: 292</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Isuzu dealers</p> <p><b>SUPPLIER</b></p> <p>Isuzu Australia Limited No picture available.</p>	<p><b>HAZARDS</b></p> <p>Steering function interference could cause an accident.</p> <p><b>DEFECTS</b></p> <p>Isuzu Motors Japan have identified that the tie rod may impact the the I-beam during operation.</p>	<p>A letter is being sent to affected consumers.</p> <p>For further information, contact your local Isuzu dealer.</p>
<b>USA</b>	<p><b>VEHICLE MAKE / MODEL</b></p> <p>kme / predator-2010-2011 kme / predator panther-2010-2011 kme / predator ss-2010-2011 kme / predator xl-2010-2011</p> <p><b>MANUFACTURER</b></p> <p>kovatch mobile equipment corp</p> <p><b>COMPONENT</b></p> <p>electronic stability control</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>78</p> <p><b>SUMMARY</b></p> <p>Kovatch mobile equipment corporation (kme) is recalling certain 2010-2011 predator, predator ss, predator panther, and predator xl emergency vehicles manufactured from March 1, 2010 through October 10, 2011, equipped with feature code 04azx meritor wabco electronic stability control (esc) units. Under certain road and driving conditions, vehicle body roll and road inclination characteristics may adversely affect the slip angle calculation of the electronic stability control (esc) system. This might cause the esc to perceive an over steering situation and therefore apply the outer wheel brake on the front axle until the vehicle is perceived to be stable.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The vehicle may deviate from the intended line of travel, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Kme will notify owners, and dealers will install a new esc module free of charge. The recall is expected to begin on, or before, June 15, 2012. Owners may contact kme at 1-570-669-5154.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger vehicles Discovery I, Discovery II, Range Rover automatic diesel and Range Rover Classic</p> <p><b>BRAND:</b> Land Rover</p> <p><b>TYPE/NUMBER OF MODEL:</b></p> <p>1995 to 1998 Model Year Discovery I, 1999 to 2004 Model Year Discovery II, 1995 to 2001 Model Year Range Rover automatic diesel and 1995 Model Year Range Rover Classic vehicles</p> <p><b>DESCRIPTION:</b> Passenger vehicle.</p> <p><b>COUNTRY OF ORIGIN:</b> United Kingdom</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>The coupling for the rear propeller shaft could separate, leading to the rear propeller shaft becoming detached from the vehicle. Should this happen, a road accident could occur.</p>	<p>Recall ordered by the authorities.</p>
EU/ GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle "S 1000 RR"</p> <p><b>BRAND:</b> BMW</p> <p><b>TYPE/NUMBER OF MODEL:</b> Type: K10 Model: S 1000 RR, model year: 2012 EC type approval: e1 *2002/24*0421. The notification concerns motorcycles manufactured between 4 October 2010 and 10 April 2012.</p> <p><b>DESCRIPTION:</b> Motorcycle.</p> <p><b>COUNTRY OF ORIGIN:</b> Germany</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>Engine damage may occur as a result of a loosened connecting-rod bolt which could lead to the engine locking.</p>	<p>Voluntary corrective action taken by the manufacturer.</p>
AUSTRALIA	<p>Isuzu Australia Limited—N &amp; F Series Vehicles</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>N &amp; F series vehicles</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Recall campaign number: 12-Z-03</p> <p><b>WHO SOLD THIS PRODUCT</b></p> <p>Authorised Isuzu dealers</p> <p><b>SUPPLIER</b></p> <p>Isuzu Australia Limited</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>The vehicle may roll backwards unexpectedly, posing a hazard to other road users.</p> <p><b>DEFECTS</b></p> <p>The Hill Start Aid (HSA) may fail to activate.</p>	<p>A letter is being sent to affected customers.</p> <p>For further information, contact your local Isuzu dealer.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> butler / bc-1010 -2011</p> <p><b>MANUFACTURER</b> butler trailer mfg co, inc</p> <p><b>COMPONENT</b> equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 4</p> <p><b>SUMMARY</b> Butler trailers (butler) is recalling certain model year 2011 bc-1010 cargo trailers equipped with a dexter axle electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable. No picture available.</p>	<p><b>CONSEQUENCE</b> The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Butler will notify owners, and dexter axle dealers will replace the electric/hydraulic (e/h) brake actuator pump, free of charge. Butler has not provided a notification schedule. Owners may contact butler trailers, inc. at 1-336-674-8390.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> tiffin / phaeton-2012</p> <p><b>MANUFACTURER</b> tiffin motorhomes, inc.</p> <p><b>COMPONENT</b> service brakes, air</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 2</p> <p><b>SUMMARY</b> Tiffin motorhomes (tiffin) is recalling two model year 2012 phaeton recreational vehicles built on a spartan chassis and equipped with 3030 brake chambers. These vehicles fail to comply with the requirements of federal motor vehicle safety standard number 121, "air brake systems" because they do not meet the park brake and draw bar requirements. No picture available.</p>	<p><b>CONSEQUENCE</b> The park brake may not be sufficient to hold the vehicle in place. Accordingly, the vehicle could roll away and strike and injure a bystander or cause a crash without warning.</p>	<p><b>REMEDY</b> The affected vehicles have not been sold yet and tiffin has notified the dealers that are in possession of the vehicles. Spartan dealers will install improved brake chambers prior to sale. Owners may contact tiffin motorhomes at 1-256-356-8661.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> mcneilus / zr-2010-2012</p> <p><b>MANUFACTURER</b> mcneilus truck &amp; manufacturing</p> <p><b>COMPONENT</b> exterior lighting: hazard flashing warning lights</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 270</p> <p><b>SUMMARY</b> Mcneilus is recalling certain model year 2010-2012 zr trucks, manufactured from April 26, 2010, through May 1, 2012 for failing to comply with the requirements of federal motor vehicle safety standard no. 108 "lamps, reflective devices and associated equipment." The hazard warning lamps do not work when the ignition is in the off position. No picture available.</p>	<p><b>CONSEQUENCE</b> Inadequate lighting could reduce the visibility of the vehicle, increasing the potential for a crash.</p>	<p><b>REMEDY</b> Mcneilus will notify owners, and mcneilus service technicians will connect the hazard warning lights directly to the vehicle's power supply, free of charge. The safety recall is expected to begin in early June 2012. Owners may contact mcneilus at 507-374-6321.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> zap / xebra-2008</p> <p><b>MANUFACTURER</b> qingqi group motorcycle co., ltd</p> <p><b>COMPONENT</b> service brakes, hydraulic</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 627</p> <p><b>SUMMARY</b> Qingqi group motorcycle co, ltd, through its designated agent, zap USA, is recalling certain model year 2008 zap xebra all electric motorcycles manufactured from January 1, 2008, through December 31, 2008. These vehicles fail to conform to the braking distance requirements of federal motor vehicle safety standard no. 122, "motorcycle brake systems." No picture available.</p>	<p><b>CONSEQUENCE</b> These vehicles take longer distances to stop, increasing the risk of a vehicle crash.</p>	<p><b>REMEDY</b> Zap, the designated agent of qingqi group motorcycle co, ltd, will notify owners, and zap dealers will repair the vehicles free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact zap at 1-707-525-8658.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> fisker / karma-2012</p> <p><b>MANUFACTURER</b> fisker automotive, inc.</p> <p><b>COMPONENT</b> electrical system: battery: propulsion system</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 19</p> <p><b>SUMMARY</b> Fisker is recalling certain model year 2012 fisker karma passenger cars manufactured from September 22, 2011, through January 20, 2012. Within the high-voltage battery, certain hose clamps may have been positioned incorrectly during assembly. If positioned incorrectly, the battery compartment cover could interfere with the hose clamps, potentially causing a coolant leak from the cooling hoses.</p>	<p><b>CONSEQUENCE</b> If coolant enters the battery compartment, an electrical short could occur possibly resulting in a fire.</p>	<p><b>REMEDY</b> All known owners will be notified and instructed not to charge or drive the vehicle. owners will be advised to contact an authorized fisker dealer who will arrange transporting the vehicle directly to their repair facility. The repair facility will replace the high-voltage battery with a new part, free of charge. The safety recall is expected to begin during May 2012. Owners may contact fisker consumer affairs at 1-855-575-7577, option 2, 6am - 7pm (pst) monday through friday.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> ud trucks / ud3300-2008-2010</p> <p><b>MANUFACTURER</b> ud trucks corporation</p> <p><b>COMPONENT</b> service brakes, air</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 261</p> <p><b>SUMMARY</b> Ud trucks north America (ud trucks) is recalling certain model year 2008-2010 ud 3300 trucks equipped with a dual steering system. Modifications to the vehicles may have resulted in loss of isolation between the primary and secondary air brake systems. Thus, these vehicles fail to comply with the requirements of federal motor vehicle safety standard number 121, "air brake systems." Modifications to the vehicles may have resulted in loss of isolation between the primary and secondary air brake systems. No picture available.</p>	<p><b>CONSEQUENCE</b> If the vehicle experiences an air leak in either the primary or the secondary system, the vehicle may experience a total loss of brakes, increasing the risk of a vehicle crash.</p>	<p><b>REMEDY</b> Ud trucks will notify owners and will correct the air brake system of the affected vehicles. The recall is expected to begin on or before July 15, 2012. Owners may contact ud trucks at 1-336-393-2233.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> enworth / t680-2013</p> <p><b>MANUFACTURER</b> Paccar incorporated</p> <p><b>COMPONENT</b> equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 13</p> <p><b>SUMMARY</b> Paccar is recalling certain model year 2013 kenworth t680 vehicles equipped with a 76" sleeper and grey or tan color-matched bunk restraints for failing to comply with the requirements of federal motor vehicle safety standard (fmvss) no. 302, "flammability of interior materials." No picture available.</p>	<p><b>CONSEQUENCE</b> Flammable material, in the presence of an ignition source, could result in a fire.</p>	<p><b>REMEDY</b> Paccar will notify owners and install new bunk restraints in the affected vehicles. The safety recall is expected to begin during July 2012. Owners may contact kenworth at 1-425-828-5440.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> mci / d4000-2009-2011 mci / d4500-2009-2011 mci / d4505-2010</p> <p><b>MANUFACTURER</b> motor coach industries, inc</p> <p><b>COMPONENT</b> interior lighting</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 312</p> <p><b>SUMMARY</b> Motor coach industries, inc (mci) is recalling certain model year 2009-2011 d4000, d4500 and 2010 d4505 motor coaches equipped with led lights interior lights and powered by either a vansco or io multiplex system. Due to excessive power draw of the led lights, heat may build up at the fuse block and connector, causing components to melt. No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, surrounding material may be damaged and will burn, increasing the risk of a fire.</p>	<p><b>REMEDY</b> Mci will notify owners, and dealers will install re-designed wiring, free of charge. The recall is expected to begin during June 2012. Owners may contact mci at 1-866-624-2622.</p>



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> keystone / vantage-2012-2013</p> <p><b>MANUFACTURER</b> keystone rv company</p> <p><b>COMPONENT</b> equipment: recreational vehicle</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 440</p> <p><b>SUMMARY</b> Keystone rv companies (keystone) is recalling certain model year 2012 and 2013 vantage recreational vehicles manufactured from October 12, 2011, through May 7, 2012. These vehicles were manufactured without protective (a.k.a. gimp) molding on the metal around the holding tank valves. No picture available.</p>	<p><b>CONSEQUENCE</b> As a result, the user may suffer cuts to hands and arms when reaching past the sharp edges of the access cut-out in order to operate the holding tank valves.</p>	<p><b>REMEDY</b> Keystone will notify owners, and dealers will install the protective gimp molding around the access area for the holding tank valves, free of charge. The safety recall is expected to begin during June 2012. Owners may contact keystone at 1-866-425-4369.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> arboc / freedom-2011-2012 arboc / spirit of mobility-2011-2012</p> <p><b>MANUFACTURER</b> arboc specialty vehicles, llc</p> <p><b>COMPONENT</b> structure: body: roof and pillars</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 57</p> <p><b>SUMMARY</b> Arboc specialty vehicles, llc (arboc) is recalling certain model year 2011 and 2012 spirit of mobility and freedom transit buses manufactured from April 1, 2011, Through March 25, 2012, equipped with prolo roof escape hatches. Increased friction between the rear plate assemblies, p/no. 009327, and the nylon rear pop-up support, p/no. 008956, may result in an opening force of the prolo roof hatches that exceeds federal standard requirements. Thus, these hatches fail to conform to the requirements of federal motor vehicle safety standard no. 217, "bus emergency exits and window retention and release." No picture available.</p>	<p><b>CONSEQUENCE</b> In the event of an emergency, the vehicle occupants may be unable to open the roof hatch, which would hinder egress of the bus, possibly resulting in injury to the vehicle occupants.</p>	<p><b>REMEDY</b> Arboc will notify owners. specialty manufacturing, inc. will provide service kits along with repair instructions to dealers and owners, free of charge. Arboc has not yet provided the agency with a notification schedule. Owners may contact arboc at 1-574-825-1720 or smi at 1-800-951-7867.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> western star / 4900-2009</p> <p><b>MANUFACTURER</b> daimler trucks north america</p> <p><b>COMPONENT</b> Electrical system:battery:cables</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 12</p> <p><b>SUMMARY</b> Daimler trucks north america (dtna) is recalling 12 my 2009 western star 4900 trucks built with dd15 engines. A new forward cab crossmember design reduced clearance for cab mounted battery disconnect switch power cables on standard cab height vehicles. During cab articulation, the new crossmember may pinch power cables against the cab. No picture available.</p>	<p><b>CONSEQUENCE</b> Cables that become pinched between the cab and forward cab crossmember could short to ground and potentially overheat resulting in a vehicle fire and injury to vehicle occupants.</p>	<p><b>REMEDY</b> Dtna will notify owners, and dealers will remove the cables and reinstall them in a new safe location. Damaged cables will be replaced. Both will be done free of charge. The recall is expected to begin on or before July 22, 2012. This recall is an expansion of recall 09v-226. Owners may contact daimler trucks toll free at 1-800-547-0712.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> elite / flatbed-2012</p> <p><b>MANUFACTURER</b> elite trailers, inc.</p> <p><b>COMPONENT</b> equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 2</p> <p><b>SUMMARY</b> Elite trailers, inc. (elite) is recalling two model year 2012 elite flatbed trailers equipped with a dexter axle electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable. No picture available.</p>	<p><b>CONSEQUENCE</b> The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Elite will notify the owners, and dexter axle dealers will replace the electric/hydraulic (e/h) brake actuator pump, free of charge. Owners may contact elite trailers, inc. at 1-918-962-4567.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> kia / Borrego-2009</p> <p><b>MANUFACTURER</b> kia motors corporation</p> <p><b>COMPONENT</b> rakes, hydraulic:pedals and linkages</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 21,912</p> <p><b>SUMMARY</b> Kia is recalling certain model year 2009 borrego vehicles, manufactured from May 2, 2008, through January 20, 2009, equipped with non-adjustable brake pedals. Certain pedal mounts may have a fiberglass composition that allows them to break off in a collision where the impact has not immobilized the vehicle, which would then allow the vehicle to roll. No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, the driver would need to stop the vehicle with the parking brake or experience a possible second impact, increasing the risk of personal injury.</p>	<p><b>REMEDY</b> Kia will notify owners, and dealers will replace the brake pedal mount, free of charge. The recall will begin during June 2012. Owners may contact kia consumer assistance center at 1-800-333-4542.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> kia / rio-2006-2008</p> <p><b>MANUFACTURER</b> kia motors corporation</p> <p><b>COMPONENT</b> air bags: frontal: sensor/control module</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 72,568</p> <p><b>SUMMARY</b> Kia is recalling certain model year 2006-2008 rio vehicles, manufactured from February 20, 2005, through December 9, 2007. The front passenger seat occupant sensor mat can experience fatigue cracking. If sufficient cracking occurs, the occupant classification system (ocs) will cease to function such that the system will not be able to detect whether a child passenger is in the seat and the airbag will deploy during a crash necessitating deployment. No picture available.</p>	<p><b>CONSEQUENCE</b> Air bag deployment with a child in the front passenger side seat increases the risk of injury to that child.</p>	<p><b>REMEDY</b> Kia will notify owners, and dealers will replace the ocs seat sensor mat, free of charge. The recall is expected to begin during July 2012. Owners may contact kia consumer assistance center at 1-800-333-4542.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> belmont trailer / gn16ld-2011</p> <p><b>MANUFACTURER</b> belmont machine co.</p> <p><b>COMPONENT</b> equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1</p> <p><b>SUMMARY</b> Belmont machine company (belmont) is recalling one model year 2011 belmont gn16ld trailer equipped with a dexter axle electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable. No picture available.</p>	<p><b>CONSEQUENCE</b> The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Belmont has notified the owner, and a dexter axle dealer will replace the electric/hydraulic (e/h) brake actuator pump, free of charge. Owners may contact belmont machine company at 1-717-556-0040.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> stealth / cfsfcr3716-2010-2011 stealth / cfsfsa3516-2010-2011 stealth / cfstfsc2812-2010-2011</p> <p><b>MANUFACTURER</b> forest river, inc.</p> <p><b>COMPONENT</b> equipment: other: labels</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 57</p> <p><b>SUMMARY</b> Forest river is recalling certain model year 2010-2011 stealth recreational trailers. The gross vehicle weight rating (gvwr) and cargo carrying capacity specification is incorrect on the federal certification label and the tire information label. These vehicles fail to comply with the requirements of part 567, "certification." No picture available.</p>	<p><b>CONSEQUENCE</b> Incorrect weight information may lead to overloading, which may cause axle or tire failure, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Forest river will notify owners, and dealers will remove and replace the labels with corrected labels. The safety recall began during May 2012. Owners should contact forest river at 909-873-3777.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> foretravel / nimbus-2007-2011 foretravel / phenix-2007-2010</p> <p><b>MANUFACTURER</b> foretravel, inc.</p> <p><b>COMPONENT</b> visibility: glass, side/rear</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 121</p> <p><b>SUMMARY</b> Foretravel motorcoach (foretravel) is recalling certain model year 2007-2010 phenix and 2007-2011 nimbus recreational vehicles equipped with se-gi windows. The adhesive bond on some panels between the glass portion and the hinge may de-bond, allowing the panel to detach and fall from the vehicle.  No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurred during travel it could create a road hazard, increasing the risk of a crash or personal injury.</p>	<p><b>REMEDY</b> Foretravel will notify owners, and is working with se-gi products to develop remedy instructions and obtain parts. The recall is expected to begin during June 2012. Owners may contact foretravel motorcoach, inc. at 1-800-547-0712.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> lincoln / mkt limousine/livery-2013</p> <p><b>MANUFACTURER</b> ford motor company</p> <p><b>COMPONENT</b> service brakes, air: disc: rotor</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 128</p> <p><b>SUMMARY</b> Ford is recalling certain model year 2013 lincoln mkt vehicles with a town car package manufactured from March 6, 2012, through April 3, 2012, which are available only to body builders for upfitting as hearse or livery/limousine vehicles. These vehicles may have been transported with rear brake rotor bolts that are not fully seated allowing the head to protrude above the wheel mounting surface.  No picture available.</p>	<p><b>CONSEQUENCE</b> The raised bolt head could lead to torque loss in the wheel joint, potentially leading to wheel separation, increasing the risk of a crash.</p>	<p><b>REMEDY</b> All the affected vehicles have been quarantined at the coach builder's facilities and will be repaired before delivery to owners. Notices were mailed to the coach builders on May 24, 2012. For more information, owners may contact the ford motor company customer relationship center at 1-866-436-7332.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> fccc / mc-2005-2012 fccc / mcl-2005-2012</p> <p><b>MANUFACTURER</b> daimler trucks North America</p> <p><b>COMPONENT</b> service brakes, hydraulic</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 2,287</p> <p><b>SUMMARY</b> Daimler trucks North America (dtna) is recalling certain model year 2005 through 2012 freightliner custom chassis incomplete motorhome chassis manufactured from March 18, 2005, through July 19, 2011, equipped with bosch hydraulic disc brake. Hydraulic brake equipped motorhome chassis exposed to long periods of time of non-driving may experience diametrical brake caliper piston growth and reduced piston to bore clearance potentially leading to brake drag and overheating resulting in reduced brake performance. No picture available.</p>	<p><b>CONSEQUENCE</b> Reduced brake performance may lead to a vehicle crash.</p>	<p><b>REMEDY</b> Dtna will notify owners, and dtna dealers will repair the vehicles, free of charge. The safety recall is expected to begin on or before July 20, 2012. Owners may contact dtna at 1-800-547-0712.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> vermeer / bc1500-2007-2012</p> <p><b>MANUFACTURER</b> vermeer manufacturing company</p> <p><b>COMPONENT</b> structure:frame and members</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1,770</p> <p><b>SUMMARY</b> Vermeer is recalling certain model year 2007-2012 vermeer bc1500 trailers. During the assembly process, a section of the main frame may have been incorrectly welded. As a result, bending or fatigue fractures can result, leading to frame failure. No picture available.</p>	<p><b>CONSEQUENCE</b> Frame failure may increase the risk of personal injury or property damage.</p>	<p><b>REMEDY</b> Vermeer will notify owners, and will repair the vehicles, free of charge. The safety recall is expected to begin on August 10, 2012. Owners may contact vermeer at 641-628-3141.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>van hool / c2045-2010-2012  van hool / t2140-2011-2012  van hool / t2145-2010-2011  van hool / td925-2011</p> <p><b>MANUFACTURER</b></p> <p>van hool n.v.</p> <p><b>COMPONENT</b></p> <p>electronic stability control</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>17</p> <p><b>SUMMARY</b></p> <p>Van hool is recalling certain model year 2010-2012 c2045, 2011-2012 t2140, 2010-2011 t2145 and 2011 td925 motorcoaches, equipped with meritor wabco electronic stability control (esc) modules, manufactured from August 2005, through September 2011. Under certain road and driving conditions, vehicle body roll and road inclination characteristics may adversely affect the slip angle calculation of the electronic stability control (esc) system. This might cause the esc to perceive an over steering situation and therefore apply the outer wheel brake on the front axle until the vehicle is perceived to be stable.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The vehicle may deviate from the intended line of travel, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Van hool will notify owners via its dealer abc bus inc. and replace the control module free of charge. The recall is expected to begin on, or before, June 30, 2012. Owners may contact the warranty administrator for abc bus, inc. toll free at 1-877-427-7278.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b></p> <p>shasta revere / sht27bh-2012-2013</p> <p><b>MANUFACTURER</b></p> <p>forest river, inc.</p> <p><b>COMPONENT</b></p> <p>equipment: other: labels</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b></p> <p>7</p> <p><b>SUMMARY</b></p> <p>Forest river is recalling certain model year 2012-2013 shasta revere recreational vehicles. The gross vehicle weight rating (gvwr) and cargo carrying capacity specification is incorrect on the federal certification label and the tire information label. Thus, these vehicles fail to comply with the requirements of part 567, "certification."</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Incorrect weight information may lead to overloading, which may cause axle or tire failure, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Forest river will notify owners, and include the corrected labels in each letter. Forest river has not provided a notification schedule. Owners should contact forest river at 574-825-7178.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> starcraft / starlite-2011-2012</p> <p><b>MANUFACTURER</b> starcraft bus</p> <p><b>COMPONENT</b> structure: body: roof and pillars</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 61</p> <p><b>SUMMARY</b> Starcraft bus is recalling certain model year 2011 and 2012 starlite shuttle buses manufactured from April 1, 2011, through March 25, 2012, equipped with specialty manufacturing inc. (smi) prolo roof hatches. Increased friction between the rear plate assemblies, p/no. 009327, and the nylon rear pop-up support, p/no. 008956, may result in an opening force of the prolo roof hatches that exceeds federal standard requirements. Thus, these hatches fail to conform to the requirements of federal motor vehicle safety standard no. 217, "bus emergency exits and window retention and release." No picture available.</p>	<p><b>CONSEQUENCE</b> In the event of an emergency, egress of the bus may be hindered possibly resulting in injury to the vehicle occupants.</p>	<p><b>REMEDY</b> Starcraft bus will notify owners. Smi will provide service kits along with repair instructions to dealers and owners, free of charge. The safety recall is expected to begin during June 2012. Owners may contact starcraft bus at 1-800-347-7440 or smi at 1-800-951-7867.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> diamond coach / pt-2008-2010 diamond coach / vip-2008-2010</p> <p><b>MANUFACTURER</b> diamond coach corporation</p> <p><b>COMPONENT</b> equipment adaptive</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 278</p> <p><b>SUMMARY</b> Diamond coach corporation (diamond coach) is recalling certain model year 2008-2010 pt and vip buses equipped with braun century-2 and vista-2 wheelchair lifts. Over time, and with frequent use, the roll stop latches on the wheelchair lift's outer barrier may become bent or misaligned. No picture available.</p>	<p><b>CONSEQUENCE</b> A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p><b>REMEDY</b> Diamond coach is working with braun to identify and notify owners, and braun dealers will repair the vehicles, free of charge. The safety recall is expected to begin during June 2012. Owners may contact diamond coach at 1-800-442-4645.</p>



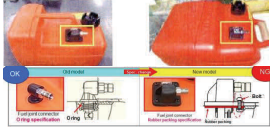
AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> startrans / senator-2011</p> <p><b>MANUFACTURER</b> startrans bus corporation</p> <p><b>COMPONENT</b> structure: body: roof and pillars</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1</p> <p><b>SUMMARY</b> NA No picture available.</p>	<p><b>CONSEQUENCE</b> NA</p>	<p><b>REMEDY</b> NA</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> blue bird / all American-2012 blue bird / vision-2012</p> <p><b>MANUFACTURER</b> blue bird body company</p> <p><b>COMPONENT</b> structure: body: roof and pillars</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 11</p> <p><b>SUMMARY</b> Blue bird corporation (blue bird) is recalling certain model year 2012 all american and vision non-school buses manufactured from May 20, 2011, through October 20, 2012, equipped with specialty manufacturing inc. (smi) prolo roof hatches. Increased friction between the rear plate assemblies, p/no. 009327, and the nylon rear pop-up support, p/no. 008956, may result in an opening force of the prolo roof hatches that exceeds federal standard requirements. Thus, these hatches fail to conform to the requirements of federal motor vehicle safety standard no. 217, "bus emergency exits and window retention and release." No picture available.</p>	<p><b>CONSEQUENCE</b> In the event of an emergency, egress of the bus may be hindered possibly resulting in injury to the vehicle occupants.</p>	<p><b>REMEDY</b> Blue bird will notify owners. smi will provide service kits along with repair instructions to dealers and owners, free of charge. The safety recall is expected to begin on, or about, June 21, 2012. Owners may contact blue bird at 1-478-822-2242 or smi at 1-800-951-7867.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> blue bird / all American-2012-2013 blue bird / vision-2012-2013</p> <p><b>MANUFACTURER</b> blue bird body company</p> <p><b>COMPONENT</b> structure: body: roof and pillars</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1,406</p> <p><b>SUMMARY</b> Blue bird corporation (blue bird) is recalling certain model year 2012 through 2013 all American and vision school buses manufactured from April 7, 2011, through March 21, 2012, equipped with specialty manufacturing inc. (smi) prolo roof hatches. Increased friction between the rear plate assemblies, p/no. 009327, and the nylon rear pop-up support, p/no. 008956, may result in an opening force of the prolo roof hatches that exceeds federal standard requirements. Thus, these hatches fail to conform to the requirements of federal motor vehicle safety standard no. 217, "bus emergency exits and window retention and release."  No picture available.</p>	<p><b>CONSEQUENCE</b> In the event of an emergency, egress of the bus may be hindered possibly resulting in injury to the vehicle occupants.</p>	<p><b>REMEDY</b> Blue bird will notify owners. smi will provide service kits along with repair instructions to dealers and owners, free of charge. The safety recall is expected to begin on, or about, June 21, 2012. Owners may contact blue bird at 1-478-822-2242 or smi at 1-800-951-7867.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> collins / grand bantam-2008 2010 collins / mid bus grand guide-2008 2010 collins / mid bus super guide-2008 2010 collins / super bantam-2008 2010</p> <p><b>MANUFACTURER</b> collins bus corporation</p> <p><b>COMPONENT</b> equipment adaptive</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 238</p> <p><b>SUMMARY</b> Collins is recalling certain model year 2008 and 2010 grand bantam, super bantam, mid bus grand guide, and mid bus super guide school buses manufactured from February 21, 2008, through September 21, 2010, equipped with braun century-2 wheelchair lifts. Over time, and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned.  No picture available.</p>	<p><b>CONSEQUENCE</b> A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p><b>REMEDY</b> Collins will notify owners and repairs will be performed by authorized braun dealers free of charge. The safety recall is expected to begin on or about June 22, 2012. Owners may contact the braun customer experience group at 1-800-488-0359 or collins bus customer service at 1-800-533-1850 ext. 424.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b> ic / cesb-2007 2009 2011</p> <p><b>MANUFACTURER</b> navistar, inc</p> <p><b>COMPONENT</b> equipment adaptive</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 4</p> <p><b>SUMMARY</b> Navistar is recalling certain model year 2007, 2009, and 2011 ic cesb school buses equipped with braun century-2 and vista-2 wheelchair lifts. Over time, and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. No picture available.</p>	<p><b>CONSEQUENCE</b> A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p><b>REMEDY</b> Navistar has reported that all the affected buses have been repaired by authorized braun dealers. Therefore, an owner notification notice is not necessary for this campaign. Owners may contact navistar at 1-260-461-1890.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> honda / civic-2012</p> <p><b>MANUFACTURER</b> honda (american honda motor co.)</p> <p><b>COMPONENT</b> power train: driveline: driveshaft</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 50,190</p> <p><b>SUMMARY</b> Honda is recalling certain model year 2012 honda civic vehicles. During assembly, the process required to seat the driver's side driveshaft and set the retaining clip was not completed. As a result, the driveshaft may separate. No picture available.</p>	<p><b>CONSEQUENCE</b> If this occurs, the vehicle will have a loss of drive power and may roll away if the parking brake has not been set when the gear selector has been placed in the "park" position, increasing the risk of crash or pedestrian injury.</p>	<p><b>REMEDY</b> Honda will notify owners, and dealers will inspect the driver's side driveshaft and install a new driveshaft, as needed, free of charge. The safety recall is expected to begin on, or about, June 21, 2012. Owners may contact honda customer service at 1-800-999-1009.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE / MODEL</b> scion / fr-s-2013</p> <p><b>MANUFACTURER</b> toyota motor North America, inc.</p> <p><b>COMPONENT</b> equipment: other: owners/service/other manual</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1,156</p> <p><b>SUMMARY</b> Toyota is recalling certain model year 2013 scion fr-s vehicles manufactured from March 22, 2012, through May 14, 2012. The owner's manual contains an inaccurate description of the actual operation of the front passenger occupant classification system. Other portions of the owner's manual, describing the air bag system, require clarification. As such, these vehicles fail to comply with federal motor vehicle safety standard (fmvss) no. 208, "occupant crash protection." No picture available.</p>	<p><b>CONSEQUENCE</b> If a user reads and follows inaccurate owner's manual information, this could lead to an increased risk of injury to a front passenger seat occupant under certain crash conditions.</p>	<p><b>REMEDY</b> Toyota will notify owners, and will mail corrected inserts for the owner's manuals, free of charge. The safety recall is expected to begin during June 2012. Owners may contact toyota at 1 866-707-2466.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b> subaru / brz-2013</p> <p><b>MANUFACTURER</b> subaru of america, inc.</p> <p><b>COMPONENT</b> equipment: other: owners/service/other manual</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED</b> 1,886</p> <p><b>SUMMARY</b> Subaru is recalling certain model year 2013 brz vehicles manufactured from November 25, 2011, through May 25, 2012. The owner's manual contains an inaccurate description of the actual operation of the front passenger occupant classification system. Other portions of the owner's manual, describing the air bag system, require clarification. As such, these vehicles fail to comply with federal motor vehicle safety standard (fmvss) no. 208, "occupant crash protection." No picture available.</p>	<p><b>CONSEQUENCE</b> Misinformation could lead to an increased risk of injury to front seat occupants during certain crash conditions.</p>	<p><b>REMEDY</b> Subaru will notify owners, and will mail corrected owner's manuals, free of charge. The safety recall is expected to begin during June 2012. Owners may contact subaru at 1-800-782-2783.</p>

<b>AUTO: MOTOR VEHICLE EQUIPMENT</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</b></p> <p>webasto / hollandia 600 webasto / hollandia 700 webasto / hollandia tvs 900</p> <p><b>MANUFACTURER</b></p> <p>auto detailer</p> <p><b>COMPONENT</b></p> <p>equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>69</p> <p><b>SUMMARY</b></p> <p>Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by auto detailer on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p><b>REMEDY</b></p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto detailer by clicking on the hyperlink affected vehicle list or you may visit webasto's website at <a href="http://www.sunroofcheck.com">http://www.sunroofcheck.com</a>. you can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</b></p> <p>dorman / control arm</p> <p><b>MANUFACTURER</b></p> <p>dorman products, inc.</p> <p><b>COMPONENT</b></p> <p>equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>2,612</p> <p><b>SUMMARY</b></p> <p>Dorman products, inc. (dorman) is recalling certain service replacement equipment control arms, part numbers 520-121, 520-122, 2410121, and 2410122 shipped from November 2010 through January 2012. The control arms may have an inadequate heat treatment of the ball stud, possibly resulting in premature fracture.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Fracture of the ball stud on the control arm can result in impaired steering and handling, possibly resulting in a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Dorman will notify owners and refund all amounts paid and/or replace recalled units at no cost to the owner. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact dorman at 1-800-523-2492.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Honda MPE—Honda outboard fuel tank</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Portable fuel tank on 10HP to 60HP models</p> <p><b>IDENTIFYING FEATURES</b></p> <p>N/A</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Honda Marine dealers</p> <p><b>SUPPLIER</b></p> <p>Honda MPE</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://www.hondampe.com.au">http://www.hondampe.com.au</a></p> 	<p><b>HAZARDS</b></p> <p>Leaking fuel may pose a fire hazard.</p> <p><b>DEFECTS</b></p> <p>Fuel may leak from the portable fuel tank pickup.</p>	<p>Voluntary recallReturn the fuel tank to a Honda Marine dealer for a replacement unit.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</b></p> <p>bendix / e-10-Jul 27, 2011 - May 18, 2012</p> <p>bendix / e-10pr-Jul 27, 2011 - May 18, 2012</p> <p>bendix / e-10r-Jul 27, 2011 - May 18, 2012</p> <p>bendix / e-6-Jul 27, 2011 - May 18, 2012</p> <p>bendix / plunger kit-Jul 27, 2011 - May 18, 2012</p> <p>bendix / treadle assembly-Jul 27, 2011 - May 18, 2012</p> <p><b>MANUFACTURER</b></p> <p>bendix commercial vehicle system</p> <p><b>COMPONENT</b></p> <p>equipment</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>1,284</p> <p><b>SUMMARY</b></p> <p>Bendix commercial vehicle systems, llc (bendix) is recalling certain brake valves, treadle assemblies, and/or plunger kits sold as aftermarket replacement equipment and sold and installed as original equipment to various vehicle manufacturers. The brake valve plunger may fracture during brake application, resulting in reduced brake pedal angle and travel. This condition may limit the driver's ability to deliver full pressure from the foot brake valve. There is also a potential that the brake plunger could become lodged and not allow release of the service brakes.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This condition could reduce braking ability and/or lead to loss of vehicle control, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Bendix will notify owners of the aftermarket equipment and will provide a free remedy. Bendix is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject brake valves, treadle assemblies, and plunger kits, free of charge. The safety recall is expected to begin during June 2012. Owners may contact their vehicle manufacturer or bendix at 1-440-329-9386.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>TIRE BRAND NAME / TIRE LINE / TIRE SIZE:</b></p> <p>cooper / discoverer h/t / lt235/85r16-Dec 11, 2011 - Dec 17, 2011</p> <p>cooper / discoverer h/t / p265/70r17-Jan 01, 2012 - Jan 07, 2012</p> <p>cooper / discoverer lxx / 265/70r17-Jan 01, 2012 - Jan 07, 2012</p> <p>cooper / mastercraft courser htr / lt235/85r16-Dec 11, 2011 - Dec 17, 2011</p> <p>del-nat / delta a/s sierradial / 265/70r17-jan 01, 2012 - jan 07, 2012</p> <p>del-nat / national a/s commando / 265/70r17-Jan 01, 2012 - Jan 07, 2012</p> <p>pep boys / definity dakota h/t / p265/70r17-Jan 01, 2012 - Jan 07, 2012</p> <p>tbc / sigma stampede radial suv / p265/70r17-Jan 01, 2012 - Jan 07, 2012</p> <p><b>MANUFACTURER</b></p> <p>cooper tire &amp; rubber co.</p> <p><b>COMPONENT</b></p> <p>tires: tread/belt</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>10,236</p> <p><b>SUMMARY</b></p> <p>Cooper tire &amp; rubber company (cooper) is recalling certain cooper brand discoverer h/t tires, sizes lt235/85r16 and p265/70r17; discoverer lxx, size 265/70r17; and mastercraft courser htr, size lt235/85r16. Also included in this recall are tires branded as del-nat delta a/s sierradial or national a/s commando, size 265/70r17; pep boys definity dakota h/t, size p265/70r17; and tbc sigma stampede radial suv, size p265/70r17. Contaminated rubber may have been used in the tread compound which could result in tread separation.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Tread separation can result in loss of vehicle control, increasing the risk of a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Cooper will notify owners, and dealers will replace the tires free of charge. Free mounting and balancing will also be included, as applicable. The recall is expected to begin on June 15, 2012. Owners may contact cooper tire &amp; rubber company's consumer relations department at 1-800-854-6288.</p>

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[gcsc@sgs.com](mailto:gcsc@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2012 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

