

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 MARCH 2012

CONTENTS

AUTOMOTIVE

Pages 1 to 25



[Motor Vehicle \(46\)](#)


Child Safety Seat (0)

[Motor Vehicle Equipment \(6\)](#)


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Chrysler—Chrysler Voyager Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>2008 Chrysler Voyager vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Campaign number: L01 Target Number: 442</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Chrysler, Jeep and Dodge dealerships</p> <p>SUPPLIER</p> <p>Chrysler Australia No picture available.</p>	<p>HAZARDS</p> <p>Inadvertent airbag deployment may pose an injury/crash hazard.</p> <p>DEFECTS</p> <p>The Occupant Restraint Controller (ORC) module may have been contaminated by water leaking from the Heating, Ventilation and Air Conditioning (HVAC) drain grommet. Water in the ORC module could cause the illumination of the airbag warning light and/or a potential inadvertent airbag deployment without warning.</p>	<p>Chrysler Australia Pty Ltd will write to owners of all affected vehicles.</p> <p>Alternatively, consumers can contact their Chrysler, Jeep, or Dodge distributor/dealer to schedule a service appointment at their convenience.</p>
EU/UNITED KINGDOM	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Sportage"</p> <p>BRAND: Kia</p> <p>TYPE/NUMBER OF MODEL: Sportage 1.7 CRDi</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Slovakia</p> <p>No picture available.</p>	<p>INJURIES</p> <p>Some vehicles have been fitted with a vacuum pump that could fail in service. If this occurs it will reduce the amount of vacuum available to the servo which, after a number of braking applications, will result in increased braking distances and pedal hardness. This could lead to a road accident.</p>	<p>Voluntary corrective action taken by the manufacturer.</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycle "V-Strom"</p> <p>BRAND: Suzuki</p> <p>TYPE/NUMBER OF MODEL:</p> <p>DL650A, DL650ASE and DL650EXP</p> <p>The recall concerns 2012 models with VIN numbers from JS1C7111100100314 to JS1C7111100105723.</p> <p>DESCRIPTION: Motorcycle.</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The front brake switch is susceptible to failure. If this occurs, the brake light will not illuminate when the front brake lever is operated. Should this occur, motorists behind may not notice braking deceleration, increasing the risk of a rear-end crash.</p>	<p>Voluntary corrective action taken by the manufacturer.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA	MEASURES ADOPTED
EU/MALTA	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car Koleos</p> <p>BRAND: Renault</p> <p>TYPE/NUMBER OF MODEL:</p> <p>Type Approval No e11*2001/116*0261</p> <p>"Manufacturing Period: from 6 to 10 September 2010."</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available.</p>	<p>INJURIES</p> <p>Possible loss of steering assistance could lead to an accident causing injuries.</p>	Voluntary corrective action taken by the manufacturer.
EU/ PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <ol style="list-style-type: none"> Juke Micra Patrol <p>BRAND: Nissan</p> <p>TYPE/NUMBER OF MODEL:</p> <ol style="list-style-type: none"> F15 K13 Y62 <p>See attached document for production dates and range of affected VINs.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN:</p> <ol style="list-style-type: none"> UK and Japan India Japan <p>No picture available.</p>	<p>FIRE</p> <p>The fuel rail pressure sensor may be insufficiently tightened to the fuel rail of the engine and it may loosen gradually due to heat and vibration of the engine. If left undetected and the vehicle continues to be driven in this condition, in an extreme case, fuel leakage may occur between the fuel rail pressure sensor and the fuel rail.</p>	Voluntary corrective action taken by the manufacturer.
AUSTRALIA	<p>Kawasaki—Mule Utility Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>KAF400DCF - Mule 610 4x4 XC</p> <p>KAF400ACF - Mule 610 4x4</p> <p>KAF400BCF - Mule 600</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: DJE031A</p> <p>Target Number: 274</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Kawasaki dealerships</p> <p>SUPPLIER</p> <p>Kawasaki Motors Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Leaking fuel poses a fire hazard.</p> <p>DEFECTS</p> <p>The fuel pump bracket may have been assembled incorrectly, causing the fuel hose to contact the air box and possibly creating a fuel leak.</p>	Kawasaki will write to owners of affected vehicles. Owners are advised to return the affected vehicles to their authorised Kawasaki dealer who will perform the necessary repairs free of charge.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA	MEASURES ADOPTED
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <ol style="list-style-type: none"> Swift SX4 Splash <p>BRAND: Suzuki</p> <p>TYPE/NUMBER OF MODEL:</p> <p>The vehicles affected are those produced in 2011 and 2012.</p> <ol style="list-style-type: none"> Swift type NZ: e4*2007/46*0155*03 - e4*2007/46*0155*04 SX4 type EY: e4*2001/116*0105*13 - e4*2001/116*0105*14 Splash type EX: e4*2001/116*0130*06 - e4*2001/116*0130*07 <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Hungary</p> <p>No picture available.</p>	<p>INJURIES</p> <p>In some cases the steering column was not fitted correctly to the steering box; thus a steering failure cannot be ruled out, which could lead to an accident.</p>	Voluntary corrective action taken by the manufacturer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car Cayenne</p> <p>BRAND: Porsche</p> <p>TYPE/NUMBER OF MODEL:</p> <p>Cayenne (92A), Cayenne Diesel (92A), Cayenne S Hybrid (92A), Cayenne S (92A), Cayenne Turbo (92A).</p> <p>The recall concerns cars built between 08 March 2010 and 31 January 2012.</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No picture available.</p>	<p>INJURIES</p> <p>If a headlight module is not locked correctly, relative movements with respect to the wing will occur whilst driving and can cause the headlight to become detached from the wing which could lead to a road accident.</p>	Voluntary corrective action taken by the manufacturer.
AUSTRALIA	<p>Porsche—Cayenne</p> <p>PRODUCT DESCRIPTION</p> <p>Cayenne (92A), Cayenne Diesel (92A), Cayenne S Hybrid (92A), Cayenne S (92A), Cayenne Turbo (92A), 2011 and 2012 Models</p> <p>IDENTIFYING FEATURES</p> <p>Campaign number: AC01 Target Number: 1459</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Porsche dealerships</p> <p>SUPPLIER</p> <p>Porsche Cars Australia Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Detachment of the headlight from the car may result in a crash or pose a hazard to other road users.</p> <p>DEFECTS</p> <p>It is possible that the headlight module may not be locked correctly, resulting in the headlight becoming detached from the wing of the car.</p>	Consumers should contact their local Porsche authorised dealership for the rework of the headlight module.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Ducati—Monster Motorcycle (2012 Model)</p> <p>PRODUCT DESCRIPTION</p> <p>Model: 11EVO, MY 2012</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: 846/12 Target Number: 120</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Ducati dealerships</p> <p>SUPPLIER</p> <p>Ducati Motor Holding</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Failure of the rear wheel may result in an accident and injury to the rider or other road users.</p> <p>DEFECTS</p> <p>The rear wheel of the motorcycle may develop structural problems due to a non-conformity with the fabrication standards.</p>	<p>Consumers should contact their authorised Ducati dealer as soon as possible to arrange for the replacement of the rear wheel (rim) on the motorcycle. For more information, consumers can contact the National After Sales Department on 02 87413838 / 02 8741 3831, Monday to Friday between 8:30am and 5pm.</p>
AUSTRALIA	<p>Husqvarna Pty Ltd— Lawn Tractor Models CTH2038 and CTH2642TE</p> <p>PRODUCT DESCRIPTION</p> <p>The affected Hydro-Gear transaxles were included in 54 lawn tractors manufactured by the Husqvarna Group from 1 December 2010 to 1 April 2011 under the brand name Husqvarna.</p> <p>IDENTIFYING FEATURES</p> <p>Hydro-Gear transaxle model no. 170061 with serial numbers 0333 through 0351 Husqvarna tractor model nos. CTH2038 and CTH2642TE with serial nos. 010611D001376 through 02150211D001032</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Husqvarna dealers in Australia</p> <p>SUPPLIER</p> <p>Hydro-Gear Limited Partnership / Hydro-Gear Europe BVBA</p> <p>SUPPLIER'S WEB SITE</p> <p>http:// www.hydro-gear.com</p> <div style="text-align: center;">  </div>	<p>HAZARDS</p> <p>The drive gears may fail, causing the drive system to lose the ability to brake effectively, posing a risk of injury to the operator or bystanders.</p> <p>DEFECTS</p> <p>There is a potential defect in the bull gear, which will manifest itself as broken gear teeth under load and cause loss of engine braking.</p>	<p>Cease use of the lawn tractor immediately and contact the place of purchase to arrange for a service appointment and have the transaxle inspected to determine if a transaxle replacement is necessary. . For more information contact Husqvarna Technical Service on 1300 755 214 or at technical.service@husqvarna.com.au.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Kawasaki—Ninja Motorcycles (2008-2012 Models)</p> <p>PRODUCT DESCRIPTION</p> <p>Kawasaki Motorcycles ZX1000E8F- 2008 Ninja ZX- 10R ZX1000E9F- 2009 Ninja ZX-10R ZX1000FAF- 2010 Ninja ZX-10R ZX600R9F- 2009 Ninja ZX-6R ZX600R9FA- 2009 Ninja ZX-6R- Monster Energy ZX600RAF- 2010 Ninja ZX-6R ZX600RBF- 2011 Ninja ZX-6R ZX600RCF-2012 Ninja ZX-6R</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: DAD372A Target Number- 1431</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Kawasaki dealers</p> <p>SUPPLIER</p> <p>Kawasaki Motors Pty Ltd No picture available.</p>	<p>HAZARDS</p> <p>Insufficient charging of the battery may result in poor engine performance, engine stalling or a no-start condition. This condition may increase the risk of an accident.</p> <p>DEFECTS</p> <p>Excessive heat within the circuit board and uncontrolled electric current output may result in insufficient charging to the motorcycle battery.</p>	<p>Kawasaki will write to owners of affected vehicles. Owners are advised to return the affected vehicles to their authorised Kawasaki dealer, who will perform the necessary repairs free of charge.</p>
AUSTRALIA	<p>Volvo—XC70, V60, S60 and XC60 vehicles (2012 models)</p> <p>PRODUCT DESCRIPTION</p> <p>XC70, V60, S60 and XC60 vehicles MY 2012</p> <p>IDENTIFYING FEATURES</p> <p>Target Number: 1255</p> <p>VIN range: XC70- 118101 to 127175 V60- 035101 to 054616 S60 - 076075 to 170045 XC60- 237068 to 271560</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Volvo dealers</p> <p>SUPPLIER</p> <p>Volvo Car Australia Pty Ltd No picture available.</p>	<p>HAZARDS</p> <p>Failure of the airbags to deploy during a crash may increase the risk of injury to the occupants of the vehicle.</p> <p>DEFECTS</p> <p>The wiring harness under the driver and/or passenger seat may not have been properly affixed to the seat frame during vehicle assembly. As a result, the harness connector may detach from the socket and the airbags may not function as intended, causing the SRS warning lamp to illuminate or the airbags to fail to deploy during a crash.</p>	<p>Owners of affected vehicles will be contacted by letter. Owners are advised to contact their respective authorised Volvo dealers for inspection and re-position of the wiring harness.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Maserati Australia—Granturismo & Granturismo Convertible Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>Maserati Granturismo</p> <p>IDENTIFYING FEATURES</p> <p>Campaign Number: 198 Target Number: 131</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Maserati dealers</p> <p>SUPPLIER</p> <p>ATECO AUTOMOTIVE PTY LTD</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.maserati.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Failure of the rear lights to operate may pose a crash hazard.</p> <p>DEFECTS</p> <p>The rear lights may not be in conformance and therefore not function properly.</p>	<p>Maserati are contacting customers for inspection of their vehicles and replacement of the rear lights if necessary.</p>
AUSTRALIA	<p>KYMCO—UXV 500 ATV Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>Campaign Number: KTI-12003 Target Number: 251</p> <p>IDENTIFYING FEATURES</p> <p>All models produced between 2009 and 2011 VIN Range: RFAAOAA 09B100101 through 9CB490364</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised KYMCO dealers</p> <p>SUPPLIER</p> <p>Standard Motor Australia Limited Partnership</p> 	<p>HAZARDS</p> <p>Potential fire hazard.</p> <p>DEFECTS</p> <p>Affected vehicles have an exposed portion of the exhaust system that may allow debris such as leaves/grass or other flammable materials to come into contact with the exposed area. There is a risk that the debris may catch fire and burn.</p>	<p>Owners should return their vehicles to an authorised KYMCO dealership to have a Protector Kit fitted over the exposed portion of the exhaust system. Owners should discontinue the use of this vehicle until the Protector Kit has been fitted. For customer inquiries please contact KYMCO on (03) 9644 3900.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAKER	MEASURES ADOPTED
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car/Van Viano, Vito</p> <p>BRAND: Mercedes-Benz</p> <p>TYPE/NUMBER OF MODEL: Type: 639</p> <p>EC type-approval: e1*2007/46*0457, e1*2007/46*0458, e1*2007/46*0459</p> <p>The vehicles affected were produced in September 2011.</p> <p>DESCRIPTION: Passenger car / van</p> <p>COUNTRY OF ORIGIN: Spain</p> <p>No picture available.</p>	<p>INJURIES</p> <p>Due to an error in the assembly process, the screws for the shock absorber strut on the front-axle steering knuckle did not achieve the specified tightening torque. Insufficient tightening torque can result in shearing of the screws in question. The altered chassis geometry can lead to poorer vehicle handling which could lead to a road accident.</p>	Voluntary corrective action taken by the manufacturer.
EU/POLAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car Impreza, Forester</p> <p>BRAND: Subaru</p> <p>TYPE/NUMBER OF MODEL:</p> <p>Impreza: vehicles produced between 2001 and 2007</p> <p>Forester: vehicles produced between 2003 and 2008.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>Corrosion of the front control arm, may cause a loss of directional stability and lead to an accident.</p>	Voluntary corrective action taken by the manufacturer.
AUSTRALIA	<p>Toyota—RAV4 ACA & GSA 33R Models</p> <p>PRODUCT DESCRIPTION</p> <p>Toyota RAV4 ACA & GSA 33R Models</p> <p>IDENTIFYING FEATURES</p> <p>Recall campaign no: 2507C</p> <p>Target number: 22</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Toyota dealers</p> <p>SUPPLIER</p> <p>Toyota</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>During steering operation, a welded portion of the prototype instrument panel reinforcement (steering column support bracket) may separate, causing noise. In the worst case, steering operation may be affected.</p> <p>DEFECTS</p> <p>There is a possibility that a prototype instrument panel reinforcement has been installed on certain RAV4 vehicles.</p>	Owners of the affected vehicles will be notified by telephone and mail. Any authorised Toyota dealer will replace the Instrument Panel Reinforcement with a new one at NO CHARGE to the vehicle owner.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL infiniti / q45-2003-2005</p> <p>MANUFACTURER Nissan North America, inc</p> <p>COMPONENT air bags: frontal: driver side inflator module</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED NA</p> <p>SUMMARY Nissan is recalling certain model year 2003-2005 infiniti q45 vehicles. A wiring connector for the seat mounted airbag may experience increased electrical resistance, resulting in the non-deployment of the side air bags.</p> <p>No picture available.</p>	<p>CONSEQUENCE Non-deployment of side air bags could increase the risk of personal injury.</p>	<p>REMEDY Nissan will notify owners, and dealers will modify the wiring connector, free of charge. The safety recall is expected to begin on or about March 12, 2012. Owners may contact Nissan customer service at 1-800-647-7261.</p>
USA	<p>VEHICLE MAKE / MODEL freightliner / 114sd-2012-2013 freightliner / business class m2-2006-2013 freightliner / cascadia-2006-2013 freightliner / century-2006-2013 freightliner / Columbia-2006-2013 freightliner / Coronado-2006-2013 sterling / 9500-2006-2013 western star / 4700-2012-2013 western star / 4900-2006-2013 western star / 6900-2006-2013</p> <p>MANUFACTURER Daimler trucks North America</p> <p>COMPONENT engine and engine cooling: engine: diesel</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 103,437</p> <p>SUMMARY Daimler trucks (dtna) is recalling certain model year 2006-2013 freightliner, sterling, and western star vehicles, equipped with Detroit diesel epa07 and epa10, dd13 and dd15/16 engines, manufactured from January 20, 2006, through February 20, 2012. The pump to rail high pressure fuel line support system used on these engines is sensitive to assembly torque and may be damaged during service work. As a result of other repairs, the line supports may loosen, potentially leading to fuel line cracking and a fuel leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE A fuel leak could create a road hazard, increasing the risk of a crash. Also a fuel leak in the presence of an ignition source can result in a fire.</p>	<p>REMEDY Dtna will notify owners, and the high pressure fuel line support system will be replaced by dtna authorized service facilities, free of charge. The safety recall is expected to begin during March 2012. Owners may contact dtna at 1-800-547-0712.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Nissan / quest-2011-2012</p> <p>MANUFACTURER Nissan North America, inc.</p> <p>COMPONENT electrical system: software</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 23,531</p> <p>SUMMARY Nissan is recalling certain model year 2011-2012 Nissan quest vehicles, manufactured from July 29, 2010, through February 21, 2012. Due to software programming, while driving at slow speeds or idling on a decline with ¼ tank fuel or less, there may be an insufficient supply of fuel to the engine. as a result, the engine may stall. No picture available.</p>	<p>CONSEQUENCE Vehicle stalling could increase the risk of a crash.</p>	<p>REMEDY Nissan will notify owners, and dealers will reprogram the fuel pump control module, free of charge. The safety recall is expected to begin during mid March 2012. Owners may contact Nissan customer service at 1-800-647-7261.</p>
USA	<p>VEHICLE MAKE / MODEL pierce / arrow xt-2010-2012 pierce / dash cf-2010-2012 pierce / quantum-2010-2012 pierce / velocity-2010-2012</p> <p>MANUFACTURER pierce manufacturing</p> <p>COMPONENT engine and engine cooling: engine: diesel</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 276</p> <p>SUMMARY Pierce is recalling certain model year 2010-2012 arrow xt, dash cf, quantum and velocity emergency vehicles manufactured from October 13, 2010, through February 8, 2012, and equipped with Detroit diesel dd13 epa 2010 engines. The engine shutdown software normally provided to protect the engine and vehicle may not have been disabled on engines intended for emergency vehicle applications. No picture available.</p>	<p>CONSEQUENCE If the vehicle operator receives and ignores multiple warnings indicating the need for operator intervention, the engine may shut down unexpectedly. Unexpected emergency vehicle engine shutdown under certain conditions could hamper rescue operations and place the public at risk.</p>	<p>REMEDY Pierce will notify owners, and Detroit diesel dealers will disable the engine shutdown software, free of charge. Pierce has not provided a notification schedule. Owners may contact pierce at 888-974-3723.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Dutchmen / rubicon-2012</p> <p>MANUFACTURER Dutchmen manufacturing, inc.</p> <p>COMPONENT structure: frame and members</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 28</p> <p>SUMMARY Dutchmen is recalling certain model year 2012 Rubicon travel trailers manufactured from October 12, 2011, through February 23, 2012. These vehicles have been manufactured with a frame support located too close to the trailer tires which could result in the support contacting the tires when loaded. No picture available.</p>	<p>CONSEQUENCE Contact between the support and tire could result in tire failure, leading to loss of the vehicle control, increasing the risk of a crash.</p>	<p>REMEDY Dutchmen will notify owners, and dealers will remove the interfering frame support and install a new frame support, free of charge. The safety recall is expected to begin during March 2012. Owners may contact Dutchmen at 1-574-537-0700.</p>
USA	<p>VEHICLE MAKE / MODEL ford / focus-2000-2005</p> <p>MANUFACTURER ride control, llc</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 10,006</p> <p>SUMMARY Ride control, llc (ride control) is recalling certain readymount strut assemblies, p/n 746641mt and 746646mt, with corresponding aftermarket customer part numbers: gabriel g56944 and gabriel g56945, and privately branded partsmaster with part numbers g68944 and g68945. The strut assemblies were sold as aftermarket service equipment for use on certain 2000 through 2005 ford focus vehicles. These assemblies were produced with an incorrect nut that does not contain a flange. The absence of the flange nut can allow the readymount assembly to pull apart the top mount. No picture available.</p>	<p>CONSEQUENCE If the assembly separates during installation, it could result in injury to the installer. If the assembly separates while the vehicle is in motion, it could result in damage to the vehicle and possibly result in a vehicle crash.</p>	<p>REMEDY Ride control will notify owners and will set up procedures to repair or replace the affected parts without charge to the owner. The safety recall is expected to begin during March 2012. Owners may contact ride control at 1-800-999-3903.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>Volvo / s60-2012</p> <p>Volvo / s80-2012</p> <p>Volvo / xc60-2012</p> <p>Volvo / xc70-2012</p> <p>MANUFACTURER</p> <p>Volvo cars of n.a. llc.</p> <p>COMPONENT</p> <p>electrical system: wiring</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>17,000</p> <p>SUMMARY</p> <p>Volvo is recalling certain model year 2012 s60, xc60, s80 and xc70 vehicles manufactured from May 16, 2011, through October 6, 2011. In these vehicles, the wire harness under the front seats may have not been attached properly to the seat frame. As a result, when the seats are moved to adjust the seating position, the wire harness may get pulled, causing it to disconnect.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of crash, the front and/or side impact air bags may deploy improperly or not at all, increasing the risk of injury. Also, the lap belt pretensioner may not deploy.</p>	<p>REMEDY</p> <p>Volvo will notify owners, and dealers will inspect and, if necessary, secure the seat wire harness. This service will be performed free of charge. The safety recall is expected to begin on March 30, 2012. Owners may contact Volvo cars at 1-800-458-1552.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>Ducati / monster 1100 evo-2011-2012</p> <p>MANUFACTURER</p> <p>Ducati North America</p> <p>COMPONENT</p> <p>wheels: rim</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>892</p> <p>SUMMARY</p> <p>Ducati is recalling certain model year 2011-2012 monster 1100 evo motorcycles, manufactured from January 17, 2011, through January 24, 2012 and equipped with rear rims marked with code du6-rr. Over time, the spokes on the rear wheel rim may develop cracks.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Cracks may lead to failure of the rear wheel rim, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Ducati will notify owners, and dealers will replace the rear wheel rim, free of charge. Ducati has not yet provided the agency with an owner notification schedule for this campaign. Owners may contact Ducati at 1-800-231-6696 or go to their website at www.ducati.com.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL jeep / liberty-2004-2005</p> <p>MANUFACTURER Chrysler group llc</p> <p>COMPONENT suspension: rear</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 209,724</p> <p>SUMMARY Chrysler is recalling certain model year 2004 and 2005 jeep liberty vehicles manufactured from July 3, 2003, through July 14, 2005, originally sold, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode island, Vermont, west Virginia, Wisconsin, and the district of Columbia. Some vehicles may be equipped with rear lower control arms that can experience a rear suspension lower control arm fracture due to excessive corrosion. No picture available.</p>	<p>CONSEQUENCE A fracture of the rear lower control arm may result in a loss of vehicle control and may lead to a vehicle crash.</p>	<p>REMEDY Chrysler will notify owners, and dealers will replace the rear lower control arms on all affected vehicles originally sold in, or currently registered in the nhtsa defined salt belt states, free of charge. The safety recall is expected to begin by the end of April 2012. Owners may contact Chrysler at 1-800-853-1403.</p>
USA	<p>VEHICLE MAKE / MODEL autocar / acx-2012</p> <p>MANUFACTURER mcneilus truck & manufacturing</p> <p>COMPONENT service brakes, air: supply: hoses, lines/piping, and fittings</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 111</p> <p>SUMMARY McNeil's is recalling certain model year 2012 autocar acx trucks, manufactured from March 17, 2011, through February 10, 2012. The refuse truck manufacturing process may require that the tag axle on the chassis be removed. During removal, two air lines must be reinstalled in the correct location. If the air lines are reconnected incorrectly, the tag axle brakes will be applied when the tag axle is lifted, but will not function when the tag is axle is lowered. No picture available.</p>	<p>CONSEQUENCE Reduced braking ability could increase the risk of a crash.</p>	<p>REMEDY McNeil's will notify owners will inspect vehicles and perform repairs free of charge. The safety recall is expected to begin on or about March 15, 2012. Owners may contact McNeil's at 507-374-6321.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL utilimaster / aeromaster-2011</p> <p>MANUFACTURER utilimaster corporation</p> <p>COMPONENT power train: automatic transmission: gear position indication (prndl)</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 679</p> <p>SUMMARY Utilimaster is recalling certain model year 2011-2012 aeromaster vehicles manufactured from March 11, 2009, through December 3, 2012. The transmission gear shifter's cable may break at the attachment to the transmission control selector arm assembly mounted on the steering column. If the cable breaks, the transmission gear indicator in the 'prndl' display in the instrument panel will remain in the first gear position regardless of the gear selected. No picture available.</p>	<p>CONSEQUENCE An incorrect gear indication in the instrument panel may prevent the driver from knowing if they are in park or reverse, increasing the risk of a crash.</p>	<p>REMEDY Utilimaster will notify owners, and dealers will replace the transmission selector arm assembly and the transmission gear shifter's cable assembly, free of charge. The safety recall is expected to begin on or about March 2, 2012. Owners may contact utilimaster at 517-543-6400.</p>
USA	<p>VEHICLE MAKE / MODEL hitchhiker / discover America-2012</p> <p>MANUFACTURER nu wa industries, inc.</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 3</p> <p>SUMMARY Nu wa industries, inc. is recalling certain model year 2012 hitchhiker discover America recreation vehicles, manufactured from October 10, 2011 through January 30, 2012, equipped with electric/hydraulic (e/h) brake actuator pumps. Some of these pumps may not have been properly heat treated. This condition can cause premature wear of some critical components in these pumps which can render the unit inoperable. No picture available.</p>	<p>CONSEQUENCE The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY Nu wa will notify owners, and dexter axle company will replace actuators, free of charge. Nu wa has not provided a notification schedule. Owners may contact nu wa industries at 1-800-835-0676.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>Kawasaki / ex250jcf-2012 Kawasaki / ex250jcfa-2012 Kawasaki / ex250jcfal-2012 Kawasaki / ex250jcfl-2012 Kawasaki / ex650ecf-2012 Kawasaki / ex650ecfl-2012 Kawasaki / kle650ccf-2012 Kawasaki / kle650ccfl-2012</p> <p>MANUFACTURER</p> <p>Kawasaki motors corp., U.S.A.</p> <p>COMPONENT</p> <p>structure</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>793</p> <p>SUMMARY</p> <p>Kawasaki is recalling certain model year 2012 ex250jcf/a/al/l ninja 250, ex650ecf/l ninja 650 and kle650ccf/l versys motorcycles manufactured from September 13, 2011 through October 25, 2011. Due to engine vibration and damage during assembly, the circlips on the footpeg mounting pins can break and fall off and cause the footpeg to detach from the motorcycle.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the foot peg detaches, it could create a road hazard for other vehicle traffic and possibly distract the rider, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Kawasaki will notify owners, and dealers will replace the passenger footpeg pin circlips, free of charge. The safety recall is expected to begin on or about March 12, 2012. Owners may contact Kawasaki at 1-866-802-9381.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>excel / limited-2012</p> <p>MANUFACTURER</p> <p>Peterson industries, inc.</p> <p>COMPONENT</p> <p>equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>16</p> <p>SUMMARY</p> <p>Peterson industries, inc. is recalling certain model year 2012 excel limited recreational vehicles, equipped with electric/hydraulic (e/h) brake actuator pumps. Some of these pumps may not have been properly heat treated. This condition can cause premature wear of some critical components in these pumps which can render the unit inoperable.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Peterson will notify owners, and dealers will replace the actuators, free of charge. Peterson has not provided a notification schedule. Owners may contact Peterson industries at 1-800-368-3759.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Toyota / Tacoma-2005-2009</p> <p>MANUFACTURER Toyota motor North America, inc.</p> <p>COMPONENT air bags: frontal</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 495,470</p> <p>SUMMARY Toyota is recalling certain model year 2005-2009 tacoma vehicles, manufactured from September 14, 2004, through August 29, 2008. Over time, steering wheel vibration may damage the spiral cable assembly (clockspring) that powers the driver's air bag module. If damage occurs, the air bag warning lamp will illuminate and the air bag may become deactivated. No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the driver's side air bag may not deploy, increasing the risk of personal injury.</p>	<p>REMEDY Toyota will notify owners, and dealers will replace the spiral cable assembly, free of charge. The safety recall is expected to begin in early April 2012. Owners may contact Toyota at 1-800-331-4331.</p>
USA	<p>VEHICLE MAKE / MODEL Toyota / camry-2009 Toyota / camry hv-2009 Toyota / venza-2009-2011</p> <p>MANUFACTURER Toyota motor North America, inc.</p> <p>COMPONENT exterior lighting:brake lights:switch</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 186,798</p> <p>SUMMARY Toyota is recalling certain model year 2009 camry and model year 2009-2011 venza vehicles manufactured from October 20, 2008, through January 4, 2011, and July 1, 2008, through February 28, 2009. During assembly of the contact-type stop lamp switch, silicone grease may have come in contact with the surface of the switch which could cause contact resistance. If this occurs, warning lamps could illuminate, a no start condition could result, the shift lever may not shift from the "park" position, or the vehicle's brake lights could become inoperative. No picture available.</p>	<p>CONSEQUENCE Inoperative brake lights would not warn other drivers that the vehicle is slowing or stopping, increasing the risk of a crash.</p>	<p>REMEDY Toyota will notify owners, and dealers will replace the stop lamp switch, free of charge. The safety recall is expected to begin in early April 2012. Owners may contact Toyota at 1-800-331-4331.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>starcraft / prodigy-2010-2011</p> <p>starcraft / quest-2010-2011</p> <p>MANUFACTURER</p> <p>starcraft bus</p> <p>COMPONENT</p> <p>seats</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>22</p> <p>SUMMARY</p> <p>Starcraft is recalling certain model year 2010-2011 prodigy and quest school buses, manufactured from October 11, 2010 through January 3, 2011. These buses are equipped with bus seats manufactured by c.e. white. The seats were sold and installed as original equipment for certain starcraft school buses. The seats fail to conform to the requirements of federal motor vehicle safety standard number 222, "school bus passenger seating and crash protection."</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a crash, the seat back may fail, increasing the risk of injury to the seat's occupant.</p>	<p>REMEDY</p> <p>Starcraft will notify owners, and dealers will install a reinforcing bracket that c.e. white has provided. Starcraft has not provided a remedy schedule. Owners may contact starcraft at 1-800-347-7440.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>cruiser rv / enterra e303bhs-2013</p> <p>cruiser rv / enterra e314res-2013</p> <p>MANUFACTURER</p> <p>cruiser rv</p> <p>COMPONENT</p> <p>equipment: other: labels</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>47</p> <p>SUMMARY</p> <p>Cruiser rv is recalling certain model year 2013 enterra recreational vehicles, models e303bhs, and e314res, manufactured from December 16, 2011, through February 17, 2012. These vehicles have the incorrect federal id tag, tire and wheel information labels which fail to comply with the requirements of part 567, "certification."</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Failure to follow proper tire and wheel specifications because of a misprinted label could increase the risk of a crash.</p>	<p>REMEDY</p> <p>Cruiser rv will mail to consumers the corrected label or the customer will have the option for dealers to install the label free of charge. The safety recall is expected to begin during March 2012. Owners may contact cruiser rv at 1-877-514-7289.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL coachmen / encounter-2012 coachmen / Mirada-2012</p> <p>MANUFACTURER coachmen rv company, llc</p> <p>COMPONENT power train: automatic transmission: gear position indication (prndl)</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,449</p> <p>SUMMARY Coachmen rv is recalling certain model year 2011 -2012 Mirada and encounter recreational vehicles built on a ford f-53 chassis, manufactured from February 1, 2010, through February 17, 2012. The gear shifter's cable may break at the attachment to the transmission control selector arm assembly mounted on the steering column. If the cable breaks, the transmission gear indicator in the gear display in the instrument panel will remain in the first gear position regardless of the gear selected. No picture available.</p>	<p>CONSEQUENCE An incorrect gear indication in the instrument panel may prevent the driver from knowing if they are in park or reverse, increasing the risk of a crash.</p>	<p>REMEDY Coachmen will notify owners, and dealers will replace the transmission selector arm assembly and the gear shifter's cable assembly, free of charge. Coachmen has not provided a notification schedule for this campaign. Owners may contact coachmen rv at 1-800-453-6064.</p>
USA	<p>VEHICLE MAKE / MODEL mci / d4505-2012</p> <p>MANUFACTURER motor coach industries, inc</p> <p>COMPONENT electrical system</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 23</p> <p>SUMMARY Motor coach industries, inc (mci) is recalling certain model year 2012 d4505 motor coaches, equipped with a sedan style entrance door and an actia multiplex system. Thirty minutes after the park brake is set and the ignition is turned off, the entrance door will close without warning. No picture available.</p>	<p>CONSEQUENCE The entrance door will close without warning, increasing the risk of personal injury to people entering or exiting the bus.</p>	<p>REMEDY Mci will notify owners, and remedy the affected coaches by reprogramming the multiplex system, free of charge. The recall is expected to begin during March 2012. Owners may contact mci at 1-866-624-2622.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Subaru / forester-2009-2012</p> <p>MANUFACTURER Subaru of America, inc.</p> <p>COMPONENT seat belts: rear</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 275,000</p> <p>SUMMARY Subaru is recalling certain model year 2009-2012 forester vehicles manufactured from November 26, 2007, through March 13, 2012. The automatic locking retractor in the seat belt assemblies located in the rear center seating of the affected vehicles do not meet lockability requirements and fail to comply with federal motor vehicle safety standard no. 208, "occupant crash protection." Specifically, the assemblies may not permit proper installation and secure attachment of a child restraint in that seating position. No picture available.</p>	<p>CONSEQUENCE An insecure installation of a child restraint can increase the risk of injury to a child during a crash.</p>	<p>REMEDY Subaru will notify owners, and dealers will replace the rear center seat belt assembly with a newly modified automatic locking retractor, free of charge. The safety recall is expected to begin on or before April 13, 2012. Owners may contact Subaru at 1-800-782-2783.</p>
USA	<p>VEHICLE MAKE / MODEL trans tech / horizon-2011</p> <p>MANUFACTURER trans tech bus</p> <p>COMPONENT seat belts: front: anchorage</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2</p> <p>SUMMARY Transportation collaborative inc. (tci) is recalling two model year 2011 horizon transit buses manufactured of ford e350 and e450 econoline chassis. The fiberglass installed failed to meet design specifications, causing the insufficient torque valves at the upper torso mounting point. As such, these vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 210, "seat belt assembly anchorages." No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the shoulder restraint could detach from the b-pillar anchorage, increasing the risk of personal injury to the occupant.</p>	<p>REMEDY Tci will notify owners, and provide instructions and repair kits or the bus may be taken to an authorized repair facility, at no cost to the owner. The recall is expected to begin during March 2012. owners may contact tci at 1-845-988-0419.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL trans tech / sst-2011-2012</p> <p>MANUFACTURER trans tech bus</p> <p>COMPONENT seat belts: front: anchorage</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 11</p> <p>SUMMARY Transportation collaborative, inc. (tci) is recalling certain model year 2011 and 2012 trans tech model sst school buses manufactured of ford e350 and e450 econoline chassis. The fiberglass installed failed to meet design specifications, causing the insufficient torque valves at the upper torso mounting point. As such, these vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 210, "seat belt assembly anchorages." No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the shoulder restraint could detach from the b-pillar anchorage, increasing the risk of personal injury to the occupant.</p>	<p>REMEDY Tci will notify owners, and provide instructions and repair kits or the bus may be taken to an authorized repair facility, at no cost to the owner. The recall is expected to begin during March 2012. Owners may contact tci at 1-845-988-0419.</p>
USA	<p>VEHICLE MAKE / MODEL ford / f-650-2011 ford / f-750-2011</p> <p>MANUFACTURER ford motor company</p> <p>COMPONENT service brakes, air: supply: check valve</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 352</p> <p>SUMMARY Ford is recalling certain model year 2011 f-650 and f-750 trucks, manufactured from December 3, 2010, through December 20, 2011, equipped with bendix atr-6 antilock traction relay valves. In extremely cold conditions, the bendix relay valves may potentially develop internal leakage. Internal leakage can lead to air pressure being delivered to affected primary or secondary brake causing continuous brake application. No picture available.</p>	<p>CONSEQUENCE Unexpected continuous brake application can cause the brakes to overheat and lead to a fire. Unexpected continuous brake application can cause the driver to lose control of the vehicle, increasing the risk of a crash. Also, the brakes may be applied without illuminating the brake lights, failing to give proper warning to other drivers.</p>	<p>REMEDY Ford will notify owners, and dealers will install a bendix atr-6 traction relay valve kit. This service will be performed free of charge. The recall will begin on April 23, 2012. Owners may contact ford motor company at 1-800-392-3673.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Buick / regal-2012</p> <p>MANUFACTURER general motors llc</p> <p>COMPONENT exterior lighting</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 3,633</p> <p>SUMMARY General motors (gm) is recalling certain model year 2012 Buick regal vehicles manufactured from February 22, 2011, through February 22, 2012 for failing to comply with the requirements of federal motor vehicle safety standard no. 108 "lamps, reflective devices and associated equipment." Due to a software error, the parking lamps do not activate when either the parking lamps or headlamps are turned on. No picture available.</p>	<p>CONSEQUENCE Inadequate lighting could reduce the visibility of the vehicle, increasing the potential for a crash.</p>	<p>REMEDY General motors will notify owners, and dealers will reprogram the body control module free of charge. The recall is expected to begin on March 12, 2012. Owners may contact gm at 1-800-521-7300.</p>
USA	<p>VEHICLE MAKE / MODEL azure dynamics / balance hybrid-2010-2012</p> <p>MANUFACTURER azure dynamics corporation</p> <p>COMPONENT electrical system</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 261</p> <p>SUMMARY Azure dynamics is recalling certain model year 2010-2012 balance hybrid vehicles manufactured on a ford e450 chassis. If the low temperature radiator fans seize, the fuse may blow, which will cause the vehicle control unit to lose power, since it is on the same circuit. No picture available.</p>	<p>CONSEQUENCE If this condition occurs, the vehicle will stall and cannot be restarted, increasing the risk of a crash.</p>	<p>REMEDY Azure dynamics will notify owners and dealers will upgrade the wiring harnesses free of charge. Azure dynamics has not provided a notification schedule. Owners may contact azure dynamics at 1-866-473-1636.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Mack / leu-2010-2012 Mack / mru-2011-2012</p> <p>MANUFACTURER Mack trucks, inc</p> <p>COMPONENT suspension: front</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 240</p> <p>SUMMARY Mack is recalling certain model year 2010-2012 leu and model year 2011-2012 mru vehicles, manufactured from May 14, 2009, through October 31, 2011, and built to operate on compressed natural gas. On these vehicles the alternator ground cable runs directly to the starter, which defeats the circuit protection. No picture available.</p>	<p>CONSEQUENCE In the event of an electrical short, a vehicle fire may result.</p>	<p>REMEDY Mack will notify owners, and dealers will relocate the alternator ground cable to the engine ground stud. This service will be performed free of charge. The recall is expected to begin on, or before March 30, 2012. Owners may contact Mack trucks at 1-800-866-1177.</p>
USA	<p>VEHICLE MAKE / MODEL infiniti / m45-2003-2004</p> <p>MANUFACTURER Nissan North America, inc.</p> <p>COMPONENT fuel system, gasoline</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 8,120</p> <p>SUMMARY Nissan is recalling certain model year 2003-2004 infiniti m45 vehicles manufactured from March 7, 2002, through June 3, 2004. Due to a circuit board failure, the fuel gauge may read a fuel level higher than actually exists. As a result, the vehicle may run out of gas without notice. No picture available.</p>	<p>CONSEQUENCE The vehicle may stall without warning, increasing the risk of a crash.</p>	<p>REMEDY Nissan will notify owners, and dealers will modify the circuit board free of charge. The recall is scheduled to begin in mid-April 2012. Owners may contact Nissan customer service at 1-800-647-7261.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Jayco—Starcraft Caravan</p> <p>PRODUCT DESCRIPTION</p> <p>Windows (size 1028 x 914mm) fitted to certain Jayco Starcraft caravans</p> <p>IDENTIFYING FEATURES</p> <p>Certain Jayco Starcraft caravans with chassis numbers between N80001 and P80127</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Jayco dealers</p> <p>SUPPLIER</p> <p>Jayco Corporation Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.jayco.com.au/</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the window sash separates from the window frame while in motion, the window could possibly be ejected, causing a hazard to road users.</p> <p>DEFECTS</p> <p>The window sashes may separate from the window frames under extreme conditions.</p>	<p>Customers should contact the nearest Jayco dealer or Jayco service agent to have additional locks fitted to the window sashes as required. Letters will be sent to all affected customers.</p>
AUSTRALIA	<p>Hyundai—Santa Fe with Diesel 'R' Engine</p> <p>PRODUCT DESCRIPTION</p> <p>Santa Fe (CM) F/L, diesel 'R' engine</p> <p>IDENTIFYING FEATURES</p> <p>Recall campaign number: RC21B003</p> <p>See attached list for VIN range.</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Hyundai dealers</p> <p>SUPPLIER</p> <p>Hyundai</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Insufficient clearance between components could result in a fuel leak. A diesel fuel leak may pose a hazard to other road users and/or a risk of fire.</p> <p>DEFECTS</p> <p>There may be insufficient clearance between the engine cover assembly and the fuel return hose.</p>	<p>Owners of affected vehicles will be contacted by letter. Dealerships will conduct a service check of all vehicles to be recalled and will rectify the defect where necessary.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</p> <p>diamond-black / brake line kit diamondback / brake line kit</p> <p>MANUFACTURER</p> <p>harley-davidson motor company</p> <p>COMPONENT</p> <p>equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>5,757</p> <p>SUMMARY</p> <p>Harley Davidson is recalling accessory brake line kits sold for installation on certain model year 1996-2012 dyna and certain model year 1999-2012 softail motorcycles. Due to manufacturing and installation conditions these accessory brake line kits may leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If a leak occurs and remains undetected, the rider may have reduced braking ability, increasing the risk of a crash, leading to injury or death.</p>	<p>REMEDY</p> <p>Harley Davidson will notify owners, and dealers will inspect the motorcycles and replace the accessory brake lines, as necessary, free of charge. The safety recall is expected to begin on or about March 5, 2012.</p> <p>Owners may contact Harley-Davidson at 1-800-258-2464.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</p> <p>Gabriel / readymount g56944 Gabriel / readymount g56945 partsmaster / readymount g68944 partsmaster / readymount g68945</p> <p>MANUFACTURER</p> <p>ride control, llc</p> <p>COMPONENT</p> <p>equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>10,006</p> <p>SUMMARY</p> <p>Ride control, llc (ride control) is recalling certain readymount strut assemblies, p/n 746641mt and 746646mt, with corresponding aftermarket customer part numbers: gabriel g56944 and gabriel g56945, and privately branded partsmaster with part numbers g68944 and g68945. The strut assemblies were sold as aftermarket service equipment for use on certain 2000 through 2005 ford focus vehicles. These assemblies were produced with an incorrect nut that does not contain a flange. The absence of the flange nut can allow the readymount assembly to pull apart the top mount.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the assembly separates during installation, it could result in injury to the installer. If the assembly separates while the vehicle is in motion, it could result in damage to the vehicle and possibly result in a vehicle crash.</p>	<p>REMEDY</p> <p>Ride control will notify owners and will set up procedures to repair or replace the affected parts without charge to the owner. The safety recall is expected to begin during March 2012. Owners may contact ride control at 1-800-999-3903.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</p> <p>Detroit diesel / dd13-apr 22, 2009 - feb 01, 2012</p> <p>MANUFACTURER</p> <p>Daimler trucks north America</p> <p>COMPONENT</p> <p>fuel system, diesel</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>670</p> <p>SUMMARY</p> <p>Daimler trucks (dtna) is recalling certain Detroit diesel epa07 and epa10 dd13 engines manufactured from April 22, 2009, through February 1, 2012. These engines were installed as original equipment on various heavy duty trucks and emergency vehicles. The pump to rail high pressure fuel line support system used on these engines is sensitive to assembly torque and may be damaged during service work. As a result of other repairs, the line supports may loosen, potentially leading to fuel line cracking and a fuel leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A fuel leak could create a road hazard, increasing the risk of a crash. Also a fuel leak in the presence of an ignition source can result in a fire.</p>	<p>REMEDY</p> <p>Dtna will notify owners, and the high pressure fuel line support system will be replaced by dtna authorized service facilities, free of charge. The safety recall is expected to begin during March 2012. Owners may contact dtna at 1-800-547-0712.</p>
USA	<p>TIRE BRAND NAME / TIRE LINE / TIRE SIZE:</p> <p>advance extra grip / ar215 / p235/75r15 lt</p> <p>MANUFACTURER</p> <p>gtc North America, inc.</p> <p>COMPONENT</p> <p>tires: sidewall</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>12,289</p> <p>SUMMARY</p> <p>Gtc North America, inc., (gtc) is recalling certain advance extra grip ar215 light truck radial tires, size p235/75r15, produced from September 2008 through December 2009. Some of the subject tires experience blistering or bubbles on the tire's sidewall. These tires fail to conform to the requirements of federal motor vehicle safety standard no. 139, "new pneumatic radial tires for light vehicles."</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>These tires may experience blistering on their sidewall that, with extended use, could lead to tread chunking with belt edge exposure and possible air loss, thereby increasing the potential risk of property damage, personal injury, or a crash.</p>	<p>REMEDY</p> <p>Gtc will notify owners, and replace the noncompliant tires with a similar tire free of charge. Free mounting and balancing will also be included, as applicable. The safety recall is expected to begin during March 2012. Owners may contact gtc at 1-330-498-5000.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

www.sgs.com/regulatorycompliance

© 2012 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

