

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

1-15 MAY 2013

## CONTENTS

### AUTOMOTIVE

Pages 2 to 23



[Motor Vehicle \(38\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(8\)](#)

Please note that from November 2012 on, product recall notifications can be searched on line in several countries via the Global portal on product recalls hosted by the Organisation for Economic Co-operation and Development (OECD). You can access the OECD site by using the following [link](#).

**SGS**

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>LIBERO/L24CB-2012-2013  REGENCY GT/GT24MB-2012-2013  REGENCY GT/GT27S-2012-2013  REGENCY GT/GT28D-2012-2013  REGENCY GT/GT29T-2012-2013  SERENITY/S24CB-2012-2013  UNITY/U24CB-2012-2013  UNITY/U24IB-2012-2013  UNITY/U24MB-2012-2013  UNITY/U24TB-2012-2013</p> <p><b>MANUFACTURER</b></p> <p>TRIPLE E RECREATIONAL VEHICLES</p> <p><b>COMPONENT</b></p> <p>EXTERIOR LIGHTING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>410</p> <p><b>SUMMARY</b></p> <p>Triple E Recreational Vehicles (Triple E) is recalling certain model year 2012-2013 Libero L24CB, Serenity S24CB, Regency GT (GT24MB, GT27S, GT28D, GT29T), and Unity (U24CB, U24IB, U24TB, U24MB). The light for the license plate does not adequately illuminate the license plate to have it be visible when it is dark out. Therefore, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment."  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Without license plate illumination, the vehicle may be difficult to identify at night.</p>	<p><b>REMEDY</b></p> <p>Triple E Recreational Vehicles will notify owners and dealers will install a new license plate lamp, free of charge. The recall is expected to begin in early-May 2013. Owners may contact Triple E at 1-877-992-9906. Triple E's number for this campaign is CA#7719-1.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>TEREX/AERIAL DEVICES-1998-2005</p> <p><b>MANUFACTURER</b></p> <p>TEREX SOUTH DAKOTA, INC.</p> <p><b>COMPONENT</b></p> <p>EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>500</p> <p><b>SUMMARY</b></p> <p>Terex South Dakota, Inc. (Terex) is recalling certain model year 1998-2005 OM Aerial Devices used on utility trucks. The leveling arm at the elbow can develop fatigue cracks.  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Fatigue cracks may cause the leveling arm to fail. If the arm fails while the aerial device is in use, the platform may move unexpectedly, increasing the risk of injury to the operator or those nearby.</p>	<p><b>REMEDY</b></p> <p>Terex will notify owners to inspect their unit immediately and arrange repairs with Terex or dealers. Repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex at 1-605-884-3892. Terex's recall campaign number is SN606.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>ITASCA/CAMBRIA-2012-2014  ITASCA/MERIDIAN-2012-2014  ITASCA/SPIRIT-2012-2014  ITASCA/SUNCRUISER-2012-2014  ITASCA/SUNOVA-2012-2014  WINNEBAGO/ADVENTURER-2012-2014  WINNEBAGO/ASPECT-2012-2014  WINNEBAGO/CHALET-2012-2014  WINNEBAGO/JOURNEY-2012-2014  WINNEBAGO/MINNIE WINNIE-2012-2014  WINNEBAGO/SIGHTSEER-2012-2014</p> <p><b>MANUFACTURER</b></p> <p>Winnebago Industries, Inc</p> <p><b>COMPONENT</b></p> <p>EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>1,927</p> <p><b>SUMMARY</b></p> <p>Winnebago Industries is recalling certain model year 2012-2014 Minnie Winnie, Chalet, Aspect, Sightseer, Adventurer, and Journey motorhomes; and model year 2012-2014 Itasca Spirit, Cambria, Sunova, Suncruiser, and Meridian motorhomes. The affected vehicles were manufactured January 10, 2012, through April 5, 2013 and may be missing a range enclosure.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A missing range enclosure may allow the gas range flame to be extinguished due to air flow. In such a case, propane gas will continue to flow without a flame. If propane continues to flow, in the presence of an ignition source, it may suddenly combust resulting in a fire and/or personal injury.</p>	<p><b>REMEDY</b></p> <p>Winnebago notify owners and dealers will install a range enclosure, free of charge. The safety recall will begin by the end of May 2013. Owners may contact Winnebago at 1-641-585-3535. Winnebago's recall campaign number is 128.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>LION/360-2014</p> <p><b>MANUFACTURER</b></p> <p>LION BUS INC.</p> <p><b>COMPONENT</b></p> <p>SERVICE BRAKES, HYDRAULIC</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>1</p> <p><b>SUMMARY</b></p> <p>Lion Bus, Inc. is recalling one model year 2014 360 bus manufactured in December 2012. Due to insufficient distance between the air compressor discharge line and the hydraulic brake line, the lines may chafe against each other resulting in a hole in the brake line.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A brake line hole could result in a loss of brake fluid. The fluid loss could lengthen the stopping distance required thus increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Lion Bus will notify the owner and an Alliance Bus representative will modify the bus to ensure that there is adequate distance between the air compressor discharge line and the hydraulic brake line. The manufacturer has not yet provided a notification schedule.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b> TOYOTA/FJ CRUISER-2007-2013</p> <p><b>MANUFACTURER</b> Toyota Motor Engineering &amp; Manufacturing</p> <p><b>COMPONENT</b> EXTERIOR LIGHTING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 11,489</p> <p><b>SUMMARY</b> Toyota Motor Corporation (Toyota) is recalling certain model year 2007-2013 FJ Cruiser vehicles manufactured January 25, 2006 through February 23, 2013 and equipped with a Toyota Auxiliary Driving Lamp Kits mounted to the front bumper. These lamp assemblies include 55 watt bulbs and due to this wattage and mounting angle, the combination of the upper beam headlamps plus the auxiliary lamps are too bright and exceed the maximum light output allowed for an upper beam headlamp. Therefore, these vehicles fail to conform to Federal Motor Vehicle Safety Standard No. 108, "Lamps, reflective devices, and associated equipment." No picture available.</p>	<p><b>CONSEQUENCE</b> Light intensities above the maximum allowable limit could cause increased glare for oncoming traffic and increase the risk of a crash.</p>	<p><b>REMEDY</b> Toyota will notify owners, and dealers will replace the 55 watt bulbs with 35 watt bulbs, free of charge. The recall is expected to begin in late May 2013. Owners may contact Toyota at 1-800-331-4331.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b> FERRARA/INTRUDER EMBER-2011-2012 HME/SPECTR-2012 HME/SPECTR FIRE APPARATUS-2012</p> <p><b>MANUFACTURER</b> HME, Inc.</p> <p><b>COMPONENT</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 11</p> <p><b>SUMMARY</b> HME is recalling certain model year 2012 Spectr Fire Apparatus, Spectr Chassis, and 2011-2012 Ferrara Intruder Ember Chassis vehicles manufactured January 26, 2011, through November 7, 2012. These vehicles have axles are equipped with an MGM Type 24 J-series piston parking brake chamber. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. No picture available.</p>	<p><b>CONSEQUENCE</b> Overheated brake components could result in a fire.</p>	<p><b>REMEDY</b> HME will notify owners and the brake chambers will be inspected and replaced as needed, free of charge. The safety recall is expected to begin on, or before, May 13, 2013. Owners may contact HME at 1-616-534-1463.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>THOR/CHALLENGER-2013-2014            THOR/CHATEAU-2013-2014            THOR/CHATEAU SPORT-2013-2014            THOR/FOUR WINDS 5000-2013-2014            THOR/FOUR WINDS SIESTA-2013            THOR/HURRICANE-2013-2014            THOR/MAJESTIC-2014            THOR/PALAZZO-2013            THOR/WINDSPORT-2013-2014</p> <p><b>MANUFACTURER</b></p> <p>Thor Motor Coach</p> <p><b>COMPONENT</b></p> <p>EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>427</p> <p><b>SUMMARY</b></p> <p>Thor Motor Coach is recalling certain model year 2013-2014 Challenger, Four Winds 5000, Hurricane, Chateau, Chateau Sport, and Windsport; model year 2013 Palazzo and Four Winds Siesta and model year 2014 Majestic motorhomes manufactured February 13, 2013, through April 09, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. A damaged motor may lead to an unfurling of the awning.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Thor Motor Coach will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. Thor has not yet provided a notification schedule. Owners may contact Thor at 1-877-855-2867 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>JEEP/WRANGLER-2008-2012</p> <p><b>MANUFACTURER</b></p> <p>Chrysler Group LLC</p> <p><b>COMPONENT</b></p> <p>AIR BAGS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>5,440</p> <p><b>SUMMARY</b></p> <p>Chrysler Group LLC (Chrysler) is recalling certain model year 2008-2012 Jeep Wrangler right-hand drive vehicles manufactured February 1, 2007, through October 10, 2011. The affected vehicles have airbag clockspring assemblies that could experience broken airbag circuits.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a crash necessitating airbag deployment, a broken electrical circuit in the airbag clockspring wiring assembly can lead to non-deployment of the driver-side frontal airbag and will not be able to properly protect the driver, increasing the risk of injuries.</p>	<p><b>REMEDY</b></p> <p>Chrysler will notify owners, and dealers will replace the clockspring and add a steering wheel dust shield, free of charge. The recall is expected to begin May 2013. Owners may contact Chrysler at 1-800-247-9753. This recall supercedes NHTSA recall 11V-528. Chrysler's recall campaign number is</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>ITASCA/CAMBRIA-2013-2014  ITASCA/IMPULSE-2013-2014  ITASCA/SUNCRUISER-2013-2014  ITASCA/SUNOVA-2013-2014  ITASCA/SUNSTAR-2013-2014  WINNEBAGO/ACCESS-2013-2014  WINNEBAGO/ADVENTURER-2013-2014  WINNEBAGO/ASPECT-2014  WINNEBAGO/FORZA-2014  WINNEBAGO/SIGHTSEER-2013-2014  WINNEBAGO/VISTA-2013-2014</p> <p><b>MANUFACTURER</b></p> <p>Winnebago Industries Inc.</p> <p><b>COMPONENT</b></p> <p>EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>523</p> <p><b>SUMMARY</b></p> <p>Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2013-2014 Winnebago Access, Aspect, Sightseer, Vista, Adventurer, Forza and Itasca Impulse, Cambria, Sunova, Sunstar, Suncruiser motorhomes manufactured February 20, 2013, through April 25, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. A damaged motor may lead to an unfurling of the awning.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Winnebago will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. Winnebago has not yet provided a notification schedule. Owners may contact Winnebago at 1-800-537-1885 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.</p>
EU/PORTUGAL	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Light motor vehicle: pick-up</p> <p><b>BRAND:</b> Mitsubishi</p> <p><b>NAME:</b> L200</p> <p><b>TYPE/NUMBER OF MODEL:</b> L200 (KA4T/KB4T); MY: 2012 - 2013.</p> <p><b>DESCRIPTION:</b> Production period: 28th Jul 2011 – 3th Nov 2011 and 1st Dec 2011 – 11th Oct 2012.</p> <p><b>COUNTRY OF ORIGIN:</b> Thailand</p> <p>No pictures available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries due to low engine power performance, poor idling, "MIL on" and engine stalling. Due to DPF (Diesel Particulate Filter) clogging, engine stalling may occur.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b>  MERCEDDES/GL350-2013  MERCEDDES/GL450-2013  MERCEDDES/GL550-2013  MERCEDDES/GL63-2013</p> <p><b>MANUFACTURER</b>  Mercedes-Benz USA, LLC.</p> <p><b>COMPONENT</b>  SEAT BELTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  272</p> <p><b>SUMMARY</b>  Mercedes-Benz USA, LLC (Mercedes) is recalling certain model year 2013 GL350 BlueTEC, GL450 4MATIC, GL550 4MATIC, and GL63 AMG vehicles manufactured May 15, 2012 through October 4, 2012. The second row seat belt anchor fitting bolts may not be properly torqued.  No picture available.</p>	<p><b>CONSEQUENCE</b>  If the bolts are not properly torqued, the seat belt anchor bolts may continue to loosen and in the the event of a crash, the belted occupant may not be properly restrained, increasing the risk of injury.</p>	<p><b>REMEDY</b>  Mercedes-Benz will notify owners and dealers will check, and tighten the bolts of the seat belt anchor fittings, as necessary, free of charge. The recall campaign is expected to begin in May 2013. Owners may contact Mercedes-Benz at 1-800-367-6372.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b>  RAM/1500-2013</p> <p><b>MANUFACTURER</b>  Chrysler Group LLC</p> <p><b>COMPONENT</b>  ENGINE AND ENGINE COOLING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  498</p> <p><b>SUMMARY</b>  Chrysler Group LLC (Chrysler) is recalling certain model year 2013 RAM 1500 trucks manufactured manufactured June 25, 2012, through December 12, 2012. In the affected vehicles, the coolant bypass valve may stick in a position that does not allow coolant to flow into the heater core. Thus, these vehicles fail to conform to the requirements of Federal Vehicle Motor Safety Standard (FMVSS) No. 103, "Windshield Defrosting and Defogging Systems."  No picture available.</p>	<p><b>CONSEQUENCE</b>  Without a properly working windshield defrosting system, a buildup of moisture or ice could limit the driver's ability to see, increasing the risk of a crash.</p>	<p><b>REMEDY</b>  Chrysler will notify owners, and dealers will replace the suspect coolant valves along with an updated calibration, free of charge. The recall is expected to begin in June 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N25.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>JAYCO/EAGLE-2013            JAYCO/EAGLE HT-2013            JAYCO/EAGLE PREMIER-2013-2014            JAYCO/JAY FEATHER ULTRA LITE-2013-2014            JAYCO/JAY FLIGHT-2013-2014            JAYCO/JAY FLIGHT BUNGALOW-2013            JAYCO/JAY FLIGHT DESTINATION-2013            JAYCO/JAY FLIGHT SWIFT-2013-2014            JAYCO/OCTANE-2013-2014            JAYCO/PINNACLE-2013            JAYCO/PRECEPT-2014            JAYCO/REDHAWK-2013            JAYCO/SEISMIC-2013            JAYCO/WHITE HAWK-2013-2014</p> <p><b>MANUFACTURER</b></p> <p>Jayco, Inc.</p> <p><b>COMPONENT</b></p> <p>EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>2,491</p> <p><b>SUMMARY</b></p> <p>Jayco is recalling certain model year 2013-14 Eagle Premiere, Jay Feather Ultra Lite, Jay Flight, Jay Flight Swift, Octane, and White Hawk; model year 2013 Eagle, Eagle HT, Jay Flight Bungalow, Jay Flight Destination, Pinnacle, Redhawk and Seismic; and model year 2014 Precept recreational vehicles. In these vehicles, if the awning installation sequence is not completely followed, the awning motor may unknowingly become damaged.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Jayco will notify owners and dealers will inspect and replace the awning motor free of charge. The recall is expected to begin in May 2013. Owners may contact Jacyo at 1-800-283-8267 for more information.</p>



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>NEWMAR/BAY STAR-2013-2014  NEWMAR/BAY STAR SPORT-2013  NEWMAR/CANYON STAR-2013-2014  NEWMAR/DUTCH STAR-2013-2014  NEWMAR/VENTANA-2013  NEWMAR/VENTANA LE-2013</p> <p><b>MANUFACTURER</b></p> <p>Newmar Corporation</p> <p><b>COMPONENT</b></p> <p>EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>111</p> <p><b>SUMMARY</b></p> <p>Newmar Corporation is recalling certain model year 2013 Bay Star Sport, Ventana and Ventana LE and model year 2013-2014 Bay Star, Canyon Star and Dutch Star motorhomes. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Newmar will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. The manufacturer has not provided a notification schedule. Owners may contact Newmar at 1-574-773-7791 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>NEWMAR/CANYON STAR-2012-2013</p> <p><b>MANUFACTURER</b></p> <p>Newmar Corporation</p> <p><b>COMPONENT</b></p> <p>EXTERIOR LIGHTING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>103</p> <p><b>SUMMARY</b></p> <p>Newmar Corporation is recalling certain model year 2012-2013 Canyon Star motorhomes manufactured August 4, 2011, through February 19, 2013, for failing to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The affected vehicles may have missing reflectors on the rear cap.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The absence of reflectors could reduce the ability for others to see the motorhome, increasing the risk that another vehicle may crash into the motorhome.</p>	<p><b>REMEDY</b></p> <p>Newmar will notify owners and dealers will install the required reflectors. The manufacturer has not yet provided a notification schedule. Owners may contact Newmar at 1-574-773-7791.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b> VOLVO/BUS9700-2009-2013</p> <p><b>MANUFACTURER</b> Volvo Bus Corporation</p> <p><b>COMPONENT</b> ELECTRICAL SYSTEM</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 285</p> <p><b>SUMMARY</b> Volvo Bus Corporation is recalling certain model year 2009-2013 9700 coaches manufactured from August 28, 2008, through April 19, 2013. Certain conditions may cause the affected coaches to go into a software controlled mode that would result in the throttle signal being fixed at 1750rpms regardless of throttle pedal input from the driver. No picture available.</p>	<p><b>CONSEQUENCE</b> The driver may lose the ability to control the bus's speed, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Volvo Bus will notify owners and dealers will remedy the software calibrations in the affected coaches, free of charge. The recall is expected to begin by July 1, 2013. Owners may contact Volvo Bus at 1-336-393-2000. Volvo Bus's recall campaign number is SR13-80.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b> TRIUMPH/EXPLORER-2012-2013 TRIUMPH/EXPLORER XC-2012-2013</p> <p><b>MANUFACTURER</b> Triumph Motorcycles America, LTD</p> <p><b>COMPONENT</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1,186</p> <p><b>SUMMARY</b> Triumph Motorcycles America, Ltd. is recalling certain model year 2012-2013 Explorer and Explorer XC motorcycles. The Gross Vehicle Weight Rating data on the certification Label is incorrect. Thus, the motorcycles fail to comply with the requirements of Part 567, "Certification." No picture available.</p>	<p><b>CONSEQUENCE</b> The incorrect label could cause the operator to overload the motorcycle which may result in handling issues and/or tire failure, increasing the risk of a crash.</p>	<p><b>REMEDY</b> Triumph will notify owners and replace the labels with corrected GVWR data, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Triumph at 1-678-854-2010 for more information.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>BMW/325CI-2002-2003  BMW/325I-2002-2003  BMW/325IT-2002-2003  BMW/325XI-2002-2003  BMW/325XIT-2002-2003  BMW/330CI-2002-2003  BMW/330I-2002-2003  BMW/330XI-2002-2003  BMW/M3-2002-2003</p> <p><b>MANUFACTURER</b></p> <p>BMW of North America, LLC</p> <p><b>COMPONENT</b></p> <p>AIR BAGS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>42,080</p> <p><b>SUMMARY</b></p> <p>BMW is recalling certain model year 2002-2003 325i, 325xi, 330i, 330xi sedans; 325Ci and 330Ci coupes and convertibles; 325iT and 325xiT Sports Wagons; and M3 coupes and convertibles to address a safety defect in the passenger side frontal air bag which may produce excessive internal pressure causing the inflator to rupture upon deployment of the air bag.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the passenger seat occupant or other occupants.</p>	<p><b>REMEDY</b></p> <p>BMW intends to issue initial notifications to owners informing them of the safety defect in May. Once replacement parts are available, estimated for July, BMW will notify owners again to contact their dealers and schedule a replacement of the passenger air bag, free of charge. Owners may contact BMW customer service at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b></p> <p>BRECKENRIDGE/BRECKENRIDGE-2013</p> <p><b>MANUFACTURER</b></p> <p>Dutchmen Manufacturing, Inc.</p> <p><b>COMPONENT</b></p> <p>EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b></p> <p>5</p> <p><b>SUMMARY</b></p> <p>Dutchmen Manufacturing is recalling certain model year 2013 Breckenridge recreational vehicles manufactured February 13, 2013, through April 9, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If motor damage has occurred, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Dutchmen will notify owners and dealers will replace the affected motors with a design that is not subject to an out-of-sequence installation error. This will be done at no cost to the owner. Owners are being instructed not to drive their vehicle until repairs can be performed. Owners may contact Dutchmen at 1-574-537-0700.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b>            BUICK/LACROSSE-2012-2013            BUICK/REGAL-2012-2013            CHEVROLET/MALIBU ECO-2013</p> <p><b>MANUFACTURER</b>            General Motors LLC</p> <p><b>COMPONENT</b>            ELECTRICAL SYSTEM</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            42,904</p> <p><b>SUMMARY</b>            General Motors (GM) is recalling certain model year 2012 and 2013 Buick LaCrosse and Regal, and model year 2013 Chevrolet Malibu Eco vehicles equipped with eAssist. These vehicles may have a condition in which the Generator Control Module (GCM) may not function properly. This could cause a gradual loss of battery charge and the illumination of the malfunction indicator light.            No picture available.</p>	<p><b>CONSEQUENCE</b>            If the vehicle is continued to be driven, the engine may stall and/or the vehicle may not start. In addition, there may be a burning or melting odor, smoke, and possibly a fire in the trunk.</p>	<p><b>REMEDY</b>            GM will notify owners and dealers will test the GCM and replace it, as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM at 1-800-521-7300. GM's recall campaign number is 13136.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b>            JEEP/COMMANDER-2006-2010            JEEP/GRAND CHEROKEE-2005-2010</p> <p><b>MANUFACTURER</b>            Chrysler Group LLC</p> <p><b>COMPONENT</b>            ELECTRICAL SYSTEM , POWER TRAIN</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            295,345</p> <p><b>SUMMARY</b>            Chrysler Group LLC (Chrysler) is recalling certain model year 2005-2010 Jeep Grand Cherokee vehicles manufactured February 11, 2004, through March 9, 2010; and 2006-2010 Jeep Commander vehicles manufactured January 31, 2005, through March 10, 2010. A transfer case electrical failure may result in an unintentional shifting of the transfer case into the neutral position.            No picture available.</p>	<p><b>CONSEQUENCE</b>            If the vehicle shifts into neutral, it may roll away increasing the risk of a crash or personal injury.</p>	<p><b>REMEDY</b>            Chrysler will notify owners, and dealers will reflash the final drive controller which governs the transfer case, with new software, free of charge. The recall is expected to begin in June 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N23.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b> TIFFIN/ALLEGRO-2013 TIFFIN/BREEZE-2013</p> <p><b>MANUFACTURER</b> Tiffin Motorhomes, Inc.</p> <p><b>COMPONENT</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 293</p> <p><b>SUMMARY</b> Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2013 Breeze and Allegro motorhomes. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged.  No picture available.</p>	<p><b>CONSEQUENCE</b> If motor damage has occurred, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p><b>REMEDY</b> Tiffin will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. Tiffin has not yet provided a notification schedule. Owners may contact Tiffin at 1-256-356-8661 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b> HEARTLAND/BIG COUNTRY-2013-2014 HEARTLAND/BIGHORN-2013-2014 HEARTLAND/ELK RIDGE-2013-2014 HEARTLAND/ELK RIDGE EXPRESS-2013-2014 HEARTLAND/LANDMARK-2013-2014 HEARTLAND/PROWLER-2013-2014 HEARTLAND/SILVERADO-2013-2014 HEARTLAND/SUNDANCE-2013-2014 HEARTLAND/SUNDANCE XLT-2013-2014</p> <p><b>MANUFACTURER</b> Heartland Recreational Vehicles, LLC</p> <p><b>COMPONENT</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 890</p> <p><b>SUMMARY</b> Heartland Recreational Vehicles is recalling certain model year 2013-2014 Big Country, Bighorn, Elk Ridge, Elk Ridge Express, Landmark, Prowler, Sundance, Sundance XLT, and Silverado fifth wheel and travel trailers manufactured February 13, 2013, through April 16, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged.  No picture available.</p>	<p><b>CONSEQUENCE</b> If motor damage has occurred, it is possible that the awning can unfurl unexpectedly, either while the trailer is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p><b>REMEDY</b> Heartland will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. A notification schedule has not yet been provided. Owners may contact Heartland Recreational Trailers at 1-888-262-5992 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed. Heartland's recall campaign number is 99-01-11.</p>


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE/MODEL</b>            SPARTAN/K2-2006-2011            SPARTAN/K3-2006-2011            SPARTAN/MM-2006-2010</p> <p><b>MANUFACTURER</b>            Spartan Motors, Inc.</p> <p><b>COMPONENT</b>            STEERING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            2,694</p> <p><b>SUMMARY</b>            Spartan Motors Chassis (Spartan) is recalling certain model year 2006-2011 K2, and K3 and 2006-2010 MM motorhome chassis manufactured July 20, 2005, through December 17, 2010. The steering gear mounting brackets may crack and detach resulting in a loss of steering.            No picture available.</p>	<p><b>CONSEQUENCE</b>            A loss of steering control may increase the risk of a crash.</p>	<p><b>REMEDY</b>            Spartan will notify owners. Starting in mid-June 2013, dealers will install a replacement bracket or a reinforcement to the existing bracket. Until the remedy is available, owners may have their vehicle inspected at any Spartan service center. All repairs will be performed free of charge. The recall is expected to begin on, or before, May 17, 2013.</p>
USA	<p><b>VEHICLE MAKE/MODEL</b>            SUBARU/LEGACY-2013            SUBARU/OUTBACK-2013</p> <p><b>MANUFACTURER</b>            Subaru of America, Inc.</p> <p><b>COMPONENT</b>            STEERING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            5,379</p> <p><b>SUMMARY</b>            Subaru is recalling certain model year 2013 Outback and Legacy vehicles manufactured from February 15, 2012, through June 15, 2012. In the affected vehicles, the inner and outer shafts of the steering column assembly may become disengaged from one another.            No picture available.</p>	<p><b>CONSEQUENCE</b>            If the shafts become disengaged, the driver would lose the ability to steer the vehicle, increasing the risk of a crash.</p>	<p><b>REMEDY</b>            Subaru will notify owners, and dealers will replace the steering column assembly with a new one, free of charge. The recall is expected to begin on, or before, May 15, 2013. Owners may contact Subaru at 1-800-782-2783. Subaru's recall campaign number is WQI-45.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
EU/PORTUGAL	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Honda</p> <p><b>NAME:</b> Stream, Jazz, CR-V, Civic, Odyssey</p> <p><b>TYPE/NUMBER OF MODEL:</b> Model Year: 2001 to 2003; Production period: 11 July 2000 to 18 August 2003</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Passenger cars.</p> <p><b>COUNTRY OF ORIGIN:</b> Canada, Japan, Turkey, United Kingdom, United States.</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>The passenger's front airbag inflator could produce excessive internal pressure if it deploys, causing the inflator to rupture. In this case, metal fragments could be propelled upwards toward the windscreen or downward towards the front passenger's footwell, potentially causing injury to the passenger.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle</p> <p><b>BRAND:</b> KTM</p> <p><b>NAME:</b> 85 SX, 150 SX, 250 SX, 250 EXC and 300 EXC</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall affects 2013 model year motorcycles.</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Motorcycles, 2-stroke, 85cc – 300cc.</p> <p><b>COUNTRY OF ORIGIN:</b> Austria</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>Due to a production fault on the upper part of the throttle grip housing, the throttle cable wire may slide out of the deflection roller and become wedged between the deflection roller and the housing. This blocks the throttle slide and results in an uncontrollable riding situation.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passengers car</p> <p><b>BRAND:</b> Peugeot</p> <p><b>NAME:</b> 208</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns vehicles, with VINs from VF3 CC8HR0 CT050798 to VF3 CCHMW0 DT001255.</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> France</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>On affected vehicles, the nuts securing the rear wheel hubs may not be properly locked, since the depth of the locking impression on the nut cover may not be sufficient. This problem could cause an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle</p> <p><b>BRAND:</b> Husaberg</p> <p><b>NAME:</b> TE 125, TE 250 and TE 300</p> <p><b>TYPE/NUMBER OF MODEL:</b> TE 125, TE 250 and TE 300</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> 125cc, 250cc and 300cc motorcycle</p> <p><b>COUNTRY OF ORIGIN:</b> Unknown</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>On the upper part of the chassis of the accelerator handle, there is a risk that the petrol cable comes out of the idler roller and remains stuck between the roller and the chassis, possibly blocking the petrol track and causing a loss of control.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Honda</p> <p><b>NAME:</b> Pilot, MDX, Legend, Odyssey, Elysion, Step Wagon</p> <p><b>TYPE/NUMBER OF MODEL:</b> Type: YF1. The recall concerns vehicles manufactured in 2005.</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> United States</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>A faulty component in the electronic VSA (Vehicle Stability Assist) system can cause a brief application of the brakes. If the driver brakes when such a fault occurs, the VSA system may activate the braking assistance function, thus boosting the braking effect. This unexpected and unnecessary braking assistance increases the risk of an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
AUSTRALIA	<p>Porsche—Porsche 911 Carrera (991) &amp; 911 Carrera 4 (991)</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Porsche 911 Carrera (991) &amp; 911 Carrera 4 (991) vehicles from model year 2012 to 2013 that were manufactured between 03.11.2011 and 14.11.2012</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Recall Campaign: AD01</p> <p>Target: 47</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Porsche dealers</p> <p><b>SUPPLIER</b></p> <p>Porsche Cars Australia Pty Ltd</p> <p>No picture available.</p>	<p><b>DEFECTS</b></p> <p>The rear mufflers may not achieve the required service life and may crack.</p> <p><b>HAZARDS</b></p> <p>If the defect occurs, the exhaust tailpipe may become detached and pose a hazard to other road users.</p>	<p>A letter will be sent to affected owners.</p> <p>Consumers should contact their nearest Porsche dealer to arrange for inspection and have the defect remedied.</p>




AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Volkswagen</p> <p><b>NAME:</b> UP!</p> <p><b>TYPE/NUMBER OF MODEL:</b></p> <p>The recall affects certain 2013 vehicles produced between January and March 2013.</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Germany</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>Incorrectly parameterised airbag control units may have been fitted. For these airbag control units, the diagnosis function of the side crash sensors is deactivated. Should a fault occur in the side airbag system, the fault would not be recognised and the airbag warning light would not be activated. Failure to detect such a fault could lead to an increased risk of injuries for passengers in the event of an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Seat</p> <p><b>NAME:</b> Mii</p> <p><b>TYPE/NUMBER OF MODEL:</b> Mii (AA). The recall concerns certain 2013 model year vehicles, with VINs from AA / DD 320365 to AA / DD 324562.</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Passenger car.</p> <p><b>COUNTRY OF ORIGIN:</b> Spain</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>Incorrectly parameterised airbag control units may have been fitted. For these airbag control units, the diagnosis function of the side crash sensors is deactivated. Should a fault occur in the side airbag system, the fault would not be recognised and the airbag warning light would not be activated. Failure to detect such a fault could lead to an increased risk of injuries for passengers in the event of an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/AUSTRIA	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle</p> <p><b>BRAND:</b> Motobi</p> <p><b>NAME:</b> Unknown</p> <p><b>TYPE/NUMBER OF MODEL:</b> DFE50GY</p> <p>e13*2002/24*0552*00</p> <p>Batch number/Barcode: Unknown</p> <p><b>DESCRIPTION:</b> Motorcycle</p> <p><b>COUNTRY OF ORIGIN:</b> Germany</p> <p>No picture available.</p>	<p><b>INJURIES</b></p> <p>The handbrake lever fitted to the right handlebar is mounted in such a way that the necessary braking force on the front wheel is not achieved. This may lead to an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Mazda Australia Pty Limited—Mazda 6 (GG/GY) Passenger Vehicles</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Mazda 6 (GG/GY) Passenger Vehicles</p> <p><b>IDENTIFYING FEATURES</b></p> <p>This recall includes Mazda6 (GG/GY) vehicles within the ranges listed below (inclusive):</p> <p>VIN Ranges:</p> <p>GG Models JM0 GG1031 00 101259 – JM0 GG1031 00 116497</p> <p>GY Models JM0 GY1031 00 100009 – JM0 GY1031 00 100741</p> <p>Note: Not all vehicles within the above VIN and production date range are affected by this recall.</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Mazda dealers</p> <p><b>SUPPLIER</b></p> <p>Mazda Australia Pty Limited</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://www.mazda.com.au/">http://www.mazda.com.au/</a></p> <p>No picture available.</p>	<p><b>DEFECTS</b></p> <p>The passenger-side air bag inflator may have been assembled with improperly manufactured propellant.</p> <p><b>HAZARDS</b></p> <p>In the event of a collision, the inflator may rupture and cause the passenger-side air bag to deploy abnormally, increasing the risk of injury to the occupant.</p>	<p>Owners of affected vehicles will be contacted by Mazda to arrange to have their vehicles repaired.</p>
AUSTRALIA	<p>Husqvarna—Off Road Two-Stroke Motorcycles</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Off road two-stroke motorcycles MY13 CR125-WR125-WR250-WR300</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Target: 215</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Motorcycle stores nationally</p> <p><b>SUPPLIER</b></p> <p>Husqvarna Motorcycles / Paul Feeney Group</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://www.husqvarnamotorcycles.com.au">http://www.husqvarnamotorcycles.com.au</a></p> 	<p><b>DEFECTS</b></p> <p>Incorrectly produced inner cable retaining guide within the upper throttle housing.</p> <p><b>HAZARDS</b></p> <p>It may be possible for the inner cable to jump the cable wheel and be pinched between the cable wheel and the upper throttle housing. This may cause the throttle to stick and may pose a hazard to the rider and other road users.</p>	<p>A letter is being sent to affected owners. Follow Husqvarna/Paul Feeney Group instructions sent via Registered Mail, cease riding the motorcycle, return to an Authorised Husqvarna Dealer for replacement of the upper throttle housing.</p>

<b>AUTO: MOTOR VEHICLE</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
<b>AUSTRALIA</b>	<p>Fiat Chrysler Group—Jeep Commander and Grand Cherokee</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>2006-2010 Jeep Commander and 2005-2010 Jeep Grand Cherokee.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>WH-Grand Cherokee and XH Jeep Commander.</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Authorised Chrysler Jeep Dodge retailers.</p> <p><b>SUPPLIER</b></p> <p>Fiat Chrysler Group</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p>No</p> <p>No picture available.</p>	<p><b>DEFECTS</b></p> <p>Some circuit boards may transmit compromised signals that enable inadvertent gearshifts to neutral on start-up.</p> <p>Note, vehicles in the US are sold with remote start, this option was not available on Australian vehicles.</p> <p><b>HAZARDS</b></p> <p>Vehicle may go into neutral on start-up.</p> <p>As Australian customers are already in the vehicle on start up, this may prevent the hazard from occurring, as foot should be on the brake on start-up.</p>	<p>Chrysler will send a letter to affected owners. Chrysler dealers will perform a software update at no cost to customers to prevent the occurrence.</p>
<b>AUSTRALIA</b>	<p>Isuzu Australia Limited—N-Series 4HK1 engines</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Some 2006-2007 N-Series trucks with 4HK1 engines manufactured between June 2006 and June 2007.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Campaign number: 13-Z-02</p> <p>Target number: 85</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Unknown</p> <p><b>SUPPLIER</b></p> <p>Isuzu Australia Limited</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p>No</p> <p>No picture available.</p>	<p><b>DEFECTS</b></p> <p>Trucks may seep or leak diesel fuel from the linkage pipe at the upper or lower fuel port on the diesel fuel supply pump.</p> <p><b>HAZARDS</b></p> <p>Should the defect occur, fuel may leak onto the road, presenting a risk to other road users.</p>	<p>A letter is being sent to affected customers.</p> <p>For further information, contact your local Isuzu dealer.</p>

<b>AUTO: MOTOR VEHICLE EQUIPMENT</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
<b>AUSTRALIA</b>	<p>Mitsubishi—i-MiEV Brake Electric Vacuum Pump</p> <p><b>PRODUCT DESCRIPTION</b> i-MiEV brake electric vacuum pump</p> <p><b>IDENTIFYING FEATURES</b> Recall Campaign number: 010058 Target number: 77</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b> Authorised Mitsubishi dealers</p> <p><b>SUPPLIER</b> Mitsubishi Motors Australia Ltd No picture available.</p>	<p><b>DEFECTS</b> Manufacturing processes may have induced a condition that can result in cracking of the pump rotor and or vane.</p> <p><b>HAZARDS</b> The defect may result in reduced braking capacity and this may increase the risk of an accident occurring.</p>	<p>All owners of affected vehicles will be contacted by email at their last known address and requested to contact the nearest Mitsubishi dealer to make an appointment to have the vehicle repaired.</p>
<b>AUSTRALIA</b>	<p>Hyundai—Hyundai i20 Vehicle Jack</p> <p><b>PRODUCT DESCRIPTION</b> Hyundai i20 Vehicle Jack</p> <p><b>IDENTIFYING FEATURES</b> Recall Campaign number: 3Rc102 Target number: 1,526</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b> Authorised Hyundai dealers</p> <p><b>SUPPLIER</b> Hyundai No picture available.</p>	<p><b>DEFECTS</b> An incorrect warning label has been attached to Hyundai i20 vehicle jacks.</p> <p><b>HAZARDS</b> The warning label is non-compliant with the mandatory standard.</p>	<p>Contact your nearest Hyundai dealer to have the correct sticker fitted to the vehicle jack.</p> <p>A list of Hyundai dealer locations and service department contact details can be found at <a href="http://www.hyundai.com.au">www.hyundai.com.au</a> (click on "FIND A DEALER" and follow the instructions).</p>
<b>USA</b>	<p><b>EQUIPMENT BRAND NAME/PART NO. OR MODEL NO.</b> PRO SERIES/TRANSLITE BIKE RACK-0/01/2011 - 06/30/2012</p> <p><b>MANUFACTURER</b> Cequent Performance Products, Inc.</p> <p><b>COMPONENT</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 2,330</p> <p><b>SUMMARY</b> Cequent Performance Products, Inc. (Cequent) is recalling certain Pro Series Translite Bike Racks, Part No. 63144, manufactured from October 1, 2011 through June 30, 2012. The bike rack cradles may tear if excessive force is applied to the cradle straps. No picture available.</p>	<p><b>CONSEQUENCE</b> Torn cradles could allow a bike to disengage from the carrier. If a bike disengages from the carrier it may fall onto the roadway, creating a hazard for other vehicles and increasing the risk of a crash.</p>	<p><b>REMEDY</b> Cequent will replace the dealer inventory and customers will receive a repair kit free of charge. The manufacturer has not yet provided a notification schedule. Customers may contact Cequent at 1-800-931-6689.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/POLAND	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Tow rope</p> <p><b>BRAND:</b> JUMBO</p> <p><b>NAME:</b> Unknown</p> <p><b>TYPE/NUMBER OF MODEL:</b> art. no. 6154032T/model: Jumbo 2000kg</p> <p>Batch number/Barcode: 8711263561543</p> <p><b>DESCRIPTION:</b> Tow rope made of nylon weave in white and orange colour. Suitable for cars weighing up to 2 tonnes.</p> <p><b>COUNTRY OF ORIGIN:</b> The Netherlands</p> 	<p><b>INJURIES</b></p> <p>The strength of the tow rope is insufficient for the declared weight of cars (2000 kg). As a result, the tow rope may break during use, causing a road traffic accident.</p>	<p>Voluntary measures:</p> <p>Withdrawal of the product from the market</p>
AUSTRALIA	<p>Monza Imports Australia—KBC VR-1X Motorcycle Helmet</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Motorcycle safety helmet</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Manufacture date: 2012-6</p> <p>The manufacture date can be seen on the Vehicle User Helmet Warning label stitched inside the comfort liner.</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Motorcycle dealers who stock KBC helmets</p> <p><b>SUPPLIER</b></p> <p>Monza Imports Australia P/L</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://www.monzaimports.com.au/">http://www.monzaimports.com.au/</a></p> <p>No picture available.</p>	<p><b>DEFECTS</b></p> <p>Affected KBC VR-1X motorcycle helmets do not meet performance requirements that are outlined in the Australian/New Zealand Standard AS/NZS1698:2006.</p> <p><b>HAZARDS</b></p> <p>There is a possibility that the helmets may not provide adequate protection to the wearer in the event of an accident and may increase the risk of death or serious injury to the wearer.</p>	<p>Consumers should immediately stop using the helmets and return it to the place of purchase for a refund or replacement.</p>

<b>AUTO: MOTOR VEHICLE EQUIPMENT</b>			
<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
<b>AUSTRALIA</b>	<p>Mitsubishi—Mirage Front Wheel Speed Sensor</p> <p><b>PRODUCT DESCRIPTION</b> Mirage front wheel speed sensor</p> <p><b>IDENTIFYING FEATURES</b> Recall campaign: 010059 Target: 3377</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b> Authorised Mitsubishi dealers</p> <p><b>SUPPLIER</b> Mitsubishi Motors Australia Limited</p> <p><b>SUPPLIER'S WEB SITE</b> No No picture available.</p>	<p><b>DEFECTS</b> Insufficient water proofing of the sensor harness may allow moisture to penetrate the sensor resulting in abnormal output signal.</p> <p><b>HAZARDS</b> This may result in various false warnings signals to illuminate on the dashboard. In addition, the braking force could reduce and/or steering control could become unstable and pose a crash hazard to the driver and other road users.</p>	<p>Mitsubishi is notifying all affected customers by letter. Owners are advised to contact their authorised Mitsubishi dealership for inspection and rectification.</p>
<b>USA</b>	<p><b>EQUIPMENT BRAND NAME/PART NO. OR MODEL NO.</b> KONI/SOCK ABSORBER-01/01/2008 - 04/30/2013</p> <p><b>MANUFACTURER</b> KONI North America</p> <p><b>COMPONENT</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 39</p> <p><b>SUMMARY</b> Koni North America (KONI) is recalling certain shock absorbers with model numbers 8245-1146L, 8245-1146R, 8245-1201L, 8245-1201R, 8245-1203L, and 8245-1203R. These shock absorbers were manufactured January 2008 through April 2013. The affected absorbers were manufactured with an incorrectly welded bracket which may cause the shock absorber to bend and rest on the drive shaft. No picture available.</p>	<p><b>CONSEQUENCE</b> A bent shock absorber may compromise vehicle handling, increasing the risk of a crash.</p>	<p><b>REMEDY</b> KONI will notify distributors and advise them to contact their customers of the recall. The shock absorbers will be replaced free of charge. The recall is expected to begin in May 2013. Customers may contact KONI at 1-800-209-3350.</p>

**AUTO: MOTOR VEHICLE EQUIPMENT**

<b>NOTIFYING COUNTRY</b>	<b>PRODUCT</b>	<b>DANGER</b>	<b>MEASURES ADOPTED</b>
AUSTRALIA	<p>Bulk Bikes—Kylin XR-205 Motorcycle Helmet (Recall Expanded)</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Open face skull cap motorcycle helmet. The original recall (PRA2013/13558) has been expanded to include all sizes (S,M,L,XL,XXL) sold between July 2012 to April 2013.</p> <p><b>IDENTIFYING FEATURES</b></p> <p>XR-205</p> <p><b>TRADERS WHO SOLD THIS PRODUCT</b></p> <p>Bulk Bikes</p> <p><b>SUPPLIER</b></p> <p>Bulk Bikes</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p>No</p> <p>No picture available.</p>	<p><b>DEFECTS</b></p> <p>A number of large sized Kylin motorcycle helmets do not meet performance requirements that are outlined in the Australian/New Zealand Standard AS/NZS1698:2006.</p> <p><b>HAZARDS</b></p> <p>There is a possibility that the helmets may not provide adequate protection to the wearer in the event of an accident and may increase the risk of death or serious injury to the wearer.</p>	<p>Consumers should immediately stop using the helmets and contact Bulk Bikes to organise for a refund or replacement. For further information please email <a href="mailto:bulkbikes@bigpond.com">bulkbikes@bigpond.com</a>.</p>

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[gcsc@sgs.com](mailto:gcsc@sgs.com)

<http://www.sgs.com/en/Consumer-Goods-Retail/Product-Recalls.aspx>

© 2013 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

**SGS**