

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16-28 FEBRUARY 2013

CONTENTS

AUTOMOTIVE

Pages 1 to 10



[Motor Vehicle \(18\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(3\)](#)

¹Please note that from November 2012 on, product recall notifications can be searched on line in several countries via the Global portal on product recalls hosted by the Organisation for Economic Co-operation and Development (OECD). You can access the OECD site by using the following [link](#).

SGS

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA	MEASURES ADOPTED
AUSTRALIA	BMW Australia Ltd—BMW 1 Series, 3 Series, X1 & Z4 motor vehicles PRODUCT DESCRIPTION BMW E82, E87, E88, 1 Series BMW E90, E91, E92 & E93, 3 Series BMW E84 X1 BMW E89 Z4 IDENTIFYING FEATURES CPA No: 33113. 1 Series - E87 CPA No: 33767. 3 Series - E90 CPA No: 41751. E84 X1 CPA No: 41041. Z4 Series - E89 TRADERS WHO SOLD THIS PRODUCT BMW dealers Australia wide SUPPLIER BMW Australia Ltd. SUPPLIER'S WEB SITE http://www.bmw.com.au No picture available.	DEFECTS The plug-in contact of the battery-positive cable on the front power distributor (fitted behind the glove compartment) may be damaged by vehicle vibrations. Damage to the plug-in contact may impair the power supply to the vehicle. HAZARDS As a result, access to the vehicle may no longer function (door locks), or the vehicle may no longer be started. In individual cases the engine may stall, the power steering may lose assistance and the electrical system may fail while driving. The situation becomes noticeable by flickering of the instrument panel and, where applicable, dipping of the engine (short, noticeable power drop). These issues pose a hazard to the drive and other road users.	Consumers should contact an authorised BMW motor vehicle service centre, or call the BMW Group Australia Customer Interaction Centre on freecall: 1800 813 299.
EU/GREECE	CATEGORY: Motor vehicles PRODUCT: Motorcycle BRAND: KAWASAKI NAME: 1. EJ800AB 2. EJ800AC TYPE/NUMBER OF MODEL: W800 DESCRIPTION: The recall affects motorcycles with serial numbers: 1. EJ800AB: from JKBEJ800AAA000044 to JKBEJ800AAA005309 2. EJ800AC: from JKBEJ800AAA008001 to JKBEJ800AAA010781 COUNTRY OF ORIGIN: Japan No picture available.	INJURIES A bearing failure in the fuel pump could occur. This would stop the fuel pump working correctly and may lead to the engine stalling which may cause an accident.	Voluntary measures: Recall of the product from end users.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAKER	MEASURES ADOPTED
EU/ GERMANY	CATEGORY: Motor vehicles PRODUCT: Passenger car BRAND: Citroën NAME: Citroën C4 Picasso TYPE/NUMBER OF MODEL: EC type approval: e2*2001/116*0345*00, *01, *03, *05-*07, *09, *11-*13, *15, type: U***** EC type approval: e2*2007/46*0061*01-*03, type: U Manufacturing years: 2006-2010 DESCRIPTION: Passenger car. COUNTRY OF ORIGIN: France No picture available.	FIRE The electric cable leading to the starter can become worn, which can cause a short circuit. The possibility of a fire breaking out, even after the engine has been switched off, cannot be ruled out.	Voluntary measures: Recall of the product from end users.
EU/UNITED KINGDOM	CATEGORY: Motor vehicles PRODUCT: Pick-up truck / passenger vehicle BRAND: Ford NAME: Ranger TYPE/NUMBER OF MODEL: 6FPGXXMJ2GCC42558 to 6FPPXXMJ2PCY72333. Vehicles built between 18/12/2011 and 18-01-13 DESCRIPTION: Pick-up truck / passenger vehicle. COUNTRY OF ORIGIN: South Africa No picture available.	FIRE There is a possibility of a faulty electrical connection to the electric booster heater. This could lead to rapid and significant heat generation at the connection, with a risk of smoke and/or fire from behind the instrument panel.	Voluntary measures: Recall of the product from end users.
EU/UNITED KINGDOM	CATEGORY: Motor vehicles PRODUCT: Van BRAND: Ford NAME: Transit TYPE/NUMBER OF MODEL: e11*2001/116*0282*10 Batch number/Barcodes: WF0KXXTPKBS86741 to WF0UXXTPUBU75804. Vehicles built between 19/05/2010 and 14-08-2012 DESCRIPTION: Van. COUNTRY OF ORIGIN: Italy No picture available.	INJURIES The bolt that secures the brake pipe bracket to the rear axle could fail and lead to subsequent fatigue failure of the rear brake pipe. This would reduce the brake performance and could cause the vehicle to crash.	Voluntary measures: Recall of the product from end users.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	Land Rover Australia—Range Rover Evoque 2012MY PRODUCT DESCRIPTION Range Rover Evoque 2012MY IDENTIFYING FEATURES Campaign number: P031 Target number: 10 VIN range: SALVA2BG0CH704223 - SALVA2AE6DH713526 TRADERS WHO SOLD THIS PRODUCT Authorised Land Rover dealerships SUPPLIER Land Rover Australia No picture available.	DEFECTS The driver could experience abnormal noise from the front of the vehicle during low speed manoeuvring. In rare cases, this may indicate a fatigue fracture in one or both of the steering gear mount fixings. HAZARDS If both bolts fail, this may compromise the turning circle of the vehicle, possibly posing a hazard to the driver and other road users.	Contact the nearest Land Rover dealership for inspection of the vehicle and rectification if required.
AUSTRALIA	Land Rover Australia—Range Rover Evoque 2012MY PRODUCT DESCRIPTION Range Rover Evoque 2012MY IDENTIFYING FEATURES Campaign number: P029 Target: 28 VIN range: SALVA2AE7CH687968 - SALVA2BG1CH688422 TRADERS WHO SOLD THIS PRODUCT Authorised Land Rover dealerships SUPPLIER Land Rover Australia No picture available.	DEFECTS The driver may experience abnormal noise from the rear of the vehicle when driving or when the brakes are applied. In rare cases, this may indicate that one or both of the brake caliper fixings could become detached from the vehicle. HAZARDS This may lead to loss of a brake circuit function and possible sudden deflation of a tyre, increasing the risk of a vehicle accident.	Contact the nearest Land Rover dealership for inspection of the vehicle and rectification if required.
EU/GREECE	CATEGORY: Motor vehicles PRODUCT: Passenger car BRAND: NISSAN NAME: Juke TYPE/NUMBER OF MODEL: Juke, F15. Type Approval No. e11*2007/46*0132. Batch number/Barcode: The recall concerns vehicles produced from 07/06/2012 to 04/07/2012 DESCRIPTION: Passenger car. COUNTRY OF ORIGIN: United Kingdom No picture available.	BURNS In the event that the driver's airbag is deployed during a frontal impact, small holes may appear on the surface of the airbag. The holes are caused by high temperature gas from the airbag inflator exhausting directly onto the surface of the airbag material. Contact of the high temperature gas / airbag material with the driver's skin can cause burns.	Voluntary measures: Recall of the product from end users.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAKER	MEASURES ADOPTED
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Motorcycle BRAND: Can-Am NAME: Spyder TYPE/NUMBER OF MODEL: SPYDER GS SM5 and SE5 (years 2008 and 2009) and SPYDER RS SM5 and SE5 (year 2010). DESCRIPTION: Three-wheeled motorcycle. COUNTRY OF ORIGIN: Canada No picture available.	FIRE Under certain circumstances there may be leakage of fuel vapour from the vent hose of the fuel vapour canister in the closed engine compartment. If the fuel vapour comes into contact with an ignition source, it could ignite causing a fire.	Voluntary measures: Recall of the product from end users.
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Motorcycle BRAND: Can-Am NAME: Spyder TYPE/NUMBER OF MODEL: GS SERIES (years 2008 and 2009), RS SERIES and RT SERIES (years 2010, 2011 and 2012). DESCRIPTION: Three wheeled motorcycle. COUNTRY OF ORIGIN: Canada No picture available.	FIRE The fuel cap might not properly seal the fuel tank filler neck. In the presence of an ignition source the fuel vapours ignite resulting in a fire.	Voluntary measures: Recall of the product from end users.
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Motorcycle BRAND: BMW NAME: S1000RR TYPE/NUMBER OF MODEL: S1000RR The VIN numbers of the affected vehicles are in the range Z028528 to Z036140. Batch number/Barcode: Category L3e, CN code 0524 DESCRIPTION: Motorcycle. COUNTRY OF ORIGIN: Germany No picture available.	INJURIES The bolts for attaching the side stand to the chassis could loosen. The motorcycle could thus fall over instead of resting on the stand.	Voluntary measures: Recall of the product from end users.
EU/SPAIN	CATEGORY: Motor vehicles PRODUCT: Motorcycle BRAND: APRILIA NAME: Atlantic 125 and 300. TYPE/NUMBER OF MODEL: 125/300 DESCRIPTION: Motor cycle with engine capacities of 124c.c. ("125") and 278c.c. ("300"). COUNTRY OF ORIGIN: Italy No picture available.	INJURIES There may be a fault in the weld between the handlebars and the steering column. In this case, steering the vehicle could become more difficult, giving rise to the risk of a traffic accident.	Voluntary measures: Recall of the product from end users.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL KENWORTH/t680-2013-2014 KENWORTH/t880-2013-2014 PETERBILT/567-2013-2014 PETERBILT/579-2013-2014 MANUFACTURER PACCAR Incorporated COMPONENT ELECTRICAL SYSTEM , EXTERIOR LIGHTING SUMMARY PACCAR is recalling certain model year 2013-2014 Kenworth T680 and T880 trucks, manufactured from January 18, 2012, through February 1, 2013; and model year 2013-2014 Peterbilt 579 and 567 vehicles, manufactured from January 20, 2012, through January 31, 2013. The Exterior Lights Self-Test switch is intended to be used when the vehicle is parked. If the switch is pressed while the vehicle is in motion, the Exterior Lights Self-Test switch will cause all exterior lighting to be extinguished. No picture available.	CONSEQUENCE An unexpected loss of lighting during vehicle operation may reduce the driver's ability to see other vehicles, pedestrians, or objects, as well as reduce the truck's visibility to other drivers or pedestrians, increasing the risk of crash.	REMEDY PACCAR will notify owners, and dealers will disable the Exterior Lights Self-Test software parameter and remove the Exterior Lights Self-Test switch and install a switch plug in its place. The services will be offered free of charge. The recall will begin during February 2013. Owners may contact Kenworth at 1-425-828-5000 or Peterbilt at 1-940-591-4000.
USA	VEHICLE MAKE / MODEL SPARTAN/rma103-2008-2009 SPARTAN/rma79-2008-2009 SPARTAN/TDA-2008-2009 MANUFACTURER Spartan ERV COMPONENT EQUIPMENT SUMMARY Spartan ERV is recalling certain model year 2008-2009 RMA 75, RMA 103, and TDA aerial fire apparatus manufactured from April 04, 2008, through April 13, 2010 and equipped with hydraulic extension and retraction cylinders produced by RamRod Industries. The cylinders on the affected vehicles may have welded rod eyes that were not properly heat treated during the manufacturing process. No picture available.	CONSEQUENCE An improperly manufactured rod eye end attachment may fracture or separate. In the event two affected cylinders are installed on the same aerial lift device, the aerial lift may retract without warning and cause severe injury and/or property damage.	REMEDY Spartan ERV will notify owners, and dealers will replace the affected cylinders, free of charge. The recall is expected to begin during in late February 2013. Owners may contact Spartan ERV at 1-800-867-6478, Option 2.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL SPARTAN/MMP 100-2008-2010 SPARTAN/RMP 100-2005-2011 MANUFACTURER Spartan ERV COMPONENT EQUIPMENT SUMMARY Spartan is recalling certain model year 2005-2011 RMP 100 and 2008-2010 MMP 100 aerial vehicle apparatus. These vehicles are equipped with a single platform inclinometer that may provide an intermittent signal allowing the platform to be tilted more than below the horizontal plane. No picture available.	CONSEQUENCE The intermittent signal may allow the aerial platform to be tilted more than below the horizontal plane which could allow the platform to strike nearby objects or people increasing the risk of injury or property damage.	REMEDY The intermittent signal may allow the aerial platform to be tilted more than below the horizontal plane which could allow the platform to strike nearby objects or people increasing the risk of injury or property damage.
USA	VEHICLE MAKE / MODEL FONTAINE/INT'L 4300 W/DUAL STEERIN-2011-2013 FONTAINE/INT'L 4400 W/DUAL STEERIN-2011-2013 FONTAINE/INT'L 7300 W/DUAL STEERIN-2011-2013 FONTAINE/INT'L 7400 W/DUAL STEERIN-2011-2013 FONTAINE/INT'L 7500 W/DUAL STEERIN-2011-2013 MANUFACTURER Fontaine Modification COMPONENT STEERING SUMMARY Fontaine Modification is recalling certain model year 2011-2013 Navistar International 4300, 4400, 7300, 7400, and 7500 trucks; manufactured January 1, 2011 through January 9, 2013 and were modified to be able to be steered from either front seat. Certain steering assembly retaining clips may not be completely engaged, resulting in the clips coming loose. No picture available.	CONSEQUENCE Without a retaining clip, the steering may feel "loose" and be unresponsive which may increase steering difficulty and the likelihood of a vehicle crash.	REMEDY Fontaine will notify owners and dealers will inspect each truck's steering cross shaft assembly. Any that are found defective will have the complete steering cross shaft assembly replaced, free of charge. This recall is expected to begin in February 2013. Owners may contact Fontaine at 1-800-366-8246.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL ROLLS-ROYCE/PHANTOM-2013 MANUFACTURER Rolls-Royce Motor Cars, Ltd. COMPONENT FUEL SYSTEM, GASOLINE SUMMARY Rolls-Royce Motor Cars is recalling certain model year 2013 Phantom vehicles manufactured from November 2, 2012, through January 18, 2013. The fuel filler necks may be missing the anti-misfueling devices. The devices prevent misfueling and discharge static electricity. No picture available.	CONSEQUENCE Without the anti-misfueling device, there is an increased risk of fire from static electricity.	REMEDY Rolls-Royce is presently contacting all affected owners. Dealers will inspect the gas tank and replace any affected fuel filler necks, free of charge. The recall began in early February 2013. Owners may contact Rolls-Royce at 1-877-877-3735.
USA	VEHICLE MAKE / MODEL CHRYSLER/200-2013 DODGE/AVENGER-2013 MANUFACTURER Chrysler Group LLC COMPONENT FUEL SYSTEM, GASOLINE SUMMARY Chrysler is recalling certain model year 2013 Chrysler 200 and Dodge Avenger vehicles manufactured from October 30, 2012, through November 2, 2012. These vehicles may have a gas tank that has a broken control valve in the fuel tank assembly. No picture available.	CONSEQUENCE A broken control valve in the fuel tank assembly may lead to an engine stall or fuel leakage. An engine stall while driving may contribute to a vehicle crash. Fuel leakage, in the presence of an ignition source, may result in a fire.	REMEDY Chrysler will notify owners, and dealers will inspect the fuel tank assembly and replace any affected control valves, free of charge. The recall is expected to begin during March 2013. Owners may contact Chrysler at 1-800-247-9753.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. YAKIMA/SPARETIME MANUFACTURER Yakima Products, Inc. COMPONENT EQUIPMENT SUMMARY Yakima Products, Inc. (Yakima) is recalling certain SpareTime, two bike, rack systems, part number 8002598, manufactured from November 1, 2011, through October 30, 2012. These racks are for use on vehicles with a rear hatch door mounted spare tire system. The affected bike racks have mounting bolts that may break. No picture available.	CONSEQUENCE If the mounting bolts break, the bike rack may fall from the vehicle, possibly becoming a road hazard to other vehicles or causing injury to pedestrians.	REMEDY Yakima will notify owners and mail replacement bolts with instructions to owners, free of charge. The safety recall is expected to begin in February 2013. Owners may contact Yakima at 1-888-925-4621.
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. FULMER/AF-80-07/01/2008 - 07/31/2008 FULMER/AF-81-07/01/2008 - 07/31/2008 FULMER/AF-82-07/01/2008 - 07/31/2008 MANUFACTURER Fulmer Helmets, Inc. COMPONENT EQUIPMENT SUMMARY Fulmer Helmets, Inc. (Fulmer) is recalling certain motorcycle helmets, models AF-80, AF-81, and AF-82, sizes medium, large, XL, and 2XL. During testing, the affected helmets fail to conform to the impact attenuation, penetration, labeling, and retention requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." No picture available.	CONSEQUENCE By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury.	REMEDY Fulmer will replace any helmet or offer a reimbursement for any noncompliant helmet. The recall is expected to begin March 8, 2013. Owners may contact Fulmer toll-free at 1-800-489-2300.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	TIRE BRAND NAME - TIRE LINE/TIRE SIZE - PRODUCTION DATES: HERCULES/HERCULES ALL TRAC A/T-12/07/2008 - 10/16/2010 HERCULES/HERCULES ALL TRAC A/T-12/14/2008 - 10/16/2010 HERCULES/HERCULES ALL TRAC A/T-11/16/2008 - 10/16/2010 HERCULES/HERCULES ALL TRAC A/T-11/09/2008 - 10/16/2010 HERCULES/HERCULES ALL TRAC A/T-12/07/2008 - 10/16/2010 HERCULES/HERCULES ALL TRAC A/T-12/14/2008 - 10/16/2010 HERCULES/HERCULES ALL TRAC A/T-11/23/2008 - 10/16/2010 MANUFACTURER Hercules Tire & Rubber Company COMPONENT TIRES SUMMARY Hercules Tire & Rubber Company (Hercules Tire) is recalling certain Hercules ALL TRAC A/T 10-ply Load Range E tires, sizes LT215/85R16 115/112S, DOT Serial Numbers JEHMECL5008-4010; LT235/85R16 120/116S, DOT Serial Numbers JEKMECL4708-4010; LT245/75R16 120/116S DOT Serial Numbers JEJKECL4608-4010; LT265/75R16 123/120S, DOT Serial Numbers JENKECL4808-4010; LT265/70R17 121/118S, DOT Serial Numbers JENJFCL5108-4010; LT245/75R17 121/118S, DOT Serial Numbers JELKFCL5008-4010 and LT225/75R16 115/112S, DOT Serial Numbers JEJKECL5108-4010. These tires can experience in-service belt and tread separations. No picture available.	CONSEQUENCE Should a separation occur, the driver could lose control of the vehicle without warning, which could increase the risk of a vehicle crash.	REMEDY Hercules Tire will notify owners and replace the affected tires free of charge, including mounting and balancing. The recall is expected to begin during February 2013. Owners may contact Hercules Tire at 1-888-965-5795 or by email: alltracresponse@HerculesTire.com for more information.

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

<http://www.sgs.com/en/Consumer-Goods-Retail/Product-Recalls.aspx>

© 2013 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

