

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 30 APRIL 2012

CONTENTS

AUTOMOTIVE

Pages 1 to 16




[Motor Vehicle \(26\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(4\)](#)


SGS

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Kawasaki Motors Pty Ltd—ATV Model KRF750NCS (2012 Teryx Fi 750 4x4)</p> <p>PRODUCT DESCRIPTION All terrain recreational utility vehicle (off road)</p> <p>IDENTIFYING FEATURES JKARFDN1 JCB503763 to 504908</p> <p>TRADERS WHO SOLD THIS PRODUCT All authorised Kawasaki RUV dealerships</p> <p>SUPPLIER KAWASAKI MOTORS PTY LTD</p> <p>SUPPLIER'S WEB SITE http://www.kawasaki.com.au/</p> <p>No picture available.</p>	<p>HAZARDS Exceeding the vehicle's occupant capacity may cause loss of control and a serious accident.</p> <p>DEFECTS An incorrect general warning label indicating the incorrect occupant capacity may have been installed on the glove compartment cover. The label may indicate the maximum number of occupants to be four persons, whereas the vehicle's maximum capacity is two persons.</p>	Return the vehicle to an authorised Kawasaki RUV dealership for inspection and replacement of the label where necessary.
AUSTRALIA	<p>PMX Pty Ltd—Hunter 125cc Quad Bike</p> <p>PRODUCT DESCRIPTION 125cc automatic farm quad bike with forward and reverse gears</p> <p>IDENTIFYING FEATURES All VIN numbers from PMXHUNTER 000000000001 and up</p> <p>SUPPLIER PMX Pty Ltd</p> <p>SUPPLIER'S WEB SITE http://www.pmxaus.com.au</p> 	<p>HAZARDS The front wheel bearings may suddenly collapse while in motion, possibly causing loss of control.</p> <p>DEFECTS The front wheel bearings may collapse due to a manufacturing fault.</p>	Consumers should contact PMX Pty Ltd on 08 61616494 to have a new set of wheel bearings sent out. Alternatively, customers can bring the bike back to us for the bearings to be replaced at no charge.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>550i GT, 550i saloon, 550i estate car 650i cabriolet, 750i saloon, 750Li saloon 760i saloon, 760Li saloon ActiveHybrid 7, ActiveHybrid 7 L X5 xDrive50i, X6 xDrive50i X5 M, X6 M</p> <p>BRAND: BMW</p> <p>TYPE/NUMBER OF MODEL:</p> <p>EC type / EC type approval GT / e1*2007/46*0215* 5L / e1*2007/46*0363* 5K / e1*2007/46*0455* 6C / e1*2007/46*0562* 7L / e1*2007/46*0276* HY / e1*2007/46*0323* X5 / e1*2007/46*0421* X6 / e1*2007/46*0412* M7X / e1*2007/46*0172*</p> <p>The vehicles concerned were produced during the following periods:</p> <p>550i GT, 4/2011 – 5/2011 550i saloon, 4/2011 – 5/2011 550i estate car, 4/2011 – 5/2011 650i cabriolet, 4/2011 – 5/2011 750i saloon, 4/2011 – 5/2011 750Li saloon, 4/2011 – 5/2011 760i saloon, 4/2011 – 4/2011 760Li saloon, 4/2011 – 5/2011 ActiveHybrid 7, 4/2011 – 4/2011 ActiveHybrid 7 L, 4/2011 – 4/2011 X5 xDrive50i, 4/2011 – 6/2011 X6 xDrive50i, 4/2011 – 6/2011 X5 M, 5/2011 – 6/2011 X6 M, 5/2011 – 6/2011</p> <p>DESCRIPTION: Passenger car COUNTRY OF ORIGIN: Germany No picture available.</p>	<p>FIRE</p> <p>The housing of the auxiliary coolant pump may crack. If cracks occur, coolant may enter the pump electronics. This may lead to a failure of the auxiliary coolant pump. In a few rare cases there may be smouldering of the auxiliary coolant pump. If so, an engine compartment fire or even a vehicle fire cannot entirely be ruled out.</p>	Voluntary corrective action taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>MINI Cooper S (R56)</p> <p>MINI Cooper S Clubman (R55)</p> <p>MINI Cooper S Convertible (R57)</p> <p>MINI Cooper S Countryman (R60)</p> <p>MINI JCW (R56)</p> <p>MINI JCW Clubman (R55)</p> <p>MINI JCW Convertible (R57)</p> <p>BRAND: BMW</p> <p>TYPE/NUMBER OF MODEL:</p> <p>EC type / EC type approval</p> <p>MINI-N / e1*2001/116*0343</p> <p>UKL-K / e1*2007/46*0370</p> <p>UKL-L / e1*2007/46*0371</p> <p>UKL-C / e1*2007/46*0369</p> <p>UKL/X / e1*2007/46*0496</p> <p>The vehicles concerned were produced during the following periods:</p> <p>MINI Cooper S (R56), 3/2011 – 4/2011</p> <p>MINI Cooper S Clubman (R55), 3/2011 – 4/2011</p> <p>MINI Cooper S Convertible (R57), 3/2011 – 4/2011</p> <p>MINI Cooper S Countryman (R60), 4/2011 – 4/2011</p> <p>MINI JCW (R56), 3/2011 – 4/2011</p> <p>MINI JCW Clubman (R55), 3/2011 – 4/2011</p> <p>MINI JCW Convertible (R57), 3/2011 – 4/2011</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No picture available</p>	<p>FIRE</p> <p>The housing of the auxiliary coolant pump may crack. If cracks occur, coolant may enter the pump electronics. This may lead to a failure of the auxiliary coolant pump. In a few rare cases there may be smouldering of the auxiliary coolant pump. If so, an engine compartment fire or even a vehicle fire cannot entirely be ruled out.</p>	Voluntary corrective action taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Sedici"</p> <p>BRAND: Fiat</p> <p>TYPE/NUMBER OF MODEL: Type: FY, EC type-approval: e4*2001/116*0106</p> <p>DESCRIPTION: The vehicles affected were produced from November 2011 to January 2012.</p> <p>COUNTRY OF ORIGIN: Hungary</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The lower joint of the intermediate shaft was not properly attached to the steering system. This may lead to loss of steering control.</p>	<p>Voluntary corrective action taken by the manufacturer.</p>
AUSTRALIA	<p>BMW Australia Ltd—BMW S 1000 RR motorcycle</p> <p>PRODUCT DESCRIPTION</p> <p>BMW S 1000 RR motorcycle</p> <p>IDENTIFYING FEATURES</p> <p>CPA: 41663. S 1000</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>All authorised BMW motorcycle dealers Australia-wide</p> <p>SUPPLIER</p> <p>BMW Australia Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.motorcycles.bmw.com.au/</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Escaping oil or sudden engine seizure may result in a serious accident and/or pose a hazard to other road users.</p> <p>DEFECTS</p> <p>BMW Motorrad has found that there have been a few, isolated cases of engine damage occurring at high engine rpm. This was caused by conrod bolts working loose.</p>	<p>Consumers should contact their authorised BMW motorcycle service centre, or call the BMW Group Australia Customer Interaction Centre on freecall: 1 800 813 299.</p>
USA	<p>NAME OF PRODUCT: Teryx Recreational Off-Highway Vehicles</p> <p>UNITS: About 2,000</p> <p>DISTRIBUTOR: Kawasaki Motors Corp., U.S.A., of Irvine, Calif.</p> <p>DESCRIPTION: The recalled vehicles are model year 2012 Kawasaki four-wheel recreational off-highway vehicles with side-by-side seating for two people, automobile style controls, with model types Teryx 750 FI 4x4, Teryx 750 FI 4x4 LE, Teryx 750 FI 750 4x4 LE SGE and Teryx 750 FI 4x4 Sport. The model type is printed on the hood of the vehicles. The recalled vehicles are available in the solid colors green, red, grey, silver, black and camouflage (khaki).</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD: The recalled products have been incorrectly labeled as having a higher occupant capacity than is safe. Operating the vehicle with additional occupants creates an injury or death hazard.</p> <p>INCIDENTS/INJURIES:</p> <p>None</p>	<p>Voluntary recall.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	<p>Rolls-Royce Motor Cars Ltd—Rolls-Royce Phantom Series I</p> <p>PRODUCT DESCRIPTION</p> <p>Rolls-Royce Phantom Sedan Rolls-Royce Phantom Extended Wheel Base Rolls-Royce Phantom Coupe Rolls-Royce Phantom Drophead Coupe</p> <p>IDENTIFYING FEATURES</p> <p>UHxxxxx, RR01, RR2, RR3, 100533/1</p> <p>Traders who sold this product</p> <p>Both authorised Rolls-Royce motor car dealers – Sydney & Melbourne</p> <p>SUPPLIER</p> <p>Rolls-Royce Motor Cars Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.rolls-roycemotorcars.com</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Due to the possibility of oil entering the brake booster, there may be a reduction in power braking assistance and an increased chance of an accident occurring.</p> <p>DEFECTS</p> <p>Engine oil from the brake vacuum pump may enter the brake vacuum line. In some cases, it is possible that after a period of time oil may enter the brake booster.</p>	<p>A letter is being sent to all affected consumers.</p> <p>Consumers should contact their authorised Rolls-Royce motor car dealer, or email customer.relationsuk@rolls-roycemotorcars.com</p>
AUSTRALIA	<p>Rolls-Royce Motor Cars Ltd—Rolls-Royce Ghost</p> <p>PRODUCT DESCRIPTION</p> <p>Rolls-Royce Ghost Sedan Rolls-Royce Ghost Extended Wheel Base</p> <p>IDENTIFYING FEATURES</p> <p>UHxxxxx RR4, 42248</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Both authorised Rolls-Royce motor car dealers – Sydney & Melbourne</p> <p>SUPPLIER</p> <p>Rolls-Royce Motor Cars Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.rolls-roycemotorcars.com</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the turbo cooling pump cracks, the pump electronics may smoulder, possibly causing an engine compartment fire or a vehicle fire.</p> <p>DEFECTS</p> <p>The turbo cooling pump housing may crack, causing engine coolant to penetrate the electronics of the pump. This could lead to an internal short circuit and subsequent failure of the pump, which may result in smouldering.</p>	<p>A letter is being sent to all affected consumers.</p> <p>Consumers should contact their authorised Rolls-Royce motor car dealer, or email customer.relationsuk@rolls-roycemotorcars.com</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/MALTA	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car Nouvelle C3 / C3 Picasso</p> <p>BRAND: Citroën</p> <p>TYPE/NUMBER OF MODEL: Nouvelle C3:- e2*2007/46*0003*00, e2*2007/46*0003*05, e2*2007/46*0003*09</p> <p>C3 Picasso:- e2*2001/116*0371*07, e2*2001/116*0371*10, e2*2001/116*0371*11</p> <p>DESCRIPTION: Nouvelle C3:- Manufacturing Dates From 29/10/10 to 29/04/2011 Chassis Number VF7SCKFT0AA672608 to VF7SCKFT6CW500022. C3 Picasso:- Manufactured From 02/11/2010 to 25/02/2011 Chassis Number VF7SH5FW0AT569254 to VF7SH5FW0BT510893</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The battery cable may break which could lead to a potential stalling of the engine which in turn could lead to a road accident.</p>	Voluntary corrective action taken by the manufacturer.
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Camper van "Esprit I and Esprit XL I"</p> <p>BRAND: Dethleffs</p> <p>TYPE/NUMBER OF MODEL: Type: EG/DF 003 EC type approval: e1*2001/116*0416</p> <p>DESCRIPTION: Vehicles manufactured in 2010 and 2011 are concerned.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The wiping action by the left-hand windscreen wiper arm in poor wind and weather conditions may result in failure of the windscreen wiper unit which could lead to a road accident.</p>	Voluntary corrective action taken by the manufacturer.
USA	<p>VEHICLE MAKE / MODEL</p> <p>atc / qst-2012 atc / rsx-2012</p> <p>MANUFACTURER</p> <p>aluminum trailer company</p> <p>COMPONENT</p> <p>equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>2</p> <p>SUMMARY</p> <p>Aluminum trailer company (atc) is recalling certain model year 2012 rsx gooseneck and quest (qst) car haulers equipped with a dexter axle brand electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Atc will notify owners and dexter axle dealers will replace the electric/hydraulic (e/h) brake actuator pumps, free of charge. Atc has not provided a notification schedule. Owners may contact atc at 1-877-441-2440.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL international / terrastar-2012</p> <p>MANUFACTURER navistar, inc</p> <p>COMPONENT steering: gear box: shaft pitman</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 234</p> <p>SUMMARY Navistar is recalling certain model year 2012 international terrastar trucks, manufactured from August 23, 2011, through November 16, 2011 and equipped with a sheppard m83 steering gear (feature code 05psn). The fastener attaching the pitman arm to the steering gear shift may have been over tightened. As a result, the securing bolt may fail and the pitman arm may separate from the steering gear. No picture available.</p>	<p>CONSEQUENCE If this occurs, a loss of steering control could result, increasing the risk of crash resulting in property damage, personal injury, or death.</p>	<p>REMEDY Navistar will notify owners, and dealers will replace the pitman arm fasteners. This service will be performed free of charge. The recall is expected to begin on or about June 15, 2012. Owners may contact Navistar at 1-800-448-7825.</p>
USA	<p>VEHICLE MAKE / MODEL Nissan / titan-2012</p> <p>MANUFACTURER Nissan North America, inc.</p> <p>COMPONENT equipment: other: labels</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 918</p> <p>SUMMARY Certain model year 2012 nissan titan vehicles, manufactured from June 10, 2011, through July 22, 2011, equipped with the sports appearance package have incorrect seating capacity information displayed on the tire placard. These vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 110, "tire selection and rims." No picture available.</p>	<p>CONSEQUENCE An incorrect capacity label may lead to vehicle overloading. Vehicle overloading may increase the likelihood of a crash.</p>	<p>REMEDY Nissan will supply owners with a new label and instructions on how install the label or the owner will have the option of taking their vehicle to a Nissan dealer to have the new label installed free of charge. The safety recall is expected to begin on or about May 14, 2012. Owners may contact Nissan at 1-615-725-1000.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL chevrolet / express-2008-2010 ford / transit connect-2010 gmc / savanna-2009</p> <p>MANUFACTURER main mobility, inc.</p> <p>COMPONENT equipment adaptive</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 34</p> <p>SUMMARY Main mobility is recalling certain conversion vans built on model year 2008-2010 chevrolet express, 2009 gmc savana, and 2010 ford transit connect chassis, and fitted with certain braun wheelchair lifts. Over time and with frequent use, the roll stop latches on the wheelchair lift's outer barrier may become bent or misaligned. No picture available.</p>	<p>CONSEQUENCE A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY Main mobility is working with braun to notify owners, and braun dealers will repair the vehicles, free of charge. Main mobility has not provided a notification schedule. Owners may contact main mobility at 1-716-759-6811.</p>
USA	<p>VEHICLE MAKE / MODEL big tex / 22gn-2012 big tex / 25gn-2012</p> <p>MANUFACTURER big tex trailer manufacturing, inc.</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 20</p> <p>SUMMARY Big tex is recalling certain model year 2012 22gn and 25gn trailers equipped with a dexter axle electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable. No picture available.</p>	<p>CONSEQUENCE The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY Big tex will notify owners and dexter axle dealers will replace the electric/hydraulic (e/h) brake actuator pumps, free of charge. Owners may contact big tex manufacturing, inc. at 1-903-575-0300.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>bmw / 5-series-2011 bmw / 5-series gran turismo-2011 bmw / 6 series-2012 bmw / 7-series-2012 bmw / x5 sav-2012 bmw / x6 sav-2012</p> <p>MANUFACTURER</p> <p>bmw of North America, llc</p> <p>COMPONENT</p> <p>engine and engine cooling: engine: other fuel types: turbo-charger</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>2,846</p> <p>SUMMARY</p> <p>Bmw is recalling certain model year 2011 5-series, 5-series gran turismo, model year 2012 6-series convertible, 7-series, x5 sav, and x6 sav vehicles equipped with 8- or 12-cylinder, turbocharged, engines because the circuit board for the electric auxiliary water pump can overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This could lead to a smoldering of the pump or an engine compartment or vehicle fire.</p>	<p>REMEDY</p> <p>Bmw will notify owners, and dealers will replace the auxiliary water pump free of charge. The safety recall is expected to begin during April 2012. Owners may contact bmw customer relations and services at 1-800-525-7417.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>cbgt / gooseneck trailer-2012</p> <p>MANUFACTURER</p> <p>custom built gooseneck trailers, inc.</p> <p>COMPONENT</p> <p>equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>2</p> <p>SUMMARY</p> <p>Custom built gooseneck trailers, inc. (cbgt) is recalling 1 25' and 1 40' model year 2012 trailers, manufactured between January 14, 2011, and January 18, 2012, equipped with an electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Cbgt will notify owners and dealers will replace the electric/hydraulic (e/h) brake actuator pumps, free of charge. Owners may contact custom built gooseneck trailers, inc. at 1-903-383-2896.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL girardin / g5-2009-2011</p> <p>MANUFACTURER corp. micro bird, inc.</p> <p>COMPONENT equipment adaptive</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 38</p> <p>SUMMARY Micro bird is recalling certain model year 2009 through 2011 micro bird g5 school buses equipped with braun century-2 and vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. No picture available.</p>	<p>CONSEQUENCE A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY Micro bird will notify owners, and the repairs will be performed by authorized braun dealers free of charge. The safety recall is expected to begin at the end of April 2012. Owners may contact micro bird at 1-819-477-2012.</p>
USA	<p>VEHICLE MAKE / MODEL bmw / s 1000 rr-2012</p> <p>MANUFACTURER bmw of North America, llc</p> <p>COMPONENT engine and engine cooling:engine</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,414</p> <p>SUMMARY Bmw is recalling certain model year 2012 s1000rr motorcycles, manufactured from September 1, 2011, through April 10, 2012. Due to a manufacturing process error, the connecting rod bolts may become loose during high engine temperatures and/or high engine operating speeds which could result in catastrophic engine damage. No picture available.</p>	<p>CONSEQUENCE In the event of engine damage, escaping oil could cause handling issues, increasing the risk of a crash.</p>	<p>REMEDY Bmw will notify owners, and dealers will replace the connecting rod bolts free of charge. The safety recall is expected to begin during May 2012. Owners may contact bmw customer relations and services at 1-800-525-7417.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>trans tech / dw5+9159frl-2008-2010 trans tech / dw5159frl-2009-2010 trans tech / dw6+9166-2008 trans tech / dw6158frl-2008-2010 trans tech / dw6159frl-2008-2010 trans tech / dw7+9195frl-2009 trans tech / dw8195frl-2009 trans tech / sth4+9139-2010</p> <p>MANUFACTURER</p> <p>trans tech bus</p> <p>COMPONENT</p> <p>equipment adaptive</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>77</p> <p>SUMMARY</p> <p>Transportation collaborative incorporated (tci) is recalling certain model year 2008-2010 trans tech buses equipped with braun century-2 and vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY</p> <p>Tci will notify owners, and the repairs will be performed by authorized braun dealers free of charge. The recall is expected to begin during April 2012. Owners may contact tci at 845-988-0419.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>trans tech / dw5+9159frl-2009</p> <p>MANUFACTURER</p> <p>trans tech bus</p> <p>COMPONENT</p> <p>equipment adaptive</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>1</p> <p>SUMMARY</p> <p>Transportation collaborative incorporated (tci) is recalling one model year 2007 dw7+9195frl manufactured by U.S. bus and equipped with a braun century-2 or a vista-2 wheelchair lift. Over time and with frequent use, the roll stop latches on the wheelchair lift's outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY</p> <p>Tci will notify the owner, and the repairs will be performed by an authorized braun dealer free of charge. The recall is expected to begin during April 2012. Owners may contact tci at 845-988-0419.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Nissan / armada-2012 Nissan / titan-2012</p> <p>MANUFACTURER Nissan North America, inc.</p> <p>COMPONENT equipment: other: labels</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 26,626</p> <p>SUMMARY Nissan is recalling certain model year 2012 titan and armada vehicles, manufactured from August 12, 2011, through March 13, 2012. The part 567 certification labels on the vehicles do not contain rim size information. Thus, these vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 110, "tire selection and rims." No picture available.</p>	<p>CONSEQUENCE The omission of the rim size may lead to an incorrect tire/wheel combination which may increase the likelihood of a crash.</p>	<p>REMEDY Nissan will supply owners with a new label and instructions on how install the label or the owner will have the option of taking their vehicle to a Nissan dealer to have the new label installed free of charge. The safety recall is expected to begin on or about May 14, 2012. Owners may contact Nissan at 1-615-725-1000.</p>
USA	<p>VEHICLE MAKE / MODEL pj trailers / dd-2011</p> <p>MANUFACTURER pj trailers</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 194</p> <p>SUMMARY Pj trailers is recalling certain model year 2012 trailers, equipped with dexter axle brand electric/hydraulic (e/h) brake actuator pumps. Some of these pumps may not have been properly heat treated. this condition can cause premature wear of some critical components in these pumps which can render the unit inoperable. No picture available.</p>	<p>CONSEQUENCE The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY Pj trailer will notify owners, and dealers will replace the actuators, free of charge. Pj trailers has not provided a notification schedule. Owners may contact pj trailers at 1-903-669-0213.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>freightliner / 108sd-2012-2013 freightliner / business class m2-2012-2013 freightliner / cascadia-2012-2013 freightliner / Coronado-2012-2013</p> <p>MANUFACTURER</p> <p>Daimler buses North America, inc.</p> <p>COMPONENT</p> <p>service brakes, air: supply: quick release valve</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>3,116</p> <p>SUMMARY</p> <p>Daimler trucks (dtna) is recalling certain model year 2012-2013 freightliner 108sd, business class m2, cascadia, coronado vehicles, equipped with a haldex quick release valve, and manufactured from February 3, 2012, through March 2, 2012. The quick release valve cover may not be correctly manufactured, allowing the cover to become separated from the valve body. If the cover separates from the valve body, the front brakes may not function.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If this condition occurs, increased vehicle stopping distance may result, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dtna will notify owners, and where necessary, the quick release valve will be replaced by dtna authorized service facilities, free of charge. The safety recall is expected to begin before June 15, 2012. Owners may contact dtna at 1-800-547-0712.</p>
AUSTRALIA	<p>Bombardier Recreational Products—MY 2010 Can-Am™ Spyder™ RT Series Roadster</p> <p>PRODUCT DESCRIPTION</p> <p>MY 2010 Can-Am™ Spyder™ RT Series Roadster motortrike</p> <p>IDENTIFYING FEATURES</p> <p>All serial numbers in MY 2010 of the Can-Am™ Spyder™ RT Series Roadster</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>BRP Australia through its network of authorized BRP dealers</p> <p>SUPPLIER</p> <p>Bombardier Recreational Products Inc.</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.can-am.brp.com</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The defect may cause a serious accident, possibly resulting in injury or death.</p> <p>DEFECTS</p> <p>A pin securing the brake pedal connecting rod could disengage and eventually fall off. This could cause a total loss of main brake function without prior warning.</p>	<p>Call an authorized BRP Can-Am roadster dealer and make an appointment to have the roadster repaired. The dealer will perform this work at no charge to the consumer.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>TIRE BRAND NAME / TIRE LINE / TIRE SIZE: michelin / xm505 lrj / 305/85r22.5 michelin / xzu2 lrj / 12r22.5 michelin / xzu3 lrj / 305/85r22.5</p> <p>MANUFACTURER michelin North America, inc.</p> <p>COMPONENT tires</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 77,775</p> <p>SUMMARY Michelin North America, inc. (michelin) is recalling certain michelin xzu3 lrj, size 305/85r22.5, and michelin xzu2 lrj, size 12r22.5, tires produced between October 23, 2005, and September 3, 2011; and michelin xm505 lrj, size 305/85r22.5, tires produced between April 18, 2010, and May 8, 2010, and January 23, 2011, and February 12, 2011. These tires have a casing that may experience a loss of integrity and, in some cases, have rapid air loss.</p> No picture available.	<p>CONSEQUENCE Rapid air loss of the tire while the vehicle is in use, could result in a vehicle crash.</p>	<p>REMEDY Michelin will provide information to customers on how to obtain replacement tires. The safety recall is expected to begin on or about April 30, 2012.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. outlaw / outlaw 103-jul 01, 2010 - dec 31, 2011 rodia / rhd 103-jul 01, 2010 - dec 31, 2011</p> <p>MANUFACTURER sunright international of America, inc</p> <p>COMPONENT equipment: motorcycle: helmets</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 6,997</p> <p>SUMMARY Sunright international of America, inc., dba rodia usa, is recalling certain rodia rhd 103 and outlaw 103 motorcycle helmets, sizes xs, s, m, l, xl, xxl, and xxxl, produced from July 1, 2010, through December 31, 2011. These helmets fail to conform to the frontal impact requirements of federal motor vehicle safety standard no. 218, "motorcycle helmets."</p> No picture available.	<p>CONSEQUENCE The wearer of the noncompliant helmet can sustain serious injuries in the event of a crash.</p>	<p>REMEDY Rodia usa will notify owners and the noncompliant helmet will be replaced free of charge or the owner will be offered a refund. The safety recall is expected to begin on or about April 15, 2012. Owners may contact sunright international of America at 1-888-529-9065.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. Meritor / tl series</p> <p>MANUFACTURER Meritor, inc</p> <p>COMPONENT power train: axle assembly</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 4,310</p> <p>SUMMARY Meritor is recalling certain tl series trailer axles that contain the fag brand bearing system. These axles were sold as aftermarket replacement equipment and installed as original equipment on various recreational vehicles. The bearing system has exhibited low durability life in certain vehicle applications. No picture available.</p>	<p>CONSEQUENCE Prolonged use of the system in these applications can result in the degradation of the bearing grease, thereby potentially resulting in a bearing failure and subsequent wheel end fire.</p>	<p>REMEDY Meritor is working with the vehicle manufacturers to identify and repair the vehicles that contain the subject axles free of charge. This recall campaign supersedes previous recall campaigns 10e-057 and 11e-015. Axles that were repaired under these previous campaigns will also need to be repaired under this campaign. Owners may contact their vehicle manufacturer or Meritor at 1-248-435-1725.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. energy and water solution / cng tank</p> <p>MANUFACTURER energy and water solutions</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: NA</p> <p>SUMMARY Energy and water solutions is recalling certain compressed natural gas (cng) tanks because they were produced without the dot certification label. Thus, these tanks fail to conform with the labeling requirements of federal motor vehicle safety standard no. 304, "compressed natural gas fuel container integrity." No picture available.</p>	<p>CONSEQUENCE A tank that is not certified to be crashworthy may pose a risk of rupturing in a crash, increasing the risk of a fire and the resultant injuries.</p>	<p>REMEDY Energy and water solutions will mail dot certified labels to owners of record free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact energy and water solutions at 1-801-825-5580.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

www.sgs.com/regulatorycompliance

© 2012 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

