

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

15 – 30 JUNE 2012

CONTENTS

AUTOMOTIVE

Pages 1 to 16



[Motor Vehicle \(31\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(2\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	<p>Ducati Motorcycles—1199 Panigale Motorcycles</p> <p>PRODUCT DESCRIPTION</p> <p>1199 Panigale Motorcycles (all versions)</p> <p>IDENTIFYING FEATURES</p> <p>See attached VIN list.</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Ducati dealers</p> <p>SUPPLIER</p> <p>Ducati Motor Holding</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the retaining bolt linking the swingarm to the rear suspension linkage rod fails, it may result in loss of control of the motorcycle.</p> <p>DEFECTS</p> <p>Some motorcycles may have been fitted with the incorrect retaining bolt linking the swingarm to the rear suspension linkage rod.</p>	<p>Consumers should contact their nearest authorised Ducati dealer to arrange inspection of the motorcycle, or contact the Ducati National After-Sales Department on +61-2-8741-3838 / 87413831 for further information.</p>
AUSTRALIA	<p>Isuzu Australia Limited—F Series Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>F Series vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Campaign number: 12-Z-04</p> <p>Target number: 2378</p> <p>See attached PDF for VIN number details</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Isuzu dealers</p> <p>SUPPLIER</p> <p>Isuzu Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The speedometer may cease to function, causing the driver to exceed a safe speed. This may lead to an accident or pose a hazard to other road users.</p> <p>DEFECTS</p> <p>The waterproof seal inside the speed sensor may break down, which could cause the speedometer to cease functioning.</p>	<p>A letter is being sent to affected customers. Return the vehicle to your local Isuzu dealer to have the speed sensor replaced. For further information, contact your local Isuzu dealer</p>
AUSTRALIA	<p>Ateco Automotive Pty Ltd—Citroen C3 & DS3 Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>Citroen C3 & DS3 Motor Vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Recall Campaign MQC</p> <p>VIN List attached</p> <p>C3 & DS3 vehicles</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Motor vehicle dealers</p> <p>Supplier</p> <p>Ateco Automotive Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.citroen.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>This non-conformity may affect the operation of the ABS/ESP system. This may result in reduced steering control whilst braking.</p> <p>DEFECTS</p> <p>On affected vehicles, one of the components of the hydraulic ABS/ESP block may have a non-conformity in comparison to the manufacturer's required specifications.</p>	<p>Contact your authorised Citroen dealer who will check the ABS/ESP block and if necessary replace it.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Isuzu Australia Limited—N Series Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>N Series vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Campaing number: 12-Z-05 Target number: 119</p> <p>SUPPLIER</p> <p>Isuzu Australia Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If the tow ball detaches from the draw bar while the vehicle is in motion, it could cause a serious accident.</p> <p>DEFECTS</p> <p>During the fitting of the tow ball, the securing nut may have had insufficient torque applied. This could cause the securing nut to come loose. In the worst case, the tow ball could detach and cause an accident.</p>	<p>A letter is being sent to affected customer.</p> <p>Return the vehicle to your local Isuzu dealer to have the correct torque applied to the tow ball securing nut.</p> <p>For further information, contact your local Isuzu dealer.</p>
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Camper van "BoxStar 600 and BoxStar 630"</p> <p>BRAND: Knaus Tabbert</p> <p>TYPE/NUMBER OF MODEL:</p> <p>EC type-approval: Model year 2011 - type: X250L, type approval: e1*2001/116*0439*07 Model year 2012 - type: K250L, type approval: e1*2007/46*0771*00 and *01</p> <p>The vehicles concerned were built between 2010 and 2012.</p> <p>DESCRIPTION: Camper van.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The screw attachment of the two seatbelts between the seats of the pull-out bench in the vehicle living area is incorrectly installed. Instead of the steel angle provided, only the weld spots of the nut hold the belt end-point in place. The nut could break off under stress, leaving the belts loose and useless.</p>	<p>Recall of the product from end users.</p>
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Bravo"</p> <p>BRAND: Fiat</p> <p>TYPE/NUMBER OF MODEL: Type 198, EC type approval No: e3*2001/116*0248, Production period: from September 2010 until October 2011</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Italy</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The wrong tightening torque on the lower attachment point of the steering column can lead to a loss of steering on the vehicle.</p>	<p>Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Delta"</p> <p>BRAND: Lancia</p> <p>TYPE/NUMBER OF MODEL: Type 844, EC type approval No.: e3*2001/116*0279*, production period: May 2010 - October 2010</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Italy</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The wrong tightening torque on the lower attachment point of the steering column can lead to a loss of steering on the vehicle.</p>	<p>Recall of the product from end users.</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Gran Move"</p> <p>BRAND: DAIHATSU</p> <p>TYPE/NUMBER OF MODEL: G301/303 Airbag.</p> <p>The recall affects vehicles, produced from 01/1997 to 07/1997 and from 09/1998 to 04/1999, with VINs: JDAG30*****</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>Engine coolant may leak and drop on the airbag computer. This could lead to a short-circuit of the airbag system. In the worst case, the airbag could be deployed accidentally whilst driving.</p>	<p>Recall of the product from end users.</p>
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Zafira"</p> <p>BRAND: Opel</p> <p>TYPE/NUMBER OF MODEL: Type T98MONOCAB, EC type approval Nos: e1*98/14*0110*06-*17, e1*98/14*0200*00, e1*98/14*0200*02-*06 Type: COMBO-C, Combo, type approval No: e1*2001/116*0327*01, L620*01; production period: 2001 - 2006</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No picture available.</p>	<p>FIRE</p> <p>Temperature fluctuations during the filling process (-20° to +40°) may damage the paint on the compressed natural gas (CNG) cylinders, resulting in corrosion. In extreme cases, this may cause natural gas to leak from the CNG cylinders. There is a risk that the vehicle could catch fire once the engine has been switched off.</p>	<p>Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Outlander"</p> <p>BRAND: Mitsubishi</p> <p>TYPE/NUMBER OF MODEL: Type: CWB, model:, EC type approval: e1*2001/116*0482. The vehicles concerned by the recall were built in 2011.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>There is a possibility that the parking brake cable might not have been properly hooked inside the brake shoe lever during vehicle assembly. As a result, there is a risk that the cable can suddenly become loose during transport/use of the car, leading to loss of parking (emergency) brake function.</p>	<p>Recall from consumers ordered by the authorities.</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Scooter "JET4 50, JET4 125"</p> <p>BRAND: SYM</p> <p>TYPE/NUMBER OF MODEL: JET4 50 (AD05W), JET4 125 (AD12W)</p> <p>DESCRIPTION: The recall concerns scooters with VIN numbers:</p> <p>Type JET4 50 (AD05W):</p> <p>Up to LXMAD05W1AX048873</p> <p>Up to LXMAD05W1BX013917</p> <p>Type JET4 125 (AD12W):</p> <p>Up to LXMAD12W19X051134</p> <p>Up to LXMAD12W1AX041177</p> <p>Up to LXMAD12W1BX012015</p> <p>COUNTRY OF ORIGIN: Taiwan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>There is a risk that the welding point of the pillion step with the frame may fracture. As a result the passenger may fall.</p>	<p>Voluntary recall from consumers .</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>KTM Australia—Steering Damper (990 Super Duke R MY 2007)</p> <p>PRODUCT DESCRIPTION</p> <p>Steering damper on all 990 Super Duke R MY 2007 bikes</p> <p>IDENTIFYING FEATURES</p> <p>See attached VIN list</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>KTM Australia authorised V Twin dealers</p> <p>SUPPLIER</p> <p>KTM Australia</p> <p>SUPPLIER'S WEB SITE</p> <p>http://ktm.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Failure of the steering damper clamp may cause reduced handling ability, resulting in a crash that could cause severe injury.</p> <p>DEFECTS</p> <p>There have been reports of breakage of the steering damper clamp on 3 vehicles in other markets.</p>	<p>Consumers should cease using the affected vehicles and arrange for replacement of the faulty component by taking note of the VIN number and contacting an authorised KTM dealer. For enquiries contact KTM Australia service centre 08 93516666.</p>
AUSTRALIA	<p>KTM Australia—2009 300 EXC motorcycle</p> <p>PRODUCT DESCRIPTION</p> <p>300 EXC motorcycle model year 2009 front forks (inner tubes)</p> <p>IDENTIFYING FEATURES</p> <p>See attached VIN list.</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>KTM Australia authorised dealers</p> <p>SUPPLIER</p> <p>KTM Australia</p> <p>SUPPLIER'S WEB SITE</p> <p>http://ktm.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>The inner fork tube may crack. This may adversely affect the forks' function and cause the bike / rider to crash, resulting in serious injury.</p> <p>DEFECTS</p> <p>Due to an incorrect heat treatment process, the inner tubes for the front forks may crack.</p>	<p>Cease using the affected vehicles and arrange for the faulty components to be replaced by calling any authorised KTM dealer. When calling please quote the VIN number, which can be located on the right hand side of the steering head tube. For information, contact KTM Australia Customer Service on 08 93516666.</p>
AUSTRALIA	<p>KTM Australia—450 / 525 XC ATV (MY 2008/09) and 450 / 505 SX ATV (MY 2009)</p> <p>PRODUCT DESCRIPTION</p> <p>Rear brake caliper carrier support and front brake master cylinder plunger return spring</p> <p>IDENTIFYING FEATURES</p> <p>See attached VIN list.</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>KTM Australia authorised dealers</p> <p>SUPPLIER</p> <p>KTM Australia</p> <p>SUPPLIER'S WEB SITE</p> <p>http://ktm.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Loss of rear brake or front brake function may result in severe injury or death to the rider.</p> <p>DEFECTS</p> <p>The rear brake caliper carrier support may crack and / or the front brake master cylinder plunger (piston) may not return properly. This could result in loss of rear brake or front brake function.</p>	<p>ATVs that are affected should not be operated until the rear brake and front brake components have been replaced. Owners should contact an authorised KTM dealer to make a booking and have the faulty components replaced. For further assistance, contact KTM Australia customer service on 08 93516666.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Holden Ltd—JH Cruze 1.4 Litre Turbo Petrol (model year 12/13 only)</p> <p>PRODUCT DESCRIPTION</p> <p>Holden Cruze 1.4 Litre turbo petrol engines</p> <p>IDENTIFYING FEATURES</p> <p>Model Year 2012: From 6G1P#6E8#CL600043 to 6G1P#6E8#CL623659</p> <p>Model Year 2013: From 6G1P##E8#DL800001 to 6G1P##E8#DL801674</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>All Holden dealers</p> <p>SUPPLIER</p> <p>Holden Ltd no picture available.</p>	<p>HAZARDS</p> <p>Potential fire hazard. In affected vehicles, if the pooled oil encounters an ignition source such as hot engine parts, the exhaust manifold or catalytic converter, it may ignite.</p> <p>DEFECTS</p> <p>Holden has initiated a vehicle safety recall on certain Holden Cruze 1.4 Litre turbo petrol engines due to a potential for spilt oil to pool on the lower air deflector.</p>	<p>Contact the nearest Holden dealer for a free inspection of the vehicle and rectification of the problem if necessary.</p>
AUSTRALIA	<p>Land Rover Australia—2011-2012 Land Rover Defender Seat Belt Bolts</p> <p>PRODUCT DESCRIPTION</p> <p>2011-2012 Land Rover Defender Seat Belt Bolts</p> <p>IDENTIFYING FEATURES</p> <p>2011-2012 Land Rover Defender vehicles with build dates from February 2010 until January 2012 with the following VIN ranges: LD072831 - LD076667 LD400002 - LD416856 LD799521 - LD826096</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Land Rover dealers</p> <p>SUPPLIER</p> <p>Land Rover Australia No picture available.</p>	<p>HAZARDS</p> <p>The seat belt brackets may not adequately secure passengers in the event of an accident.</p> <p>DEFECTS</p> <p>The front seat belt mounting brackets may fracture during normal vehicle usage.</p>	<p>Contact the nearest Land Rover dealership for installation of replacement front seat belt brackets.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL spartan / gladiator-2010-2012</p> <p>MANUFACTURER spartan chassis, inc.</p> <p>COMPONENT engine and engine cooling</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 102</p> <p>SUMMARY Spartan is recalling certain model year 2010-2012 gladiator emergency rescue chassis manufactured from April 12, 2010, through June 5, 2012, equipped with a cummins isx 15l engine and fan clutch assembly. Sheering of the fasteners used to mount the fan clutch mounting bracket to the front of the engine may lead to separation of the cooling fan, fan clutch and mounting bracket. No picture available.</p>	<p>CONSEQUENCE If this occurs and cab is in the raised position, the separation could increase the risk of personal injury.</p>	<p>REMEDY Spartan chassis will notify owners, and repair the vehicles. The recall is expected to begin on or about July 13, 2012. Owners may contact spartan at 1-800-543-5008.</p>
USA	<p>VEHICLE MAKE / MODEL thor motor coach / Avanti-2011 thor motor coach / outlaw-2008-2010</p> <p>MANUFACTURER thor motor coach</p> <p>COMPONENT service brakes, hydraulic</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 90</p> <p>SUMMARY Thor motor coach (tmcrv) is recalling certain model year 2008-2010 outlaw and model year 2011 avanti recreational vehicles manufactured from January 24, 2008, through September 28, 2010, equipped with bosch hydraulic disc brakes. Hydraulic brake equipped motorhome chassis exposed to long periods of time of non-driving may experience diametrical brake caliper piston growth and reduced piston to bore clearance potentially leading to brake drag and overheating resulting in reduced brake performance. No picture available.</p>	<p>CONSEQUENCE Reduced brake performance increases the risk of a crash.</p>	<p>REMEDY Freightliner custom chassis (fcc) will notify owners, and dealers will repair the vehicles, free of charge. The manufacturer has not yet provided the agency with a remedy or owner notification schedule for this campaign. Owners may contact thor motor coach at 1-877-500-1020.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL delta / 210 gn-2011 delta / 212 gn-2011</p> <p>MANUFACTURER delta mfg., inc</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2</p> <p>SUMMARY Delta is recalling one model year 2011 210 gn flatbed trailer and one model year 2011 212 gn flatbed trailer each equipped with a dexter axle electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable. No picture available.</p>	<p>CONSEQUENCE The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY Notices were mailed to owners on June 12, 2012. dexter axle dealers will replace the e/h brake actuator pump free of charge. Owners may contact delta at 1-870-523-8941.</p>
USA	<p>VEHICLE MAKE / MODEL blue bird / all American-2013</p> <p>MANUFACTURER blue bird body company</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 13</p> <p>SUMMARY Blue bird is recalling certain model year 2013 all american rear engine school buses and one aftermarket brake treadle valve. The affected buses were manufactured from December 9, 2011, through March 9, 2012. The brake valve plunger may fracture during brake application, resulting in reduced brake pedal angle and travel. This condition may limit the driver's ability to deliver full pressure from the foot brake valve. There is also a potential that the brake plunger could become lodged and not allow release of the service brakes. No picture available.</p>	<p>CONSEQUENCE Either condition could reduce braking ability and/or lead to loss of vehicle control, increasing the risk of a crash.</p>	<p>REMEDY All of the affected buses and the one aftermarket treadle valve were sold through a-z bus sales, a blue bird bus dealer. Blue bird will notify owners, and a-z bus sales will replace all thirteen treadle valves, free of charge. The safety recall is expected to begin on, or about, June 29, 2012. Owners may contact blue bird at 1-478-822-2242.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL mercedes benz / e350-2007-2009</p> <p>MANUFACTURER mercedes-benz USA, llc.</p> <p>COMPONENT suspension: rear</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 3,613</p> <p>SUMMARY Mercedes-benz is recalling certain model year 2007-2009 e350 4matic wagon vehicles manufactured from July 1, 2006, through April 30, 2009. A connecting rod for the load leveling rear suspension system may fail. No picture available.</p>	<p>CONSEQUENCE If this occurs, the driver may have reduced vehicle control, increasing the risk of a crash.</p>	<p>REMEDY Mercedes-benz will notify owners, and dealers will replace all the connecting rods, free of charge. The safety recall is expected to begin during August 2012. Owners may contact mercedes-benz at 1-201-573-0350.</p>
USA	<p>VEHICLE MAKE / MODEL neck over / flat bed trailer-2012 neck over / stock trailer-2012</p> <p>MANUFACTURER c diamond f dba. neckover trailers</p> <p>COMPONENT equipment</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 3</p> <p>SUMMARY C diamond f, inc. d/b/a neckover trailers (neckover) is recalling one model year 2012 flat bed trailer and two model year 2012 stock trailers equipped with a dexter axle electric/hydraulic (e/h) brake actuator pump. This pump may not have been properly heat treated. This condition can cause premature wear of some critical components in this pump which can render the unit inoperable. No picture available.</p>	<p>CONSEQUENCE The e/h brake actuator provides braking power to the trailer brakes. Failure of the actuator can result in the loss of braking effort by the trailer, increasing the risk of a crash.</p>	<p>REMEDY Neckover will notify owners, and dexter axle dealers will replace the electric/hydraulic (e/h) brake actuator pump, free of charge. Neckover has not provided a notification schedule. Owners may contact neckover trailers at 1-866-235-5889.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL ducati / 1199 panigale-2012</p> <p>MANUFACTURER ducati North America</p> <p>COMPONENT suspension: rear</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 375</p> <p>SUMMARY Ducati is recalling certain model year 2012 panigale motorcycles because of an incorrect screw used to retain the swingarm to the rear suspension linkage. No picture available.</p>	<p>CONSEQUENCE If the linkage detaches from the swingarm, catastrophic suspension collapse would occur and adversely affect the ability to safely handle the motorcycle, increasing the risk of a crash.</p>	<p>REMEDY Ducati will notify owners, and dealers will inspect and replace, as necessary, the incorrect screw free of charge. Ducati has not yet provided the agency with an owner notification schedule for this campaign. Owners may contact ducati at 1-800-231-6696 or go to their website at www.ducati.com.</p>
USA	<p>VEHICLE MAKE / MODEL BMW / x5-2012-2013 BMW / x6-2013</p> <p>MANUFACTURER BMW of North America, llc</p> <p>COMPONENT steering</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 2,642</p> <p>SUMMARY BMW is recalling certain model year 2012 x5 vehicles equipped with a diesel engine and 2013 x5 and x6 vehicles. Due to a machining error of the steering gear surface, power steering fluid may leak. No picture available.</p>	<p>CONSEQUENCE Leaking power steering fluid can spray onto hot exhaust parts, increasing the risk of an engine compartment fire.</p>	<p>REMEDY BMW will notify owners, and dealers will inspect, and if necessary, replace the steering gear free of charge. The safety recall is expected to begin during July 2012. Owners may contact bmw customer relations and services at 1-800-525-7417.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>champion / American coach-2008-2011 champion / American crusader-2007-2009 champion / challenger-2008-2010 champion / crusader-2008-2010 champion / ctste-2009-2010 champion / defender-2008-2010 champion / terrastar-2010</p> <p>MANUFACTURER</p> <p>champion bus, inc.</p> <p>COMPONENT</p> <p>equipment adaptive</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>892</p> <p>SUMMARY</p> <p>Champion bus is recalling certain model year 2008 through 2011 transit buses equipped with braun century-2 and/or vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY</p> <p>Champion bus will notify owners, and the repairs will be performed by authorized braun dealers free of charge. The safety recall is expected to begin during June 2012. Owners may contact champion bus at 1-810-724-6474/905-591-9557.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>eldorado / mst ii-2010 eldorado / passport-2009 eldorado / xhf-2010</p> <p>MANUFACTURER</p> <p>eldorado national - California, inc.</p> <p>COMPONENT</p> <p>equipment adaptive</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>15</p> <p>SUMMARY</p> <p>Eldorado national – california (eldorado national) is recalling certain model year 2009 and 2010 passport, mst ii, and xhf transit buses equipped with braun century-2 and/or vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY</p> <p>Eldorado national will notify owners, and the repairs will be performed by authorized braun dealers free of charge. The safety recall is expected to begin during June 2012. Owners may contact eldorado national at 1-905-591-9557.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL itasca / suncruiser-2009 winnebago / adventurer-2009-2010 winnebago / j38s-2009-2012</p> <p>MANUFACTURER winnebago industries inc.</p> <p>COMPONENT service brakes, hydraulic</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 63</p> <p>SUMMARY Winnebago industries (winnebago) is recalling certain model year 2009 through 2012 winnebago commercial vehicle model j38s, model year 2009 and 2010 adventurer motorhomes manufactured from October 30, 2008, through September 9, 2011, and one 2009 itasca suncruiser motorhome built November 2009. These motorhomes chassis are equipped with bosch hydraulic disc brakes which when exposed to long periods of time of non-driving may experience diametrical brake caliper piston growth and reduced piston to bore clearance potentially leading to brake drag and overheating resulting in reduced brake performance. No picture available.</p>	<p>CONSEQUENCE Reduced brake performance increases the risk of a crash.</p>	<p>REMEDY Freightliner custom chassis (fcc) will notify owners, and dealers will repair the vehicles, free of charge. The manufacturer has not yet provided the agency with a remedy or owner notification schedule for this campaign. Owners may contact winnebago at 1-641-585-3535 or daimler trucks at 1-800-547-0712.</p>
USA	<p>VEHICLE MAKE / MODEL chevrolet / cruze-2011-2012</p> <p>MANUFACTURER general motors llc</p> <p>COMPONENT fuel system, gasoline: storage: tank assembly: mounting</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 53,239</p> <p>SUMMARY General motors (gm) is recalling certain model year 2011 and 2012 chevrolet cruze vehicles manufactured from October 2, 2009, through May 14, 2012. Attachment welds for the fuel tank strap secondary brackets may have been omitted. No picture available.</p>	<p>CONSEQUENCE The fuel tank could come loose in a crash, possibly allowing fuel to leak from the tank. A fuel leak in the presence of an ignition source could result in a fire.</p>	<p>REMEDY Gm will notify owners, and dealers will inspect the vehicle for missing welds. If the vehicle is missing welds, dealers will secure the bracket attachments with fasteners. Repairs will be performed free of charge. The safety recall is expected to begin on, or about, July 11, 2012. Owners may contact the chevrolet owner center at 1-866-694-6546.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL chevrolet / cruze-2011-2012</p> <p>MANUFACTURER general motors llc</p> <p>COMPONENT engine and engine cooling</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 413,148</p> <p>SUMMARY General motors (gm) is recalling certain model year 2011 and 2012 chevrolet cruze vehicles manufactured from October 2, 2009, through May 31, 2012. Spilled or dripping oil (such as after an oil change) may collect in the engine shield (bellypan) near hot engine or exhaust system surfaces. As a result, the oil and the engine shield may ignite and burn. No picture available.</p>	<p>CONSEQUENCE Either condition could result in an engine compartment fire, possibly causing injury or death.</p>	<p>REMEDY Gm will notify owners, and dealers will modify the engine shield to prevent fluid from contacting the shield. Also, on vehicles with a manual transmission, dealers will apply a protective tape to the electronic power steering wire harness. Repairs will be performed free of charge to the owner. The safety recall is expected to begin on, or about, July 11, 2012. Owners may contact the chevrolet owner center at 1-866-694-6546.</p>
USA	<p>VEHICLE MAKE / MODEL coach & equipment / phoenix-2008-2012 coach and equipment / phoenix-2006-2007</p> <p>MANUFACTURER coach and equipment mfg corp.</p> <p>COMPONENT equipment adaptive</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,627</p> <p>SUMMARY Coach and equipment manufacturing corporation (coach and equipment) is recalling certain model year 2006-2010 phoenix transit buses equipped with braun century-2 and/or vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. No picture available.</p>	<p>CONSEQUENCE A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury.</p>	<p>REMEDY Coach and equipment will notify owners, and the repairs will be performed by authorized braun dealers free of charge. Owners may contact coach and equipment mfg. corp. at 1-800-946-7513.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>freightliner / business class m2-2013 freightliner / cascadia-2013 freightliner / Columbia-2013 freightliner / Coronado-2013 freightliner / custom chassis xc-2013 western star / 4900-2013</p> <p>MANUFACTURER</p> <p>daimler trucks North America</p> <p>COMPONENT</p> <p>suspension: front</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>217</p> <p>SUMMARY</p> <p>Daimler trucks North America (dtna) is recalling certain model year 2013 freightliner, western star, and freightliner custom chassis trucks manufactured from April 18, 2012, through May 11, 2012, and equipped with detroit axle-brand front axle knuckles. The front knuckles on these vehicles may have a machining error in the wheel bearing area which may lead to premature spindle failure.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the spindle fails, the wheel may separate from the knuckle, resulting in loss of vehicle control, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dtna will notify owners, and dealers will inspect and replace the affected components, free of charge. The recall is expected to begin on, or before, August 11, 2012. Owners may contact daimler trucks North America toll free at 1-800-547-0712.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. vision wheel / warrior</p> <p>MANUFACTURER vision wheels, inc.</p> <p>COMPONENT wheels: cap/cover/hub</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 4,000</p> <p>SUMMARY Vision wheels, inc. (vision wheels) is recalling certain aftermarket wheels, specifically the warrior model in the phantom black finish, sizes 17" and 18". Insufficient machining of the hub bore may result in incorrect wheel mounting when the wheel is used with a hub centering ring. No picture available.</p>	<p>CONSEQUENCE The insufficient machining and use of the supplied hub centering ring for these wheels may cause the wheel and tire assembly to become loose or potentially fall off during vehicle operation, increasing the risk of a crash.</p>	<p>REMEDY Vision wheels will notify the purchasers of these aftermarket wheels and will replace any wheels found containing an affected hub bore at no cost to the owner. The safety recall is expected to begin during June 2012. Owners may contact vision wheels at 1-800-633-3936.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. webasto / hollandia 600 webasto / hollandia 700 webasto / hollandia tvs 900</p> <p>MANUFACTURER j & r auto upholstery shoppe</p> <p>COMPONENT visibility: sun roof assembly</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 96</p> <p>SUMMARY Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by j & r upholstery shoppe, inc. on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. No picture available.</p>	<p>CONSEQUENCE In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto dealer by clicking on the hyperlink affected vehicle list or you may visit webasto's website at http://www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

www.sgs.com/regulatorycompliance

© 2012 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

