

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 30 JUNE 2013

CONTENTS

AUTOMOTIVE

Pages 2 to 13



[Motor Vehicle \(21\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(1\)](#)

Please note that from November 2012 on, product recall notifications can be searched on line in several countries via the Global portal on product recalls hosted by the Organisation for Economic Co-operation and Development (OECD). You can access the OECD site by using the following [link](#).

SGS

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL TEMSA/TS30-2012-2013 TEMSA/TS35C-2011-2013</p> <p>MANUFACTURER TEMSA GLOBAL SANAYI VE TICARET A.S.</p> <p>COMPONENT SEATS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 256</p> <p>SUMMARY Temsa Global is recalling certain model year 2011 -2013 TS35C motorcoach buses manufactured November 2010 through May 2013 and 2012-2013 TS30 motorcoach buses manufactured November 2011 through April 2013 and equipped with 3-point seat belts. The bolts used for the installation of the seat were tightened over their torque specification which may cause the bolts to fail.</p> <p>No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the bolts may break, failing to properly anchor the seat, increasing the risk of injury.</p>	<p>REMEDY Temsa Global will notify owners and dealers will replace the existing bolts with new ones. The manufacturer has not yet provided a notification schedule. Owners may contact Temsa Global at 1-877-858-3672.</p>
USA	<p>VEHICLE MAKE/MODEL TESLA/MODEL S-2013</p> <p>MANUFACTURER TESLA MOTORS, INC</p> <p>COMPONENT SEATS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1,228</p> <p>SUMMARY Tesla Motors, Inc. (Tesla) is recalling certain model year 2013 Model S electric vehicles manufactured May 10, 2013, through June 8, 2013. An improper method for aligning the left hand seat back striker to the bracket may have weakened the weld between the bracket and the frame of the vehicle.</p> <p>No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the left hand seat back may not stay mounted, increasing the risk of injury to passengers.</p>	<p>REMEDY Tesla will notify owners, and Tesla Service Centers will inspect the left hand second row strikers. Tesla will add additional mounting hardware to ensure a proper joint between the bracket and the frame, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Tesla at 1-650-681-5000.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL JEEP/GRAND CHEROKEE-1993-1998 JEEP/LIBERTY-2002-2007</p> <p>MANUFACTURER CHRYSLER GROUP LLC</p> <p>COMPONENT FUEL SYSTEM, GASOLINE , STRUCTURE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1,560,000</p> <p>SUMMARY Chrysler Group LLC (Chrysler) is recalling certain model year 1993-1998 Jeep Grand Cherokee and 2002-2007 Jeep Liberty vehicles. The fuel tanks in these vehicles are at risk of failure and leakage in certain rear impacts. No picture available.</p>	<p>CONSEQUENCE A fuel leak in the presence of an ignition source may result in a fire.</p>	<p>REMEDY Chrysler will notify owners, and dealers will inspect the rear structure. On vehicles in the recall that are not equipped with a tow hitch, Chrysler will install a Chrysler designed tow hitch free of charge, provided the condition of the vehicle can support proper installation. On vehicles in the recall that are equipped with an aftermarket tow hitch, Chrysler will assess whether the hitch and surrounding areas show evidence of sharp edges or other puncture risks. If so, Chrysler will replace the tow hitch with a Chrysler designed tow hitch free of charge, provided the condition of the vehicle can support proper installation. On vehicles already equipped with a Chrysler designed tow hitch, Chrysler will inspect the area around the tow hitch installation, and if any installation issues are identified, they will be repaired free of charge. The recall is expected to begin in July 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign numbers are N45 (for the Grand Cherokee vehicles) and N46 (for the Liberty vehicles).</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL FOREST RIVER/FORESTER2014 FOREST RIVER/LEXINGTON2014 FOREST RIVER/SOLERA2014 FOREST RIVER/SUNSEEKER2014</p> <p>MANUFACTURER FOREST RIVER, INC.</p> <p>COMPONENT ELECTRICAL SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 289</p> <p>SUMMARY Forest River, Inc. (Forest River) is recalling certain model year 2014 Sunseeker, Forester, Lexington, and Solera motorhomes manufactured between April 1, 2013, through May 21, 2013. The battery isolation manager (BIM) can develop a short circuit. No picture available.</p>	<p>CONSEQUENCE A short circuit may result in smoke, melting or a fire.</p>	<p>REMEDY Forest River will notify owners and will replace the BIM. The recall is expected to begin in early July 2013. Owners may contact Forest River Customer Service at 1-574-206-7600.</p>
USA	<p>VEHICLE MAKE/MODEL MITSUBISHI/OUTLANDER SPORT-2011</p> <p>MANUFACTURER MITSUBISHI MOTORS NORTH AMERICA, INC.</p> <p>COMPONENT VISIBILITY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 3,181</p> <p>SUMMARY Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2011 Outlander Sport vehicles manufactured August 26, 2010, through March 29, 2011. The panoramic glass roof may have been installed without primer being applied before the adhesive. No picture available.</p>	<p>CONSEQUENCE Without primer being used, the panoramic glass roof may have reduced adhesion, possibly allowing the glass roof to detach from the vehicle, resulting in a road hazard to other vehicles.</p>	<p>REMEDY MMNA will notify owners and dealers will inspect the panoramic glass to see if primer was installed. If primer is not present, the glass will be reinstalled. MMNA has not yet provided a notification schedule. MMNA's recall number is SR-13-007. Customers may contact MMNA at 1-888-648-7820.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL</p> <p>CHEVROLET/W-SERIES-2001-2010 CHEVROLET/WT5500-2001-2004 GMC/W-SERIES-2001-2010 GMC/WT5500-2001-2004 ISUZU/FRR-2001-2004 ISUZU/N-SERIES-2001-2013</p> <p>MANUFACTURER</p> <p>ISUZU MANUFACTURING SERVICES OF AMERICA</p> <p>COMPONENT</p> <p>ELECTRICAL SYSTEM , EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>1,774</p> <p>SUMMARY</p> <p>Isuzu Manufacturing Services of America, Inc. (Isuzu) is recalling certain model year 2001-2013 Isuzu N-Series; model year 2001-2010 Chevrolet and GMC W-Series; model year 2001-2004 Isuzu FRR and model year 2001-2004 Chevrolet and GMC WT5500 trucks. The affected vehicles are equipped with an optional oil pan heater (RPO code IG3). Debris may collect at the contact point of the heater plug and the extension cord. This may cause overheating of the extension cord.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Overheating of the extension cord could melt the oil pan heater plug and/or block heater plug, resulting in an increased risk of fire.</p>	<p>REMEDY</p> <p>Isuzu will notify owners and dealers will inspect the trucks. The extension cord and damaged components will be replaced, free of charge. The recall is expected to begin by August 2013. Owners may contact Isuzu at 1-866-441-9638.</p>
USA	<p>VEHICLE MAKE/MODEL</p> <p>NABI/31LFW-2013 NABI/40LFW-2012-2013</p> <p>MANUFACTURER</p> <p>NORTH AMERICAN BUS INDUSTRIES, INC.</p> <p>COMPONENT</p> <p>ELECTRICAL SYSTEM , EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>100</p> <p>SUMMARY</p> <p>North American Bus Industries, Inc. (NABI) is recalling certain model year 2012-2013 40LFW and model year 2013 31LFW transit buses manufactured October 5, 2012, through May 15, 2013 and equipped with a rear mount Suttrak electric HVAC. The fuse holder inside the HVAC may allow voltage spikes, which may damage electrical components.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Damage to electrical components may result in a fire.</p>	<p>REMEDY</p> <p>NABI will notify the fleet owner of the affected buses and dealers will replace the cables and fuse holders for the HVAC system, free of charge. The recall is expected to begin in early July 2013. NABI's recall number is 20135. Owners may contact NABI at 1-256-831-4296.</p>



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL MID BUS/CSD-7450R-C-2006-2007</p> <p>MANUFACTURER COLLINS BUS CORPORATION</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 17</p> <p>SUMMARY Collins Bus Corporation (Collins) is recalling certain model year 2006-2007 Mid Bus CSD-7450R-C buses manufactured September 11, 2006, through October 25, 2007 and equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. No picture available.</p>	<p>CONSEQUENCE If the cable does not clear the wheelchair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire.</p>	<p>REMEDY Collins will notify owners and instruct them to take their vehicle to their Mid Bus dealer where it will be inspected. If needed, Ricon will provide a supplemental cover kit and instructions free of charge. This recall campaign will begin in early July 2013. Owners may contact Collins at 1-800-533-1850 ext. 424, or Ricon at 1-800-322-2884.</p>
USA	<p>VEHICLE MAKE/MODEL ZERO/FX-2013 ZERO/XU-2013</p> <p>MANUFACTURER ZERO MOTORCYCLES INC.</p> <p>COMPONENT ELECTRICAL SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 128</p> <p>SUMMARY Zero Motorcycles Inc. (Zero) is recalling certain model year 2013 FX motorcycles manufactured January 28, 2013, through May 21, 2013; and model year 2013 XU motorcycles manufactured January 16, 2013, through May 20, 2013. A manufacturing defect with the sealant material in the battery may allow water to penetrate the battery and contact the cells. No picture available.</p>	<p>CONSEQUENCE Water penetration into the battery may lead to corrosion of the cells, possibly resulting in a rapid temperature increase and off-gassing of the cells' electrolyte which may cause a burn to the rider.</p>	<p>REMEDY Zero will notify owners and dealers will replace the battery modules, free of charge. The recall is expected to begin in late June 2013. Owners may contact Zero motorcycles at 1-888-786-9376.</p>


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL VERMEER/R9X12T-2012-2013</p> <p>MANUFACTURER VERMEER MANUFACTURING COMPANY</p> <p>COMPONENT SERVICE BRAKES, AIR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 14</p> <p>SUMMARY Vermeer Manufacturing Company (Vermeer) is recalling certain model year 2012-2013 R9X12T trailers manufactured May 25, 2012, through May 3, 2013. The air-brake booster valve was installed incorrectly, allowing the brake application time to exceed the permissible amount. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 121, "Air Brake Systems." No picture available.</p>	<p>CONSEQUENCE The extra brake application time may result in extended stopping distances, increasing the risk of crash.</p>	<p>REMEDY Vermeer will notify owners, and dealers will re-plumb the air brake booster valve, free of charge. The recall is expected to begin by July 29, 2013. Owners may contact Vermeer at 1-641-628-3141. Vermeer's recall number is IK00-1843.</p>
USA	<p>VEHICLE MAKE/MODEL HONDA/FIT-2007-2008</p> <p>MANUFACTURER HONDA (AMERICAN HONDA MOTOR CO.)</p> <p>COMPONENT VISIBILITY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 143,083</p> <p>SUMMARY Honda is re-recalling certain model year 2007-2008 Fit vehicles covered under previous recall 10V-033. The remedy applied in this earlier recall may have been insufficient. In the affected vehicles, over time, the plastic cover may separate from the master power window switch allowing water to enter the driver's window and reach the master power window switch. If the master power window switch is damaged as a result of the water intrusion, overheating and failure of the switch may result. No picture available.</p>	<p>CONSEQUENCE An overheated switch can cause smoke, melting and fire.</p>	<p>REMEDY Honda will notify owners in July 2013 and will instruct owners to take their vehicles to dealers to have a free inspection conducted. If the switch is damaged, it will be replaced free of charge. If the switch is not damaged, the owner will be instructed to await a second notification that will instruct them to return to the dealer to have a replacement switch installed free of charge. Honda anticipates it will have sufficient parts inventory to notify owners of vehicles with undamaged switches to return to dealers for replacement switches in Fall 2013. Owners may contact Honda at 1-800-999-1009. Honda's recall number is JA6.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: TOYOTA</p> <p>NAME: Prius</p> <p>TYPE/NUMBER OF MODEL: ZVW30</p> <p>Batch number/Barcode: -</p> <p>DESCRIPTION: Passenger car. The recall concerns vehicles with production period from 10/10/2008 to 02/10/2009 and 24/12/2008 to 07/10/2009.</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>As a result of a problem with the brake pressure accumulator, nitrogen gas could leak from the brake pressure accumulator into the brake fluid and gradually cause the brake pedal stroke to become longer, resulting in decreased hydraulic pressure. This could result in increased stopping distances.</p>	<p>Voluntary measures: Recall of the product from end users.</p>
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycle</p> <p>BRAND: Triumph</p> <p>NAME: 1) Tiger 800, Tiger 800XC 2) Speed Triple, Speed Triple R 3) Street Triple, Street Triple R 4) Daytona 675, Daytona 675R 5) Tiger 1050 6) Tiger Sport 7) Street Triple, Street Triple R 8) Street Triple 70KW 9) Daytona 675, Daytona 675R</p> <p>TYPE/NUMBER OF MODEL: 1) Type: A08 approval number: e11*2002/24*1048* 2) Type: 515NV approval number: e11*2002/24*1049* 3) Type: D67LD approval number: e11*2002/24*0611* 4) Type: D67LC approval number: e11*2002/24/0803* 5) Type: 115NG approval number: e11*2002/24/0440* 6) Type: 115NG approval number: e11*2002/24*1604* 7) Type: L67LR approval number: e11*2002/24*1512* 8) Type: L67LR3 approval number: e11*2002/24*1533* 9) Type: H67 approval number: e11*2002/24*1592*</p> <p>Batch number/Barcode: N/A</p> <p>DESCRIPTION: Motorcycle. Construction years 2012 to 2013</p> <p>COUNTRY OF ORIGIN: Thailand, United Kingdom</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>The stems of the indicators can break, with the result that other road users will not be able to see in which direction the rider wishes to turn. This can lead to an accident.</p>	<p>Voluntary measures: Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: BMW</p> <p>NAME: 3 Series</p> <p>TYPE/NUMBER OF MODEL: 3 series E46</p> <p>Batch number/Barcode: N/A</p> <p>DESCRIPTION: Passenger car. Production date: 12/2001 to 03/2003.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>A degradation of the inflator propellant for the front passenger air bag could occur over time. This could lead in very rare cases to an overly aggressive combustion of the propellant during an airbag deployment possibly resulting in separation of the airbag housing and injury of the vehicle occupant.</p>	<p>Voluntary measures: Recall of the product from end users.</p>
AUSTRALIA	<p>Fiat Chrysler Group—2010-2012 Jeep Patriot and Compass Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>2010-2012 Jeep Patriot and Compass vehicles</p> <p>IDENTIFYING FEATURES</p> <p>Recall campaign: RC N01</p> <p>Target: 6794</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Chrysler, Jeep & Dodge dealers</p> <p>SUPPLIER</p> <p>Chrysler Australia Pty Ltd trading as Fiat Chrysler Group</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> <p>No pictures available.</p>	<p>DEFECTS</p> <p>The Occupant Restraint Control Module (ORC) has a software error.</p> <p>HAZARDS</p> <p>The software error could result in non-deployment of the seatbelt pretensioner and/or side airbag curtains during low speed roll-over events and increase the risk of injury to occupants.</p>	<p>A letter is being sent to affected customers. Contact your local Chrysler dealerships to arrange an appointment for them to reprogram the module with new software.</p>
AUSTRALIA	<p>Honda—2006 YM Integra & 2006-2007 YM S2000 Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>2006 YM Integra & 2006-2007 YM S2000 vehicles brake booster</p> <p>IDENTIFYING FEATURES</p> <p>Campaign number: 5MK</p> <p>Target: 433</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Honda Authorised dealers</p> <p>SUPPLIER</p> <p>Honda Australia Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> <p>No pictures available.</p>	<p>DEFECTS</p> <p>When the brake pedal is pressed, the master power booster body can be displaced and the sealability of the diaphragm can be reduced. If this occurs brake assist power is reduced, causing a longer stopping distance than expected.</p> <p>HAZARDS</p> <p>The loss of braking effectiveness may pose an accident hazard to the driver and other road users.</p>	<p>A letter will be sent to affected owners. Owners are advised to contact their authorised dealership for rectification.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Mercedes Benz Australia/Pacific Pty Ltd— Mitsubishi Fuso Euro 5 Heavy FP54 Trucks</p> <p>PRODUCT DESCRIPTION</p> <p>Mitsubishi Fuso Euro 5 heavy FP54 trucks in order to replace front brake air hoses. This affects trucks built between 12.07.2011 to 8.02.2013.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign number: RCFF0113FPBRHOSE</p> <p>Target: 12</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Mitsubishi dealers</p> <p>SUPPLIER</p> <p>Mercedes Benz Australia/Pacific Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> <p>No pictures available.</p>	<p>DEFECTS</p> <p>The front brake air hoses are too long. This may allow the hoses to make contact with other components damaging the hoses.</p> <p>HAZARDS</p> <p>If the defect occurs this may result in reduced braking efficiency. This may pose a hazard to the driver and other road users.</p>	<p>A letter will be sent to affected owners. The front brake air hoses will be replaced; these repairs will be carried out free of charge.</p> <p>For further information, please contact your local dealer.</p>
AUSTRALIA	<p>Mercedes Benz Australia/Pacific Pty Ltd— Mitsubishi Fuso Euro 5 Heavy FP54 Trucks</p> <p>PRODUCT DESCRIPTION</p> <p>Mitsubishi Fuso Euro 5 heavy FP54 trucks in order to replace the fuel tank. This affects trucks built between 14.09.2011 to 07.09.2012.</p> <p>IDENTIFYING FEATURES</p> <p>Campaign number: RCFF0113FP54FUEL</p> <p>Target: 11</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Mitsubishi dealers</p> <p>SUPPLIER</p> <p>Mercedes Benz Australia/Pacific Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> <p>No pictures available.</p>	<p>DEFECTS</p> <p>The fuel tank securing straps may have been over-tightened during production, this may result in damage to the fuel tanks.</p> <p>HAZARDS</p> <p>If the defect occurs, this may cause fuel leakage resulting in a hazard to other road users, and in the worst case scenario cause a fire.</p>	<p>A letter will be sent to affected owners. The fuel tank will be replaced; these repairs will be carried out free of charge.</p> <p>For further information, please contact your local dealer.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: 2011 Polaris Ranger RZR XP 900 recreational off-highway vehicles</p> <p>UNITS: About 4,500</p> <p>DESCRIPTION This recall involves 2011 model Polaris Ranger RZR XP 900 recreational off-highway vehicles. The machines are either white or red and have a "RZR XP" decal on the right and left rear side panels. The right and left of the hood have "Dual Overhead Cam" decals. There are also "900 EFI" decals on the front right and left of the machine.</p> <p>IMPORTER Unknown</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD: The firewall behind the driver and passenger seats can overheat and melt, posing a burn hazard to consumers.</p> <p>INCIDENTS/INJURIES The firm has received one report of an incident involving a consumer who received burn injuries to a finger.</p>	<p>Consumers should immediately stop using the vehicles and contact Polaris to schedule a free repair. Polaris is contacting its known customers directly.</p>
EU/DENMARK	<p>CATEGORY: Machinery</p> <p>PRODUCT: Multi-purpose machine</p> <p>BRAND: AVANT</p> <p>NAME: AVANT 600 Series</p> <p>TYPE/NUMBER OF MODEL: 630, 635</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Self-propelled earth-moving machinery on wheels, having equipment or attachment (working tool) or both, primarily designed to perform excavation, loading, transportation, drilling, spreading, compacting or trenching of earth, rock and other materials (multi purpose machine).</p> <p>COUNTRY OF ORIGIN: Finland</p> 	<p>INJURIES The machine is not fitted with FOPS (Falling Object Protective Structure), therefore when handling objects, there is a risk of crushing (eg. the spine of the operator) if hit by a falling object.</p> <p>The product does not comply with the Machinery Directive 2006/42/EC and the relevant European standard EN 474-3: 2006+A1:2009.</p>	<p>Compulsory measures: Recall of the product from end users.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/UNITED KINGDOM	<p>CATEGORY: Machinery</p> <p>PRODUCT: Slurry tanker</p> <p>BRAND: REDROCK</p> <p>NAME: Vacuum Tanker</p> <p>TYPE/NUMBER OF MODEL: 1600 gallon single two wheel axle</p> <p>Batch number/Barcode: 35505</p> <p>DESCRIPTION: Slurry tanker is a rolled metal tank which is fixed to an axle. The size of slurry tankers varies, in a typical range from 850 gallon (3865 litres) to 5000 gallon (22730 litres). This type of equipment is found in agriculture, construction, quarries.</p> <p>COUNTRY OF ORIGIN: United Kingdom</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries during foreseeable maintenance activity of wheel/tyre removal and replacement on Single Axle slurry tanker.</p> <p>The machinery design does not include a jacking or propping point,so there is no strong point available. Therefore, the movement of the raised vehicle leads to overturn and crushing. The movement of the jack or prop leads to instability and overturn. A full or partially full liquid load increases the risk of movement and overturn. Working close to the body of the machine, under it, in front of the wheel arches means the operator is within the danger zone, thereby increasing risk of injury.</p> <p>1 fatal accident reported. The product does not comply with the Machinery Directive 2006/42/EC and with the relevant national standards.</p>	Compulsory measures: Withdrawal of the product from the market.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. SUTRAK/HVAC SYSTEM (ACE219G)</p> <p>MANUFACTURER SUTRAK USA</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 154</p> <p>SUMMARY Sutrak USA (Suttrak) is recalling certain HVAC Systems manufactured May 2012 through May 2013 used in DART 39000 buses manufactured by North American Bus Industries, Inc. The fuse holder inside the HVAC may allow voltage spikes, which may damage electrical components. No picture available.</p>	<p>CONSEQUENCE Damage to electrical components may result in a fire.</p>	<p>REMEDY Suttrak has been working with the bus manufacturer and the affected fleet and will replace the fuse holders, free of charge. The recall is expected to begin in late June 2013. Owners may contact Suttrak at 1-303-287-2700.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

<http://www.sgs.com/en/Consumer-Goods-Retail/Product-Recalls.aspx>

© 2013 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

