

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 30 NOVEMBER 2011

CONTENTS

AUTOMOTIVE


Pages 1 to 38



[Motor Vehicle \(28\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(2\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Bombardier Recreational Products—Can-Am ATV</p> <p>PRODUCT DESCRIPTION</p> <p>MY 2010: (1) Can-Am® OUTLANDER™ 800R, 650 and 500 (packages XT, XT-P and Ltd) (2) MAX and One-Up models: Can-Am® RENEGADE™ 800R (package X xc only)</p> <p>MY 2011: (1) Can-Am® OUTLANDER™ 800R, 650 and 500 (packages XT, XT-P, X xc, X mr and Ltd) (2) MAX and One-Up models: Can-Am® RENEGADE™ 800R (package X xc only)</p> <p>IDENTIFYING FEATURES</p> <p>See bulletin for serial numbers</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>BRP Australia (throughout its network of authorized BRP dealers)</p> <p>SUPPLIER</p> <p>Bombardier Recreational Products Inc.</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.brp.com</p> 	<p>HAZARDS</p> <p>In some situations the operator could lose control of the vehicle, causing serious injuries or even death.</p> <p>DEFECTS</p> <p>Some vehicles may have been delivered or repaired with dynamic power steering (DPS) that has cracks on its main shaft. Pieces may detach inside the DPS and cause gears to jam, resulting in a sudden limitation of the vehicle steering range.</p>	<p>Call an authorized BRP Can Am ATV dealer and make an appointment to have your ATV repaired. The dealer will perform this work at no charge to the consumer.</p>
AUSTRALIA	<p>Holden—Holden Captiva Series 1 (Diesel)</p> <p>PRODUCT DESCRIPTION</p> <p>2.0 L Diesel Holden Captiva Series 1</p> <p>IDENTIFYING FEATURES</p> <p>Recall campaign number: 11-H-05</p> <p>TARGET NUMBER: 16,181</p> <p>2008 VIN: KL3CD26RJ8H307843 to KL3CG26RJ8H313387 2009 VIN: KL3CA26RJ9B258567 to KL3CD26RJ9B557340 2010-2011 VIN: KL3CA26RJAB000715 to KL3CD26RJAB118110</p> <p>SUPPLIER</p> <p>GM Holden Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>In affected vehicles, the fuel feed hose could potentially leak diesel fuel, resulting in a remote possibility of fire or a hazard to other road users.</p> <p>DEFECTS</p> <p>Potential manufacturing defect within fuel feed hose.</p>	<p>Owners of affected vehicles will be contacted by letter. Owners are advised to contact their authorised dealership for inspection and rectification.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	<p>Chrysler—Chrysler Dodge Grand Voyager & Chrysler Town & Country</p> <p>PRODUCT DESCRIPTION 2011 RT model year</p> <p>IDENTIFYING FEATURES Campaign number: RC L26</p> <p>TARGET NUMBER: 103</p> <p>TRADERS WHO SOLD THIS PRODUCT Chrysler, Jeep, or Dodge distributor/dealer</p> <p>SUPPLIER Chrysler No picture available.</p>	<p>HAZARDS Incorrect brake pads may lead to reduced braking capacity and increase the risk of an accident occurring.</p> <p>DEFECTS Non compliant brake pads may have been incorrectly installed on the vehicle.</p>	<p>Chrysler Australia Pty Ltd will write to owners of all affected vehicles.</p> <p>Alternatively contact your Chrysler, Jeep, or Dodge distributor/dealer, at your convenience, to schedule a service appointment.</p>
EU/ GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT Motorcycle "Daytona 675" and "Daytona 675 R"</p> <p>BRAND: Triumph</p> <p>TYPE/NUMBER OF MODEL: Type: D67LC; EC type approval: e11*2002/24*0803*02-*03</p> <p>The vehicles in question are 2010 and 2011 models with VINs in the range SMTD00NS9BT464449 to SMTD03NS8CT516155.</p> <p>DESCRIPTION: Motorcycle.</p> <p>COUNTRY OF ORIGIN: United Kingdom No picture available.</p>	<p>INJURIES The cable connecting the flushing valve to the fuel vapour collection system may come into contact with the exhaust pipe and, if damaged, cause a short circuit. As a result, the vehicle electronics could fail and thus the motor could stop, which, in the worst case, could cause the rider to fall.</p>	<p>Voluntary corrective action taken by the manufacturer.</p>
EU/IRELAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Verso"</p> <p>BRAND: Toyota</p> <p>TYPE/NUMBER OF MODEL: Model codes, VIN range, production periods: AUR20 NMT DD26R# 0R001002-0R045065: Feb. 13 2009 - Mar. 3 2011; AUR21 NMT DB26R# 0R001001-0R007026: Feb. 11 2009 - Feb. 22 2011; ZGR20 NMT DE26R# 0R001107-0R016843: Mar. 6 2009 - Mar. 3 2011; ZGR21 NMT DG26R# 0R001008-0R028717 : Feb. 11 2009 - Feb. 26 2011.</p> <p>DESCRIPTION: Passenger Car</p> <p>COUNTRY OF ORIGIN: Japan No picture available.</p>	<p>INJURIES The product poses a risk of injuries as the panoramic roof may detach while driving. Two incidents reported in Europe.</p>	<p>Voluntary corrective action taken by the manufacturer.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
EU/IRELAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car RX300/RX400h</p> <p>BRAND: Lexus</p> <p>TYPE/NUMBER OF MODEL</p> <p>Model Code, VIN Range, Production Period: WMI VDS VIS RX300 MCU35 JTJ HF31U# 00026501-02006484</p> <p>1 June 2004 to 31 March 2005.</p> <p>RX400h MHU38 JTJ HW31U# 00001030- 00005147.</p> <p>24 September 2004 to 31 March 2005</p> <p>DESCRIPTION: Passenger Car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available.</p>	<p>INJURIES</p> <p>The belt for the power steering pump may become detached from the pulley which could result in a sudden increase in steering effort and lead to a road accident.</p>	Voluntary corrective action taken by the manufacturer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Scooter "Lead"</p> <p>BRAND: Honda</p> <p>TYPE/NUMBER OF MODEL:</p> <p>Lead EX, model code JF19</p> <p>The recall concerns certain 2010 model year vehicles produced from the 27th January 2010 to the 23rd May 2011, with Type Approval No. e4*2002/24*1792*04.</p> <p>DESCRIPTION: Scooter</p> <p>COUNTRY OF ORIGIN: China</p> <p>No picture available.</p>	<p>INJURIES</p> <p>Corrosion on the front brake lever pivot bolt may result in the front brake dragging and, in the worst case, the front brake locking.</p>	Voluntary corrective action taken by the manufacturer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car "Civic"</p> <p>BRAND: Honda</p> <p>TYPE/NUMBER OF MODEL</p> <p>Civic Type R.</p> <p>The recall concerns 2009 and 2010 model year vehicles, manufactured between 17 July 2009 and 20 August 2010, with VINs from SHHFN23809U002741 to SHHFN23809U002755 or from SHHFN2360AU000491 to SHHFN2360AU002362 and type approval number e11*2001/116*0306*01.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: United Kingdom</p> <p>No picture available.</p>	<p>FIRE</p> <p>Due to its incorrect positioning, it is possible for the wire harness in the engine compartment to be damaged, which could lead to a short circuit and the risk of a fire occurring.</p>	Voluntary corrective action taken by the manufacturer.

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL ford / e-series-2004-2008</p> <p>MANUFACTURER Terex south Dakota, inc.</p> <p>COMPONENT fuel system, gasoline: storage: auxiliary tank</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 5,123</p> <p>SUMMARY Terex telelect is recalling certain model year 1997 through 2009 xt55 aerial devices mounted on trucks. These vehicles are used to elevate personnel to trim trees and for utility work while parked in the work area. Cracks can develop around the lower boom hinge pin boss at the turntable which can progress into failure of the plates if not detected. No picture available.</p>	<p>CONSEQUENCE Failure of the plates will cause unexpected motion of the boom and could cause the platform to fall, resulting in serious injury or death to a person standing on the platform.</p>	<p>REMEDY Terex will notify owners and will repair the vehicles free of charge. The safety recall is expected to begin during November 2100. Owners may contact Terex utilities warranty department at 1-605-884-3892.</p>
USA	<p>VEHICLE MAKE / MODEL ford / e-150-2004-2008 ford / e-250-2004-2008 ford / e-350-2004-2008</p> <p>MANUFACTURER ford motor company</p> <p>COMPONENT fuel system, gasoline: storage: tank assembly</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 17</p> <p>SUMMARY Ford is recalling certain replacement fuel tanks that could be installed into model year 2004 through 2008 e-150, e-250, and e-350 vans and wagons. The affected fuel tanks have an extra obdii sensor hole on the top of the tank that may not be properly sealed and may leak fuel. No picture available.</p>	<p>CONSEQUENCE A fuel leak in the presence of an ignition source may result in a fire.</p>	<p>REMEDY Ford will notify owners, and dealers will replace the fuel tanks free of charge. The safety recall is expected to begin on or about November 28, 2011. Owners may contact ford motor company customer relationship center at 1-800-232-5952.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL molly trolley / molly trolley-2006-2007</p> <p>MANUFACTURER: molly corporation</p> <p>COMPONENT equipment: electrical: air conditioner</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 10</p> <p>SUMMARY Molly is recalling certain model year 2006 and 2007 transit buses built on ford and freightliner chassis and equipped with carrier genv em-1 evaporator units. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing. No picture available.</p>	<p>CONSEQUENCE If sufficient arcing occurs, the fuse holder may melt, and a vehicle fire may occur.</p>	<p>REMEDY Molly will notify owners and provide information on how to obtain the retrofit kit from carrier along with repair instructions. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. (See carrier's recall campaign 11e-003.) Owners may contact carrier at 1-800-793-4741.</p>
USA	<p>VEHICLE MAKE / MODEL lotus / elise-2011</p> <p>MANUFACTURER lotus cars ltd</p> <p>COMPONENT exterior lighting: turn signal: flasher unit</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 52</p> <p>SUMMARY Lotus is recalling certain model year 2011 elise vehicles manufactured from June 2010, through February 2011, for failing to comply with the requirements of federal motor vehicle safety standard number 108, "lamps, reflective devices, and associated equipment." These vehicles were fitted with turn signal modules which were not compatible with the revised front headlight configuration which includes the integral front led turn signal units. The incompatible module may, under certain conditions cause all the led turn signal lamps to flash at an erratic frequency when the hazard warning switch is depressed. In addition, in the event that either a front or rear turn signal lamp fails to illuminate or does not flash at the correct frequency when operated, the remaining functioning signal lamps on that vehicles side as well as the instrument turn tell tale lamp will not flash at an increased rate as intended. No picture available.</p>	<p>CONSEQUENCE The driver will not be visually alerted to the fact that one or more of the vehicles turn signal lamps is not operating correctly, increasing the risk of a crash.</p>	<p>REMEDY Lotus will notify owners, and dealers will replace the turn signal module free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact lotus at 1-800-245-6887.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL tomberlin / avl-2012</p> <p>MANUFACTURER tomberlin automotive group</p> <p>COMPONENT seat belts</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 8</p> <p>SUMMARY Tomberlin automotive group is recalling certain model year 2012 tomlerlin avl low speed vehicles manufactured from June 2011 through September 2011. The seat belt identification tag does not include the date of manufacturer. Accordingly, the seat belts fail to conform to the requirements of federal motor vehicle safety standard no. 500, "low speed vehicles." No picture available.</p>	<p>CONSEQUENCE In the event of a safety issue with the affected seat belts, the vehicle owner may not be able to identify the seat belt if it does not have a date of manufacture.</p>	<p>REMEDY Tomberlin will notify owners and replace the seat belts free of charge. The safety recall is expected to begin during November 2011. Owners may contact tomlerlin at 1-706-860-8880.</p>
USA	<p>VEHICLE MAKE / MODEL chg / cf250t v3-2005-2009 chg / cf250t v5-2005-2009</p> <p>MANUFACTURER cfmoto powersports, inc.</p> <p>COMPONENT service brakes, hydraulic</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 6,405</p> <p>SUMMARY Cfmoto is recalling certain model year 2005 through 2009 cf250t v3, and cf205t v5 automatic motorcycles manufactured from January 1, 2005, through December 31, 2009. These models were built with a left hand rear wheel brake instead of the required right foot operated rear wheel brake. Therefore, these vehicles fail to comply with the requirements of federal motor vehicle safety standard number 123, "motorcycle controls and displays." No picture available.</p>	<p>CONSEQUENCE The absence of standardized motorcycle controls may hinder the operators ability to effectively brake, increasing the risk of a crash.</p>	<p>REMEDY Cfmoto will notify owners, and dealers will install a right foot control rear wheel brake kit free of charge. The safety recall is expected to begin on or before May 1, 2012. Owners may contact cfmoto at 1-888-823-6686.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL infiniti / g37 coupe-2011-2012 Nissan / 370z-2011</p> <p>MANUFACTURER Nissan North America, inc.</p> <p>COMPONENT visibility: power window devices and controls</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,788</p> <p>SUMMARY Nissan is recalling certain model year 2011 and 2012 infiniti g37 coupe vehicles and certain model year 2011 Nissan 370z vehicles manufactured from July 2, 2011, through August 29, 2011. Due to a programming error, the power window switch controller in the subject vehicles was manufactured out of specification. No picture available.</p>	<p>CONSEQUENCE The threshold for auto reverse activation is higher than the nissan specification. Should a body part become trapped by a closing window, a pinch injury may result.</p>	<p>REMEDY Nissan will notify owners, and dealers will replace the power window switches with new ones free of charge. The safety recall is expected to begin on or about November 28, 2011. Owners may contact Nissan at 1800-647-7261 or infiniti at 1-800-662-6200.</p>
USA	<p>VEHICLE MAKE / MODEL Chevrolet / express-2012 gmc / savanna-2012</p> <p>MANUFACTURER general motors llc</p> <p>COMPONENT air bags</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 1,798</p> <p>SUMMARY Gm is recalling certain model year 2012 Chevrolet express and gmc savana vehicles manufactured from June 2, 2011, through October 17, 2011. The second stage of the dual-stage air bag will not inflate in a severe frontal impact. Accordingly, the air bags fail to conform to the requirements of federal motor vehicle safety no. 208, "occupant crash protection." No picture available.</p>	<p>CONSEQUENCE An improperly deployed air bag will increase the risk of injury to the occupant.</p>	<p>REMEDY Gm will notify owners, and dealers will install a new front passenger air bag free of charge. The safety recall is expected to begin during November 2011. Owners may contact gmc at 1-800-462-8782 or chevrolet at 1-800-222-1020.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>hino / nd8j-2012 hino / ne8j-2012 hino / nj8j-2012 hino / nv8j-2012</p> <p>MANUFACTURER</p> <p>hino motors sales U.S.A., inc.</p> <p>COMPONENT</p> <p>power train: axle assembly</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>NA</p> <p>SUMMARY</p> <p>Hino is recalling certain model 2012 nd8j, ne8j, nj8j, and nv8j commercial trucks manufactured from July 25, 2011, through September 16, 2011. During assembly, the wheel-end retainer on the front or rear axle may have been installed incorrectly.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>The wheel-hub and axle shaft can separate from the vehicle, possibly resulting in a crash.</p>	<p>REMEDY</p> <p>The manufacturer is in the process of developing a remedy and a notification schedule for this campaign.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>mci / d4505-2010-2011</p> <p>MANUFACTURER</p> <p>motor coach industries, inc</p> <p>COMPONENT</p> <p>electrical system: alternator/generator/regulator</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>112</p> <p>SUMMARY</p> <p>Motor coach industries (mci) is recalling certain model year 2010-2011 d4505 motor coaches manufactured from May 1, 2010, through September 30, 2011. These vehicles were equipped with penntex alternators that, as installed, may collect moisture at the power stud. This moisture may result in corrosion buildup at and around the power stud base.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This corrosion may create a short circuit between the power stud and the alternator body, which in turn could result in burning of the power stud or the power cable end. This could increase the risk of a fire. Additionally, the vehicle battery could discharge which could cause the vehicle to stall.</p>	<p>REMEDY</p> <p>Mci will inspect and modify the alternator installation free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact mci customer service at 1-800-241-2947.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Winnebago / era-2012</p> <p>MANUFACTURER Winnebago of Indiana, llc</p> <p>COMPONENT suspension: rear: springs</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 3</p> <p>SUMMARY Winnebago is recalling certain model year 2012 era motor homes, manufactured from July 25, 2011, through August 4, 2011 and built on sprinter/Daimler chassis. The supplier of the rear springs rolled the spring eye diameter out of tolerance during production, and then corrected the diameter without heating the parts. This could potentially lead to a crack of the spring eye over time. No picture available.</p>	<p>CONSEQUENCE If a spring eye were to crack, the rear spring could collapse, suddenly upsetting the vehicles handling, which could increase the risk of a crash.</p>	<p>REMEDY Winnebago is working with sprinter/Daimler to notify owners. Sprinter/Daimler is handling the remedy for this campaign, please see 11v-323. Sprinter/Daimler dealers will replace the rear springs as necessary free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact sprinter at 1-877-762-8267.</p>
USA	<p>VEHICLE MAKE / MODEL hme / 1871-2009-2012</p> <p>MANUFACTURER hme incorporated</p> <p>COMPONENT electronic stability control</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 346</p> <p>SUMMARY Hme corporation is recalling certain model year 2009 through 2012 fire trucks manufactured from January 16, 2009, through November 1, 2011, built with Meritor wabco electronic stability control (esc) system manufactured from September 15, 2005 through September 1, 2011, with part numbers 446 065 020 0, 400 850 179 0, 400 850 195 0, 446 065 027 0, and 400 850 185 0. Under certain road and driving conditions, vehicle body roll and road inclination characteristics may adversely affect the slip angle calculation of the electronic stability control (esc) system. This might cause the esc to perceive an over steering situation and therefore apply the outer wheel brake on the front axle until the vehicle is perceived to be stable. No picture available.</p>	<p>CONSEQUENCE If the driver is slow to react during this esc intervention, the vehicle may deviate from the intended line of travel, increasing the risk of a crash.</p>	<p>REMEDY Hme will notify owners and replace the control module free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact hme at 1-616-534-1463.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Tiffin / allegro-2011 Tiffin / phaeton-2011</p> <p>MANUFACTURER Tiffin motorhomes, inc.</p> <p>COMPONENT engine and engine cooling</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 279</p> <p>SUMMARY Tiffin motorhomes, inc. (Tiffin) is recalling certain model year 2011 allegro and phaeton recreational vehicles built on freightliner chassis and equipped with a Cummins isc, isx, ism, or isl diesel engine. The v-band clamp assembly, part numbers q187684, q187685, and q187686, used to connect the inlet and outlet cone sections to the diesel oxidation catalyst (doc)/diesel particulate filter (dpf) include a t-bolt which can fracture and fail when subjected to stress or load. A fracture or failure of the t-bolt may cause the clamp to loosen and the inlet or outlet sections attached to the doc/dpf housing to disconnect. No picture available.</p>	<p>CONSEQUENCE If the inlet or outlet sections disconnect, hot exhaust gases can vent prior to exiting the tailpipe, creating the risk of combustion and a fire. If both clamps fail, there is a risk in some applications that the doc/dpf housing may detach completely, creating a road hazard.</p>	<p>REMEDY Tiffin is working with Cummins to identify and notify owners of the recall campaign. Repairs will be performed by authorized Cummins dealers free of charge. The safety recall began October 10, 2011. Owners may contact Cummins at 1-812-377-5000 or Tiffin at 1-256-356-8661.</p>
USA	<p>VEHICLE MAKE / MODEL startrans / mfsab-2007-2011</p> <p>MANUFACTURER startrans bus corporation</p> <p>COMPONENT structure: body: door</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 436</p> <p>SUMMARY Startrans is recalling certain model year 2005 through 2011 model mfsab school activity buses. The rear door emergency exit is partially blocked by the bus seats. Accordingly, these buses fail to conform to the requirements of federal motor vehicle safety standard no. 217, "bus emergency exits and window retention and release." No picture available.</p>	<p>CONSEQUENCE Egress from the bus may be hindered in the event of an emergency, increasing the risk of injury to the bus occupants.</p>	<p>REMEDY Startrans will notify owners, and dealers will repair the buses free of charge. The safety recall is expected to begin during November 2011. Owners may contact startrans at 1-574-642-0811.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>pierce / arrow xt-2005 2008 2010</p> <p>pierce / custom contender-2010-2011</p> <p>pierce / dash-2005</p> <p>pierce / enforcer-2005</p> <p>pierce / impel-2005 2009-2011</p> <p>pierce / quantum-2005 2010-2011</p> <p>pierce / saber-2011</p> <p>pierce / velocity-2010-2011</p> <p>MANUFACTURER</p> <p>pierce manufacturing</p> <p>COMPONENT</p> <p>structure: body: door</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>59</p> <p>SUMMARY</p> <p>Pierce manufacturing (pierce) is recalling certain model year 2005, 2008-2011 arrow xt, custom contender, dash, enforcer, impel, quantum, saber, and velocity 75 foot hal (heavy aluminum ladder) fire apparatus bodies vehicles manufactured from May 17,2005, through October 13, 2011, that may be equipped with dual scba cylinder storage compartments. These compartments extend inboard horizontally from the side of the rear body. The scba compartment door latch orientation may have been manufactured incorrectly, allowing the door to accidentally open while the vehicle is in motion. The door may open without warning and without knowledge to the driver.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>If the door opens, the scba cylinders may fall out of the compartment and onto the roadway, increasing the risk of a crash or injury to pedestrians.</p>	<p>REMEDY</p> <p>Pierce dealers will notify owners, and will install a flat reinforcement plate that spans the length of the scba door. This service will be performed free of charge. The safety recall is expected to begin on or before December 5, 2011. Owners may contact pierce at 1-920-832-3000.</p>
USA	<p>VEHICLE MAKE / MODEL</p> <p>hino / ne8j-2012</p> <p>MANUFACTURER</p> <p>hino motors sales U.S.A., inc.</p> <p>COMPONENT</p> <p>steering</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>37</p> <p>SUMMARY</p> <p>Hino motors is recalling certain model year 2012 ne8j trucks. During the assembly process, the steering attachment bolts may have been insufficiently torqued.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Insufficient torque of the steering arm bolts may result in bolt fatigue and fracture and/or arm separation, thereby potentially resulting in loss of steering control, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>The manufacturer is in the process of developing a remedy and a notification schedule for this campaign.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL jayco / eagle super lite-2012 jayco / jay flight-2012</p> <p>MANUFACTURER jayco, inc.</p> <p>COMPONENT equipment: electrical</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 80</p> <p>SUMMARY Jayco is recalling certain model year 2012 jay flight and eagle super lite ½ ton travel trailers manufactured from October 6, 2011, through October 17, 2011. The power converters may have been built with an undersized input coil, which may cause overheating, smoking, and melting of the converter. No picture available.</p>	<p>CONSEQUENCE This could result in a fire, injury or death.</p>	<p>REMEDY Jayco will notify owners, and jayco dealers will repair the travel trailers as necessary free of charge. The safety recall is expected to begin during December 2011. Owners may contact jayco at 1-800-283-8267.</p>
USA	<p>VEHICLE MAKE / MODEL dodge / journey-2012 fiat / 500-2012</p> <p>MANUFACTURER Chrysler group llc</p> <p>COMPONENT service brakes, hydraulic: fluid</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 340</p> <p>SUMMARY Chrysler is recalling certain model year 2012 dodge journey and fiat 500 vehicles manufactured from October 24, 2011, through October 26, 2011. Some vehicles were assembled with contaminated brake fluid and may experience a degradation of the sealing components within the brake system. No picture available.</p>	<p>CONSEQUENCE This could lead to loss of braking ability increasing the risk of a crash.</p>	<p>REMEDY Chrysler will notify owners and replace all brake components that come in contact with hydraulic brake fluid. This service will be performed free of charge. The safety recall is expected to begin during December 2011. Owners may contact Chrysler at 1-800-853-1403.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL Chevrolet / Colorado-2012 gmc / canyon-2012</p> <p>MANUFACTURER general motors llc</p> <p>COMPONENT seat belts: front</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 5,220</p> <p>SUMMARY General motors (GM) is recalling certain model year 2012 Chevrolet Colorado and gmc canyon vehicles, manufactured from September 9, 2011, through October 19, 2011, for failing to comply with the requirements of federal motor vehicle safety standard number 208, "occupant crash protection." These vehicles may have been produced with driver safety belt buckle electrical connector terminals that do not fit snugly with the connector pins, causing the connection to be intermittent. No picture available.</p>	<p>CONSEQUENCE The loose connections may cause the driver to not receive a visual or audible warning that the driver seat belt is not fastened, thereby increasing the risk of personal injury in the event of a crash.</p>	<p>REMEDY GM will notify owners and dealers will replace the seat belt buckle electrical connector terminals free of charge. The safety recall is expected to begin on or before November 30, 2011. Owners may contact Chevrolet at 1-800-630-2438 and gmc at 1-866-996-9463.</p>
USA	<p>VEHICLE MAKE / MODEL starcraft / autumn ridge-2012 starcraft / travel star-2012</p> <p>MANUFACTURER starcraft rv, inc.</p> <p>COMPONENT equipment: electrical</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 9</p> <p>SUMMARY Starcraft is recalling certain model year 2012 autumn ridge and travel star travel trailers manufactured from October 6, 2011, through October 17, 2011. The power converters may have been built with an undersized input coil, which may cause overheating, smoking, and melting of the converter. No picture available.</p>	<p>CONSEQUENCE This could result in a fire, injury or death.</p>	<p>REMEDY Starcraft will notify owners, and starcraft dealers will repair the travel trailers as necessary, free of charge. The safety recall is expected to begin during December 2011. Owners may contact starcraft at 1-800-945-4787.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL</p> <p>beaver coach / contessa-2009-2010 beaver coach / marquis-2009 beaver coach / patriot-2009 holiday rambler / ambassador-2011 holiday rambler / endeavour-2011 holiday rambler / imperial-2009-2010 holiday rambler / navigator-2009-2011 holiday rambler / Neptune-2011 holiday rambler / sceptre-2010-2011 holiday rambler / trip-2011 Monaco / Camelot-2010-2011 Monaco coach / cayman-2011 Monaco coach / diplomat-2011 Monaco coach / dynasty-2009-2011 Monaco coach / knight-2011 Monaco coach / signature-2009-2011 Monaco coach / vesta-2011</p> <p>MANUFACTURER</p> <p>Navistar, inc</p> <p>COMPONENT</p> <p>visibility: windshield</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED</p> <p>630</p> <p>SUMMARY</p> <p>Navistar is recalling certain model year 2009-2011 beaver, holiday rambler and Monaco coach brand recreational vehicles manufactured from January 11, 2008, through April 15, 2011. See the above list for models. The front windshield shade may separate from the cabin body without warning, possibly impairing the driver's ability to see the roadway.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An impairment to a driver's ability to see the roadway could cause a vehicle crash potentially resulting in property damage, personal injury, or death.</p>	<p>REMEDY</p> <p>Navistar will notify owners, and dealers will inspect the shade mounting clips and repair the vehicles as necessary free of charge. The safety recall is expected to begin December 10, 2011. Owners may contact Navistar at 1-877-466-6226.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. Meritor / mfs-08</p> <p>MANUFACTURER Meritor, inc</p> <p>COMPONENT steering: column</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 162</p> <p>SUMMARY Meritor is recalling certain mfs-08 series non-drive front axles sold as original equipment to be installed on various heavy trucks. During the assembly process, the steering attachment bolts may have been insufficiently torqued. No picture available.</p>	<p>CONSEQUENCE Insufficient torque of the steering arm bolts may result in bolt fatigue and fracture and/or arm separation, thereby potentially resulting in loss of steering control, increasing the risk of a crash.</p>	<p>REMEDY Meritor is in the process of developing the notice and accompanying service instructions. The safety recall is expected to begin during November 2011. Owners may contact Meritor at 1-800-535-5560 or their vehicle manufacturer.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO. ford / service fuel tank</p> <p>MANUFACTURER ford motor company</p> <p>COMPONENT fuel system, gasoline: storage: tank assembly</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED 17</p> <p>SUMMARY Ford is recalling certain replacement fuel tanks that could be installed into model year 2004 through 2008 e-150, e-250, and e-350 vans and wagons. The affected fuel tanks have an extra obdii sensor hole on the top of the tank that may not be properly sealed and may leak fuel. No picture available.</p>	<p>CONSEQUENCE A fuel leak in the presence of an ignition source may result in a fire.</p>	<p>REMEDY Ford will notify owners, and dealers will replace the fuel tanks free of charge. The safety recall is expected to begin on or about November 28, 2011. Owners may contact ford motor company customer relationship center at 1-800-232-5952.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2011 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

