

PRODUCT RECALLS

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 31 MAY 2013

CONTENTS

AUTOMOTIVE

Pages 1 to 22



[Motor Vehicle \(34\)](#)

[Child Safety Seat \(1\)](#)

[Motor Vehicle Equipment \(3\)](#)

Please note that from November 2012 on, product recall notifications can be searched on line in several countries via the Global portal on product recalls hosted by the Organisation for Economic Co-operation and Development (OECD). You can access the OECD site by using the following [link](#).

SGS

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL MACK/CHU-2013-2014 MACK/CXU-2013-2014 MACK/GU-2013-2014 MACK/LEU-2013-2014 MACK/MRU-2013-2014</p> <p>MANUFACTURER MACK TRUCKS, INC.</p> <p>COMPONENT SERVICE BRAKES</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 5,023</p> <p>SUMMARY Mack Trucks, Inc. is recalling certain model year 2013-2014 CHU, CXU, GU, MRU, and LEU trucks manufactured July 16, 2012, through march 18, 2013 and equipped with drum brakes. The clevis pin for the brake slack adjuster may be missing a cotter pin. If the cotter pin is not installed, the clevis pin may loosen and fall out causing a loss of brake function on the affected wheel.</p> <p>No picture available.</p>	<p>CONSEQUENCE A loss of brake function at one wheel will lead to increased stopping distances and pulling to the left or right when braking, which may increase the risk of a crash.</p>	<p>REMEDY Mack Trucks, Inc. will notify owners, and dealers will inspect the brake slack adjusters and install the brake hardware, as necessary, free of charge. The recall is expected to begin on, or before, June 17, 2013. Owners may contact Mack Trucks at 1-800-528-6586. Mack Trucks' recall campaign number is SC0370.</p>
USA	<p>VEHICLE MAKE/MODEL ALFA ROMEO/8C-2008 MASERATI/GRANTURISMO-2008 MASERATI/QUATTROPORTE-2005-2008</p> <p>MANUFACTURER MASERATI NORTH AMERICA, INC.</p> <p>COMPONENT SUSPENSION</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 7,438</p> <p>SUMMARY Maserati North America, Inc. (Maserati) is recalling certain model year 2005-2008 Quattroporte, 2008 Granturismo, and 2008 Alfa Romeo 8C vehicles. The rear tie rod assemblies may have insufficient anti-corrosion material applied, allowing them to weaken and possibly fail.</p> <p>No picture available.</p>	<p>CONSEQUENCE Failure of the tie rods may result in a loss of vehicle control and increase the risk of a crash.</p>	<p>REMEDY Maserati will notify owners and dealers will replace the tie rod assemblies. The recall is expected to begin by the end of June 2013. Customers may contact Maserati at 1-877-696-2737. Maserati's recall campaign number is 205.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL GULF STREAM/CAVALIER-2001 GULF STREAM/CONQUEST-2001 GULF STREAM/INDEPENDENCE-2001 GULF STREAM/ULTRA-2001 GULF STREAM/ULTRA SUPREME-2001 GULF STREAM/YELLOWSTONE-2001</p> <p>MANUFACTURER GULF STREAM COACH, INC.</p> <p>COMPONENT ELECTRICAL SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 126</p> <p>SUMMARY Gulf Stream Coach is recalling certain model year 2001 Ultra, Conquest, Independence, Ultra Supreme, Yellowstone, and Cavalier motorhomes with floorplans 6316 or 8325. The motorhomes were manufactured May 17, 2000, through December 31, 2000. A portion of the electrical wiring may not be properly secured. This condition may cause wear and possible heat development between the refrigerator coils and the wire. No picture available.</p>	<p>CONSEQUENCE A failure of the wiring could result in property damage, fire, or injury.</p>	<p>REMEDY Gulf Stream will notify owners, and dealers will repair the motorhomes free of charge. The recall is expected to begin by May 30, 2013. Owners may contact Gulf Stream at 1-800-289-8787. Gulf Stream's recall campaign number is 13WG-2000.</p>
USA	<p>VEHICLE MAKE/MODEL STARCRAFT/ALLSTAR-2006-2012</p> <p>MANUFACTURER STARCRAFT BUS</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 169</p> <p>SUMMARY Starcraft Bus is recalling certain model year 2006-2012 Allstar buses manufactured November 2006, through July 2012. The affected buses are equipped with a Ricon manufactured wheelchair lift which may have an optional armored pendant cable. The cable may have been installed such that it doesn't clear the wheelchair lift and without a protective cover, or a misinstalled protective cover. No picture available.</p>	<p>CONSEQUENCE If the cable does not clear the wheelchair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire.</p>	<p>REMEDY Starcraft will notify owners and direct them to contact Ricon. Ricon will provide a supplemental cover kit with instructions, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Starcraft at 1-800-348-7440 or Ricon at 1-818-267-3000. Starcraft's recall campaign number is 12E-017.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL TEREX/AERIAL DEVICES-2012-2013 TEREX/DIGGER DERRICK-2012-2013</p> <p>MANUFACTURER TEREX SOUTH DAKOTA, INC.</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 118</p> <p>SUMMARY Terex is recalling certain model year 2012-2013 Aerial Devices and Digger Derricks manufactured September 2012 through February 2013. The lock valve cavity in the outrigger cylinder may be machined incorrectly and the seals may be damaged. No picture available.</p>	<p>CONSEQUENCE Damaged seals may allow the outrigger to drift. If the outrigger cylinder drifts, stability may be affected and the unit may overturn, increasing the risk of injury.</p>	<p>REMEDY Terex will notify owners, and dealers will inspect the affected outriggers to determine if they were machined correctly. The inspection and any necessary repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex at 1-605-884-3892. Terex's recall campaign number is SN607.</p>
USA	<p>VEHICLE MAKE/MODEL GULF STREAM/CANYON TRAIL-2013 GULF STREAM/KINGSPORT-2013 GULF STREAM/SEDONA-2013 GULF STREAM/TRAIL MASTER-2013</p> <p>MANUFACTURER GULF STREAM COACH, INC.</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 27</p> <p>SUMMARY Gulf Stream Coach, Inc. is recalling certain model year 2013 Canyon Trail, Sedona, Ridgeline, Kingsport, and Trail Master recreational vehicle trailers manufactured February 13, 2013, through April 24, 2013. The vehicles are equipped with Weatherpro and 9100 series power awnings. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. No picture available.</p>	<p>CONSEQUENCE If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.</p>	<p>REMEDY Gulf Stream will notify owners and Dometic staff will replace the affected motors with motors of a different design. Gulf Stream has not yet provided a notification schedule. Owners may contact Gulf Stream at 1-574-773-7761 or Dometic at 1-888-447-0003 for more information. Gulf Stream Coach's recall number for this campaign is 13AW-0204. Owners are being instructed not to drive their vehicle until repairs can be performed.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL BLUE BIRD/ALL AMERICAN-2010-2014 BLUE BIRD/VISION-2010-2014</p> <p>MANUFACTURER BLUE BIRD BODY COMPANY</p> <p>COMPONENT SEATS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 441</p> <p>SUMMARY Blue Bird is recalling certain model year 2010 through 2014 All American and Vision model school buses manufactured from August 25, 2009, through March 19, 2013, and equipped with C. E. White Inc. Flip Seats models Quasi Static "QSJ11" (30", 36", 39" and 45"), Student Safety Seat "SSSJ" (30", 36", 39" and 45"), or School Bus Seat "SBJ" (30", 36", 39" and 45"). No picture available.</p>	<p>CONSEQUENCE When a Flip Seat is installed in front of another passenger seat, it is possible for the occupant of the rearward passenger seat to insert their toes and/or foot into the lower frame area of the Flip Seat. When a vehicle passenger occupies the Flip Seat, pushing the seat bottom downward to the horizontal position to sit in the seat, the occupant of the rearward seat could suffer a pinch point injury to their toes and/or foot.</p>	<p>REMEDY Blue Bird will notify owners, and dealers will install a safety guard to prevent passengers from placing their toes or feet in the opening on the back of the subject Flip Seats, free of charge. The recall is expected to begin on, or about, June 13, 2013. Owners may contact Blue Bird at 1-478-822-2242 for more information. Blue Bird's number for this campaign is R13WF.</p>
USA	<p>VEHICLE MAKE/MODEL CHEETAHCH/ASSIS/TRAILER-2013-2014 JOHN EVANS/CHASSIS/TRAILER-2013-2014 JOHN EVANS/RMFD CHASSIS/TRAILER-2013-2014</p> <p>MANUFACTURER JOHN EVANS MANUFACTURING CO.</p> <p>COMPONENT WHEELS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 380</p> <p>SUMMARY John Evans Manufacturing Co. (John Evans) is recalling certain model year 2013-2014 chassis and trailers; model year 2013-2014 remanufactured chassis and trailers, and model year 2013-2014 Cheetah Chassis and trailers. The affected products were manufactured September 5, 2012, through April 19, 2013. The wheel lug nuts may not be properly torqued. No picture available.</p>	<p>CONSEQUENCE Insufficient torque on the wheel lug nuts could lead to separation of the wheels from the chassis or trailer, which may increase the risk of a crash.</p>	<p>REMEDY John Evans will notify owners, and dealers will inspect each trailer. The affected trailers will have the lug nuts re-torqued, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact John Evans customer service at 1-803-436-3102.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL CADILLAC/SRX-2013</p> <p>MANUFACTURER GENERAL MOTORS LLC</p> <p>COMPONENT WHEELS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 18,871</p> <p>SUMMARY General Motors (GM) is recalling certain model year 2013 Cadillac SRX vehicles, manufactured January 31, 2012, through March 18, 2013, and equipped with 18 inch wheels. On the affected vehicles, the wheel lug nuts may loosen. No picture available.</p>	<p>CONSEQUENCE If the lug nuts loosen, they may fall off or cause the wheel studs to fracture. Either condition would allow the wheel to separate from the vehicle, increasing the risk of a crash.</p>	<p>REMEDY GM will notify owners, and dealers will remove and reinstall the wheel nuts by performing a tire rotation, free of charge. The recall is expected to begin by June 3, 2013. Owners may contact GM at 1-800-521-7300. GM's recall campaign number is 13116.</p>
USA	<p>VEHICLE MAKE/MODEL FERRARA-IGNITER2011-2012 FERRARA-ULTRA2011-2012</p> <p>MANUFACTURER FERRARA FIRE APPARATUS, INC</p> <p>COMPONENT PARKING BRAKE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 202</p> <p>SUMMARY Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2011-2012 Igniter and Ultra firetrucks. These vehicles are equipped with Meritor axle assemblies that were built with disc brakes using MGM J24 series air brake chambers. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. No picture available.</p>	<p>CONSEQUENCE Overheated brake components could result in a fire.</p>	<p>REMEDY Ferrara has notified all affected owners and has replaced all of the affected brake chambers. Owners may contact Ferrara at 1-800-443-9006.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL ISUZU/N-SERIES-2013</p> <p>MANUFACTURER ISUZU MANUFACTURING SERVICES OF AMERICA</p> <p>COMPONENT POWER TRAIN</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 196</p> <p>SUMMARY Isuzu Manufacturing Services of America, Inc. (Isuzu) is recalling certain model year 2013 N-Series trucks manufactured March 8, 2012, through April 26, 2012 and equipped with an automatic transmission. Due to a manufacturing change, the transmission retaining ring may dislodge from the clutch drum. No picture available.</p>	<p>CONSEQUENCE If the ring dislodges while the vehicle is in motion, the vehicle may lose forward driving power and become stalled, increasing the risk of a crash.</p>	<p>REMEDY Isuzu will notify owners, and dealers will replace the affected transmissions, free of charge. The recall is expected to begin June in 2013. Customers may contact Isuzu Customer service at 1-866-441-9638.</p>
USA	<p>VEHICLE MAKE/MODEL TRIUMPH/SPEED TRIPLE-2012-2013</p> <p>MANUFACTURER TRIUMPH MOTORCYCLES AMERICA, LTD</p> <p>COMPONENT POWER TRAIN</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 279</p> <p>SUMMARY Triumph Motorcycles (Triumph) is recalling certain model year 2012-2013 Speed Triple motorcycles manufactured June 2012 through January 2013. Due to the incorrect engagement of the neutral switch and gear selector drum, the neutral light may remain illuminated despite the motorcycle actually being in gear. No picture available.</p>	<p>CONSEQUENCE The operator may think the motorcycle is in neutral while the motorcycle is in gear. This could lead to unintended movement of the motorcycle and a possible crash.</p>	<p>REMEDY Triumph will notify owners, and dealers will correct the engagement of the neutral switch and gear selector drum, free of charge. The recall is expected to begin by the end of May 2013. Owners may contact Triumph at 1-678-854-2010 for more information.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE/MODEL CARGO MATE/ELIMINATOR-2013-2014 COACHMEN/BROOKSTONE-2013-2014 COACHMEN/CATALINA-2013-2014 COACHMEN/CHAPARRAL-2013-2014 COACHMEN/CONCORD-2013-2014 COACHMEN/ENCOUNTER-2013-2014 COACHMEN/FREEDOM EXPRESS-2013-2014 COACHMEN/FREELANDER-2013-2014 COACHMEN/LEPRECHAUN-2013-2014 COACHMEN/MIRADA-2013-2014 COACHMEN/PURSUIT-2013-2014 COACHMEN/SPORTCOACH-2013-2014 FOREST RIVER/BLUE RIDGE-2013-2014 FOREST RIVER/CARDINAL-2013-2014 FOREST RIVER/CHEROKEE-2013-2014 FOREST RIVER/COLUMBUS-2013-2014 FOREST RIVER/EVO-2013-2014 FOREST RIVER/FLAGSTAFF-2013-2014 FOREST RIVER/FORESTER-2013-2014 FOREST RIVER/GEORGETOWN-2013-2014 FOREST RIVER/LEXINGTON-2013-2014 FOREST RIVER/PUMA-2013-2014 FOREST RIVER/ROCKWOOD-2013-2014 FOREST RIVER/SABRE-2013-2014 FOREST RIVER/SALEM-2013-2014 FOREST RIVER/SANDPIPER-2013-2014 FOREST RIVER/SANDSTORM-2013-2014 FOREST RIVER/SIERRA-2013-2014 FOREST RIVER/STEALTH-2013-2014 FOREST RIVER/SUNSEEKER-2013-2014 FOREST RIVER/WILDCAT-2013-2014 FOREST RIVER/WILDWOOD-2013-2014 FOREST RIVER/WORK AND PLAY-2013-2014 FOREST RIVER/XLR-2013-2014 PALOMINO/MAVERICK TRUCK CAMPER-2013-2014 PRIME TIME/AVENGER-2013-2014 PRIME TIME/CRUSADER-2013-2014 <i>to be continue</i>	CONSEQUENCE If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash.	REMEDY Forest River will notify owners and Dometic staff will replace the affected motors with motors of a different design. A notification schedule has not yet been provided. Owners may contact Forest River at 1-574-389-4600 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
	<p><i>Continue</i></p> <p>PRIME TIME/LACROSSE-2013-2014 PRIME TIME/SANIBER-2013-2014 PRIME TIMET/RACER-2013-2014 SHASTA/PHOENIX-2013-2014 SHASTA/REVERE-2013-2014</p> <p>MANUFACTURER FOREST RIVER, INC.</p> <p>COMPONENT EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 9,526</p> <p>SUMMARY Forest River is recalling certain model year 2013-2014 Forest River models Blue Ridge, Cardinal, Cherokee, Columbus, EVO, Georgetown, Flagstaff, Forester, Lexington, Puma, Rockwood, Sabre, Salem, Sandpiper, Sandstorm, Sierra, Stealth, Sunseeker, Wildcat, Wildwood, Work and Play and XLR; Coachmen models Brookstone, Catalina, Chaparral, Concord, Encounter, Freedom Express, Frelander, Leprechaun, Mirada, Pursuit, and Sportcoach; Prime Time models Avenger, Crusader, Lacrosse, Saniber, and Tracer; Palomino model Maverick Truck Camper; Cargo Mate model Eliminator and Shasta models Revere, Phoenix recreational vehicles manufactured from February 13, 2013, through April 18, 2013. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear.</p> <p>No picture available.</p>		

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL BRAMMO/EMPULSE-2013</p> <p>MANUFACTURER BRAMMO, INC.</p> <p>COMPONENT ELECTRICAL SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 5</p> <p>SUMMARY Brammo, Inc. is recalling certain model year 2013 Empulse electric motorcycles manufactured February 22, 2013, through March 29, 2013. Due to a high current cable being attached to the motor controller incorrectly, electrical shorting can occur. No picture available.</p>	<p>CONSEQUENCE An electrical short can cause a complete loss of power while riding the motorcycle or a fire, either of which can result in a vehicle crash or personal injury.</p>	<p>REMEDY Brammo will notify owners, and technicians will inspect the high current cable at the motor controller and correct its installation, if needed. The manufacturer has not yet provided a notification schedule. Customers may contact Brammo at 1-541-482-9555.</p>
USA	<p>VEHICLE MAKE/MODEL ELITE/LIVESTOCK TRAILER-2012</p> <p>MANUFACTURER ELITE TRAILER MANUFACTURING, LLC</p> <p>COMPONENT SERVICE BRAKES, HYDRAULIC</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 9</p> <p>SUMMARY Elite Trailer Manufacturing is recalling certain model year 2012 Livestock Gooseneck trailers manufactured November 17, 2011, through January 17, 2012. These vehicles are equipped with Carlisle hydraulic brake actuators. One of the rotating components in the hydraulic brake pump missed a heat treating operation causing the actuator to wear at a higher than normal rate. As a result, the hydraulic pump could fail and result in a loss of braking ability in the trailer. No picture available.</p>	<p>CONSEQUENCE Loss of braking ability can lead to loss of control of the trailer, increasing the risk of a crash, serious injuries, or property damage.</p>	<p>REMEDY Elite Trailer has notified all affected owners and dealers have replaced all of the defective actuators. Owners may contact Elite Trailer at 1-800-657-7305.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE/MODEL PIERCE/DASH CF-2007-2013 PIERCE/IMPEL-2007-2013 PIERCE/VELOCITY-2007-2013</p> <p>MANUFACTURER PIERCE MANUFACTURING</p> <p>COMPONENT STRUCTURE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1,965</p> <p>SUMMARY Pierce Manufacturing Inc. (Pierce) is recalling certain model year 2007-2013 Velocity, Impel, and Dash CF emergency vehicles manufactured June 6, 2007, through May 17, 2013. The springs in the outer door handles are not of sufficient stiffness to prevent inadvertent door opening in certain impacts. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 206, "Door Locks and Door Retention Components." No picture available.</p>	<p>CONSEQUENCE In the event of a crash, the weak springs may allow the door to open and possibly fail to contain emergency personnel or equipment, increasing the risk of injury.</p>	<p>REMEDY Pierce will notify owners, and dealers will replace the door latch spring with a stiffer one, free of charge. Owners may contact Pierce at 1-920-832-3000. The manufacturer has not yet provided a notification schedule. Pierce's recall number is 74B242.</p>
USA	<p>VEHICLE MAKE/MODEL BOSCH/MASTER CYLINDER -07/01/2011 - 04/12/2012</p> <p>MANUFACTURER CENTRIC PARTS</p> <p>COMPONENT SERVICE BRAKES, HYDRAULIC</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 240</p> <p>SUMMARY Centric Parts is recalling certain Hydro-Mar master cylinders manufactured by Bosch from July 1, 2011 through April 12, 2012. The master cylinders are equipped with a 2.0 bore and 84 cubic inch reservoir containing a fluid level indication switch and without a differential pressure switch. The brake fluid level indicator (FLI) may not properly detect a low brake fluid level situation and warn the driver. No picture available.</p>	<p>CONSEQUENCE If the brake system develops an external leak, it may result in a loss of brake fluid below the detection level of the fluid indicator switch. Without a warning, the driver may be unaware that the brake fluid level is low. A low brake fluid level may reduce the available braking force which could lengthen the required stopping distance and increase the risk of a crash.</p>	<p>REMEDY Centric Parts is working with Bosch to notify owners and Bosch will replace the fluid level indicator switch free of charge. The manufacturer has not provided a notification schedule. Owners may contact Centric Parts at 1-626-961-5775.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Competition/Closed Course and Enduro Motorcycles</p> <p>UNITS: About 7,000</p> <p>DESCRIPTION The recall includes 13 models of KTM and Husaberg brand competition/closed-course and off-road motorcycles. Eleven 2013 KTM models are being recalled: 85 SX, 85 SXS, 125 SX, 150 SX, 150 XC, 200 XC-W, 250 SX, 250 XC, 250 XC-W, 300 XC and 300 XC-W. Two 2012 and 2013 Husaberg models are being recalled: TE 250 and TE 300. The model number is printed on the rear fender on both sides of the motorcycles below the tail end of the seat. The KTM motorcycles are black and orange and KTM is printed on the front number plate and on both sides of the shrouds covering the fuel tank. The Husaberg motorcycles are blue, yellow and white with Husaberg printed on both sides of the shrouds covering the fuel tank. Consumers can identify the model year by checking the letter in the 10th position of the vehicle identification number (VIN) on the right side of the steering head. The letter "C" is a 2012 model; "D" is a 2013 model.</p> <p>IMPORTER KTM North America Inc., of Amherst, Ohio</p> <p>MANUFACTURED IN: Austria</p> 	<p>HAZARD: During use, the throttle cable can malfunction and result in an uncontrollable throttle. This poses a crash hazard to the rider.</p> <p>INCIDENTS/INJURIES None reported</p>	<p>Consumers should immediately stop using the recalled KTM and Husaberg motorcycles and contact a KTM or Husaberg authorized dealer to schedule a free repair.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Rolls-Royce Motor Cars Ltd—Rolls-Royce Ghost, Model Year 2013 only</p> <p>PRODUCT DESCRIPTION</p> <p>Standard Wheel Base Sedan Extended Wheel Base Sedan</p> <p>IDENTIFYING FEATURES</p> <p>RR4, DUHxxxxx, 42248</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Both authorised Rolls-Royce Motor Car dealers – Sydney & Melbourne</p> <p>SUPPLIER</p> <p>Rolls-Royce Motor Cars Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.rolls-roycemotorcars.com</p> <p>No pictures are available.</p>	<p>DEFECTS</p> <p>A selection of Rolls-Royce Ghost models have been identified as having an incorrect software installation, possibly resulting in the fuel tank ventilation system being deactivated.</p> <p>HAZARDS</p> <p>The active carbon filter in the fuel system may not be working as it should, possibly leading to fuel vapours (which are potentially hazardous) being emitted from the system.</p>	<p>Visit your Rolls-Royce dealership to enable Rolls-Royce technicians to carry out the work.</p>
AUSTRALIA	<p>Hino Motor Sales Australia Pty Ltd—RB8 Tow Bar Flexible Coupling Kit</p> <p>PRODUCT DESCRIPTION</p> <p>Chiron/UBC RB8 buses</p> <p>IDENTIFYING FEATURES</p> <p>Recall campaign: RCH1004</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Chiron/UBC dealers</p> <p>SUPPLIER</p> <p>Hino Motor Sales Australia Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> <p>No pictures are available.</p>	<p>DEFECTS</p> <p>The brackets that attach the tow bar to the chassis may crack.</p> <p>HAZARDS</p> <p>In the worst case scenario, the tow bar could become detached from the bus and pose a hazard to the bus occupants and other road users.</p>	<p>All owners of affected vehicles will be contacted individually by letter. For further information contact your local Hino dealer.</p>
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Mercedes-Benz</p> <p>NAME: GL350, GL450, GL500, GL63 AMG</p> <p>TYPE/NUMBER OF MODEL: Type: 166, 166 AMG EC type-approval numbers: e1*2007/46*0598*04, e1*2007/46*0826*00</p> <p>Batch number/Barcode: Not applicable</p> <p>DESCRIPTION: Year of manufacture is 2012.</p> <p>COUNTRY OF ORIGIN: United States</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the second-row seat belt anchor fitting bolts may not be properly torqued. The anchor bolts may thus continue to loosen through vibration caused by driving and therefore may not withstand the strain.</p>	<p>Voluntary measures: Recall of the product from end users</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Volvo Group Australia Pty Ltd—UD Trucks Allison 3000 Oil Cooler Hoses</p> <p>PRODUCT DESCRIPTION</p> <p>Condor PK UD trucks with Allison 3000RDS automatic series transmissions</p> <p>IDENTIFYING FEATURES</p> <p>Recall: K751</p> <p>Target no. 194</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Unknown</p> <p>SUPPLIER</p> <p>Volvo Group Australia Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> <p>No pictures are available.</p>	<p>DEFECTS</p> <p>The snap-ring connecting the oil hose at the transmission oil cooler may be missing.</p> <p>HAZARDS</p> <p>If the snap-ring is missing, oil may leak onto the road and pose a hazard to other road users.</p>	<p>A letter is being sent to affected owners.</p> <p>Should you have any further enquiries or need to locate the closest dealership, please contact Yasmin Cronin on (07) 3718 3332.</p>
AUSTRALIA	<p>Aston Martin Lagonda Limited—V8, DB9, Virage, Rapide S, V12 Vantage Sports Cars</p> <p>PRODUCT DESCRIPTION</p> <p>V8, DB9, Virage, Rapide S, V12 Vantage sports cars</p> <p>IDENTIFYING FEATURES</p> <p>Unknown</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Aston Martin Melbourne / Aston Martin Sydney / Solitaire Aston Martin Adelaide / Barbagallo Aston Martin / Sunshine Aston Martin</p> <p>SUPPLIER</p> <p>Aston Martin Lagonda Limited</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.astonmartin.com</p> <p>No pictures are available.</p>	<p>DEFECTS</p> <p>It is possible that the throttle pedal lever may fracture.</p> <p>HAZARDS</p> <p>If the throttle lever fractures, the throttle will return to the idle position. The loss of throttle function may pose a hazard to the driver and other road users.</p>	<p>A letter is being sent to affected consumers. Owners should contact their local Aston Martin dealer.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Jayco Corporation Pty Ltd—Selected Jayco Caravan Models</p> <p>PRODUCT DESCRIPTION</p> <p>Jayco caravans</p> <p>IDENTIFYING FEATURES</p> <p>Selected chassis numbers between R42040 & R80230</p> <p>Target number: 519</p> <p>Campaign number: JC0037</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Jayco dealers</p> <p>SUPPLIER</p> <p>Jayco Corporation Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.jayco.com.au/</p> <p>No pictures are available.</p>	<p>DEFECTS</p> <p>The handbrake handle may not fully engage.</p> <p>HAZARDS</p> <p>If the defect occurs, the van may roll when parked and is not hitched to a vehicle.</p>	<p>Contact the nearest Jayco dealer or service agent and make a booking to have the handle replaced.</p>
AUSTRALIA	<p>Jayco Corporation Pty Ltd—Jayco Selected Motorhomes</p> <p>PRODUCT DESCRIPTION</p> <p>Jayco selected motorhomes</p> <p>IDENTIFYING FEATURES</p> <p>Selected motorhomes between chassis nos. P90610 & P90640</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Jayco dealers</p> <p>Target: 11</p> <p>Campaign: JC0036</p> <p>SUPPLIER</p> <p>Jayco Corporation Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.jayco.com.au/</p> <p>No pictures are available.</p>	<p>DEFECTS</p> <p>The rear compartment seat brackets may not sufficiently interlock to make it secure.</p> <p>HAZARDS</p> <p>In the event of an accident, the rear compartment seat may move and pose a hazard to the occupants of the motorhome.</p>	<p>Consumers should contact the nearest Jayco dealer or service agent and have their motorhomes inspected. If required, the bracket will be replaced free of charge.</p>


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Nissan</p> <p>NAME: Micra</p> <p>TYPE/NUMBER OF MODEL: Micra (K13). Production Date: 1 June 2012 to 15 March 2013. Range affected VIN's: MDHFBUK13U (0507009 – 0540019).</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: India</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>The brake master cylinder plunger may not meet the supplier roughness specification. In this condition when operating the braking system under light braking force the user may experience longer brake pedal travel. In extreme cases reduced braking performance may occur and as a result the braking distances required to stop the vehicle will increase.</p>	<p>Voluntary measures: Recall of the product from end users</p>
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Kia</p> <p>NAME: Sorento, Carens, Carnival, Soul, Sportage, Optima</p> <p>TYPE/NUMBER OF MODEL: Types: AM, JC, XM, FG, MB, TF, JES Models: Sorento, Carens, Carnival, Soul, Sportage, Optima Type approval numbers: e4*2001/116*0133*, e9*98/14*0045*, e11*2007/116*0358*, e4*2001/116*0114*, e4*2001/116*0112*, e4*2007/46*0255*, e4*2001/116*0120* Year of manufacture: 2006 to 2011</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Republic of Korea</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>A fault in the brake light switch may result in the brake light not coming on when the brake pedal is pressed or in the brake light remaining on. Moreover, in vehicles with automatic transmission it may not be possible to move the lever out of the 'P' position. The electronic stability control (ESC) may fail to operate, causing the 'ESC OFF' warning lamp on the dashboard to light up; if the cruise control is used, operating the brake pedal may not de-activate the speed control.</p>	<p>Voluntary measures: Recall of the product from end users</p>


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Mercedes-Benz</p> <p>NAME: A180 CDI, A200 CDI, A220 CDI, A180, A200, A250</p> <p>TYPE/NUMBER OF MODEL: Type: W176. Model: A180 CDI, A200 CDI, A220 CDI, A180, A200, A250 EC type Approvals: e1*2007/46*0928* Production period: 06/2012 to 12/2012</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>The laser perforation of the dashboard for the front passenger airbag (i.e. the intended break point for unfolding of the airbag from inside) might not have been carried out correctly. In the event of a forceful frontal collision triggering the front passenger airbag, in individual cases the airbag might not unfold as intended.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: SKODA</p> <p>NAME: Citigo</p> <p>TYPE/NUMBER OF MODEL: The recall concerns certain SKODA Citigo vehicles, produced from January 2013 to 13 March 2013, with VINs from 630729 to 640502 and from 600005 to 600006.</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Czech Republic</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>Incorrectly parameterised airbag control units may have been fitted. On incorrectly parameterised airbag control units the diagnosis function of the side crash sensors is deactivated. Therefore, a potential fault in the side airbag system cannot be recognised and the airbag warning light does not come on.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: PORSCHE</p> <p>NAME: 911</p> <p>TYPE/NUMBER OF MODEL: Models 911 Carrera (991) and 911 Carrera 4 (991)</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: The recall affects Porsche 911 Carrera (991) and 911 Carrera 4 (991) vehicles, from model year 2012 to 2013, manufactured between 03.11.2011 and 14.11.2012.</p> <p>COUNTRY OF ORIGIN: Germany</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>The exhaust tailpipe of the rear muffler can crack on vehicles with higher mileage and this can subsequently result in the loss of the exhaust tailpipe. This can lead to road accidents.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: HYUNDAI</p> <p>NAME: Tucson, Accent, Santa Fe and ix55 Veracruz</p> <p>TYPE/NUMBER OF MODEL: Models Tucson (JM), Accent (MC), Santa Fe (CM) and ix55 Veracruz (EN) (Recall Campaign HRE13-41-P140-JM MC CM EN)</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Passenger car. The recall affects the following vehicles: JM: produced from 01 May 2007 to 28 February 2009, with VINs from KMHJM81BP7U699688 to KMHJN81VR9U990168 MC: produced from 01 December 2006 to 28 February 2009, with VINs from KMHCM31AP6U031828 to KMHCN41VR7U151364 CM: produced from 01 April 2007 to 31 July 2011, with VINs from KMHSG81DP7U195348 to KMHSH81XSCU801903 EN: produced from 01 December 2007 to 28 February 2009, with VINs from KMHNU81CP8U078380 to KMHNU81WP9U095540</p> <p>COUNTRY OF ORIGIN: Republic of Korea</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>The brake light switch may malfunction. As a result the brake lights can either stop to operate after pressing the brake pedal or remain switched on after releasing the brake pedal. Depending on the equipment of the vehicle and as a result of the above mentioned malfunction, it is possible that the following systems can be affected: a) In vehicles with cruise control this can become inoperative b) In vehicles with automatic transmission the swift lever can't be moved from the parking (P) position and c) In vehicles with Electronic Stability Control System (ESC) this can become inoperative with the warning lamp «ESC OFF» switched on.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: HYUNDAI</p> <p>NAME: Veloster</p> <p>TYPE/NUMBER OF MODEL: Model Veloster (FS)</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: The recall affects certain vehicles produced from start of production to 28 Feb 2012, with VINs from start of production to KMHTC6ADXCU063169.</p> <p>COUNTRY OF ORIGIN: Republic of Korea</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>Due to water entering the rear brake caliper, the hand brake may not release completely. Incomplete release of the hand brake could cause an accident.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>


AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Peugeot</p> <p>NAME: Partner</p> <p>TYPE/NUMBER OF MODEL: Type: 7, Model: Partner III, EC type-approval: e2*2001/116*0365*, e2*2007/46*0001*</p> <p>Batch number/Barcode: Not applicable</p> <p>DESCRIPTION: Vehicles produced between November 2011 and December 2011 are affected. Information on the operation (under the code ZDU) is provided by the dealers.</p> <p>COUNTRY OF ORIGIN: France</p> <p>No pictures are available.</p>	<p>INJURIES</p> <p>The products pose a risk of injuries because the fixing bolts of the front seat belt return rails may loosen. The belt could thus not function properly in cases of accidents or sudden braking.</p>	<p>Voluntary measures:</p> <p>Recall of the product from end users</p>
USA	<p>VEHICLE MAKE/MODEL</p> <p>DODGE/SPRINTER 2500-2008</p> <p>MANUFACTURER</p> <p>WHEELED COACH INDUSTRIES, INC.</p> <p>COMPONENT</p> <p>ELECTRICAL SYSTEM</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>6</p> <p>SUMMARY</p> <p>Road Rescue is recalling certain ambulances built on model year 2008 Dodge Sprinter 2500 chassis from April 2008 through December 2008. The failure of a power disconnect solenoid terminates the flow of electricity to the ambulance conversion.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>When the electrical power is interrupted, the siren, warning lights, and patient compartment lights may not operate. There may be a loss of power to life saving equipment in the patient compartment. In the event of an emergency, the ambulance may not be able to alert other vehicles of its presence, slowing its trip to the hospital and increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Wheeled Coach Industries, Inc. will notify owners, and a Wheeled Coach/Road Rescue service center will replace the defective solenoid, free of charge. The recall is expected to begin June 3, 2013. Owners may contact Road Rescue at 1-800-628-8178.</p>

AUTO: CHILD SAFETY SEAT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Love N Care—Triton Child Restraint</p> <p>PRODUCT DESCRIPTION</p> <p>Combination harnessed child restraint for children approximately 6 months to 4 years old and booster seat for children approximately 4 to 8 years old</p> <p>IDENTIFYING FEATURES</p> <p>Model number: LM 215</p> <p>Standards Australia serial numbers: SC682047 to SC683000 and SC683003 to SC683008</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>My Baby Warehouse</p> <p>SUPPLIER</p> <p>Love N Care</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.lovencare.com.au</p> 	<p>DEFECTS</p> <p>The product does not comply with the Australian Standard, AS/NZS 1754:2010 clause 4.3.7 (b) (i), which requires that the child's head is kept at least 10mm away from the vehicle door during side impacts.</p> <p>HAZARDS</p> <p>In the event of a side impact, the child's head may not be adequately protected.</p>	<p>Please contact Love N Care to receive a compliant replacement headrest cover by mail. For further information, please contact Love N Care on 1300 732 599 or visit the website: www.lovencare.com.au</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.</p> <p>HARLEY-DAVIDSON/HYBRID C/C HALF HELMET</p> <p>MANUFACTURER</p> <p>KBC AMERICA, INC.</p> <p>COMPONENT</p> <p>EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>456</p> <p>SUMMARY</p> <p>KBC America, Inc. (KBC) is recalling certain Harley-Davidson Hybrid C/C Half Motorcycle Helmets, sizes L, XL, and XXL manufactured in March 2011. During testing, the affected helmets failed to conform to the impact attenuation and penetration requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets."</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury.</p>	<p>REMEDY</p> <p>The remedy for this recall campaign is still under development. The manufacturer has not yet provided a notification schedule. Customers may contact KBC at 1-818-526-7771.</p>
AUSTRALIA	<p>Hubco Automotive Ltd—Prorack Fitting Kits for Roof Racks</p> <p>PRODUCT DESCRIPTION</p> <p>Fitting kits for fixing Prorack or Whipbar roof racks to the specific motor vehicles listed below</p> <p>IDENTIFYING FEATURES</p> <p>Kit Number Vehicle Listing</p> <p>K508 Mitsubishi ASX 5dr SUV 2010+ IR</p> <p>K491 Audi A3 Sportback 5dr 2005+ IR</p> <p>K421 Audi A4 Avant 5dr Wagon2008+ IR</p> <p>K422 Audi A6 Avant 5dr Wagon2005+ IR</p> <p>K393 Audi Q7 5dr SUV2006 + IR</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Sold through roof rack specialist or automotive accessory stores</p> <p>SUPPLIER</p> <p>Hubco Automotive Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>https://whispbar.com.au</p> 	<p>DEFECTS</p> <p>The fitting kits for the Prorack and Whipbar roof racks can become loose and detach from the roof of an affected vehicle.</p> <p>HAZARDS</p> <p>If the defect occurs and the roof rack becomes detached while the vehicle is in motion, this poses a serious risk to the driver and other road users.</p>	<p>Customers should detach and cease using the roof racks that are attached with these fitting kits. Hubco Automotive Ltd will organise for the return of the product and arrange for customers to receive a replacement product or a refund.</p>

AUTO: MOTOR VEHICLE EQUIPMENT

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycle lubricant and oil</p> <p>BRAND: Castrol</p> <p>NAME: Actevo, 2T</p> <p>TYPE/NUMBER OF MODEL: Castrol 2T 1L and Castrol Actevo 2T 1L.</p> <p>Batch number/Barcode: Castrol 2T 1L (EAN Code 4.008.177.053.641); - Affected batches: 150742; 122303; 125520; 115131.,</p> <p>Castrol Actevo 2T 1L (EAN Code 4.008.177.053.900); - Affected batches: 126486; 112696; 135401; 119680.</p> <p>DESCRIPTION: Motorcycle lubricant, mainly used for off-road competition motorcycles or small scooters.</p> <p>COUNTRY OF ORIGIN: Italy</p> 	<p>INJURIES</p> <p>The presence of a high level of water in the product may cause seizure of the engine.</p>	Voluntary measures: Recall of the product from end users

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

<http://www.sgs.com/en/Consumer-Goods-Retail/Product-Recalls.aspx>

© 2013 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

