

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

1 – 15 MAY 2010

## CONTENTS

### AUTOMOTIVE

Pages 1 to 23



[Motor Vehicle \(43\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(8\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	<p>Mitsubishi—Lancer Evolution vehicles—replace the clip retaining the clutch oil feed tube</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>09/10 model Lancer Evolution vehicles</p> <p><b>TARGET NUMBER:</b> 234</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Affected vehicles are between the following VIN ranges:</p> <p>09 Model year Lancer Evolution: Between JMFSNCZ4A9U000001 and JMFSNCZ4A9U000438 Between JMYSNCZ4A9U000274 and JMYSNCZ4A9U000750</p> <p>10 Model year Lancer Evolution: Between JMFSNCZ4AAU000208 and JMFSNCZ4AAU000221 Between JMYSNCZ4AAU000202 and JMYSNCZ4AAU000203</p> <p><b>SUPPLIER</b></p> <p>Mitsubishi Motors Australia Ltd</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>This will result in clutch fluid loss and the inability to operate the clutch.</p> <p><b>DEFECTS</b></p> <p>The strength of the wire clip retaining the oil pressure pipe to the clutch master cylinder may be insufficient allowing the pipe to become disconnected during clutch operation.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Mistubishi will be contacting all owners via mail on 12 May 2010 requesting you contact your Mitsubishi dealer for replacement of retaining clip of clutch feed oil pipe with a modified type.</p>
AUSTRALIA	<p>Mitsubishi—CJ model Lancer vehicles—inspect/replace tyres</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>CJ model Lancer vehicles</p> <p><b>TARGET NUMBER:</b> 982</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Affected vehicles are between the following VIN ranges:</p> <p>JMFLMCX4AAU000216 and JMFLMCX4AAU000285 JMFLNCX5AAU000339 and JMFLNCX5AAU000402 JMFLTCX5AAU000367 and JMFLTCX5AAU000447 JFMSMCY4AAU000373 and JFMSMCY4AAU000530 JMFSNCY5AAU000572 and JMFSNCY5AAU000791 JMFSTCY5AAU000685 and JMFSTCY5AAU0001094</p> <p><b>SUPPLIER</b></p> <p>Mitsubishi Motors Australia Ltd</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>Operation of the vehicle with the tyre in this condition may lead to a loss of air pressure.</p> <p><b>DEFECTS</b></p> <p>A production condition during the wheel and tyre assembly process may have resulted in a tear in the tyre sidewall.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Mitsubishi will be contacting all owners via direct mail on 19 MAY 2010 requesting you contact your local Mitsubishi dealer for inspection of vehicle tyres and replacement of affected units.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Great Wall Motors—V240</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Great Wall Motors V240 vehicles</p> <p><b>TARGET NUMBER:</b> 2514</p> <p><b>SUPPLIER</b></p> <p>Great Wall Motors</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>In certain circumstances a side impact may cause the lever to release.</p> <p><b>DEFECTS</b></p> <p>On some V240 vehicles there may be a manufacturing defect in the handbrake assembly which could cause the handbrake to disengage.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Contact your authorised Great Wall Dealer to inspect and replace the handbrake lever with the correct part.</p>
AUSTRALIA	<p>Subaru—MY 10 Liberty and Outback vehicles fitted with the continuously variable transmission (CVT)</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>MY 10 Liberty and Outback vehicles fitted with the continuously variable transmission (CVT)</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Chassis Range:  Liberty Sedan 2010: 002005-003880  Liberty Wagon 2010: 002086-006056  Outback 2010: 002075-006068</p> <p><b>TARGET NUMBER:</b> 2,288</p> <p><b>SUPPLIER</b></p> <p>Subaru (Aust) Pty Limited</p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>Vehicle malfunction</p> <p><b>DEFECTS</b></p> <p>Certain MY10 Liberty and Outback vehicles fitted with the CVT may experience an oil leak from a faulty oil cooler hose.</p>	<p><b>CONSUMERS ACTION</b></p> <p>Contact your authorised Subaru dealer for inspection and replacement of faulty oil cooler hose if necessary.</p>
AUSTRALIA	<p>Select Scootas Pty Ltd—SYM Orbit 125 &amp; Classic 125</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>All SYM Orbit 125 &amp; Classic 125 motor scooters.</p> <p>Identifying features</p> <p><b>TARGET NUMBER:</b> 517</p> <p><b>SUPPLIER</b></p> <p>Select Scootas Pty Ltd</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://scoota.com.au">http://scoota.com.au</a></p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>Vehicle malfunction.</p> <p><b>DEFECTS</b></p> <p>In some instances the carburetor return spring has failed.</p>	<p><b>CONSUMERS ACTION</b></p> <p>All owners of affected scooters will be contacted by mail and requested to contact the nearest SYM dealer to make an appointment for repair.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Peugeot—407—Exterior Lighting Malfunction</p> <p><b>PRODUCT DESCRIPTION</b></p> <p>Peugeot 407 vehicles</p> <p><b>IDENTIFYING FEATURES</b></p> <p>Please see attached supporting documentation for VIN numbers.</p> <p><b>TRAGET NUMBER:</b> 49</p> <p><b>SUPPLIER</b></p> <p>Sime Darby Automobiles Pty Limited trading as Peugeot Automobiles Australia</p> <p><b>SUPPLIER'S WEB SITE</b></p> <p><a href="http://www.peugeot.com.au">http://www.peugeot.com.au</a></p> <p>No picture available.</p>	<p><b>HAZARDS</b></p> <p>Vehicle malfunction</p> <p><b>DEFECTS</b></p> <p>There is a possibility of the wiring harness coming into contact with the cooling fan blade causing damage to the harness.</p>	<p><b>CONSUMERS ACTION</b></p> <p>You are requested to contact an approved Peugeot dealer to arrange inspection and re-routing of the engine cooling fan wiring harness.</p>
EU/GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Alto</p> <p><b>BRAND:</b> Suzuki</p> <p><b>TYPE/NUMBER OF MODEL:</b> Alto type GF, EC type approval e6*2001/116*0123*00. The vehicles concerned were manufactured in 2009.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> India</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries because there is a possibility that defective wiring could cause the brake light switch to malfunction. The brake lights would then no longer function during braking which could lead to an accident.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car/van - Ulysse and Scudo</p> <p><b>BRAND:</b> Fiat</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns Ulysse vans, whose chassis numbers range in the interval between 3351749 and 3376826, and all Scudo vehicles, whose chassis numbers range between 4003021 and 4171160 and between 5999002 and 5999517.</p> <p><b>DESCRIPTION:</b> Passenger car/van</p> <p><b>COUNTRY OF ORIGIN:</b> Italy</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries because there is the possibility that, due to a software problem, the headlamps could switch off while driving, which could lead to a road accident.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car/van - Scudo 1.6 JTD</p> <p><b>BRAND:</b> Fiat</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns all vehicles, with chassis numbers ranging between 4004090 and 4264060.</p> <p><b>DESCRIPTION:</b> Passenger car/van</p> <p><b>COUNTRY OF ORIGIN:</b> Italy</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>On the affected vehicles, deterioration in time of the rear braking system friction material is possible, due to infiltration of water and dirt in the rear drum brakes.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Laguna III</p> <p><b>BRAND:</b> Renault</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns Laguna III, Hatchback and Sport Tourer, vehicles, from the start of production up to 24 August 2009.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> France</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>There is a risk of deterioration of the driver's seat belt lap pre-tensioner cable due to fatigue, particularly when the seat is in the lowest position.</p>	Voluntary corrective actions taken by the manufacturer.
EU/POLAND	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - XC90, XC70, V70, S60</p> <p><b>BRAND:</b> Volvo</p> <p><b>TYPE/NUMBER OF MODEL:</b> VIN numbers for Europe: XC90 2006-09 0224000-0512668 S60 2006-09 0500001-0727539 V70 2006-08 0530000-0693560 XC70 2006-07 0208000-0288617.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Sweden</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries as there is the possibility that a rise in oil pressure in the engine could cause engine damage which could lead to a road accident.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Jeep Cherokee</p> <p><b>BRAND:</b> Chrysler</p> <p><b>TYPE/NUMBER OF MODEL:</b> Type KJ EC type-approval e4*98/14*0058*01-02</p> <p><b>DESCRIPTION:</b> The notification concerns vehicles built between 2002 and 2003.</p> <p><b>COUNTRY OF ORIGIN:</b> United States</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>There is the possibility of lubricant leaking from the upper ball joint of the front suspension wishbone arm which could result in accelerated wear and possibly separation of the joint.</p>	Voluntary corrective actions taken by the manufacturer.
EU/PORTUGAL	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Modus</p> <p><b>BRAND:</b> Renault</p> <p><b>TYPE/NUMBER OF MODEL:</b> Vehicles since production began up to 26 October 2009. Fabrication numbers: W860022 - W999998 // WA00001 - WA02521.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Spain</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The mechanism for securing the rear bench seat may not work properly when the position of the seat is adjusted (the plastic lever may break and/or the anchoring hooks may not be held sufficiently tight). In the event of a frontal impact, there is a risk that rear passengers may not be sufficiently restrained</p>	Voluntary corrective actions taken by the manufacturer.
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car/van - Scudo 2.0 JTD</p> <p><b>BRAND:</b> Fiat</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns all vehicles, with chassis ranging between 4003021 and 4208669 and between 5999002 and 5999517.</p> <p><b>DESCRIPTION:</b> Passenger car/van</p> <p><b>COUNTRY OF ORIGIN:</b> Italy</p> <p>No picture available</p>	<p><b>FIRE</b></p> <p>The product poses a risk of fire because there could be contact between the fuel pipe and the engine sound insulation cover, resulting in deterioration of the fuel pipe over time.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE													
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED										
EU/SWEDEN	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - S80, V70, XC70, XC60, C30, C70, S40 and V50</p> <p><b>BRAND:</b> Volvo</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns vehicles with 5 cylinder diesel engines with DPF (Diesel Particle Filter), engine code 69, 71, 77, 78 and 86.</p> <p><b>MODEL, MODEL YEAR(S) AND VIN:</b>  S80, 2007-2009, 0000850 / 0107561  V70, 2008-2009, 0000399 / 0111999  XC70, 2008-2009, 0000400 / 0065987  XC60, 2009, 0000212 / 0036471  C30, 2007-2010, 0000269 / 0206299  C70, 2007-2010, 0010000 / 0099398  S40, 2006-2010, 0177491 / 0509783  V50, 2006-2010, 0180043 / 0569282</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Sweden</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries as the engine oil level may be above maximum which could lead to maintained or increased engine speed, potentially leading to subsequent engine break down.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>										
USA	<table border="0"> <tr> <td><b>VEHICLE MAKE / MODEL</b></td> <td><b>MODEL YEAR(S)</b></td> </tr> <tr> <td>FCCC / B2</td> <td>2005-2011</td> </tr> <tr> <td>FCCC / MC</td> <td>2005-2011</td> </tr> <tr> <td>FCCC / S2</td> <td>2005-2011</td> </tr> <tr> <td>FREIGHTLINER / BUSINESS CLASS M2</td> <td>2005-2010</td> </tr> </table> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> EXTERIOR LIGHTING:TAIL LIGHTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 6569</p> <p><b>SUMMARY:</b> DTNA is recalling certain model year 2005 through 2011 freightliner business class c2, FCCC B2 CHASSIS, S2 CHASSIS, and MC CHASSIS manufactured beginning January 19, 2005 through April 16, 2010. The stop lamps may be intermittent during light brake applications.</p> <p>No picture available.</p>	<b>VEHICLE MAKE / MODEL</b>	<b>MODEL YEAR(S)</b>	FCCC / B2	2005-2011	FCCC / MC	2005-2011	FCCC / S2	2005-2011	FREIGHTLINER / BUSINESS CLASS M2	2005-2010	<p><b>CONSEQUENCE</b></p> <p>The stop lamps may not properly indicate that the service brakes are applied which may lead to a crash without warning.</p>	<p><b>REMEDY</b></p> <p>DTNA will notify owners and repairs will be performed by dtna dealerships free of charge. Dtna has not yet provided the agency with a notification schedule. Owners may contact dtna at 1-800-547-0712.</p>
<b>VEHICLE MAKE / MODEL</b>	<b>MODEL YEAR(S)</b>												
FCCC / B2	2005-2011												
FCCC / MC	2005-2011												
FCCC / S2	2005-2011												
FREIGHTLINER / BUSINESS CLASS M2	2005-2010												

**AUTO: MOTOR VEHICLE**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b></p> <p>INFINITI / G35 COUPE                      2005-2007            INFINITI / G35 SEDAN                      2005-2006</p> <p><b>MANUFACTURER:</b> NISSAN NORTH AMERICA, INC.</p> <p><b>COMPONENT:</b> seats</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 134215</p> <p><b>SUMMARY:</b> NISSAN is recalling certain model year 2005 through 2007 infiniti g35 sedans manufactured from march 29, 2004 through August 25, 2006 and infiniti g35 coupes manufactured from April 1, 2004 through May 30, 2007. The wire harness connecting the belt tension sensor (bts) and the occupant detection sensor (ods) control unit under the front passenger seat can experience relative movement which can cause wear and oxidization of the terminals and may cause interruption of the signal.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a crash, the airbag may not deploy, increasing the risk of injury.</p>	<p><b>REMEDY</b></p> <p>NISSAN has not yet provided the agency with a remedy plan or notification schedule.</p>
USA	<p><b>VEHICLE MAKE / MODEL:</b> THOMAS BUILT BUSES / HDX</p> <p><b>MODEL YEAR(S):</b> 2009-2010</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM:WIRING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 118</p> <p><b>SUMMARY:</b> DTNA is recalling certain model year 2009 and 2010 hdx non school buses manufactured beginning November 20, 2007 through may 8, 2009. The heater coolant flow valve actuator O-ring may allow coolant leakage into the heater core compartment and the actuator pc board area potentially causing the actuator to overheat and/or melt.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>An overheated and/or melted actuator may result in a vehicle fire.</p>	<p><b>REMEDY</b></p> <p>DTNA will notify owners and repairs will be performed by Thomas built dealerships free of charge. Dtna has not yet provided the agency with a notification schedule.</p> <p>Owners may contact thomas built at 1-336-889-4871.</p>



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>            THOMAS BUILT BUSES / HDX      2009-2010</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM:WIRING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1515</p> <p><b>SUMMARY:</b> DTNA is recalling certain model year 2009 and 2010 hdx school buses manufactured on november 15, 2007 through june 15, 2009. the heater coolant flow valve actuator 0-ring may allow coolant leakage into the heater core compartment and the actuator pc board area potentially causing the actuator to overheat and/or melt.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>An overheated and/or melted actuator may result in a vehicle fire.</p>	<p><b>REMEDY</b></p> <p>DTNA will notify owners and repairs will be performed by thomas built dealerships free of charge. Dtna has not yet provided the agency with a notification schedule.</p> <p>Owners may contact thomas built at 1-336-889-4871.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>            BIG DOG / BULLDOG      2004            BIG DOG / CHOPPER      2004            BIG DOG / MASTIFF      2004            BIG DOG / RIDGEBACK      2004            BIGDOG / BOXER      2004            BIGDOG / PITBULL      2004</p> <p><b>MANUFACTURER:</b> BIG DOG MOTORCYCLES, LLC</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1895</p> <p><b>SUMMARY:</b> Big dog is recalling certain 2004 chopper, bulldog, ridgeback, mastiff, boxer, and pitbull motorcycles. There is a possible loose connection between the harness connector and the electronic harness controller.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This condition may cause the motorcycle to experience intermittent loss of electrical power to various components, which can lead to, among other things, a loss of headlamp function or a vehicle stall, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Big dog will notify owners and dealers will repair the motorcycles free of charge. The safety recall is expected to begin on or about May 24, 2010. Owners may contact big dog at 1-316-219-9121.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>    <b>MODEL YEAR(S)</b>  HUMMER / H3                      2006-2010</p> <p><b>MANUFACTURER:</b> GENERAL MOTORS CORP.  <b>COMPONENT:</b> STRUCTURE:BODY:HOOD  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  162129</p> <p><b>SUMMARY:</b> GM is recalling certain model year 2006 through 2010 hummer h3 vehicles. Some of these vehicles have a condition in which the integral clip-tabs on the louver on the hood may fracture, causing the hood louver rattle against the hood and become loose. If this indicator is unnoticed, additional clips could fracture and the hood louver could detach from the vehicle.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If the vehicle is being driving when this occurs, it could strike a following vehicle and cause injury and/or property damage.</p>	<p><b>REMEDY</b></p> <p>Dealers will apply an adhesive to the hood louver to secure it to the hood. This service will be performed free of charge. The safety recall began on April 12, 2010. Owners may contact hummer at 800-732-5493 or at the owner center at www.gmownercenter.com.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>    <b>MODEL YEAR(S)</b>  SPARTAN / GLADIATOR            2007-2009</p> <p><b>MANUFACTURER:</b> SPARTAN CHASSIS, INC.  <b>COMPONENT:</b> ENGINE AND ENGINE COOLING  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  167</p> <p><b>SUMMARY:</b> Spartan is recalling certain model year 2007 through 2009 gladiator fire apparatus class 8 vehicles manufactured beginning august 21, 2001 through March 8, 2010, equipped with Detroit diesel series 60 engines. The engine may shut down unexpectedly when a diesel particulate filter over temperature condition is detected.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Unexpected emergency vehicle engine shutdown under certain conditions could hamper rescue operations and place the public at risk.</p>	<p><b>REMEDY</b></p> <p>Spartan will notify owners and Detroit diesel will repair the vehicles free of charge by reprogramming the engine control logic to illuminate a malfunction indicator light without requesting engine shutdown. Please see Daimler trucks' defect report 10e-005. The safety recall is expected to begin on or about May 10, 2010. Owners may contact Daimler trucks at 1-800-547-0712 or spartan chassis at 1-800-543-4277 - option 1.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>  THOMAS BUILT BUSES / SAF-T-LINER C2</p> <p><b>MODEL YEAR(S):</b> 2005-2011</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA  <b>COMPONENT:</b> EXTERIOR LIGHTING:TAIL LIGHTS  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  6669</p> <p><b>SUMMARY:</b> DTNA is recalling certain model year 2005 through 2011 Thomas built Saf-t-Liner C2 school buses manufactured beginning January 19, 2005 through April 16, 2010. The stop lamps may be intermittent during light brake applications.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The stop lamps may not properly indicate that the service brakes are applied which may lead to a crash without warning.</p>	<p><b>REMEDY</b></p> <p>DTNA will notify owners and repairs will be performed by dtna dealerships free of charge. Dtna has not yet provided the agency with a notification schedule. Owners may contact dtna at 1-800-547-0712.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b>            FARBER / SPECIALTY VEHICLE    2008-2010</p> <p><b>MANUFACTURER:</b> FARBER SPECIALTY VEHICLES</p> <p><b>COMPONENT:</b> EQUIPMENT ADAPTIVE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 7</p> <p><b>SUMMARY:</b> Farber Specialty Vehicles (fsv) is recalling certain model year 2008 through 2010 fsv specialty vehicles manufactured between october 2007 and december 2009 and fitted with certain ricon s series and k series l-model wheelchair lifts. Due to a problem in the software that controls the lift's "up" function, should the "up" button be released before the floor level limit switch is activated, the lift may continue its upward travel and may overrun the floor level cut off point.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>When the platform overruns the vehicle floor level and stops at an angle from 15-20 degrees, it is possible for a person in a wheelchair to tip over and for someone standing on the platform to fall, possibly resulting in injuries.</p>	<p><b>REMEDY</b></p> <p>FSV will notify owners and the repairs will be performed by authorized ricon dealers free of charge. A software solution for this safety defect is under investigation. Until the software solution is available, ricon will provide owners with a bulletin outlining proper wheelchair lift operation and will ship owners a dvd-based training aid to promote proper lift operation at no cost. The safety recall began on April 20, 2010. Owners may contact ricon at 1-818-267-3000 or fsv at 1-614-863-6470.</p>
USA	<p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b>            DODGE / 1500    2003-2008            DODGE / 2500    2003-2008            DODGE / 3500    2003-2008</p> <p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b>            FABTECH / FT44039            FABTECH / FTS93001</p> <p><b>MANUFACTURER:</b> FABTECH MOTORSPORTS</p> <p><b>COMPONENT:</b> STEERING:GEAR BOX:SHAFT PITMAN</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1500</p> <p><b>SUMMARY:</b> Fabtech is recalling certain aftermarket replacement pitman arms, p/nos. Fts93001 and ft44039, installed for use on certain 2003 through 2008 dodge 2500 4wd, 3500 4wd, and 1500 4wd mega cab vehicles. The pitman arm can fracture and break away from the steering box causing total loss of steering control.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Steering loss could result in a vehicle crash possibly resulting in property damage, injury or death.</p>	<p><b>REMEDY</b></p> <p>Fabtech will notify owners and authorized installers will inspect for defective pitman arm and replace if necessary free of charge. The safety recall is expected to begin during May 2010. Owners may contact fabtech at 1-877-432-2832.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b></p> <p>SUBARU / LEGACY 2010 SUBARU / OUTBACK 2010</p> <p><b>MANUFACTURER:</b> SUBARU OF AMERICA, INC.</p> <p><b>COMPONENT:</b> ENGINE AND ENGINE COOLING:COOLING SYSTEM:HOSE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 29443</p> <p><b>SUMMARY:</b> SUBARU is recalling certain model year 2010 outback and legacy passenger vehicles manufactured from July 31 through December 1, 2009. a crack can occur in the cvt cooler hose resulting in a fluid leak.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The manufacturer has not yet provided a description of the consequence as it relates to motor vehicle safety.</p>	<p><b>REMEDY</b></p> <p>SUBARU will notify owners and dealers will replace any affected cooler hoses free of charge. Subaru has not yet provided the agency with a notification schedule.</p> <p>Owners may contact subaru at 1-856-488-8500.</p>
USA	<p><b>VEHICLE MAKE / MODEL MODEL YEAR(S)</b></p> <p>MCI / D4000 2010 MCI / D4005 2010 MCI / D4500 2010 MCI / D4505 2010 MCI / E4500 2010 MCI / J4500 2010</p> <p><b>MANUFACTURER:</b> MOTOR COACH INDUSTRIES, INC</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 335</p> <p><b>SUMMARY:</b> MCI is recalling certain model year 2010 d4000, d4005, d4500, d4505, e4500, and j4500 model motor coaches manufactured from september 2009 through may 2010, equipped with arvinmeritor front and tag axle assemblies. The suspect axles may have had improper torque applied to the hub/rotor/wheel adapter bolts during the assembly process. Reduced bolt torque could lead to vibration loosening of the bolt.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could result in a loss of the wheel possibly resulting in a crash.</p>	<p><b>REMEDY</b></p> <p>MCI will notify owners and dealers will repair the motor coaches free of charge. The safety recall is expected to begin during may 2010. owners may contact mci at 1-800-241-2947.</p>

**AUTO: MOTOR VEHICLE**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>KENWORTH / T2000            2010            KENWORTH / T660            2010            KENWORTH / T800            2010            KENWORTH / W900            2010</p> <p><b>MANUFACTURER:</b> PACCAR INCORPORATED</p> <p><b>COMPONENT:</b> SUSPENSION: REAR:AXLE: SPINDLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 21</p> <p><b>SUMMARY:</b> KENWORTH is recalling certain model year 2010 t2000, t660, t800 and w900 vehicles manufactured between july 30, 2009 and september 18, 2009. the rear axle outer end hub may have not been primed with oil properly during the rear axle installation process. Potential lack of oil may cause the outer end bearing to heat up and/or seize, possibly resulting in the overheating of the wheel end.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A wheel end fire may occur, increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will replace the bearings, seals and will add oil to the outer end hub as well as inspect races and axle housing for damage and replacing as necessary free of charge. The safety recall is expected to begin during june 2010. owners may contact kenworth at 425-828-5440.</p>
USA	<p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>BRP / SEA-DOO ADVANCED TEC            2010</p> <p><b>MANUFACTURER:</b> BOMBARDIER RECREATIONAL PRODUCTS INC.</p> <p><b>COMPONENT:</b> TRAILER HITCHES</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 381</p> <p><b>SUMMARY:</b> BRP is recalling certain model year 2010 sea-doo advanced tec trailers manufactured from december 10, 2009 through march 22, 2010. The latching mechanism of a sea-doo personal watercraft to an advanced tec trailer (known as the icatch) may be misadjusted and not properly secure the front end of the personal watercraft being transported. When this condition exists, it is possible that road oscillations cause the personal watercraft to jump out of the icatch hook part of the mechanism.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>if the rear latching straps are not used to properly secure the back end of the personal watercraft, it may slide off the trailer increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will install a safety cable on the front latch mechanism, to affix an updated label on the trailer and to give to the owner an updated user guide. This service will be performed free of charge. The safety recall is expected to begin on or before June 15, 2010. Owners may contact brp at 1-888-638-5397.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>PIERCE / ARROW XT            2006-2010  PIERCE / DASH                2006-2010  PIERCE / LANCE                2006-2010  PIERCE / QUANTUM            2006-2010  PIERCE / VELOCITY            2006-2010</p> <p><b>MANUFACTURER:</b> PIERCE MANUFACTURING  <b>COMPONENT:</b> ENGINE AND ENGINE COOLING  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  827</p> <p><b>SUMMARY:</b> Pierce is recalling certain model year 2006 through 2010 arrow xt, dash, lance, quantum, and velocity emergency vehicles manufactured from December 20, 2006, through February 1, 2010, equipped with Detroit diesel series 60 engines. The engine may shut down unexpectedly when a diesel particulate filter over temperature condition is detected.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Unexpected emergency vehicle engine shutdown under certain conditions could hamper rescue operations and place the public at risk.</p>	<p><b>REMEDY</b></p> <p>Pierce will notify owners and Detroit diesel will repair the vehicles free of charge by reprogramming the engine control logic to illuminate a malfunction indicator light without requesting engine shutdown. Please see Daimler trucks' defect report 10e-005. The safety recall is expected to begin on or about May 14, 2010. Owners may contact Daimler trucks at 1-800-547-0712 or pierce at 1-920-832-3000.</p>
USA	<p><b>VEHICLE MAKE / MODEL    MODEL YEAR(S)</b></p> <p>STARCRAFT / QUEST            2010</p> <p><b>MANUFACTURER:</b> STARCRAFT BUS  <b>COMPONENT:</b> SEATS  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  1</p> <p><b>SUMMARY:</b> Stacraft is recalling one model year 2010 quest school bus which fails to conform to federal motor vehicle safety standard no. 222, "school bus passenger seating and crash protection." the seat cushion retention locking mechanism in certain school bus seats can be misaligned.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The seat occupants may be injured in the event of a crash.</p>	<p><b>REMEDY</b></p> <p>Starcraft will repair the bus free of charge. The safety recall began on may 3, 2010. owners may contact starcraft at 1-800-348-7440.</p>
USA	<p><b>VEHICLE MAKE / MODEL    MODEL YEAR</b></p> <p>WILDCAT / 510                    2004-2009  WILDCAT / 510LT                2007-2009</p> <p><b>MANUFACTURER:</b> WILDCAT MFG. CO. INC  <b>COMPONENT:</b> TRAILER HITCHES  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  74</p> <p><b>SUMMARY:</b> Wildcat is recalling certain model year 2004-2009 510 and model year 2007-2009 510lt trailers equipped with an adjustable length tongue assembly. The pintle eye used in the tongue assembly does not have an adequate vertical or horizontal load rating for the gross weight of the vehicle.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The pintle eye could fail resulting in separation of the tongue from the tow vehicle increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Field kit modifications are currently under development. The safety recall is expected to begin on or before May 28, 2010. Owners may contact wildcat at 800-627-3954.</p>

**AUTO: MOTOR VEHICLE**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b>  ORION / VII                                  2007-2010</p> <p><b>MANUFACTURER:</b> DAIMLER BUSES NORTH AMERICA, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:GLASS, SIDE/REAR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  1262</p> <p><b>SUMMARY:</b> Daimler bus North America is recalling certain model year 2007 through 2010 Orion VII transit buses manufactured from December 2007 through March 2010. The passenger windows have a tip-in transom window which is attached by screws. These screws may loosen and the window may dislodge and fall into the bus.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A collapsing window could injure passengers.</p>	<p><b>REMEDY</b></p> <p>Orion will notify owners and instruct them to check that the screws are properly tightened and to inspect them periodically. Orion plans to provide an interim notification of the defect as well as an interim free remedy that will keep the windows closed and keep them from dislodging. Once a permanent remedy is developed that will permit the windows to be opened and not dislodge, and parts are available, Orion will notify owners and provide that free remedy. The recall began on October 21, 2009. Owners may contact Orion at 1-800-716-7466.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b>  NISSAN / ALTIMA                                  2010</p> <p><b>MANUFACTURER:</b> NISSAN NORTH AMERICA, INC.</p> <p><b>COMPONENT:</b> STRUCTURE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  113</p> <p><b>SUMMARY:</b> Nissan is recalling certain model year 2010 Altima vehicles manufactured from April 7, 2010 through April 13, 2010. Some of the front side member assembly components may not have been welded to specification due to a tool maintenance error.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If several structural welds are out of specification on a single vehicle, it may have an effect on the vehicle crash performance.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect and if necessary repair free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact Nissan at 1-800-647-7261.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR</b>  DODGE / CALIBER                                  2010</p> <p><b>MANUFACTURER:</b> CHRYSLER GROUP LLC</p> <p><b>COMPONENT:</b> LATCHES/LOCKS/  LINKAGES:DOORS:LATCH</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  132</p> <p><b>SUMMARY:</b> Chrysler is recalling certain model year 2010 Dodge Caliber vehicles. Some vehicles may have been built with an incorrect door lock rod in the right front door.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could result in the door unlatching when the window is rolled down increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect and replace the front right door lock rod as required free of charge. The safety recall is expected to begin during June 2010. Owners may contact Chrysler at 1-800-853-1403.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT		DANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL	MODEL YEAR	CONSEQUENCE	REMEDY
	PETERBILT / 325	2011		
	PETERBILT / 330	2011	This does not meet the standard requirements.	Dealers will re-pin the hydraulic brake harness insuring a normally closed diagnostic switch is installed. This service will be performed free of charge. The safety recall is expected to begin during June 2010. Owners may contact Peterbilt at 940-591-4196.
	PETERBILT / 337	2011		
	<b>MANUFACTURER:</b> PACCAR INCORPORATED			
	<b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC:ANTILOCK:ABS WARNING LIGHT			
	<b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 6			
	<b>SUMMARY:</b> Peterbilt is recalling certain model year 2010 and 2011 model 325, 330, 335, 337, 340, and 348 trucks for failing to comply with the requirements of federal motor vehicle safety standard no. 121, air brake systems. The ABS malfunction indicator lamp may be illuminated at all times.  No picture available.			
USA	VEHICLE MAKE / MODEL	MODEL YEAR	CONSEQUENCE	REMEDY
	CHRYSLER / 300	2010		
	DODGE / CHALLENGER	2010	The result of the defect could lead to a condition where the key may be removed from the ignition switch (win module) prior to placing the shifter in park. This could result in the potential for unintended vehicle movement and could increase the risk of a crash.	Dealers will inspect and replace the win module free of charge. The safety recall is expected to begin during July 2010. Owners may contact Chrysler at 1-800-853-1403.
	DODGE / CHARGER	2010		
	DODGE / RAM	2010		
	JEEP / COMMANDER	2010		
	JEEP / GRAND CHEROKEE	2010		
	<b>MANUFACTURER:</b> CHRYSLER GROUP LLC			
	<b>COMPONENT:</b> ELECTRICAL SYSTEM: IGNITION:MODULE			
	<b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 40131			
	<b>SUMMARY:</b> Chrysler is recalling certain model year 2010 Chrysler 300, Dodge challenger, charger, jeep commander, grand Cherokee and Dodge ram vehicles. These vehicles may have been built with a wireless ignition node (win) module exhibiting a binding condition of the solenoid latch.  No picture available.			




AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR</b></p> <p>VOLVO / XC70                              2008-2010</p> <p><b>MANUFACTURER:</b> VOLVO CARS OF N.A. LLC.</p> <p><b>COMPONENT:</b> EQUIPMENT:OTHER:LABELS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 679</p> <p><b>SUMMARY:</b> Volvo is recalling certain model year 2010 xc70 vehicles manufactured from december 5, 2006 through october 1, 2009 for failing to comply with the requirements of federal motor vehicle safety standard no. 110, tire selection and rims. The fmvss label, tire and loading information label and a page in the owner's manual contain incorrect maximum permissible inflation pressure according to fmvss 110.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This does not meet the requirements of the standard.</p>	<p><b>REMEDY</b></p> <p>The corrective action is to update the vehicles with a new fmvss label, tire and loading information label and tpms software. Volvo retailers will also apply a label with correct maximum tire pressure information to the owner's manual. This service will be performed free of charge. The recall is expected to begin during May 2010. Owners may contact Volvo at 1-800-458-1552.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR</b></p> <p>SPARTAN / ADVANTAGE              2007</p> <p>SPARTAN / DIAMOND                  2006-2008</p> <p>SPARTAN / GLADIATOR              2006-2009</p> <p>SPARTAN / METROSTAR              2008-2009</p> <p><b>MANUFACTURER:</b> SPARTAN CHASSIS, INC.</p> <p><b>COMPONENT:</b> SUSPENSION:FRONT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 58</p> <p><b>SUMMARY:</b> Spartan is recalling certain model year 2007 through 2009 gladiator, metrostar, advantage, and diamond fire apparatus chassis manufactured from January 1, 2007 through april 15, 2010, equipped with independent front suspensions supplied by ridewell corporation. Bell crank support brackets installed on the suspension cradle may crack, or separate, from the main structure (cradle assembly). Certain welds that attach the bell crank support brackets may have been omitted during the weldment operation of the suspension cradle.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A complete separation of the bell crank support bracket(s) may cause steering impairment which could result in a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>Spartan will notify owners and repair the vehicles free of charge. The safety recall is expected to begin on or about May 28, 2010. Owners may contact spartan at spartan chassis at 1-800-543-4277 - option 1.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR</b></p> <p>STARTRANS / CANDIDATE                      2009  STARTRANS / CANDIDATE II                      2009  STARTRANS / PRESIDENT                      2009  STARTRANS / SENATOR                      2009  STARTRANS / SENATOR HD                      2009  STARTRANS / SENATOR II                      2009  STARTRANS / TROLLEY                      2009</p> <p><b>MANUFACTURER:</b> STARTRANS BUS CORPORATION</p> <p><b>COMPONENT:</b> EQUIPMENT ADAPTIVE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 183</p> <p><b>SUMMARY:</b> Startrans bus is recalling certain model year 2009 candidate, candidate ii, senator, senator hd, president, trolley, and senator ii transit buses manufactured from september 2007 through december 18, 2009, and fitted with certain ricon s series and k series l-model wheelchair lifts. Due to a problem in the software that controls the lift's "up" function, should the "up" button be released before the floor level limit switch is activated, the lift may continue its upward travel and may overrun the floor level cut off point.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>When the platform overruns the vehicle floor level and stops at an angle from 15-20 degrees, it is possible for a person in a wheelchair to tip over and for someone standing on the platform to fall, possibly resulting in injuries.</p>	<p><b>REMEDY</b></p> <p>Startrans bus will notify owners and the repairs will be performed by authorized ricon dealers free of charge. A software solution for this safety defect is under investigation. Until the software solution is available, ricon will provide owners with a bulletin outlining proper wheelchair lift operation and will ship owners a dvd-based training aid to promote proper lift operation at no cost. The safety recall is expected to begin during May 2010. Owners may contact ricon at 1-818-267-3000 or startrans bus at 1-574-642-0811.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>ORION / VII                      2006-2009</p> <p><b>MANUFACTURER:</b> DAIMLER BUSES NORTH AMERICA, INC.</p> <p><b>COMPONENT:</b> VISIBILITY:GLASS, SIDE/REAR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 807</p> <p><b>SUMMARY:</b> Daimler bus North America is recalling certain model year 2006 through 2009 Orion vii transit buses manufactured from august 2007 through June 2009. The passenger windows have a tip-in transom window which is attached by screws. These screws may loosen and the window may dislodge and fall into the bus.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A collapsing window could injure passengers.</p>	<p><b>REMEDY</b></p> <p>Orion will notify owners and instruct them to check that the screws are properly tightened and to inspect them periodically. Orion plans to provide an interim notification of the defect as well as an interim free remedy that will keep the windows closed and keep them from dislodging. Once a permanent remedy is developed that will permit the windows to be opened and not dislodge, and parts are available, Orion will notify owners and provide that free remedy. The recall began on October 21, 2009. Owners may contact Orion at 1-800-716-7466.</p>

**AUTO: MOTOR VEHICLE**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR</b></p> <p>STARTRANS / CANDIDATE      2007-2009            STARTRANS / CANDIDATE II      2007-2009            STARTRANS / PRESIDENT      2007-2009            STARTRANS / SENATOR      2007-2010            STARTRANS / SENATOR HD      2007-2009            STARTRANS / SENATOR II      2007-2009            STARTRANS / TROLLEY      2007-2009</p> <p><b>MANUFACTURER:</b> STARTRANS BUS CORPORATION</p> <p><b>COMPONENT:</b> EQUIPMENT ADAPTIVE            Potential Number of Units Affected: 805</p> <p><b>SUMMARY:</b> Startrans bus is recalling certain model year 2007 through 2010 candidate, candidate ii, senator, senator hd, president, trolley, senator ii, and sentinal transit buses manufactured from december 2007 through december 18, 2009 and fitted with ricon public use lifts. The restraint belt on these lifts was designed to prevent the lift from moving, unless the tongue of the belt is fully engaged and latched in the buckle. Ricon has discovered, however, that it is possible for the operator to insert the belt tongue into the buckle without fully engaging the latching mechanism. In this case, the restraint belt would appear to be latched, and the operator could run the lift. If the restraint belt tongue is not fully engaged into the restraint belt buckle, and latched, the lift may operate with an occupant on the platform.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The user of the lift could be injured should the lift move without the restraint belt properly buckled.</p>	<p><b>REMEDY</b></p> <p>Startrans bus is working with ricon and ricon will be performing the remedy for this campaign. Please see ricon's defect report 09e-060. Ricon will provide customers with a warning decal and a dvd-based training aid. The safety recall is expected to begin during May 2010. Owners may contact ricon at 1-818-267-3000 or startrans bus at 1-574-642-0811.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR</b></p> <p>SKYLINE / PARK MODEL TRAILER      2004-2007</p> <p><b>MANUFACTURER:</b> SKYLINE CORPORATION</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 44</p> <p><b>SUMMARY:</b> Skyline is recalling certain model year 2004 through 2007 park model trailers manufactured from June 1, 2003 through May 31, 2007. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could result in a fire.</p>	<p><b>REMEDY</b></p> <p>Skyline will notify owners and replace the receivers free of charge. The safety recall is expected to begin during May 2010. Owners may contact skyline toll-free at 1-800-733-4250.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DAANGER	MEASURES ADOPTED
AUSTRALIA	<p>Mazda—BT-50 Bonnet Striker</p> <p><b>PRODUCT DESCRIPTION</b> BT-50 Bonnet Striker</p> <p><b>IDENTIFYING FEATURES</b> Affected vehicles are in the following VIN range: MMO UNYO** 00613091 – MMO UNYO** 00813977 MM8 UNFE93 00 601527, MM8UNBE1300602706, MM8 UNFE93 00 602711</p> <p><b>TARGET NUMBER:</b> 21,662</p> <p><b>SUPPLIER</b> Mazda Australia Pty Limited No picture available.</p>	<p><b>HAZARDS</b> If the vehicle is continuously driven under severe conditions, the safety hook may no longer be able to retain the bonnet and the bonnet may open while driving, hindering the visibility of the driver.</p> <p><b>DEFECTS</b> On certain BT-50 vehicles, the bonnet striker may receive more lateral input than expected when driven in severe conditions like a rough road and/or if the bonnet fitting condition is less than optimal. This may cause fatigue breakage of the bonnet striker in some cases.</p>	<p><b>CONSUMERS ACTION</b> Owners of affected vehicles will be contacted by mail. Consumers may obtain further information by contacting any authorised Mazda Dealer or free-call 1800 034 411 (10:00am to 4:00pm Eastern Standard Time, Mon-Fri) to speak to a Mazda Customer Service Representative.  Mazda dealers will replace the bonnet striker with a modified unit, and adjust the alignment of the bonnet.</p>
AUSTRALIA	<p>Pro Accessories Australia—Avon Cobra AV72 240/50 R16</p> <p><b>PRODUCT DESCRIPTION</b> Rear motorcycle tyre</p> <p><b>IDENTIFYING FEATURES</b> Batches 4109, 4209 and 4409</p> <p><b>SUPPLIER</b> Pro Accessories Australia Supplier's web site <a href="http://www.proaccessories.com.au">http://www.proaccessories.com.au</a></p> 	<p><b>HAZARDS</b> Tyre puncture and the possibility of serious injury to the rider.</p> <p><b>DEFECTS</b> Manufacturing irregularity which could result in separation of components and tyre puncture.</p>	<p><b>CONSUMERS ACTION</b> Immediately contact the dealer where they purchased the tyre and get them to replace the tyre as soon as possible. Owners of the affected tyres should ring Pro Accessories Australia on 1800 761 300 between the hours of 9am-5pm Mon-Fri to organise a free replacement.</p>


**AUTO: MOTOR VEHICLE EQUIPMENT**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> ARVINMERITOR / AXLE ASSEMBLY</p> <p><b>MANUFACTURER:</b> ARVINMERITOR, INC</p> <p><b>COMPONENT:</b> POWER TRAIN:AXLE ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 685</p> <p><b>SUMMARY:</b> Arvinmeritor is recalling certain front and tag axle assemblies sold and installed as original equipment for certain mci transit buses. The suspect axles may have had improper torque applied to the hub/rotor/wheel adapter bolts during the assembly process. Reduced bolt torque could lead to vibration loosening of the bolt.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could result in a loss of the wheel possibly resulting in a crash.</p>	<p><b>REMEDY</b></p> <p>Arvinmeritor is working with mci to notify owners and repairs will be performed by mci dealers free of charge. The safety recall is expected to begin during May 2010. Owners may contact arvinmeritor at 1-248-435-0896 or mci customer service at 1-800-241-2947.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> VILLA / DRIVER/PASSENGER SEAT</p> <p><b>MANUFACTURER:</b> VILLA INTERNATIONAL</p> <p><b>COMPONENT:</b> SEATS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 36</p> <p><b>SUMMARY:</b> VILLA is recalling certain driver and passenger seats sold and installed as original equipment for rexhall motorhomes. The seat's slide tracks fail to conform to the static pull test of federal motor vehicle safety standard nos. 207, "seating systems," and 210, "seat belt assembly anchorages."</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a crash, the seat's slide tracks can separate, possibly resulting in injury.</p>	<p><b>REMEDY</b></p> <p>VILLA is working with rexhall to notify owners and the motorhomes will be repaired free of charge. Repairs will be performed by authorized dealers. The safety recall is expected to begin during may 2010. Owners may contact villa at 1-323-564-4481.</p>

**AUTO: MOTOR VEHICLE EQUIPMENT**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>EATON / HYBRID TRANSMISSION            EATON / ULTRASHIFT HV WITH PARK            FULLER / HYBRID TRANSMISSION            FULLER / ULTRASHIFT HV WITH PARK            MANUFACTURER: EATON CORPORATION</p> <p><b>COMPONENT:</b> POWER TRAIN:AUTOMATIC TRANSMISSION</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1912</p> <p><b>SUMMARY:</b> Eaton is recalling certain Eaton and fuller branded medium duty automated mechanical transmissions, models ultrashift hv with park feature, part numbers fo-5506b-dms, fo-6506b-dm3, f-5505-dm3 and f-6505b-dm3, and the hybrid transmission with park feature, part numbers eh-6e606b-cd, eh-6e606b-p, eh-6e706b-cd, eh-6e706b-p, and eh-6e706b-upg. These transmissions are sold and installed as original equipment in medium duty commercial and school bus vehicles. Due to an error in the installation process, the park feature may not engage.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If the park feature does not engage, the vehicle can move without warning, possibly resulting in personal injury or death.</p>	<p><b>REMEDY</b></p> <p>Each vehicle manufacturer will file a defect report and remedy plan for their vehicles which included these automatic transmissions with park feature as original equipment. Eaton is working with the vehicle manufactures to identify vehicles that may contain the defect. The affected vehicles will be repaired free of charge. The safety recall is expected to begin during May or June 2010. Owners may contact their vehicle manufacturer or Eaton at 1-216-523-4077.</p>
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b></p> <p>DETROIT DIESEL / DD13            DETROIT DIESEL / DD15            DETROIT DIESEL / DD16</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> ENGINE AND ENGINE COOLING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 34069</p> <p><b>SUMMARY:</b> DTNA is recalling certain Detroit diesel engines, models dd13, dd15, and dd16, manufactured from January 1, 2007 through april 5, 2010, installed as original equipment in certain heavy duty trucks. Should the fuel filter become restricted, the low pressure fuel flange may develop a crack resulting in a leak of diesel fuel.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Diesel fuel leaking onto the roadway may result in a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>DTNA will notify owners and repairs will be performed by Detroit diesel free of charge. Each vehicle manufacturer will file a defect report and remedy plan for their vehicles which included these engines as original equipment. The safety recall is expected to begin during May 2010. Owners may contact Detroit diesel at 1-313-592-5800 or Daimler trucks at 1-800-547-0712.</p>

**AUTO: MOTOR VEHICLE EQUIPMENT**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>TIRE BRAND NAME / TIRE LINE / TIRE SIZE:</b> AVON / COBRA AV72 / 240/50R16 84V</p> <p><b>MANUFACTURER:</b> MAX-TRAC TIRE CO., INC.</p> <p><b>COMPONENT:</b> TIRES:TREAD/BELT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 64</p> <p><b>SUMMARY:</b> MAX-TRAC, DBA AVON motorcycle tyres, is recalling certain Avon cobra av72 motorcycles tires, size 240/50r16 84v, produced from October 11 through november 7, 2009. These tires fail to comply with federal motor vehicle safety standard no 119, "new pneumatic tires for motor vehicles with a gvwr of more than 4,536 kilograms (10,000 pounds) and motorcycles." separation of the breaker / ply can occur resulting in early failure.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Should this occur, the tread may separate from the tire casing increasing the risk of a vehicle crash.</p>	<p><b>REMEDY</b></p> <p>AVON motorcycle tyres will notify owners and replace the tires free of charge, including mounting and balancing. The safety recall is expected to begin during May 2010. Owners may contact Avon motorcycle tyres north america at 1-800-642-7470, option 5.</p>
EU/GERMANY	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Motorcycle handlebars - Bonanza</p> <p><b>BRAND:</b> Santee Designer Series</p> <p><b>TYPE/NUMBER OF MODEL:</b> Part numbers: CCE 696732, CCE 696702, CCE 696733, CCE 696703, CCE 696735, CCE 696705, CCE 696736, CCE 696706.</p> <p><b>DESCRIPTION:</b> Aftermarket handlebars for motorcycles. "High" and "Medium". Both models in black or chrome-plated.</p> <p><b>COUNTRY OF ORIGIN:</b> Taiwan</p> 	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries because the welding seams may develop cracks and, in extreme cases, break altogether.</p>	<p>Voluntary recall from consumers by the importer.</p>

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[Product.Recalls@sgs.com](mailto:Product.Recalls@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

**SGS**