

# PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS  
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

1 – 15 JUNE 2010

## CONTENTS

### AUTOMOTIVE

Pages 1 to 20




[Motor Vehicle \(38\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(1\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Volvo—S80, XC70 and XC60</p> <p><b>PRODUCT DESCRIPTION</b> S80, XC70 and XC60 model year 2009, equipped with a D5 diesel engine.</p> <p><b>IDENTIFYING FEATURES</b> Between the VIN range of: S80: 087016-106230 XC70: 047520-065138 XC60: 000001-028507 Target Number:484 Campaign Number: R29108</p> <p><b>SUPPLIER</b> Volvo Car Australia Pty Ltd No picture available.</p>	<p><b>HAZARDS</b> If the deviation occurs the driver may notice noise and in the worst case scenario, it could lead to loss of drive resulting in immobility of the vehicle and loss of power steering assistance.</p> <p><b>DEFECTS</b> Investigations have identified early war on the the belt tensioner.</p>	<p><b>CONSUMERS ACTION</b> Contact your Volvo Dealer to replace the belt and the belt tensioner.</p>
EU/GERMANY	<p><b>CATEGORY:</b> Motor vehicles <b>PRODUCT:</b> Motorcycle <b>BRAND:</b> Honda <b>TYPE/NUMBER OF MODEL:</b> Model VFR1200FA, Type SC63, EC type-approval e4*2002/24*2383*00</p> <p><b>DESCRIPTION:</b> Motorcycle. Products from model year 2010 are affected. <b>COUNTRY OF ORIGIN:</b> Germany</p> <p>No picture available</p>	<p><b>INJURIES</b> The product poses a risk of injuries because there is a possibility that the hooks fastening the top box to the motorcycle could break causing the top box to fall off and leading to an accident.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>
EU/FRANCE	<p><b>CATEGORY:</b> Motor vehicles <b>PRODUCT:</b> Passenger car <b>BRAND:</b> Chrysler - Sebring Cabriolet <b>TYPE/NUMBER OF MODEL:</b> The recall concerns vehicles manufactured before 13 July 2007. <b>DESCRIPTION:</b> Passenger car <b>COUNTRY OF ORIGIN:</b> United States</p> <p>No picture available</p>	<p><b>INJURIES</b> In certain circumstances, the doors may not be properly locked and could open leading to injuries.</p>	<p>Voluntary corrective actions taken by the manufacturer.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Jazz and Civic</p> <p><b>BRAND:</b> Honda</p> <p><b>TYPE/NUMBER OF MODEL:</b> Jazz: GG4, GG5, GG6 Civic: FN1, FN2, FN3, FN4, FK1, FK2, FK3.</p> <p><b>DESCRIPTION:</b> Passenger car. The recall concerns certain 2010 model year vehicles, manufactured between 2 February 2010 and 6 April 2010 and within the VIN range as indicated in the attached document.</p> <p><b>COUNTRY OF ORIGIN:</b> United Kingdom</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries as a brake pedal pin retaining clip may not be installed, in which case it is possible for the brake pedal pin to become detached.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GREECE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car - Corsa D</p> <p><b>BRAND:</b> Opel</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns 2010 model year vehicles, with VIN numbers from A 4 056611 to B 4 000023 (factory: Zaragoza, Spain) and from A 6 028704 to B 6 000004 (factory: Eisenach, Germany).</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> Spain and Germany</p> <p>no picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries as the handbrake cable end fitting can move into the support bracket, resulting in a loss of the handbrake function which could potentially lead to a road accident.</p>	Voluntary corrective actions taken by the manufacturer.
EU/MALTA	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Toyota Lexus</p> <p><b>TYPE/NUMBER OF MODEL:</b> LS460 and LS600h</p> <p><b>DESCRIPTION:</b> The recall affects certain vehicles equipped with Variable Gear Ratio Steering (VGRS).</p> <p><b>COUNTRY OF ORIGIN:</b> Japan</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>The product poses a risk of injuries as, under some circumstances, the Variable Gear Ratio Steering, "VGRS", system can cause the steering wheel to become off-centred by approximately 90 degrees.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FRANCE	<p><b>CATEGORY:</b> Motor vehicles</p> <p><b>PRODUCT:</b> Passenger car</p> <p><b>BRAND:</b> Chrysler - 300 C</p> <p><b>TYPE/NUMBER OF MODEL:</b> The recall concerns vehicles manufactured between 19 January and 12 March 2008.</p> <p><b>DESCRIPTION:</b> Passenger car</p> <p><b>COUNTRY OF ORIGIN:</b> United States</p> <p>No picture available</p>	<p><b>INJURIES</b></p> <p>In certain circumstances, the wheel nuts may come loose and the wheel could come off.</p>	Voluntary corrective actions taken by the manufacturer.
USA	<p><b>NAME OF PRODUCT:</b> BRP Ski-Doo® Snowmobiles</p> <p><b>UNITS:</b> About 37</p> <p><b>IMPORTER:</b> BRP US Inc., of Sturtevant, Wisconsin</p> <p><b>MANUFACTURER:</b> BRP Finland Oy, Finland</p> <p><b>DESCRIPTION:</b> This recall involves the Ski-Doo snowmobiles model year 2010 Expedition TUV 1200 and model year 2010 Expedition TUV SE 1200. The model year and name are displayed on each side of the snowmobile and on a decal on the right side of the snowmobile.</p> <p><b>MANUFACTURED IN:</b> Finland</p> <div style="text-align: center;">  </div>	<p><b>HAZARD:</b> Friction between the fuel hose and the electronic control unit can cause the fuel hose to wear and leak fuel, posing a fire hazard.</p> <p><b>INCIDENTS/INJURIES:</b> BRP has received six reports of fuel leaks, three of which resulted in vehicle fires. One of the incidents involved a rider suffering superficial burns.</p>	Voluntary recall

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>LABRIE / AUTOMIZER                      2008-2009  LABRIE / AUTOMIZER 2010                      2008  LABRIE / EXPERT T                      2008-2009</p> <p><b>MANUFACTURER:</b> LABRIE ENVIRONMENTAL GROUP</p> <p><b>COMPONENT:</b> SEAT BELTS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 27</p> <p><b>SUMMARY:</b> Labrie is recalling certain model year 2008 and 2009 expert t, automizer, and automizer 2010 garbage and recycling trucks. The female portion of the seat belt can be damaged by the arm rest which is also a joystick bracket.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If the female portion of the seat belt is damaged, the seat belt may not function properly in the event of a crash, increasing the risk of injury to the seat occupant.</p>	<p><b>REMEDY</b></p> <p>Labrie will notify owners and dealers will replace any damaged seat belt and install a deflector to prevent possible damages free of charge. The safety recall is expected to begin during June 2010. Owners may contact labrie at 1-877-4labrie (1-877-452-2743).</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>STARTRANS / MFSAB                      2008-2010</p> <p><b>MANUFACTURER:</b> STARTRANS BUS CORPORATION</p> <p><b>COMPONENT:</b> SEATS:BARRIERS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 130</p> <p><b>SUMMARY:</b> Startrans is recalling certain model year 2008 through 2010 mfsab model school buses manufactured from January 2008 through April 9, 2010, equipped with freedman seat barriers, p/nos. 38764 and 15198. The barrier for leg protection was built using the wrong gauge of material and fails to comply with federal motor vehicle safety standard no. 222, "school bus passenger seating and crash protection."</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event of a crash, the seat occupant(s) may not be adequately protected, increasing the risk of injury.</p>	<p><b>REMEDY</b></p> <p>Startrans will notify owners and repair the buses free of charge. The safety recall is expected to begin during June 2010. Owners may contact startrans at 1-574-642-0810.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>LOAD RITE / LR-AWV2335                      2008-2010  LOAD RITE / WV2450W                      2010</p> <p><b>MANUFACTURER:</b> LOAD RITE TRAILERS, INC.</p> <p><b>COMPONENT:</b> WHEELS:RIM</p> <p><b>SUMMARY:</b> Load rite is recalling certain model year 2008-2010 watercraft personal trailers. The capacity of the rim did not match the capacity of the tire. This causes the wheel assembly to not be sufficient for the application.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>There is a potential for the rim to fail increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will replace the tires and wheels on all trailers free of charge. The safety recall began on May 24, 2010. Owners may contact load rite at 1-215-949-5842.</p>





**AUTO: MOTOR VEHICLE**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>            CAN-AM / ROADSTER SPYDER RS SE5      2010            CAN-AM / ROADSTER SPYDER RT SE5      2010</p> <p><b>MANUFACTURER:</b> BOMBARDIER RECREATIONAL PRODUCTS INC.</p> <p><b>COMPONENT:</b> POWER TRAIN:CLUTCH ASSEMBLY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 1200</p> <p><b>SUMMARY:</b> BRP is recalling certain model year 2010 spyder rs se5 2nd series and RT se5 roadsters. When bringing a vehicle equipped with the se5 semi-automatic transmission to a full stop, the clutch may remain engaged stalling the engine. Once the engine is stalled, it could be impossible to re-start and the rear wheel could be blocked.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If this happens, the vehicle may not be able to be pushed off the roadway increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>BRP will notify owners and dealers will repair the vehicles free of charge. The manufacturer has not yet provided the agency with a notification schedule.</p> <p>Owners may contact brp at 1-888-638-5397.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>            BMW / X5      2011            BMW / X6      2011</p> <p><b>MANUFACTURER:</b> BMW OF NORTH AMERICA, LLC</p> <p><b>COMPONENT:</b> EQUIPMENT:OTHER:LABELS</p> <p><b>SUMMARY:</b> BMW is recalling certain model year 2011 x5 sav and x6 sav passenger vehicles manufactured from April 1 through May 8, 2010. The tire label does not conform to the requirements of federal motor vehicle safety standard no. 110, "tire selection and rims." the vehicles are equipped with 20-inch wheels, but the label states that the vehicles were equipped with 19-inch wheels and the stated tire pressure is incorrect for the equipped wheels.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Improper tire inflation can result in premature tire failure or reduced vehicle handling performance, either of which can increase the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>BMW will notify owners and provide correct labels free of charge. The owner will have the option to affix the label themselves or they may take their vehicle to a bmw dealer who will affix the label for them at no cost. The manufacturer has not yet provided the agency with a notification schedule.</p> <p>Owners may contact bmw at 1-800-525-7417.</p>



**AUTO: MOTOR VEHICLE**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b></p> <p>BUICK / ENCLAVE                      2008-2009            BUICK / LUCERNE                      2006-2009            CADILLAC / CTS                              2008-2009            CADILLAC / DTS                              2006-2009            CADILLAC / ESCALADE                      2007-2009            CADILLAC / ESCALADE ESV                      2007-2009            CADILLAC / ESCALADE EXT                      2007-2009            CHEVROLET / AVALANCHE                      2007-2009            CHEVROLET / SILVERADO 3500                      2007-2009            CHEVROLET / SUBURBAN                      2007-2009            CHEVROLET / TAHOE                              2007-2009            CHEVROLET / TRAVERSE                              2009            GMC / ACADIA                              2007-2009            GMC / SIERRA                              2007-2009            GMC / YUKON                              2007-2009            GMC / YUKON XL                              2007-2009            HUMMER / H2                              2006-2009            SATURN / OUTLOOK                              2007-2009</p> <p><b>MANUFACTURER:</b> GENERAL MOTORS CORP.  <b>COMPONENT:</b> ELECTRICAL SYSTEM  <b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            1365070</p> <p><b>SUMMARY:</b> GM is recalling certain model year 2006-2009 buick, lucerne; cadillac dts; hummer h2; model year 2008-2009 buick enclave; cadillac cts; model year 2007-2009 cadillac escalade, escalade esv, escalade ext; chevrolet avalanche, silverado, suburban, tahoe; gmc acadia, sierra, yukon, yukon xl; saturn outlook; and model year 2009 chevrolet traverse vehicles equipped with a heated washer fluid system (hwfs). A recall was implemented in 2008 to add a fuse to the control circuit harness to address the potential consequences of a printed circuit board (PCB) electrical short. However, there have been new reports of thermal incidents on hwfs modules after this improvement was installed. These incidents resulted from a new failure mode attributed to the device's thermal protection feature. The significance varies from minor distortion to considerable melting of the plastic around the hwfs fluid chamber.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>It is possible for the heated washer module to ignite and a fire may occur.</p>	<p><b>REMEDY</b></p> <p>Dealers will permanently disable and remove the heated washer fluid module. An updated page for the owner manual will be provided and inserted in the owner manual to document that the feature has been permanently disabled and removed from the vehicle. The safety recall is expected to begin on or before June 14, 2010. Owners may contact Buick at 1-866-608-8080, Cadillac at 1-866-982-2339, Chevrolet at 1-800-630-2438, Saturn at 1-800-972-8876, gmc at 1-866-996-9463 and hummer at 1-800-732-5493 or at the owner center at <a href="http://www.gmownercenter.com">www.gmownercenter.com</a>.</p>

AUTO: MOTOR VEHICLE											
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED								
USA	<p><b>VEHICLE MAKE / MODEL</b> KEYSTONE / COUGAR HIGH COUNTRY</p> <p><b>MODEL YEAR(S):</b> 2010-2011</p> <p><b>MANUFACTURER:</b> KEYSTONE RV COMPANY</p> <p><b>COMPONENT:</b> STRUCTURE:BODY</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 20</p> <p><b>SUMMARY:</b> Keystone RV is recalling certain model year 2010 and 2011 cougar high country fifth wheels manufactured from April 15 through May 3, 2010. The rear bedroom is missing an egress window.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>In the event an emergency evacuation is necessary, not having the egress window will increase the risk of personal injury.</p>	<p><b>REMEDY</b></p> <p>Keystone RV will notify owners and the currently installed window will be replaced with an egress window free of charge. The safety recall is expected to begin during June 2010. owners may contact keystone at 1-866-425-4369.</p>								
USA	<table border="0"> <tr> <td><b>VEHICLE MAKE / MODEL</b></td> <td><b>MODEL YEAR(S)</b></td> </tr> <tr> <td>FORD / E150</td> <td>2007-2009</td> </tr> <tr> <td>FORD / E250</td> <td>2007-2009</td> </tr> <tr> <td>FORD / E350</td> <td>2007-2009</td> </tr> </table> <p><b>MANUFACTURER:</b> MOBILITY TRANSPORTATION SERVICES</p> <p><b>COMPONENT:</b> EQUIPMENT ADAPTIVE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 60</p> <p><b>SUMMARY:</b> Mobility transportation (mts) is recalling certain model year 2007 through 2009 conversion vans built on ford e150, e250, and e350 chassis from September 16, 2008 through April 15, 2009 and fitted with ricon public use lifts. The restraint belt on these lifts was designed to prevent the lift from moving, unless the tongue of the belt is fully engaged and latched in the buckle. Ricon has discovered, however, that it is possible for the operator to insert the belt tongue into the buckle without fully engaging the latching mechanism. In this case, the restraint belt would appear to be latched, and the operator could run the lift. If the restraint belt tongue is not fully engaged into the restraint belt buckle, and latched, the lift may operate with an occupant on the platform.</p> <p>No picture available.</p>	<b>VEHICLE MAKE / MODEL</b>	<b>MODEL YEAR(S)</b>	FORD / E150	2007-2009	FORD / E250	2007-2009	FORD / E350	2007-2009	<p><b>CONSEQUENCE</b></p> <p>The user of the lift could be injured should the lift move without the restraint belt properly buckled.</p>	<p><b>REMEDY</b></p> <p>MTS is working with ricon and ricon will be performing the remedy for this campaign. Please see ricon's defect report 09e-060. Ricon will provide customers with a warning decal and a dvd-based training aid. The safety recall is expected to begin during June 2010. Owners may contact ricon at 1-818-267-3000 or mts at 1-734-453-6452.</p>
<b>VEHICLE MAKE / MODEL</b>	<b>MODEL YEAR(S)</b>										
FORD / E150	2007-2009										
FORD / E250	2007-2009										
FORD / E350	2007-2009										



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b>            KEYSTONE / RESIDENCE                      2010-2011</p> <p><b>MANUFACTURER:</b> KEYSTONE RV COMPANY</p> <p><b>COMPONENT:</b> EQUIPMENT:RECREATIONAL VEHICLE</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            43</p> <p><b>SUMMARY:</b> Keystone is recalling certain model year 2010-2011 residence travel trailers. A 30 amp breaker was installed on the washer/dryer circuit and it needs a 20 amp breaker.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>An improper protected electrical circuit will increase the risk of property damage and personal injury.</p>	<p><b>REMEDY</b></p> <p>Dealers will replace the 30 amp breaker with a 20 amp breaker free of charge. The safety recall is expected to begin during June 2010. Owners may contact keystone customer service at 1-866-425-4369.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b>            BMW / 1 SERIES                                      2008-2011</p> <p><b>MANUFACTURER:</b> BMW OF NORTH AMERICA, LLC</p> <p><b>COMPONENT:</b> SEAT BELTS:FRONT:RETRACTOR</p> <p><b>SUMMARY:</b> BMW is recalling certain model year 2008-2011 1-series vehicles. In a crash of sufficient severity, deployment of the front pretensioner and load-limiter occurs.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The insulation around the pretensioner could ignite.</p>	<p><b>REMEDY</b></p> <p>The manufacturer has not yet provided a remedy or an owner notification schedule for this campaign. Owners may contact bmw at 1-800-525-7417.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>      <b>MODEL YEAR(S)</b>            VOLKSWAGEN / ROUTAN                                      2009</p> <p><b>MANUFACTURER:</b> VOLKSWAGEN OF AMERICA, INC</p> <p><b>COMPONENT:</b> ELECTRICAL SYSTEM:WIRING</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>            15902</p> <p><b>SUMMARY:</b> Volkswagen is recalling certain model year 2009 routan vehicles manufactured from June 2008 through July 2009. These vehicles may have been built with an improper routed wire harness that may have a condition where the lower sliding door hinge bracket can make contact and wear through the wire insulation. Contact with a 12v power feed circuit within the harness may cause a high resistive short circuit within the latch mechanism located inside of the sliding door.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>This could result in an overheated latch and a fire within the rear sliding door could occur.</p>	<p><b>REMEDY</b></p> <p>Volkswagen will inspect the sliding door wire track wire assembly and the sliding door power drive unit wire assembly for damage, repair/replace as necessary, tie strap the two harnesses together and route the harnesses under the sliding door weather strip. This service will be performed free of charge. The safety recall is expected to begin during June 2010. Owners may contact Volkswagen at 1-800-822-8987.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>  FLEETWOOD / BOUNDER                      2010  FLEETWOOD / BOUNDER CLASSIC            2010  FLEETWOOD / FIESTA                            2010  FLEETWOOD / SOUTHWIND                    2010  FLEETWOOD / TERRA                            2010</p> <p><b>MANUFACTURER:</b> FLEETWOOD RV, INC.  <b>COMPONENT:</b> ELECTRICAL  SYSTEM:ALTERNATOR/GENERATOR/  REGULATOR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  44</p> <p><b>SUMMARY:</b> Fleetwood rv is recalling certain model year 2010 bounder, bounder classic, fiesta, southwind and terra class a motor homes manufactured from march 11, 2010 through march 30, 2010. These motor homes were built on workhorse custom chassis and with general motors gasoline engines and equipped with remy alternator. A low resistance electrical short in the alternator's voltage regulator may occur.  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>An electrical short in the alternator may occur without warning possibly resulting in a vehicle fire.</p>	<p><b>REMEDY</b></p> <p>Dealers will inspect and replace the alternator if necessary free of charge. Navistar/workhorse is handing the owner notification and remedy for this campaign please see navistar/workhorse's defect report 10v-158. Owners may contact navistar/workhorse at 1-877-246-7731.</p>
USA	<p><b>VEHICLE MAKE / MODEL      MODEL YEAR(S)</b>  STERLING / 360                                      2008-2009</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA  <b>COMPONENT:</b> SERVICE BRAKES, HYDRAULIC</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b>  407</p> <p><b>SUMMARY:</b> Daimler trucks is recalling certain model year 2008-2009 sterling 360 vehicles manufactured from august 8, 2007 through july 31, 2008. the ground harness connector for the abs hydraulic unit may become corroded due intrusion potentially causing the abs hydraulic motor to run continuously.  No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>The abs hydraulic motor may overheat potentially resulting in a fire.</p>	<p><b>REMEDY</b></p> <p>The ground sub harness will be replaced with a properly waterproofed harness. The abs hydraulic unit and the connector terminals will be inspected for damage and corrosion and if necessary replaced free of charge. The safety recall is expected to begin on or before august 13, 2010. Owners may contact Daimler trucks at 1-800-547-0712.</p>



AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL</b>    <b>MODEL YEAR(S)</b></p> <p>DUTCHMEN / FREEDOM SPIRIT                      2009</p> <p><b>MANUFACTURER:</b> DUTCHMEN MANUFACTURING, INC.</p> <p><b>COMPONENT:</b> EQUIPMENT:OTHER:LABELS</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 100</p> <p><b>SUMMARY:</b> Dutchmen is recalling certain model year 2009 freedom spirit recreational vehicles manufactured from march 12, 2009 through march 25, 2009 for failing to comply with the requirements of part 567, "certification." the federal label and tire loading information label does not contain the correct tire information. The labels list the wrong tire size.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>A consumer could replace the tires with tires of an incorrect size which may impact vehicle performance and handling increasing the risk of a crash.</p>	<p><b>REMEDY</b></p> <p>Dealers will mail to consumers the correct tire information label. If the consumer requires assistance installing the labels, dealers will perform the installation free of charge. The recall is expected to begin on or before June 14, 2010. Owners may contact the Dutchmen warranty service department at 866-869-1109.</p>
USA	<p><b>VEHICLE MAKE / MODEL</b>    <b>MODEL YEAR(S)</b></p> <p>SPARTAN / GLADIATOR                              2008-2010</p> <p>SPARTAN / METROSTAR                              2009-2010</p> <p><b>MANUFACTURER:</b> SPARTAN CHASSIS, INC.</p> <p><b>COMPONENT:</b> SERVICE BRAKES, AIR</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 66</p> <p><b>SUMMARY:</b> Spartan is recalling certain model year 2008 through 2010 gladiator and metrostar incomplete fire apparatus chassis cabs manufactured from November 14, 2008 through May 25, 2010, equipped with tandem rear axles and electronic stability control (esc). The vehicles fail to meet the service brake release requirements of federal motor vehicle safety standard no. 121, "air brake systems." specifically, additional valving required for the esc system reduced the air flow and volume to the brake chambers resulting in slower service brake release timing.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Service brake release timing that does not meet the minimum requirements of fmvss 121 may result in less efficient braking performance and will prevent the vehicle from being moved in a timely fashion.</p>	<p><b>REMEDY</b></p> <p>Spartan will notify owners and dealers will replace the .38 inch inside diameter brake hose to a .50 inch inside diameter hose free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact spartan chassis at 1-800-543-5008 - option 5.</p>









AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>VEHICLE MAKE / MODEL:</b> THOMAS BUILT BUSES / SAF-T-LINER C2</p> <p><b>MODEL YEAR(S):</b> 2011</p> <p><b>MANUFACTURER:</b> DAIMLER TRUCKS NORTH AMERICA</p> <p><b>COMPONENT:</b> POWER TRAIN:AUTOMATIC TRANSMISSION</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 39</p> <p><b>SUMMARY:</b>            DTNA is recall certain model year 2001 Thomas built saf-t-liner c2 school buses manufactured from April 16, 2009 through May 10, 2010, and equipped with certain Eaton hybrid transmissions with park feature. The reverse idler shaft may contact the park feature and the two components may bind, preventing the park feature from engaging.             No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>If the park feature does not engage, the vehicle can move without warning, possibly resulting in personal injury or a crash.</p>	<p><b>REMEDY</b></p> <p>DTNA will notify owners and the remedy will be performed by Eaton corporation free of charge. The safety recall is expected to begin on or about august 27, 2010. Owners may contact dtna at 1-800-547-0712 or Eaton at 1-800-826-4357 or 1-269-342-3242.</p>

**AUTO: MOTOR VEHICLE EQUIPMENT**

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p><b>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</b> ROLL-RITE / SOLID STATE RELAY MODULE</p> <p><b>MANUFACTURER:</b> ROLL-RITE, LLC</p> <p><b>COMPONENT:</b> EQUIPMENT</p> <p><b>POTENTIAL NUMBER OF UNITS AFFECTED:</b> 2377</p> <p><b>SUMMARY:</b> Roll-rite is recalling certain of its roll-rite, tarp master, super duty, and tarp stretcher aftermarket electric truck tarp systems and assemblies that contain the solid state relay module, sold separately (p/n 10999), as part of an electric kit w/rocker switch &amp; solid state relay, (p/n 10990), as part of an electric kit w/rotary switch &amp; solid state relay, (p/n 10995), or with various other tarp assemblies. Improper installation and/or short circuit in the motor leads may cause the solid state relay module to overheat or burn.</p> <p>No picture available.</p>	<p><b>CONSEQUENCE</b></p> <p>Overheating or burning of the relay module could result in a fire.</p>	<p><b>REMEDY</b></p> <p>The remedy for this defect has not yet been finalized. The safety recall is expected to begin during June 2010. Owners may contact roll-rite at 1-989-345-3434.</p>

GCSC has compiled the below sources:

#### **PRODUCT RECALLS IN EUROPE**

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

[http://ec.europa.eu/consumers/dyna/rapex/rapex\\_archives\\_en.cfm](http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm)

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

#### **PRODUCT RECALLS IN THE USA**

National Highway Traffic Safety Administration (NHTSA)

[www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm](http://www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm) (US Automotive recalls)

#### **PRODUCT RECALLS IN AUSTRALIA**

<http://www.recalls.gov.au/>

---

#### **FOR ENQUIRIES**

[Product.Recalls@sgs.com](mailto:Product.Recalls@sgs.com)

[www.sgs.com/regulatorycompliance](http://www.sgs.com/regulatorycompliance)

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

**WHEN YOU NEED TO BE SURE**

**SGS**