

PRODUCT RECALLS

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

01 – 15 NOVEMBER 2010

CONTENTS

AUTOMOTIVE

Pages 1 to 25



[Motor Vehicle \(42\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(11\)](#)















AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/IRELAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car GS300</p> <p>BRAND: Lexus</p> <p>TYPE/NUMBER OF MODEL: Production period 28 September 2004 through 28 February 2006</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available</p>	<p>INJURIES</p> <p>A problem with the fuel pump wiring could cause the engine to stall during driving or make it impossible to restart the engine.</p>	Voluntary corrective actions taken by the manufacturer.
EU/IRELAND	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger cars - GS300, IS220d, IS250, RX300, RX330</p> <p>BRAND: Lexus</p> <p>TYPE/NUMBER OF MODEL: Production periods affected: GS 17 Sep 2004 through 28 Feb 2006, IS 27 May 2005 through 20 Mar 2006, RX 10 Feb 2003 through 18 Feb 2006.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available</p>	<p>INJURIES</p> <p>If brake fluid is used that does not contain polymers, or contains only small amounts, part of a seal in the master brake cylinder could become dry and a small amount of the brake fluid could slowly leak, resulting in illumination of the brake warning lamp.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GERMANY	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger cars - Swift</p> <p>BRAND: Suzuki</p> <p>TYPE/NUMBER OF MODEL: Type of vehicle MA, EC type-approval e6*93/81*0027*01, e6*98/14*0027*02, e6*98/14*0027*03, e6*98/14*0027*04</p> <p>DESCRIPTION: The affected vehicles were manufactured between 1997 and 2002 and have a vehicle identification number in the range: TSMMA*****316394 to TSMMA*****908872.</p> <p>COUNTRY OF ORIGIN: Hungary</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries due to possible defects in the coating of the front shock-absorber unit, the brackets holding the stub-axles in place could yield to corrosion. As this corrosion progresses, it is possible that the stub axles could work themselves loose, which could lead to a road accident.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car S60</p> <p>BRAND: Volvo</p> <p>TYPE/NUMBER OF MODEL: The recall concerns model year 2011 cars with VINs from 0000001 to 0003532.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Sweden</p> <p>No picture available</p>	<p>INJURIES</p> <p>The safety catch for the bonnet may not work properly, in which case it would not protect against the risk that the bonnet may open whilst driving.</p>	Voluntary corrective actions taken by the manufacturer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger cars S40/V50/C30</p> <p>BRAND: Volvo</p> <p>TYPE/NUMBER OF MODEL: The recall concerns model year 2011 vehicles equipped with 4-cylinder or 5-cylinder petrol engines. The VINs of the affected vehicles are the following: S40: from 0530029 to 0530991 C30: from 0220053 to 0221407 V50: from 0590038 to 0592370.</p> <p>DESCRIPTION: Passenger car</p> <p>COUNTRY OF ORIGIN: Sweden</p> <p>No picture available</p>	<p>INJURIES</p> <p>A problem with the seals connecting the engine coolant bleeder hoses to the coolant expansion tank, may result in a loss of engine coolant and/or air leakage into the engine cooling system. In a worst case scenario, depending on driving conditions, this may appear very rapidly and could result in the engine breaking down which could lead to a road accident.</p>	Voluntary corrective actions taken by the manufacturer.
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car</p> <p>BRAND: Volvo</p> <p>TYPE/NUMBER OF MODEL: S80, V70, XC70, XC60 (5-cylinder diesel engine, D5244T14); model year 2010. VIN's attached.</p> <p>DESCRIPTION: Passenger car.</p> <p>COUNTRY OF ORIGIN: Sweden</p> <p>No picture available</p>	<p>INJURIES</p> <p>The use of biodiesel fuel blends may lead to increased engine oil level due to fuel dilution of the engine oil. If the engine oil level rises over the maximum level as indicated by the oil level gauge on the instrument panel it may eventually reach a level where the oil could enter the cylinders and act as fuel. In a worst case scenario this may lead to maintained or increased engine speed, potentially leading to engine breakdown. If this happens while driving it may lead to a road accident.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Van - Master III</p> <p>BRAND: Renault</p> <p>TYPE/NUMBER OF MODEL: Vehicles affected: since production began up to 09/07/2010. Fabrication numbers: B000002 to B017451.</p> <p>DESCRIPTION: Light commercial vehicle/van.</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available</p>	<p>INJURIES</p> <p>The fitting brackets that make the connection between the seats and the seatbelts may be interchanged for the left and right front seats, in which case there is a risk that the seatbelt will not hold the occupant in the seat in the event of an impact.</p>	Voluntary corrective actions taken by the manufacturer.
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger cars - Navara, Pathfinder, Micra</p> <p>BRAND: Nissan</p> <p>TYPE/NUMBER OF MODEL: Navara (D40), Pathfinder (R51) and Micra (K12).</p> <p>DESCRIPTION: Commercial and Passenger Cars: - Micra with VIN's (SJNFBK12U1) 000113 – 444382 and production period: 29 January 2004 to 28 June 2006 - Pathfinder (R51) with VIN's (VSKJLWR51U0) 022307 – 900533.</p> <p>COUNTRY OF ORIGIN: Spain and United Kingdom</p> <p>No picture available</p>	<p>INJURIES</p> <p>The products pose a risk of injuries because the ignition and ECM relay contacts, in the IPDM, may become contaminated with a build up of silicon oxide from the relay diode. This can lead to poor conduction at the relays contacts. In an extreme case, this can result in electric problems, engine stall and failure to restart the vehicle.</p>	Voluntary corrective actions taken by the manufacturer.
EU/PORTUGAL	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Van - Master</p> <p>BRAND: Renault</p> <p>TYPE/NUMBER OF MODEL: Master III</p> <p>DESCRIPTION: Light Commercial Vehicle. Production period: up to 16 April 2010. Fabrication numbers: B000001 to B006693.</p> <p>COUNTRY OF ORIGIN: France</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries because the left spindle axle of the rear axle may crack which can in the most serious cases lead to it breaking.</p>	Voluntary corrective actions taken by the manufacturer.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Passenger car - Legend</p> <p>BRAND: Honda</p> <p>TYPE/NUMBER OF MODEL: Legend (model code: KB1)</p> <p>DESCRIPTION: The recall concerns certain 2005, 2006 and 2007 model year vehicles, manufactured between 23 December 2005 and 6 February 2007 and within the VIN range from JHMKB1***7C200006 to JHMKB1***7C204817.</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries (accident) because during regular brake fluid replacement or brake bleeding operations, it may be possible for a seal in the brake master cylinder to become deformed resulting in a small brake fluid leak. If the brake fluid level reduces significantly, the brake warning light and low brake fluid warning light will be activated in the instrument panel. If the vehicle is continued to be driven in this condition, the brake pedal stroke will gradually increase. Finally, if the above symptoms are ignored, one of the brake circuits may fail. Although the remaining circuit provides sufficient brake force to stop the vehicle, the stopping distance will increase.</p>	Voluntary corrective actions taken by the importer.
EU/GREECE	<p>CATEGORY: Motor vehicles</p> <p>PRODUCT: Motorcycles - Kawasaki VN</p> <p>BRAND: Kawasaki</p> <p>TYPE/NUMBER OF MODEL: Motorcycles, models VN1700 Voyager, VN1700 Classic Tourer and VN1700 Classic</p> <p>DESCRIPTION: The recall affects MY 2009 and 2010 motorcycles with serial numbers: VN1700B9F: from JKBVNT70ABA000184 to JKBVNT70ABA001858 VN1700BAF: from JKBVNT70ABA003379 to JKBVNT70ABA004612 VN1700C9F/C9FA: from JKBVNT70CCA000045 to JKBVNT70ABA002698 VN1700DAF: from JKBVNT70CDA005026 to JKBVNT70CDA006139 VN1700E9F: from JKBVNT70EEA000045 to JKBVNT70EEA001586 VN1700FAF: from JKBVNT70EFA004028 to JKBVNT70EFA004356</p> <p>COUNTRY OF ORIGIN: Japan</p> <p>No picture available</p>	<p>INJURIES</p> <p>The product poses a risk of injuries (accident) because the engine may stall under deceleration due to an improper setting of the ECU (electronic control unit). This may cause the rider to lose balance and could result in an accident.</p>	Voluntary corrective actions taken by the importer.

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	HAZARD	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Golf cars and hospitality, utility and transport vehicles</p> <p>UNITS: About 5,000</p> <p>MANUFACTURER: Club Car, LLC of Augusta, Ga.</p> <p>DESCRIPTION: The recalled vehicles are Model 2010 DS golf cars and hospitality, utility and transport vehicles used for short-distance transportation. They are various sizes, models and colors. The vehicles can be identified by the serial number, which is above and to the right of the accelerator pedal. A list of models and serial numbers is below.</p> <p>MANUFACTURED IN: U.S.</p> <div> <p><u>Golf Cars and Hospitality Vehicles</u></p> <div>  <p>DS Electric Golf Car IQ System / PowerDrive System 48 AQ 1042-139425 to 1051-160548</p> </div> <div>  <p>DS Gas Golf Car AG 1042-139271 to 1054-160914</p> </div> <div>  <p>Café Express, AF 1039-133641 to 1051-159858</p> </div> <p><u>Transportation and Utility Vehicles</u></p> <div>  <p>Villager 4 FG/TG 1044-143850 to 1050-157489</p> </div> <div>  <p>Villager 6, Villager 6 Plus KG/QS 1040-133688 to 1054-160812</p> </div> <div>  <p>Villager 8 MG/QE 1040-133677 to 1051-159571</p> </div> <div>  <p>Carryall 232 XL/XM 1044-143891 to 1054-160925</p> </div> <div>  <p>TransPorter 4 JS/JT/N/NG 1040-134403 to 1054-160949</p> </div> <div>  <p>TransPorter 6 JP/JQ 1041-136942 to 1050-158272</p> </div> <div>  <p>Carryall 1, Carryall Turf 1 FD/FG/HD/HG 1042-139249 to 1054-160814</p> </div> <div>  <p>Carryall 2, Carryall 2 Plus, Turf 2, Turf 2 Plus EG/PG/QB/QT/RG 1040-133683 to 1054-161253</p> </div> <div>  <p>Carryall 6, Carryall Turf 6 JR/JU/JV/N/NG 1040-133932 to 1054-161146</p> </div> <div>  <p>XRT 800, 810, 850, 900 AE/JM/JY/JZ/XE/XF/XH/XJ/XU 1042-140353 to 1054-160961</p> </div> <div>  <p>Carryall 252, Turf 252 JK/JL/XG/ZG 1040-133693 to 1051-159981</p> </div> <div> <p>Custom Vehicles CQ 1044-143845 to 1044-143847</p> </div> </div>	<p>HAZARD</p> <p>The brake pedal can crack and separate, resulting in a loss of braking ability. This can result in a crash.</p> <p>INCIDENTS/INJURIES</p> <p>Club Car has received two reports of brake pedals breaking. No injuries have been reported.</p>	Voluntary recall

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	<p>Suzuki—Swift, Swift Sport and SX4 Vehicles</p> <p>PRODUCT DESCRIPTION</p> <p>Suzuki Swift and SX4 vehicles.</p> <p>IDENTIFYING FEATURES</p> <p>VIN Range:</p> <p>Swift Sport JSAE ZC31S00204009 - JSAE ZC31S00204880</p> <p>Swift JSAE ZC21S00550104 - JSAE ZC21S00558681</p> <p>SX4 JSAGYA41S00110004 - JSAGYA41S00201588</p> <p>JSAGYC41S00100015 - JSAGYC41S00201097</p> <p>JSAGYC51S00300003</p> <p>Target Number: 14,733</p> <p>Campaign Number: SSR01</p> <p>SUPPLIER</p> <p>Suzuki Australia Pty Limited</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Decreased visibility performance.</p> <p>DEFECTS</p> <p>Due to the absence of pre-coated adhesive (thread lock) on three (3) screws on the outside of each external rear view mirror base, the screw (s) may work loose and cause vibration of the mirror itself.</p>	<p>CONSUMERS ACTION</p> <p>Suzuki will write to all affected owners.</p>
AUSTRALIA	<p>Mercedes-Benz—Type 906 Vito & Sprinter Vans with OM642 Engine—Replace Oil Filler Neck</p> <p>PRODUCT DESCRIPTION</p> <p>Type 906 Vito & Sprinter Vans with OM642 Engine</p> <p>IDENTIFYING FEATURES</p> <p>Chassis Range:</p> <p>Vito Chassis - 545124 to 569599</p> <p>Sprinter Chassis - 421603 to 457428</p> <p>Campaign Number: RC852</p> <p>Target Number: 312</p> <p>SUPPLIER</p> <p>Mercedes-Benz Australia/Pacific Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>If left unattended oil may leak from the engine and result in a hazard to other road users.</p> <p>DEFECTS</p> <p>It is possible that the oil filler neck on these vehicle/s may deform or break resulting in oil leakage.</p>	<p>CONSUMERS ACTION</p> <p>Letters will be sent to affected owners.</p>
AUSTRALIA	<p>Mercedes-Benz—Vito and Viano Vans, type 639—Replace Rear Left and Right Vent Windows</p> <p>PRODUCT DESCRIPTION</p> <p>Mercedes-Benz Vito and Viano Vans, type 639</p> <p>IDENTIFYING FEATURES</p> <p>Chassis Range: 177393 to 257781</p> <p>Campaign Number: RC847</p> <p>Target Number: 33</p> <p>SUPPLIER: Mercedes-Benz Australia/Pacific Pty Ltd</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>Under certain conditions the window pane may detach unexpectedly from its mounting point thereby posing a hazard to other road users.</p> <p>DEFECTS</p> <p>The adhesive strength between the left and right rear vent window and its forward mounting hinge may be insufficient.</p>	<p>CONSUMERS ACTION</p> <p>Letters will be sent to affected owners.</p>

AUTO: MOTOR VEHICLE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>SKYLINE / ALJO 2011 SKYLINE / LAYTON 2011 SKYLINE / NOMAD 2011</p> <p>MANUFACTURER: SKYLINE CORPORATION</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 190</p> <p>SUMMARY: Skyline is recalling certain model year 2011 nomad, aljo, and layton recreational vehicles manufactured from august 1, 2010, through october 8, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Skyline is working with atwood and will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact atwood at 1-574-266-4749 or skyline at tmc 1-574-294-6521.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>MERCEDES BENZ / E 2011 MERCEDES BENZ / GL 2011 MERCEDES BENZ / M 2011 MERCEDES BENZ / R 2011</p> <p>MANUFACTURER: MERCEDES-BENZ USA, LLC.</p> <p>COMPONENT: FUEL SYSTEM, OTHER:FUEL FILTER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2297</p> <p>SUMMARY: Mercedes Benz is recalling certain model year 2011 m-class, model w164, gl-class, model x164, e-class, model w212, r-class, and model v251vehicles. The o-ring may not have been properly lubricated in all cases. Lack of lubrication can lead to leakage of the fuel filter.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Diesel fuel may be deposited on roads and making those roads slippery, increasing the potential for a crash.</p>	<p>REMEDY</p> <p>Dealers will replace the fuel filters free of charge. The safety recall is expected to begin during November 2010. Owners may contact mercedes Benz at 1-800-367-6372.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>FLEETWOOD / JAMBOREE 2011</p> <p>FLEETWOOD / JAMBOREE SPORT 2011</p> <p>FLEETWOOD / STORM 2011</p> <p>FLEETWOOD / TERRA 2011</p> <p>FLEETWOOD / TIOGA 2011</p> <p>FLEETWOOD / TIOGA RANGER 2011</p> <p>MANUFACTURER: FLEETWOOD RV, INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 83</p> <p>SUMMARY: Fleetwood is recalling certain class-a and class-c motor homes equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Fleetwood is working with atwood and will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact atwood at 1-574-266-4749.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>ORION / VI 1995-2000</p> <p>MANUFACTURER: DAIMLER BUSES NORTH AMERICA, INC.</p> <p>COMPONENT: EQUIPMENT ADAPTIVE</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 217</p> <p>SUMMARY: Daimler bus is recalling certain model year 1995 through 2000 transit buses manufactured from January 1996 through December 2000. These buses are configured with a tapped fitting for the hydraulic wheelchair ramp. In the engine compartment connected to the hydraulic pump is a fitting with an adapter for the wheelchair ramp operation. The fitting can crack and cause hydraulic fluid to leak into the engine compartment.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Hydraulic fluids leaking into the engine compartment can be ignited by the hot turbocharger and cause an engine fire.</p>	<p>REMEDY</p> <p>Bus owners will be instructed on how to repair the buses free of charge. The safety recall is expected to begin during December 2010. Owners may contact Daimler buses at 1-800-716-7566.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>KENWORTH / T660 2009-2011</p> <p>KENWORTH / T700 2009-2011</p> <p>KENWORTH / T800 2009-2011</p> <p>KENWORTH / W900 2009-2011</p> <p>MANUFACTURER: PACCAR INCORPORATED</p> <p>COMPONENT: SERVICE BRAKES, AIR:DISC:CALIPER</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 417</p> <p>SUMMARY: Paccar is recalling certain model year kenworth t660, t700, t800 and w900 vehicles manufactured from December 22, 2010, through august 2, 2010, and equipped with ag400l air disc brakes. The air disc brake caliper could be installed on the wrong side of the drive axle potentially causing interference with the suspension bracket and the rear suspension as the outermost brake pads wear and the floating caliper moves inboard.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>As this interference gets larger, this could eventually lead to reduced braking performance, increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will verify the correct orientation of the brake caliper and perform the necessary repair free of charge. The safety recall is expected to begin during November 2010. Owners may contact kenworth at 425 -828-5440.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>SUNNYBROOK / EDGEWATER 2011</p> <p>SUNNYBROOK / HARMONY 2011</p> <p>SUNNYBROOK / SUNSET CREEK 2011</p> <p>MANUFACTURER: SUNNYBROOK RV INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 21</p> <p>SUMMARY: Sunnybrook is recalling certain recreational vehicles equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.</p>	<p>REMEDY</p> <p>Sunnybrook is working with atwood and will replace or repair the stoves free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact atwood at 1-574-266-4749 or sunnybrook at 574-825-5250.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>UNNYBROOK / BRISTOL BAY 2006-2009</p> <p>SUNNYBROOK / TITAN 2003-2009</p> <p>SUNNYBROOK / WEST POINTE 2009</p> <p>MANUFACTURER: SUNNYBROOK RV INC.</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 608</p> <p>SUMMARY: Sunnybrook is recalling certain recreational vehicles, manufactured from October 2002 through May 2008, equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An overheated receiver could cause a fire.</p>	<p>REMEDY</p> <p>Sunnybrook is working with dimplex and dimplex will provide owners a free replacement plug-in remote control kit. The manufacturer has not yet provided an owner notification schedule. Owners may contact dimplex North America customer service at 1-888-346-7539.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>MACK / CHU 2011</p> <p>MACK / CXU 2011</p> <p>MANUFACTURER: MACK TRUCKS, INC</p> <p>COMPONENT: VISIBILITY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 21</p> <p>SUMMARY: Mack trucks is recalling certain model year 2011 chu and cxu, heavy trucks manufactured from july 13, 2010, through august 13, 2010, without rear mud flap hanger brackets. These vehicles fail to comply with the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment." the rear conspicuity treatment typically found on the mud flap hanger brackets may not have been installed in the alternate positions as allowed in the regulation on vehicles manufactured without rear mud flap hanger brackets.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>Lack of reflectors could lead to reduced visibility of the vehicle increasing the risk of a crash.</p>	<p>REMEDY</p> <p>Dealers will inspect and install conspicuity treatment as required free of charge. The safety recall is expected to begin on or before December 1, 2010. Owners may contact mack trucks at 1-800-866-1177.</p>

AUTO: MOTOR VEHICLE				
NOTIFYING COUNTRY	PRODUCT	DATE	RECALL TYPE	RECALL STATUS
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) PRIME TIME / PRIME TIME 2011 MANUFACTURER: PRIME TIME MANUFACTURING COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE POTENTIAL NUMBER OF UNITS AFFECTED: 511 SUMMARY: Prime time is recalling certain model year 2011 prime time recreational vehicles manufactured from June 30, 2010, through September 23, 2010, equipped with atwood 35 series range ovens. A potential exists for a small fracture within the line delivering gas to the oven cavity burner. Such a fracture may cause propane gas to leak from the line. No picture available.	2010-11-15	MANDATORY	RECALL
			CONSEQUENCE	REMEDY
			A propane leak in the presence of an ignition source could result in a fire and/or explosion causing property damage and/or personal injury.	Prime time is working with atwood and atwood will replace or repair the stoves free of charge. The safety recall is expected to begin on or about November 15, 2010. Owners may contact atwood at 1-574-266-4749 or prime time at 1- 574-862-3033.
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) FREIGHTLINER / CASCADIA 2011 FREIGHTLINER / CENTURY 2011 FREIGHTLINER / COLUMBIA 2011 FREIGHTLINER / CORONADO 2011 FREIGHTLINER / M2 2011 WESTERN STAR / 4900 2011 MANUFACTURER: DAIMLER TRUCKS NORTH AMERICA COMPONENT: EQUIPMENT:OTHER:LABELS POTENTIAL NUMBER OF UNITS AFFECTED: 7466 SUMMARY: Daimler trucks is recalling certain model year 2011 freightliner coronado, columbia, fld military, business class m2, cascadia, century, and western star 4900 trucks manufactured from august 9, 2010, through october 27, 2010 for failing to comply with the requirements of federal motor vehicle safety standard no. 110, "tire selection and rims." these vehicles were equipped with labels missing recommended cold tire inflation pressures. No picture available.	2010-11-15	MANDATORY	RECALL
			CONSEQUENCE	REMEDY
			Failure to follow proper tire inflation recommendations can result in tire failure, increasing the risk of a crash.	Labels with missing information will be replaced with corrected labels. This service will be performed free of charge. The safety recall is expected to begin on or before January 15, 2011. Owners may contact Daimler trucks at 1-800-547-0712.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>FORD / LIMO COACH 2001-2002 2005</p> <p>FORD / MPV 2001-2002 2004 2006</p> <p>FORD / MPV BUS 2001-2005</p> <p>FORD / ODYSSEY 2002-2007</p> <p>FORD / ODYSSEY XL 2004</p> <p>FORD / TERRA TRANSIT 2000-2006</p> <p>GM / LIMO COACH 2001</p> <p>GM / MPV BUS 2001-2002 2004-2007</p> <p>GM / ODYSSEY 2006-2007</p> <p>GM / ODYSSEY XL 2004-2007</p> <p>GM / TERRA TRANSIT 2000-2003 2005-2006</p> <p>MANUFACTURER: TURTLE TOP</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1817</p> <p>SUMMARY: Turtle top is recalling certain model year 2001-2007 transit buses built on various gm and ford chassis from august 2, 1999 through september 1, 2007, equipped with trans/air ta73 evaporators. The evaporator utilizes a power resistor to regulate blower speed. Should a short occur in the "low or medium speed" circuit while the blower is in high speed, the short will cause the supply voltage to feedback through the resistor to ground, not drawing enough current to trip the fuse.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This would cause the resistor temperature to rise to a point where it will melt and possibly ignite the plastic blower housing to which it is mounted. The overheating can result in a fire.</p>	<p>REMEDY</p> <p>Turtle top, in cooperation with trans/air, will install a thermal shutdown device in series with the speed resistors. This service will be performed free of charge. The safety recall is expected to begin during november 2010. owners may contact trans/air warranty and service center at 1-800-673-2446.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>JAYCO / JAY FEATHER SELECT 2011</p> <p>MANUFACTURER: JAYCO, INC.</p> <p>COMPONENT: EXTERIOR LIGHTING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 44</p> <p>SUMMARY: Certain model year 2011 jayco model jay feather select travel trailers series 29l manufactured from May 11, 2010, through September 10, 2010, are missing the intermediate side marker light. If the side marker is missing, vehicles over 30 feet in overall length do not conform to the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment."</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A missing required item of vehicle lighting equipment may reduce the vehicle's visibility to other drivers, increasing the risk of a vehicle crash.</p>	<p>REMEDY</p> <p>Jayco will notify owners and install the missing side marker light free of charge. The safety recall is expected to begin during November 2010. Owners may contact jayco at 1-574-825-0608.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>STARCRAFT / TRAVEL STAR 2011</p> <p>MANUFACTURER: STARCRAFT RV, INC.</p> <p>COMPONENT: EXTERIOR LIGHTING</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>8</p> <p>SUMMARY: Certain model year 2011 starcraft travel star travel trailers manufactured from May 5, 2010, through August 12, 2010, are missing the intermediate side marker light. If the side marker is missing, vehicles over 30 feet in overall length do not conform to the requirements of federal motor vehicle safety standard no. 108, "lamps, reflective devices, and associated equipment."</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A missing required item of vehicle lighting equipment may reduce the vehicle's visibility to other drivers, increasing the risk of a vehicle crash.</p>	<p>REMEDY</p> <p>Starcraft will notify owners and install the missing side marker light free of charge. The safety recall is expected to begin during November 2010. Owners may contact starcraft at 1-800-945-4787.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>CHIEF / CROWN 2005</p> <p>CHIEF / GENESIS 2006</p> <p>CHIEF / ROYAL VILLA 2005-2007</p> <p>CHIEF / ROYALITE 2005</p> <p>MANUFACTURER: CHIEF INDUSTRIES</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>12</p> <p>SUMMARY: King of the road is recalling certain recreational vehicles manufactured from November 1, 2004, through June 30, 2006, and equipped with dimplex electraflame, symphony, or optiflame branded electric fireplaces, stoves, and fireplace inserts. The plug in remote control receiver for the fireplace can overheat.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>This could result in a fire.</p>	<p>REMEDY</p> <p>King of the road is working with dimplex and will provide owners a free replacement plug-in remote control kit. The safety recall is expected to begin during November 2010. Owners may contact king of the road at 1-800-400-9840 or dimplex North America customer service at 1-888-346-7539.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>STARCRAFT / TRAVEL STAR 2011</p> <p>MANUFACTURER: STARCRAFT RV, INC.</p> <p>COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE:LPG LINES AND FITTINGS</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED:</p> <p>3</p> <p>SUMMARY: Starcraft is recalling certain model year 2011 travel star trailers series 299bhs, manufactured from June 24, 2010, through august 5, 2010. During the course of a routine inspection, it was discovered that the stove in the exterior kitchen was not being tested for LP leaks.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>An lp leak in the presence of an ignition source could result in a fire, injury, or death.</p>	<p>REMEDY</p> <p>Starcraft will notify owners and dealers will repair the vehicles free of charge. The safety recall is expected to begin during November 2010. Owners may contact starcraft at 1-800-945-4787.</p>

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>BUICK / LUCERNE 2010-2011 CADILLAC / DTS 2010-2011</p> <p>MANUFACTURER: GENERAL MOTORS CORP.</p> <p>COMPONENT: ELECTRICAL SYSTEM: BATTERY: CABLES</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 13780</p> <p>SUMMARY: General motors is recalling certain model year 2010-2011 dts and buick lucerne vehicles equipped with v8 engines. The starter or alternator cable is in contact with the power steering return line. If either the starter or alternator cable is contacting the power steering return line, the cable could wear through the line, causing a power steering fluid leak.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A power steering leak could result in a loss of power steering, increasing the risk of a crash, and/or the leak onto hot engine parts could cause an engine compartment fire.</p>	<p>REMEDY</p> <p>Dealers will secure and if necessary reroute the lines to prevent contact. This service will be performed free of charge. The safety recall is expected to begin on or before November 19, 2010. Owners may contact Cadillac at 1-866-982-2339, Buick at 1-866-608-8080 and at the owner center at www.gmownercenter.com.</p>
USA	<p>VEHICLE MAKE / MODEL MODEL YEAR(S)</p> <p>JEEP / LIBERTY 2008</p> <p>MANUFACTURER: CHRYSLER GROUP LLC</p> <p>COMPONENT: VISIBILITY:WINDSHIELD WIPER/WASHER: MOTOR</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 16229</p> <p>SUMMARY: Chrysler is recalling certain model year 2008 jeep liberty vehicles. The vehicles are equipped with windshield wiper motors that contain excess adhesive that may allow for water intrusion, which could result in intermittent and eventually inoperative windshield wiper operation.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>A failing or inoperative windshield wiper system will reduce a driver's visibility which could result in a crash.</p>	<p>REMEDY</p> <p>Dealers will replace the windshield wiper motor free of charge. The safety recall is expected to begin during November 2010. Owners may contact Chrysler at 1-800-853-1403.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: XINGMIN WHEEL / 15" PAINTED WHEEL (MOD) XINGMIN WHEEL / 15" PAINTED WHEEL (SPOKE) MANUFACTURER: TREDIT TIRE & WHEEL CO INC COMPONENT: WHEELS POTENTIAL NUMBER OF UNITS AFFECTED: 7392 SUMMARY: Tredit tire & wheel is recalling certain 15" painted wheels, models spoke or mod, installed as original equipment on recreational vehicles. Some of the wheels, which fasten to the axle of the vehicle body and serve as a mounting point for tires, could contain mis-aligned welds. No picture available.</p>	<p>CONSEQUENCE The wheels may break while in use, increasing the risk of a crash.</p>	<p>REMEDY Tredit tire & wheel is working with the vehicle manufactures to identify owners who may have had the defective wheels installed as original equipment. The affected wheels will be replaced free of charge. Owners may contact their vehicle manufacturer or tredit tire & wheel at 1-800-289-8667.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900 MANUFACTURER: C & C TOP SHOP, INC. COMPONENT: EQUIPMENT POTENTIAL NUMBER OF UNITS AFFECTED: 2996 SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by c & c top shop, inc on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. No picture available.</p>	<p>CONSEQUENCE In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by c & c top shop, inc by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO TRIM RESTYLING</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2135</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by auto trim restyling on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto trim restyling by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO TRIM DESIGN & GLASS</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 32</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by auto trim design & glass on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>in the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto trim design & glass by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: SAN FRANCISCO MAZ</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 300</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by san francisco maz on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by San Francisco maz by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: PRESTIGE AUTO SPECIALTIES</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 573</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by prestige auto specialties on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on october 8, 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by prestige auto specialties by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO ADDITIONS, INC.</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1623</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by auto additions, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto additions, Inc. By clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: DON'S AUTO UPHOLSTERY</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1190</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by don's auto upholstery on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by don's auto upholstery by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: AUTO AIR COMPANY</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 1709</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by auto air company on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto Air Company by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: COACH AUTOMOTIVE ACCESSORIES</p> <p>COMPONENT: EQUIPMENT</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 2887</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by [installer name] on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by [installer name] by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.:</p> <p>WEBASTO / HOLLANDIA 600</p> <p>WEBASTO / HOLLANDIA 700</p> <p>WEBASTO / HOLLANDIA TVS 900</p> <p>MANUFACTURER: ATTENTION TO DETAIL, INC.</p> <p>COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY</p> <p>POTENTIAL NUMBER OF UNITS AFFECTED: 3209</p> <p>SUMMARY: Webasto product North America, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia TVs 900 series sunroofs installed as original equipment by attention to detail, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage.</p> <p>No picture available.</p>	<p>CONSEQUENCE</p> <p>In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.</p>	<p>REMEDY</p> <p>Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on October 8, 2010. In order to determine if your vehicle is affected, please review the list of vehicles provided to us by attention to detail, inc. By clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.</p>

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www.odj.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS