

PRODUCT **RECALLS**

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16 – 31 JANUARY 2011

CONTENTS

AUTOMOTIVE

Pages 1 to 12



[Motor Vehicle \(19\)](#)

Child Safety Seat (0)

[Motor Vehicle Equipment \(5\)](#)

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
EU/GREECE	CATEGORY: Motor vehicles PRODUCT: Passenger car "Megane II RS" BRAND: Renault TYPE/NUMBER OF MODEL: The recall concerns vehicles produced between 14-04-2004 and 05-05-2004. DESCRIPTION: Passenger car COUNTRY OF ORIGIN: France No picture available	INJURIES The product poses a risk of injuries because the front, right-hand wheel hub carrier could have cracks and, in certain cases, could break leading to a road accident.	Voluntary corrective action taken by the manufacturer.
AUSTRALIA	Citroën—C4, C4 Picasso, C5II, C5 (X7) & Dispatch vehicles PRODUCT DESCRIPTION C4, C4 Picasso, C5II, C5 (X7) & Dispatch vehicles IDENTIFYING FEATURES Campaign Number: MGG Target Number: 1586 TRADERS WHO SOLD THIS PRODUCT Citroën dealers. SUPPLIER Ateco Automotive Pty Ltd No picture available.	HAZARDS This may occasionally affect braking assistance. DEFECTS The braking assistance circuit vacuum pump valve in very rare cases may have problems opening.	CONSUMERS ACTION Citroën will write to owners of affected vehicles. Owners are advised to contact their authorised Citroën dealership to arrange for replacement of the vacuum pump valve.
AUSTRALIA	Citroën—C5 (X7) Vehicles PRODUCT DESCRIPTION C5 (X7) vehicles IDENTIFYING FEATURES Campaign Number: MEW Target Number: 79 TRADERS WHO SOLD THIS PRODUCT Citroën dealers SUPPLIER Ateco Automotive Pty Ltd SUPPLIER'S WEB SITE http://citroen.com.au No picture available.	HAZARDS The defect may gradually cause the windscreen wiper mechanism not to work. DEFECTS The front wiper blade motors have an internal non-conformity.	CONSUMERS ACTION Citroën will write to owners of affected vehicles. Owners are advised to contact their authorised Citroën dealership to arrange for replacement of the two wiper motors.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA NGER	MEASURES ADOPTED
AUSTRALIA	Ducati—Multistrada 1200 Motorcycles PRODUCT DESCRIPTION Models: Multistrada 1200 MY2010 Multistrada 1200 ABS MY2010 Multistrada 1200 S Touring MY2010 Multistrada 1200 S Sport MY2010 IDENTIFYING FEATURES Campaign Number: 822/11 Target Number: 285 SUPPLIER Ducati Motor Holding No picture available.	HAZARDS Sudden loss of acceleration. DEFECTS In certain conditions (downshifting or manoeuvring with the clutch disengaged with the engine at idle) it is possible that the engine may stall.	CONSUMERS ACTION Ducati will write to owners of affected vehicles.
USA	VEHICLE MAKE / MODEL THINK / THINK CITY—2011 MANUFACTURER: THINK NORTH AMERICA, INC. COMPONENT: SEAT BELTS POTENTIAL NUMBER OF UNITS AFFECTED: 16 SUMMARY: Think north america is recalling certain model year 2011 think city vehicles for failing to comply with the requirements of federal motor vehicle safety standard no. 208, "occupant crash protection." the seat belts may have been incorrectly installed. As a result, a child restraint system used in the passenger seating position may not be positioned or retained properly. No picture available	CONSEQUENCE The seat belt may not restrain the child as intended during normal vehicle operation or during a crash, increasing the risk of injury.	REMEDY Dealer will inspect, reinstall or, if needed, replace the vehicle's seat belts. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. Think's authorized toll free service line at 855-698-4465.
USA	VEHICLE MAKE / MODEL SAAB / 9-3-2010-2011 MANUFACTURER: SAAB CARS NORTH AMERICA, INC. COMPONENT: FUEL SYSTEM, OTHER:DELIVERY:FUEL PUMP POTENTIAL NUMBER OF UNITS AFFECTED: 4,400 SUMMARY: SAAB is recalling certain model year 2010 and 2011 passenger vehicles manufactured from june 2010 through december 2010. certain fuel pumps installed as original equipment may have internal components with incorrect specifications. No picture available.	CONSEQUENCE The subject fuel pumps can seize causing the engine to stall which increases the risk of a crash.	REMEDY SAAB will notify owners and replace the defective fuel pumps free of charge. The safety recall is expected to begin on or about february 18, 2011. Owners may contact saab at 1-800-955-9007.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	DA	MEASURES ADOPTED
USA	NAME OF PRODUCT: Snowmobiles UNITS: About 16,500 MANUFACTURER: Arctic Cat Inc., of Thief River Falls, Minn. DESCRIPTION: This recall involves all 2010 Arctic Cat Z1, TZ1, F, Bearcat, M, and CF model snowmobiles. All variations of color and model features of the models listed are included in this recall. The model name is indicated on the side of vehicle, in the registration materials and owner's manual. MANUFACTURED IN: United States 	HAZARD The front lower suspension arm can crack during use which could lead to loss of control, posing a risk of severe injury or death. INCIDENTS/INJURIES Arctic Cat has received 13 reports of suspension arms cracking. No injuries or accidents have been reported.	Voluntary recall

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL VOLKSWAGEN / NEW BEETLE- 2010 VOLKSWAGEN / NEW BEETLE- 2010 MANUFACTURER: VOLKSWAGEN OF AMERICA, INC COMPONENT: SEATS POTENTIAL NUMBER OF UNITS AFFECTED: 27 SUMMARY: Volkswagen is recalling certain model year 2010 new beetle and new beetle convertible manufactured from september 1, 2010, through september 22, 2010, for failing to comply with the barrier test requirements of federal motor vehicles safety standards no. 208, "occupant crash protection," that went into effect on september 1, 2010. No picture available.	CONSEQUENCE The vehicles do not meet with requirements that went into effect on september 1, 2010, and therefore may not offer the protection attendant to those requirements.	REMEDY Dealers will offer to replace their vehicle with a comparable vehicle that was produced prior to september 1, 2010, compliant with fmvss 208 requirements. The safety recall is expected to begin on or before february 1, 2011. owners may contact volkswagen at 1-800-822-8987.
USA	VEHICLE MAKE / MODEL THINK / THINK CITY - 2011 MANUFACTURER: THINK NORTH AMERICA, INC COMPONENT: VISIBILITY:DEFROSTER/ DEFOGGER SYSTEM POTENTIAL NUMBER OF UNITS AFFECTED: 23 SUMMARY: Think north america is recalling certain model year 2011 think city vehicles. Poor performance in the vehicles" fluid heater assemblies could cause the heater-defroster system of the vehicle to fail to perform properly resulting in loss of its ability to clear the windshield in cold or humid conditions. No picture available.	CONSEQUENCE This could impair the driver's ability to view the road ahead, increasing the risk of a crash.	REMEDY Dealers will inspect and, if needed, replace the defroster system free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact think's authorized toll free service line at 855-698-4465.
USA	VEHICLE MAKE / MODEL KEYSTONE / MONTANA-2010-2011 KEYSTONE / MONTANA-BIG SKY-2009-2011 MANUFACTURER: KEYSTONE RV COMPANY COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE:LPG LINES AND FITTINGS POTENTIAL NUMBER OF UNITS AFFECTED: 258 SUMMARY: Keystone is recalling certain model year 2009-2011, montana big sky and model year 2010-2011, montana fifth wheel trailers. The propane hose for the slide room may contact the tire and may become damaged as a result. No picture available	CONSEQUENCE A propane leak, in the presence of an ignition source, could result in a fire and/or explosion causing property damage and/or personal injury.	REMEDY Dealers will install a metal plate to prevent the propane line from coming into contact with the tire. This service will be performed free of charge. The safety recall is expected to begin during january 2011. Owners may contact keystone customer service at 1-866-425-4369.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL LEXUS / GS-2006-2007 LEXUS / IS-2006-2009 MANUFACTURER: TOYOTA MOTOR NORTH AMERICA, INC. COMPONENT: FUEL SYSTEM, GASOLINE:DELIVERY POTENTIAL NUMBER OF UNITS AFFECTED: 244,779 SUMMARY: Toyota is recalling certain model year 2006-2009 lexus is and model year 2006-2007 lexus gs vehicles. Due to insufficient tightening of the fuel pressure sensor connected to an engine fuel delivery pipe with nickel phosphorus plating, there is a possibility that, over time, the pressure sensor could loosen. If loosening occurs, fuel could leak past a gasket used in the connection between the sensor and the pipe and through the threaded portion of the sensor. No picture available.	CONSEQUENCE Fuel leakage, in the presence of an ignition source, could result in a fire.	REMEDY Dealers will inspect for fuel leakage from the threaded portion of the fuel pressure sensor and if a fuel leak is not confirmed, dealers will further tighten the fuel pressure sensor with the proper torque. If a fuel leak is confirmed, the gasket between the sensor and the fuel deliver pipe will be replaced with a new one, and the sensor will be tightened with the proper torque. This service will be performed free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact toyota at 1-800-331-4331.
USA	VEHICLE MAKE / MODEL: GREAT DANE / TRAILER—2007-2009 MANUFACTURER: GREAT DANE LIMITED PARTNERSHIP COMPONENT: POWER TRAIN:AXLE ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 121 SUMMARY: Great dane is recalling certain 2007 through 2009 semi-trailer vans equipped with arvinmeritor tl axles shipped between April 2005 through July 2008. The spindle nut may not have been properly torqued or not torqued at all allowing excessive end-play in the wheel-end system that could progress to a wheel separation. No picture available.	CONSEQUENCE Separation of a wheel from the vehicle will reduce the driver's ability to control the vehicle and could result in a vehicle crash.	REMEDY Great dane will notify owners and recall repairs will be performed by arvinmeritor free of charge. The safety recall is expected to begin during january or early february 2011. owners may contact great dane customer service at 1-877-369-3493 or arvinmeritor at 1-248-435-1725.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL FORD / WINDSTAR –1999-2003 MANUFACTURER: FORD MOTOR COMPANY COMPONENT: STRUCTURE: FRAME AND MEMBERS:UNDERBODY SHIELDS POTENTIAL NUMBER OF UNITS AFFECTED: 425,288 SUMMARY: Ford is recalling certain model year 1999-2003 windstar vehicles originally sold in or currently registered in the states of connecticut, delaware, the district of columbia, illinois, indiana, iowa, kentucky, maine, maryland, massachusetts, michigan, minnesota, missouri, new hampshire, new jersey, new york, ohio, pennsylvania, rhode island, utah, vermont, west virginia, and wisconsin. A separation of a front lower control arm rear attaching bracket may result in a lower control arm separation. A separation of both front subframe rear body mounts may result in separation of the steering intermediate shaft. No picture available.	CONSEQUENCE This could result in reduced steering control increasing the risk of a crash.	REMEDY Dealers will inspect both front lower control arm rear attaching brackets, and both body mount attachments at the rear of the front subframe, and make the necessary repairs free of charge. The safety recall is expected to begin on or before february 14, 2011. owners may contact ford at 1 -866-436-7332.
USA	VEHICLE MAKE / MODEL MCI / D4000 2010-2011 MCI / D4500 2010-2011 MCI / D4505 2010-2011 MANUFACTURER: MOTOR COACH INDUSTRIES, INC COMPONENT: ENGINE AND ENGINE COOLING:COOLING SYSTEM:FAN POTENTIAL NUMBER OF UNITS AFFECTED: 138 SUMMARY: MCI is recalling certain model year 2010-2011 d4500, d4505, and d4000 motor coaches. The affected pulley covers may lack certain welds required to keep the covers attached to the coach structure. No picture available.	CONSEQUENCE The cover will eventually fail as a result of fatigue, and the cover may become detached from the coach and fall and strike a person or object, resulting in personal injury or property damage.	REMEDY MCI will inspect and replace as necessary the idler pulley covers free of charge. The safety recall is expected to begin during january 2011. Owners may contact mci customer service at 1-800-241-2947.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL ENTEGR / ASPIRE- 2010-2011 ENTEGR / INSIGNIA- 2011-2010 MANUFACTURER: ENTEGR COACH COMPONENT: EXTERIOR LIGHTING:HEADLIGHTS POTENTIAL NUMBER OF UNITS AFFECTED: 82 SUMMARY: Entegra is recalling certain model year 2010 and 2011 aspire class a motorhomes manufactured from april 22, 2009, through december 23, 2010 for failing to comply with the requirements of federal motor vehicle safety no. 108, "lamps, reflective devices, and associated equipment." the position of the high beam and low-beam headlamps are transposed from their proper position. No picture available.	CONSEQUENCE Improper height on the headlights may not fully illuminate the road surface or may inhibit the ability of motorists to see vehicles which can increase the risk of a crash.	REMEDY Dealers will disconnect and move the headlamps so that they are in their proper position. This service will be performed free of charge. The safety recall is expected to begin during february 2011. Owners may contact entegra at 1-800-945-4787.
USA	VEHICLE MAKE / MODEL FOREST RIVER / SALEM- 2010-2011 MANUFACTURER: FOREST RIVER, INC. COMPONENT: SUSPENSION:FRONT:SPRINGS:LEAF SPRING ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 209 SUMMARY: Forest river is recalling certain model year 2010-2011 salem travel trailers manufactured from september 25, 2009, through january 13, 2011. The bottom leaf on the leaf springs may rotate out of position and make contact with the tire. No picture available.	CONSEQUENCE This will cause the tire to blow out without warning and a loss of control of the vehicle resulting in property damage and/or personal injury or death.	REMEDY Dealers will place two square bend "u" bolts with washers and nuts and retaining plate that will be centered on the spring center bolt to restrain the lower spring leaf. This service will be performed free of charge. The safety recall is expected to begin during january 2011. Owners may contact forest river at 574-389-4600.
USA	VEHICLE MAKE / MODEL HINO / NJ8J—2011 HINO / NV8J—2011 MANUFACTURER: HINO MOTORS SALES U.S.A., INC. COMPONENT: SERVICE BRAKES, AIR POTENTIAL NUMBER OF UNITS AFFECTED: 146 SUMMARY: Hino is recalling certain model year 2011 nj8j and nv8j heavy trucks manufactured from october 26, 2009, through october 1, 2010. Two of the airlines to the front and rear air tanks may have been installed incorrectly. No picture available.	CONSEQUENCE In the event that the rear tank air pressure was depleted, braking function would be lost and the automatic engagement of the spring brakes will not occur, possibly resulting in a crash.	REMEDY Hino will notify owners and dealers will repair the vehicles free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact hino at 1-248-699-9300.

AUTO: MOTOR VEHICLE			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	VEHICLE MAKE / MODEL MODEL YEAR(S) K-Z / SPORTSMEN 2004 K-Z / SPORTSMEN SPORT-STER 2004 KZRV / DURANGO 2004-2005 KZRV / ESCALADE 2005-2011 KZRV / INFERNO 2008 KZRV / INFERNO SST 2010 KZRV / MONTEGO BAY 2006 KZRV / MONTEGO BAY SPORTSTER 2006 KZRV / NEW VISION 2002-2004 KZRV / SPORTSMEN LODGE 2003 KZRV / SPORTSTER 2005 2008-2010 MANUFACTURER: KZRV, L.P. COMPONENT: EQUIPMENT:RECREATIONAL VEHICLE POTENTIAL NUMBER OF UNITS AFFECTED: 1,798 SUMMARY: KZRV is recalling certain towable travel trailers equipped with 1200-series norcold refrigerators. The population of refrigerators being addressed contains either a sensing algorithm or thermal switch to shut off power to the refrigerator when high temperatures are detected in order to prevent a potential fire. The response times of the sensor algorithm and thermal switch devices to stop power are not sufficient. No picture available	CONSEQUENCE The sensing algorithm or thermal switch installed to shut off power to the refrigerator when high temperatures are detected due to a possible hydrogen gas leak may not shut off in sufficient time to prevent a fire.	REMEDY KZRV is working with norcold to identify and notify any affected owners. Owners will be instructed to contact norcold dealers to receive the remedy free of charge. Please see norcold's defect report 10e-049 for additional information. The manufacturer has not yet provided an owner notification schedule. Owners may contact NORCOLD at 1-800-767-9101.
USA	VEHICLE MAKE / MODEL DUCATI / MTS 1000- 2003-2004 2006 DUCATI / MTS 1100- 2007-2008 DUCATI / MTS 620- 2006 DUCATI / MTS1100- 2009 DUCATI / MULTISTRADA 1000 S- 2005-2005 MANUFACTURER: DUCATI NORTH AMERICA COMPONENT: FUEL SYSTEM, GASOLINE:STORAGE:TANK ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 3,911 SUMMARY: Ducati is recalling certain model year 2006 multistrada 620, model year 2003-2006, multistrada 1000, and model year 2007-2009, multistrada 1100 motorcycles. Fuel leakage can occur at the fuel tank pump flange seal. No picture available.	CONSEQUENCE Fuel leakage, in the presence of an ignition source, could result in a fire.	REMEDY Dealers will replace the fuel pump o-ring with an updated part free of charge. The manufacturer has not yet provided an owner notification schedule. Owners may contact ducati at 800-231-6696.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900 MANUFACTURER: GALVIN GLASS COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 1,000 SUMMARY: Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by galvin glass on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. No picture available.	CONSEQUENCE In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.	REMEDY Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on october 8, 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by galvin glass by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: WEBASTO / HOLLANDIA 600 WEBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900 MANUFACTURER: AE SUNROOFS, LLC COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 370 SUMMARY: Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by ae sunroofs, llc on various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. No picture available.	CONSEQUENCE In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.	REMEDY Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on october 8, 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by ae sunroofs, llc by clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: MT&G / REAR AXLE CROSS PIN MANUFACTURER: MACHINE TOOL & GEAR, INC. COMPONENT: POWER TRAIN:AXLE ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 154 SUMMARY: MT&G is working with general motors to recall certain rear axle cross pins, part numbers 25824249 and ed69145, sold for use as service parts in certain general motors vehicles. The rear axle cross pins were not properly heat treated and could fracture and become displaced within the rear axle. Should the pin shift out of position, it could create an interference condition and cause the rear axle to lock. No picture available.	CONSEQUENCE The driver may not be able to maintain directional control of the vehicle and a crash could occur without warning.	REMEDY General motors' dealers will install a new rear axle cross pin free of charge. The safety recall is expected to begin during january 2011. Owners may contact cadillac at 1-866-982-2339, chevrolet at 1-800-630-2438, gmc at 1-866-996-9463 and at the owner center at www.gmownercenter.com.
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: CARRIER / EM-1 MANUFACTURER: CARRIER CORPORATION COMPONENT: EQUIPMENT:ELECTRICAL:AIR CONDITIONER POTENTIAL NUMBER OF UNITS AFFECTED: 44,915 SUMMARY: Carrier is recalling certain carrier genv em-1 evaporator units (em-1) manufactured from january 1, 2006 through december 2010, containing a delphi pack-con iii fuse holder in an allied motion motor assembly; em-1 unit part numbers 77-62112-xx and 77-62512-xx, starting with serial number knt90890232 to serial number nne91230058, sold as aftermarket equipment and installed as original equipment on certain school and shuttle buses. Due to time, temperature, and/or vibration, the fuse may loosen in the fuse holder resulting in high resistance and arcing. No picture available.	CONSEQUENCE If sufficient arcing occurs, the fuse holder may melt, and may be accompanied by flame, smoke and potential fire.	REMEDY Carrier will notify bus manufacturers, carrier authorized dealers as well as, to the extent known by carrier, owners of record which purchased the affected units. Carrier is working with the bus manufacturers and carrier authorized dealers to identify and notify owners of the buses which may have had the affected em-1 unit sold as original equipment or as an aftermarket installation. Carrier will provide a retrofit kit along with repair instructions free of charge. The safety recall is expected to begin during february 2011. Owners may contact their vehicle manufacturer or carrier at 1-800-793-4741.

AUTO: MOTOR VEHICLE EQUIPMENT			
NOTIFYING COUNTRY	PRODUCT	ANGER	MEASURES ADOPTED
USA	EQUIPMENT BRAND NAME / PART NO. OR MODEL NO.: EBASTO / HOLLANDIA 600 EBASTO / HOLLANDIA 700 WEBASTO / HOLLANDIA TVS 900 MANUFACTURER: AUTO TRIM DESIGN OF CENTRAL VA, INC. COMPONENT: VISIBILITY:SUN ROOF ASSEMBLY POTENTIAL NUMBER OF UNITS AFFECTED: 156 SUMMARY: Webasto product north america, inc. (webasto) is recalling certain hollandia 700 and 600 series and hollandia tvs 900 series sunroofs installed as original equipment by auto trim design of central va, inc. On various passenger vehicles. The adhesive bond between the glass and the metal frame can debond increasing the risk that the sunroof glass would separate from the vehicle. Complete glass-to-frame debonding can develop gradually and may be evidenced by metal corrosion around the sunroof frame, wind noise, vibration, visual bond separation and/or water leakage. No picture available.	CONSEQUENCE In the event of a separation, the falling glass could create a road hazard or strike a trailing vehicle, and cause a crash.	REMEDY Webasto, the manufacturer of the sunroofs, will be performing the safety recall campaign. Owners who have been identified as having an affected sunroof installed in their vehicle will receive a safety recall notice from webasto. The safety recall began on october 8, 2010. in order to determine if your vehicle is affected, please review the list of vehicles provided to us by auto trim design of central va, inc. By clicking on the hyperlink affected vehicle list or you may visit webasto's website at www.sunroofcheck.com. You can also call webasto toll-free at 1-888-749-8632.

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

PRODUCT RECALLS IN THE USA

National Highway Traffic Safety Administration (NHTSA)

www-odi.nhtsa.dot.gov/cars/problems/recalls/recallsearch.cfm (US Automotive recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

Product.Recalls@sgs.com

www.sgs.com/regulatorycompliance

© 2010 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

