

PRODUCT RECALLS

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

1– 15 JANUARY 2014

ELECTRICAL & ELECTRONICS

Pages 2 to 3



[Audio Video and Household Appliances \(1\)](#)

IT & Telecommunication (0)

[Luminaires \(2\)](#)

Cord Sets, Plugs & Sockets (0)

HARDDGOODS

Pages 4 to 11



DIY, Tools and Hardware (0)

[Home Furnishing & Houseware \(13\)](#)

[Sport & Leisure Goods \(6\)](#)

Stationery and Office Supplies (0)

TOYS AND JUVENILE PRODUCTS

Pages 12 to 18



[Toys \(9\)](#)

[Juvenile Products \(3\)](#)

COSMETICS, PERSONAL CARE AND HOUSEHOLD

Pages 19 to 20



[Cosmetics and Personal Care \(1\)](#)

[Household Care \(1\)](#)

SOFTLINES

Pages 21 to 22



[Textile and Clothing \(3\)](#)

Shoes (0)

Bags and Accessories (0)

Jewellery (0)

Please note that from November 2012 on, product recall notifications can be searched online in several countries via the Global portal on product recalls hosted by the Organisation for Economic Co-operation and Development (OECD). You can access the OECD site by using the following [link](#).

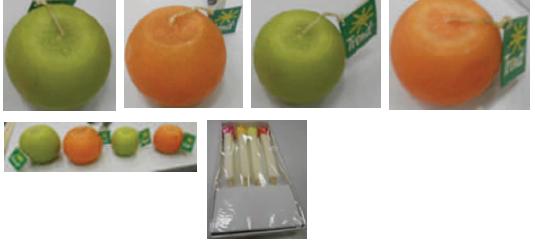
SGS

E&E: AUDIO VIDEO AND HOUSEHOLD APPLIANCES

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Kenmore oscillating fan heaters</p> <p>UNITS: About 42,500</p> <p>DESCRIPTION This recall involves Kenmore oscillating fan heaters with model number 127.90914310. The model number and Kenmore are printed on a silver sticker on the bottom of the unit. The fan heaters are gray and white, measure about 12 inches tall by 9 inches wide, have two dials at the top for temperature and fan speed and a red on-off button on the front base. Kenmore is printed on the front bottom of the fan heaters.</p> <p>IMPORTER Sears Holdings, of Hoffman Estates, Ill.</p> <p>MANUFACTURED IN: China</p>  <p>The image shows a white Kenmore oscillating fan heater on the left and its product label on the right. The label is rectangular with rounded corners. It features the 'Kenmore' logo at the top. Below it, it says 'FAN HEATER', 'MODEL NO: 127.90914310', '120V AC 60Hz 12.5 AMPS.', and 'ETLus' with a small ETL logo. At the bottom, it says 'Intertek 3090262' and 'COMFORMITY TEST REPORT'. There is also some smaller text about household type and date code.</p>	<p>HAZARD: Broken motor mounts can cause the units to overheat, catch fire and ignite nearby items, posing a fire and burn hazard to consumers.</p> <p>INCIDENTS/INJURIES Sears and Kmart have received seven reports of the fan heaters smoking or catching fire, including two reports of injuries. Injuries include one report of smoke inhalation and one report of a blister to a consumer's finger.</p>	Consumers should immediately turn off and unplug the recalled fan heaters and return them to any Sears or Kmart store for a full refund.

E&E: LUMINAIRES			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/HUNGARY	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: Light</p> <p>BRAND: Düwi</p> <p>NAME: Lampafügggesztek</p> <p>TYPE/NUMBER OF MODEL: Model: 13055</p> <p>Batch number/Barcode: 4 008297 130550</p> <p>DESCRIPTION: Light to hang from the ceiling. Two versions with the same article number but different components. Technical parameters: 230V; E27 max. 60 W; Class II.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The basic insulated wires are not protected against pulling and twisting and could detach exposing the live ends of the wires.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60598.</p>	<p>Compulsory measures: Withdrawal of the product from the market, Recall of the product from end users.</p>
AUSTRALIA	<p>Digital Camera Warehouse—Glanz Mini Pioneer 43 Studio Lighting Kit</p> <p>PRODUCT DESCRIPTION 2/3 Head 160w Studio Lighting Kit</p> <p>IDENTIFYING FEATURES Mini Pioneer 43, 160WS</p> <p>TRADERS WHO SOLD THIS PRODUCT Digital Camera Warehouse</p> <p>SUPPLIER Digital Camera Warehouse</p> <p>SUPPLIER'S WEB SITE http://www.digitalcamerawarehouse.com.au</p> <p>No Picture available.</p>	<p>DEFECTS</p> <p>The circular flash tube has three electrodes that are live parts. A consumer may come into contact with live parts, especially when moving the lightning kit or replacing a light globe. In addition, instructions provided did not provide effective safety advice.</p> <p>HAZARDS</p> <p>If the defect occurs there is a risk of electric shock.</p>	<p>Cease using the product immediately. Please contact Digital Camera Warehouse to arrange for return of the product and a refund.</p>

HARDGOODS: HOME FURNISHING & HOUSEWARE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ITALY	PRODUCT: Tableware MANUFACTURED IN: China No picture available.	CHEMICAL Migration of melamine (5.3; 6.49 mg/kg - ppm) from tableware from China.	Official detention.
EU/UNITED KINGDOM	PRODUCT: Black melamine ladles MANUFACTURED IN: China No picture available.	CHEMICAL Migration of formaldehyde (19 mg/dm ²) from black melamine ladles from China.	Official detention.
EU/ITALY	PRODUCT: Melamine dishes and tumbler MANUFACTURED IN: China No picture available.	CHEMICAL Migration of formaldehyde (59 mg/kg - ppm) from melamine dishes and tumbler from China.	Import not authorized.
EU/ITALY	PRODUCT: Scissors MANUFACTURED IN: China No picture available.	CHEMICAL Migration of chromium (0.28 mg/dm ²) from scissors from China.	Import not authorized.
EU/ITALY	PRODUCT: Stainless steel wine opener set MANUFACTURED IN: China No picture available.	CHEMICAL Migration of nickel (0.5 mg/kg - ppm) from stainless steel wine opener set from China.	Re-dispatch.
EU/UNITED KINGDOM	PRODUCT: Melamine bowls MANUFACTURED IN: China No picture available.	CHEMICAL Migration of formaldehyde (4.5 mg/dm ²) from melamine bowls from China.	Official detention.
EU/POLAND	PRODUCT: Melamine bowl MANUFACTURED IN: China No picture available.	CHEMICAL Migration of formaldehyde (18.5; 22.7; 25.5 mg/kg - ppm) from melamine bowl from China, via Spain.	Informing authorities.
EU/ITALY	PRODUCT: Machines for slicing potatoes MANUFACTURED IN: China No picture available.	CHEMICAL Migration of chromium (0.9 mg/kg - ppm) from machines for slicing potatoes from China.	Placed under customs seals.

HARDGOODS: HOME FURNISHING & HOUSEWARE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/CROATIA	<p>CATEGORY: Food-imitating products</p> <p>PRODUCT: Decorative candles</p> <p>BRAND: Trend</p> <p>NAME: Unknown</p> <p>TYPE/NUMBER OF MODEL: N° :10139165, N° :10140253, N° : 0140277 and N° :10139189.</p> <p>Batch number/Barcode: 9004181144189, 9004181185359, 9004181185366 and 900418184772.</p> <p>DESCRIPTION: Decorative candles in the shape and colour of fruit (orange and apple). A label is attached on the candle with the inscription "Trend" and a picture of the sun.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING</p> <p>The product poses a risk of choking as, due to its characteristic form, colour and size, it may be mistaken for foodstuff. Small parts can be easily detached from the product and this may lead children to put them in the mouth, swallow, suck or ingest them, which could entail the risk of choking. The product does not comply with the Directive 87/357/EEC on products which, appearing to be other than they are, endanger the health or safety of consumers.</p>	<p>Compulsory measures: Ban on the marketing of the product and any accompanying measures,</p> <p>Destruction of the product.</p>
USA	<p>NAME OF PRODUCT: Gas-fired hot water boilers</p> <p>UNITS: About 191</p> <p>DESCRIPTION This recall involves New Yorker Boiler PVCGA model cast iron hot water boilers that use natural gas or liquid petroleum to heat water for residential space heating. The boilers are green in color, about 38 inches tall and about 26 inches deep and range from 11 to 30 inches wide. The front cover of the boiler is vented and has the New Yorker Boiler logo. Recalled boilers were manufactured between May 2012 and February 2013. The model number, serial number and manufacturing date are located on a silver label on the inside panel.</p> <p>IMPORTER Unknown</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD: The air pressure switch can fail to shut down the burners when there is a blockage in the vent system, allowing the boiler to emit excessive amounts of carbon monoxide and posing a CO poisoning hazard to the consumer.</p> <p>INCIDENTS/INJURIES None reported.</p>	<p>Consumers with recalled boilers should immediately contact the installer or distributor from whom they purchased the boiler or New Yorker Boiler Company to schedule a free in-home safety inspection and repair. Consumers who continue using the boilers while awaiting repair, should have a working carbon monoxide alarm installed outside of sleeping areas in the home.</p>

HARDGOODS: HOME FURNISHING & HOUSEWARE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Norwood Furniture Science Tables</p> <p>UNITS: 655</p> <p>DESCRIPTION This recall involves Norwood Furniture's science tables. The rectangular tables have a black laminate finish tabletop with a light brown hardwood base and four legs. There are black floor grips at the bottom of each wooden leg. The table has two rectangular, front open compartments. The affected products include item numbers, NOR-PIH1027-SO for the 24" W x 48" L x 30" H table, NOR-PIH1028-SO for the 24" W x 54" L x 30" H table and NOR-PIH1029-SO for the 24" W x 60" L x 30" H table. Consumers can locate the item number on the underside of the tabletop which is listed with the Commercial Furniture phone number, the OCL# and Country of Origin:China.</p> <p>IMPORTER School Outfitters of Norwood, Ohio</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: The wooden legs can split causing instability which poses an injury hazard to those using the table.</p> <p>INCIDENTS/INJURIES There have been eight reports of instability of the tables, three of which are reports of the legs splitting. No reported injuries.</p>	Customers should contact School Outfitters to set up repair appointments with installation experts to replace the legs on all affected tables free of charge. School Outfitters is contacting customers directly.
USA	<p>NAME OF PRODUCT: Mainstays five-piece card table and chair sets</p> <p>UNITS: About 73,400</p> <p>DESCRIPTION This recall involves the Mainstays card table sets with a black padded metal folding table and four black padded metal folding chairs. "Made by: Dongguan Shin Din Metal & Plastic Products Co," or "Made by: Taiwan Shin Yeh Enterprises", is printed on a white label on the bottom of the chairs.</p> <p>IMPORTER Wal-Mart Stores Inc., of Bentonville, Ark.</p> <p>MANUFACTURED IN: China and Taiwan</p>  	<p>HAZARD: The chairs can collapse unexpectedly, posing a fall hazard and a risk of finger injury, including finger amputation.</p> <p>INCIDENTS/INJURIES Walmart has received 10 reports of injuries from collapsing chairs. Injury reports include one finger amputation, three fingertip amputations, sprained or fractured fingers and one report of a sore back.</p>	Consumers should immediately stop using the recalled card table and chair sets and return the entire set to Walmart for a full refund.

HARDGOODS: HOME FURNISHING & HOUSEWARE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Gas-fired hot water boilers</p> <p>UNITS: About 26,000 in the United States and about 310 in Canada</p> <p>DESCRIPTION This recall involves U.S. Boiler ESC, PVG and SCG model cast iron hot water boilers that use natural gas or liquid petroleum to heat water for residential space heating. The boilers are light blue in color with black trim, about 40 inches tall, about 26 inches deep and range from 12 to 31 inches wide. The model name and U.S. Boiler logo are on the front cover of the boiler. The front cover of the boiler is vented. Recalled boilers were manufactured between December 2005 and February 2013. The model number, serial number and manufacturing date are located on a silver label on the top panel of ESC models and on the inside of PVG and SCG models on the right side panel.</p> <p>IMPORTER Unknown</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD: The air pressure switch can fail to shut down the burners when there is a blockage in the vent system, allowing the boiler to emit excessive amounts of carbon monoxide and posing a CO poisoning hazard to the consumer.</p> <p>INCIDENTS/INJURIES None reported</p>	<p>Consumers with recalled boilers should immediately contact the installer or distributor from whom they purchased the boiler or U.S. Boiler to schedule a free in-home safety inspection and repair. Consumers who continue use of the boilers while awaiting repair, should have a working carbon monoxide alarm installed outside of sleeping areas in the home.</p>

HARDGOODS: SPORT & LEISURE GOODS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: SRAM Hydraulic Road Rim Brakes and Hydraulic Road Disc Brakes for bicycles</p> <p>UNITS: About 25,350</p> <p>DESCRIPTION The recalled bicycle brake models include SB Red Hydraulic Road Disc, SB Red Hydraulic Road Rim, SB 700 Hydraulic Road Disc and SB 700 Hydraulic Road Rim, used as either front or rear brakes. The SB RED brake lever is labeled "RED" on the body of the lever assembly. The SB 700 brake lever is labeled "S-Series" on the body of the lever assembly. The serial numbers for the recalled brakes have the digit "3" as the fourth digit of the serial number.</p> <p>IMPORTER Unknown</p> <p>MANUFACTURED IN: Taiwan</p> 	<p>HAZARD: The brake systems can fail, posing a crash and injury hazard.</p> <p>INCIDENTS/INJURIES The firm received 95 reports of brakes failing in the U.S. One minor injury was reported in the U.S. and another in Australia.</p>	Consumers should immediately stop using bicycles equipped with the recalled SRAM brake systems and contact any SRAM dealer to arrange for a free replacement product to be installed and to receive a \$200 product voucher or cash per customer.
USA	<p>NAME OF PRODUCT: Olympic Decline free weight bench</p> <p>UNITS: 234</p> <p>DESCRIPTION The Decline model free weight benches are designed for use in professional gyms and come in three model numbers: 16060, 16061 and 16062. The Decline model free weight bench is a traditional Olympic bench which accommodates a 7' wide Olympic bar, and the back pad declines from the knee to the shoulders at a 15 degree angle. The model numbers can be found on the bottom of the tube near where the feet are placed with serial numbers C1208 through H0913 which stand for the manufacture dates, December 2008 through September 2013.</p> <p>IMPORTER Unknown</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD: The frame of the bench can collapse forward onto the user, posing fall and injury hazards.</p> <p>INCIDENTS/INJURIES The firm received nine reports of frames fatiguing near the weld point. No injuries were reported.</p>	Consumers should stop using the benches immediately and contact Cybex to arrange for instructions for inspecting the frames for cracks or weakness and for installing the free repair.

HARDGOODS: SPORT & LEISURE GOODS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Compulsory Recall—Saekodive Buoyancy Compensators</p> <p>PRODUCT DESCRIPTION</p> <p>This recall notice is issued by the South Australian Minister for Business Services and Consumers pursuant to Section 122 of the Australian Consumer Law (SA).</p> <p>IDENTIFYING FEATURES</p> <p>Saekodive buoyancy compensators Cyclone (model #9000) and Hurricane (model #9300)</p> <p>Manufactured in 2005 and 2006, but may have been available for sale up to and including 2008.</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Seasuits Australia Pty Ltd sold the product to dive retailers in South Australia only.</p> <p>SUPPLIER</p> <p>Minister for Business Services and Consumers (South Australia)</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> 	<p>DEFECTS</p> <p>The plastic seal connecting the inflator/dump valve to the vest can become brittle and detach.</p> <p>HAZARDS</p> <p>This poses a drowning hazard if the failure occurs while underwater as the vest may fill with water and act as an anchor.</p>	<p>Consumers should immediately stop using the Saekodive buoyancy compensator and dispose of it as it may not be safe to use.</p> <p>If you have any queries in relation to this recall please contact Consumer and Business Services, Product Safety Section, on (08) 8204 9147 or at productsafety.cab@adg.sa.gov.au.</p>
AUSTRALIA	<p>Specialized Bicycles—S-Works Evade Helmet</p> <p>PRODUCT DESCRIPTION</p> <p>Specialized S-Works Evade Cycling Helmet</p> <p>IDENTIFYING FEATURES</p> <p>60714-2742; 60714-2743; 60714-2744; 60714-2712; 60714-2713; 60714-2714; 60714-2722; 60714-2723; 60714-2724</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Authorised Specialized dealers</p> <p>SUPPLIER</p> <p>Specialized Bicycles</p> <p>SUPPLIER'S WEB SITE</p> <p>No</p> 	<p>DEFECTS</p> <p>The front strap hanger moulded in to the helmets may crack or become dislodged causing the helmet to come away from the head.</p> <p>HAZARDS</p> <p>There is a possibility that the helmets may not provide adequate protection to the wearer in the event of an accident and may increase the risk of injury to the wearer.</p>	<p>If your helmet is affected by this recall, please stop using the helmet immediately and return your helmet to an Authorized Specialized Retailer for a free inspection.</p>

HARDGOODS: SPORT & LEISURE GOODS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Fitness Anywhere LLC—TRX Dip Bars and TRX Hammer Bars</p> <p>PRODUCT DESCRIPTION</p> <p>Each set of bars consists of two steel handle bars with vinyl grips that attach to the side of a steel frame used to support hanging exercises and exercise equipment. The bars are used to perform pull-ups, dips, and other hanging exercises.</p> <p>IDENTIFYING FEATURES</p> <p>The SKU numbers for the products are:</p> <ul style="list-style-type: none"> • SFDIP-S (GSA) • SFDIP-S-I • SFHMR (GSA) • SFHMR-I <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Fitness Anywhere sold its product to the following commercial clubs: MyMojo PTY Ltd., Goodlife Australia, Zanshin Health & Fitness, Virgin Active Australia, Brendan Tuck, Genesis Cairns, ZBest Fitness, Genisis Preston, QPEC</p> <p>SUPPLIER</p> <p>Fitness Anywhere LLC</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.trxtraining.com</p> 	<p>DEFECTS</p> <p>The welds on the product may crack or break, causing it to fail.</p> <p>HAZARDS</p> <p>The user may sustain an injury if the product fails.</p>	<p>Consumers should return the product to Fitness Anywhere's warehouse, DHL Supply Chain Hong Kong (DSC), located at 11 On Chuen Street, On Lok Tsuen, Fanling, New Territories, Hong Kong. Fitness Anywhere will be in direct contact with each consumer to make arrangements to provide a replacement product.</p>

HARDGOODS: SPORT & LEISURE GOODS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Expedition Equipment—Sterling Rope 8mm Bound Loop Prusiks, 8mm Edge Restraints, 8mm Nylon PER Sewn Eyes, 8mm Accessory Eyes</p> <p>PRODUCT DESCRIPTION Sewn 8mm cord, either as prusiks loops, end termination for Aztek or Pocket Hauler kit systems and or custom length cord.</p> <p>IDENTIFYING FEATURES Sterling Rope products display the production lot number in two places. The lot number is printed on the barcode label affixed to their Care, Use and Retirement document. The lot number is also printed on the shrink tube label on the sewn portion of the prusik.</p> <p>TRADERS WHO SOLD THIS PRODUCT Southern Cross Equipment, K2 Basecamp & Bushcraft Equipment</p> <p>SUPPLIER Expedition Equipment</p> <p>SUPPLIER'S WEB SITE No</p> 	<p>DEFECTS The Bound Loop Prusiks may not conform to the Sterling Rope Quality standards, and may break at a lower strength than the published values.</p> <p>HAZARDS The Bound Loops breaking at lower strength could cause failure to the system resulting in a potential fall hazard to the user.</p>	Consumers should send/return the product back to the place of purchase for a replacement.

TOYS AND JUVENILE PRODUCTS: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/CROATIA	<p>CATEGORY: Toys</p> <p>PRODUCT: Rubber ducks</p> <p>BRAND: unknown</p> <p>NAME: Unknown</p> <p>TYPE/NUMBER OF MODEL: ART. V039/38498</p> <p>Batch number/Barcode: 3856007555466</p> <p>DESCRIPTION: Set of rubber ducks packed in transparent polymer net (9 ducks in one packaging). Size of ducks is approximately 4,5 cm.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHEMICAL</p> <p>The product poses a chemical risk because it contains DEHP (28%) and DBP (0.23%). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles, while phthalates DINP, DIDP and DNOP are prohibited in toys or childcare articles that can be placed in the mouth by children.</p>	Compulsory measures: Import rejected at border, Destruction of the product.
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Toy trumpet</p> <p>BRAND: Unknown</p> <p>NAME: Toys</p> <p>TYPE/NUMBER OF MODEL: Item nº 03-211</p> <p>Batch number/Barcode: 8349103032115</p> <p>DESCRIPTION: Toy trumpet supplied in cellophane blister packaging.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING</p> <p>The product poses a risk of choking because it contains a small part (the mouthpiece) which can easily detach and be swallowed by small children.</p> <p>The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.</p>	Compulsory measures: Withdrawal of the product from the market.

TOYS AND JUVENILE PRODUCTS: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/CZECH REPUBLIC	<p>CATEGORY: Toys</p> <p>PRODUCT: Plastic doll</p> <p>BRAND: Guangda</p> <p>NAME: Fad Girl</p> <p>TYPE/NUMBER OF MODEL: Item No. 105</p> <p>Batch number/Barcode: 8594167132244</p> <p>DESCRIPTION: Plastic doll of about 25 cm, available in four different types with the head and the body in white, purple, green and brown colours respectively, and with accessories. The products are supplied in a cardboard box with a transparent window.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHEMICAL</p> <p>The product poses a chemical risk because the head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) and di-n-butyl phthalate (DBP) above the permitted levels (measured values: 7.23 % by weight DEHP, 0.19% by weight DBP). In addition it contains diisobutyl phthalate (DINP) (measured value: 8.74 % by weight).</p> <p>According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles, while phthalates DINP, DIDP and DNOP are prohibited in toys or childcare articles that can be placed in the mouth by children.</p>	Compulsory measures: Import rejected at border.
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Spectacles with button batteries</p> <p>BRAND: Unknown</p> <p>NAME: Unknown</p> <p>TYPE/NUMBER OF MODEL: Item No: NB-237</p> <p>Batch number/Barcode: 802018012378</p> <p>DESCRIPTION: Green plastic toy spectacles supplied in cellophane blister packaging with a sticker label. They emit lights and are powered by button batteries.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHEMICAL, CHOKING</p> <p>The plastic of the spectacles can easily break leaving the button batteries (small parts) accessible. Ingestion of the batteries poses a risk of choking and a chemical risk to small children. In addition, the labelling and instructions are insufficient.</p> <p>The product does not comply with the requirements of the Toy Safety Directive and the relevant European standards EN 62115.</p>	Compulsory measures: Withdrawal of the product from the market.

TOYS AND JUVENILE PRODUCTS: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/CZECH REPUBLIC	<p>CATEGORY: Toys</p> <p>PRODUCT: Plastic doll</p> <p>BRAND: TV Products</p> <p>NAME: Doll - baby "ZUZANKA"</p> <p>TYPE/NUMBER OF MODEL: PM-942 (marking on invoice)</p> <p>Batch number/Barcode: EANs: 8595194711785, 8595194711808</p> <p>DESCRIPTION: The plastic baby doll is 45 cm tall, it has a pink cap, white body with pictures of teddy bears, pink long-sleeved shirt and pink pacifier. The doll is talking, laughing, crying and sleeping. Source: 2x1, 5 V AA batteries (not included). Packaging: cardboard box with a transparent window.</p> <p>COUNTRY OF ORIGIN: Hong Kong</p> 	<p>CHEMICAL</p> <p>The product poses a chemical risk because it contains 7.9 % by weight of di-(2-ethylhexyl) phthalate (DEHP). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles, while phthalates DINP, DIDP and DNOP are prohibited in toys or childcare articles that can be placed in the mouth by children.</p>	Compulsory measures: Import rejected at border.
EU/BELGIUM	<p>CATEGORY: Toys</p> <p>PRODUCT: Water balloon pump</p> <p>BRAND: Unknown</p> <p>NAME: Fun Kit Water Bomb</p> <p>TYPE/NUMBER OF MODEL: 10018801 - B-089</p> <p>Batch number/Barcode: 4892429008981</p> <p>DESCRIPTION: Plastic water pump for filling balloons, in various colours.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries because it can easily explode and pieces of plastic may cause injuries.</p> <p>Incidents reported.</p> <p>The product does not comply with the requirements of the Toy Safety Directive.</p>	Voluntary measures: Recall of the product from end users.

TOYS AND JUVENILE PRODUCTS: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Product Description Pool noodle with connector</p> <p>Identifying Features Item Code (PLU): 43814 Barcode (EAN): 26178448</p> <p>Traders Who Sold This Product ALDI Stores</p> <p>Supplier Twinpeaks Leisure Pty Ltd</p> <p>Supplier's Web Site http://www.twinpeakslleisure.com.au/</p> 	<p>Defects The product does not fully comply with the labeling requirements of Consumer Protection Notice No. 2 of 2009 - Consumer Product Safety Standard: Flotation Toys and Aquatic Toys. This requires aquatic toys, such as pool noodles, to be permanently marked with the following warning in a contrasting colour: WARNING - AQUATIC TOY- USE ONLY UNDER SUPERVISION.</p> <p>Hazards If parents do not properly supervise children whilst they are swimming, there is an increased risk that drowning may occur.</p>	Immediately cease use and return the pool noodle to your nearest ALDI Store for a full refund.
AUSTRALIA	<p>Product Description A battery operated mobile phone toy</p> <p>Identifying Features Barcode: 1000000135268</p> <p>Traders Who Sold This Product Super Value Centre Pty Ltd</p> <p>Supplier Super Value Centre Pty Ltd</p> <p>Supplier's Web Site No</p> 	<p>Defects The product contains small parts, and does not comply with the mandatory safety standard for toys for children up to and including 36 months of age (Australian Standard AS/NZS ISO 8124.1:2003, as amended by the regulation).</p> <p>Hazards Small parts pose a potential choking hazard to young children.</p>	Consumers should return the product to the place of purchase for a refund.

TOYS AND JUVENILE PRODUCTS: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>PRODUCT DESCRIPTION Hoppy white plush bunny 8 inch Bumper Grey Plush bunny 8 inch</p> <p>IDENTIFYING FEATURES Hoppy Bunny (parenthood code 28824) manufacturers code 1122503/8 Bumper Bunny (parenthood code 28826) manufacturers code 11225-3A/8</p> <p>TRADERS WHO SOLD THIS PRODUCT Parenthood stores only</p> <p>SUPPLIER Parenthood Pty Ltd</p> <p>SUPPLIER'S WEB SITE http://www.parenthoodfurniture.com.au/</p> 	<p>DEFECTS The toys may liberate stuffing during use as they do not comply with the mandatory standard for toys for children up to and including 36 months of age (Australian Standard AS/NZS ISO 8124.1:2003, as amended by the regulation).</p> <p>HAZARDS In the event that the stuffing becomes dislodged from the toys, the stuffing is a choking hazard which may result in injury or death.</p>	Consumers should return the item to a parenthood store (addresses listed at www.parenthoodfurniture.com.au) for a full refund of the purchase price.

TOYS AND JUVENILE PRODUCTS: JUVENILE PRODUCTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Childcare articles and children's equipment</p> <p>PRODUCT: Bathtub for babies</p> <p>BRAND: Oduoya</p> <p>NAME: Lucky Baby</p> <p>TYPE/NUMBER OF MODEL: 00776</p> <p>Batch number/Barcode: 8421531007764</p> <p>DESCRIPTION: Orange bathtub for babies with a label on the base. The product is supplied without packaging.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries because it can easily break and because it is not sufficiently stable and if the child moves it may overturn. In addition, the warnings and instructions are insufficient.</p>	Compulsory measures: Withdrawal of the product from the market.
EU/BULGARIA	<p>CATEGORY: Childcare articles and children's equipment</p> <p>PRODUCT: Swimming seat</p> <p>BRAND: Suarch</p> <p>NAME: 25 "x18"Baby boat- BEN 10</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>Batch number/Barcode: Unknown</p> <p>DESCRIPTION: Children's boat floating ring in green colour with a steering wheel and a red whistle, size 25"x18", intended for children aged 3-14. The product is placed inside cellophane packaging together. The boat floating ring has two openings for the legs. On the boat there is an inscription BEN 10, pictures of cartoon characters and some warning inscriptions in a foreign language.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>DROWNING</p> <p>The product poses a risk of drowning because the inflatable boat has been made with a return valve and in the event of accidental opening of the stopper of the inflation valve the boat deflates with a risk of drowning of the child.</p> <p>The product does not comply with the relevant European standard EN 13138.</p>	Compulsory measures: Ban on the marketing of the product and any accompanying measures.

TOYS AND JUVENILE PRODUCTS: JUVENILE PRODUCTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Koala Securities Pty Ltd—"Avoca" Wooden Baby Cot</p> <p>PRODUCT DESCRIPTION Wooden Baby Cot</p> <p>IDENTIFYING FEATURES Carton Markings: Avoca Cot (White) & (Heritage) with recommended mattress size 1300 x 690 x 125mm Made in China O/N M302</p> <p>TRADERS WHO SOLD THIS PRODUCT Nursery hardware stores</p> <p>SUPPLIER Koala Securities Pty Ltd</p> <p>SUPPLIER'S WEB SITE No</p> 	<p>DEFECTS The cot does not comply with the mandatory Australian standard, AS/NZS 2172:2003 Cots for household use—safety requirements. The cot is missing the required label, on the mattress base, to notify consumers of the recommended mattress size, use of the adjustable base and the supplier's details.</p> <p>HAZARDS A consumer may use the incorrect sized cot mattress and this may lead to a suffocation hazard. In addition, if a consumer is unaware of how to use the adjustable base this may pose a fall hazard to the child.</p>	Contact the place of purchase to organise for the warning label to be affixed to the mattress base. Alternatively, consumers can contact Koala Securities to organise for a label and instruction sheet to be sent to them. For further information please contact Koala Securities Pty Ltd on (03) 9580 8000.

COSMETICS, PERSONAL CARE AND HOUSEHOLD: COSMETICS AND PERSONAL CARE			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Arbonne Europe Sarl—RE9 Advanced Restorative Day Creme SPF 15 3mL Sample Tube</p> <p>PRODUCT DESCRIPTION</p> <p>The recalled product is a 3mL trial-sized sample tube intended for a few applications and is not available for individual sale. It is found in a sample set with 6 other products in the RE9 Advanced skincare line. This 7 product sample set is then sold in quantities of 10 packs for \$24. These sample pack sets are not available to general consumers to purchase. Only authorised independent consultant distributors registered with Arbonne may purchase this sample set. The RRP and quantity of product affected are for this 10-pack of samples because the RE9 Advanced Restorative Day Crème SPF 15 3mL sample is not sold in any other manner.</p> <p>IDENTIFYING FEATURES</p> <p>Lot 45284</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Arbonne Independent Consultants</p> <p>SUPPLIER</p> <p>Arbonne Europe Sarl</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.arbonneinternational.com.au</p> 	<p>DEFECTS</p> <p>The product contains Enterobacter gergoviae bacteria.</p> <p>HAZARDS</p> <p>Enterobacter gergoviae may pose a risk of infection to immunocompromised individuals.</p>	<p>All Arbonne Independent Consultants identified as having purchased this batch will be contacted by mail. If you have product with Lot Number 45284, do not use it. Please discard any unused recalled product in your possession.</p>

COSMETICS, PERSONAL CARE AND HOUSEHOLD: HOUSEHOLD			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Chemical products</p> <p>PRODUCT: Anti-mosquito patches</p> <p>BRAND: Dekora</p> <p>NAME: Unknown</p> <p>TYPE/NUMBER OF MODEL: 9000464</p> <p>Batch number/Barcode: 8435061727283</p> <p>DESCRIPTION: Yellow mosquito-repellent patches with smiling faces. They are sold in packets of 12 units.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHEMICAL</p> <p>The product is not adequately labelled as a biocidal product and it is attractive to children. The product can be misused and children can touch it or put it in the mouth and be intoxicated.</p> <p>The product does not comply with the Regulation (EU) No 528/2012 concerning the making available on the market and use of biocidal products.</p>	<p>Compulsory measures: Withdrawal of the product from the market.</p>

SOFTLINES: TEXTILE AND CLOTHING			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/POLAND	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's trousers</p> <p>BRAND: 4F</p> <p>NAME: Unknown</p> <p>TYPE/NUMBER OF MODEL: T4Z12-JSPUT204</p> <p>Batch number/Barcode: 5900416928217</p> <p>DESCRIPTION: Black trousers for sport with pockets in the back and a wide rubber elastic band inside the waist part of the garment. Sewn-in zips are present both in the back pockets and in the legs.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries because the zip pullers are too long and they protrude below the bottom edge of the garment.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Voluntary measures: Making the marketing of the product subject to prior conditions.
EU/POLAND	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's trousers</p> <p>BRAND: 4F</p> <p>NAME: Unknown</p> <p>TYPE/NUMBER OF MODEL: T4Z12-JSPMD200</p> <p>Batch number/Barcode: 5900416923335</p> <p>DESCRIPTION: On the sides and at the back of the trouser pockets there are sewn-in zippers. On the right leg there is a symbol "4F". There is a wide rubber band and drawstring inside the waist of the trousers. Length of the free ends of the drawstring: 290 mm (size 122 cm), 145 mm (size 146 cm), 95 mm (size 152 cm), 160 mm (size 158 cm).</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>INJURIES</p> <p>The trousers pose a risk of injuries due to the presence of non-fixed cords in the waist area. Furthermore, the cords in the trousers of size 122 and 146 are too long and may cause injuries if, for example, they catch on playground facilities or other moving objects.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Voluntary measures: Making the marketing of the product subject to prior conditions.

SOFTLINES: TEXTILE AND CLOTHING			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Tottenham Hotspur Infant Home Kits</p> <p>UNITS: About 62</p> <p>DESCRIPTION The infant home kit consists of a white jersey and navy blue shorts and socks in sizes 0, 6 months, 12 months and 18 months. The jersey has style #1238534 printed on a side seam label. The jerseys are white with navy blue trim and navy blue UA and Tottenham Hotspur logos. The navy blue shorts have white trim and white UA and Tottenham Hotspur logos. The socks are navy blue.</p> <p>IMPORTER Under Armour, Inc., of Baltimore, Md.</p> <p>MANUFACTURED IN: Philippines</p> 	<p>HAZARD: The shoulder snaps on the jersey can detach, posing laceration and choking hazards.</p> <p>INCIDENTS/INJURIES There were no injuries reported.</p>	Consumers should immediately take the recalled home kits away from children and return the kits to the retailer where purchased or contact Under Armour for a full refund.

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

The Rapid Alert System for food and feed (RASFF)-Notifications search page.

<https://webgate.ec.europa.eu/rasff-window/portal/>

Disclaimer: The Commission cannot and does not take any responsibility for the accuracy of the information in these weekly overviews. The information is published as it has been received from the official contact points in the Member States/EEA-EFTA countries. In the event that further information received from a contact point regarding an already published notification leads to modification or withdrawal of the information, the Commission shall respectively include a corrigendum or a notice of withdrawal in the next weekly overview to be published.

PRODUCT RECALLS IN THE USA

Recalls and Product Safety News

www.cpsc.gov/cpscpub/prerel/prerel.html

US Food and Drug Administration (FDA)

www.fda.gov/opacom/7alerts.html (US Cosmetics recalls)

Environmental Protection Agency (EPA)

www.epa.gov/pesticides/alerts.htm (US Pesticides recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsca@sgs.com

<http://www.sgs.com/en/Consumer-Goods-Retail/Product-Recalls.aspx>

© SGS Group Management SA – 2014 – All rights reserved - SGS is a registered trademark of SGS Group Management SA. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS