

PRODUCT RECALLS

THE SGS PUBLICATION GATHERING CONSUMER PRODUCT RECALLS
IN THE EU, IN THE USA AND IN AUSTRALIA

CONSUMER TESTING SERVICES (CTS)

16– 31 MAY 2012

CONTENTS

ELECTRICAL & ELECTRONICS

Pages 2 to 16



[Electrical appliances \(15\)](#)

[Lighting Equipments \(15\)](#)

Cord Sets, Plugs & Sockets (0)

HARDLINES

Pages 17 to 33



[Toys \(10\)](#)

[Juvenile Items \(1\)](#)

Premiums (0)

[Children articles \(9\) - See 'SOFTLINES'](#)

[Home Furnishing & Houseware \(16\)](#)

[Home Improvement & DIY \(2\)](#)

[Personal & Home Care Items \(4\)](#)

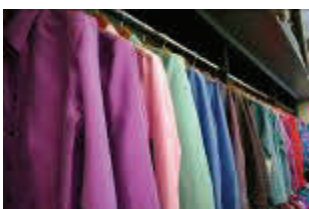
[Sport & Leisure Goods \(6\)](#)

PPE (0)

[Miscellaneous \(2\)](#)

SOFTLINES



Pages 34 to 38







[Wearing Apparels \(9\)](#)



Home Textiles (0)




Footwear, Bags and Accessories (0)

E&E: ELECTRICAL APPLIANCES			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Charger "L-Chocolate Cellular Charger"</p> <p>BRAND: Cellular</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Black plastic phone charger in a white and blue card box.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> · The quality of the bonding between the two halves of the charger casing is poor. Live parts could be exposed if this bond failed. · The insulation between the primary and secondary windings is not equivalent to reinforced insulation and creepage distances are insufficient. <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60950.</p>	Voluntary withdrawal from the market.
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Hand-dryer "World Dryer"</p> <p>BRAND: Warner Howard</p> <p>TYPE/NUMBER OF MODEL: Model number MR48 (white cover models only). The affected dryers were manufactured between May 2009 and April 2011. The changeover is denoted by the first 5 digits of the serial number. Serial numbers starting 20114 or higher are not affected; serial numbers lower i.e. 20113 and below are affected.</p> <p>DESCRIPTION: Wall-mounted hand-dryer fitted in premises such as shops, restaurants, places of work, schools.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The affected models have a rotating air outlet nozzle which is not earthed to the cover so that in the event of a failure which might cause live parts to come into contact with it, the user might receive an electric shock.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60335.</p>	Voluntary corrective action taken by the manufacturer.

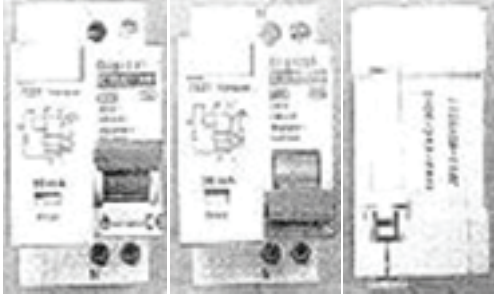

E&E: ELECTRICAL APPLIANCES			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/CYPRUS	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Digital receiver "Digital Terrestrial Receiver MPEG4"</p> <p>BRAND: Imperial</p> <p>TYPE/NUMBER OF MODEL: SD 2604C;</p> <p>Barcode: 5290656056659</p> <p>DESCRIPTION: Digital terrestrial receiver, 100-240V, 50/60Hz.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK, BURNS AND FIRE</p> <p>The product poses a risk of electric shock, fire and burns because:</p> <ul style="list-style-type: none"> - the supply cord has only basic insulation which comes into contact with the metal enclosure; - the resistance of the conductors in the supply cord is too high. <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60065.</p>	Sales ban ordered by the authorities.
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Charger "Home Charger"</p> <p>BRAND: I-power</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Home charger for iPods in plastic and cardboard packaging (NOT ORIGINAL PRODUCT).</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> - Creepage distances between "live" and "accessible" printed tracks are not sufficient. - Insulation between the primary and secondary windings of the transformer is not equivalent to reinforced insulation. - Creepage distances between primary and secondary windings are not sufficient. - It does not have sufficient mechanical strength and the pins can break. <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60950.</p>	Voluntary withdrawal from the market.



E&E: ELECTRICAL APPLIANCES			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/CYPRUS	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Digital receiver "Digital Terrestrial Receiver"</p> <p>BRAND: Fujitec</p> <p>TYPE/NUMBER OF MODEL: SD2100</p> <p>Barcode: 5204689118031</p> <p>DESCRIPTION: Digital terrestrial receiver, 100-240V, 50/60Hz.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK, BURNS AND FIRE</p> <p>The product poses a risk of electric shock, fire and burns because:</p> <ul style="list-style-type: none"> - the supply cord has only basic insulation which comes into contact with the metal enclosure; - the resistance of the conductors in the supply cord is too high. <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60065.</p>	Sales ban ordered by the authorities.
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: USB Charger YXT-030 for 3G/3Gs/4G</p> <p>BRAND: Yongxingtong</p> <p>TYPE/NUMBER OF MODEL: Model: YXT-030</p> <p>DESCRIPTION: USB charger kit with charger to use in car. Packaged in plastic and cardboard.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The mains charger supplied with the product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> - The wires to the live mains plugs pins are not secured independently of their soldered connections. - Creepage distances are insufficient between "live" and "accessible" printed tracks. - The insulation between the primary and secondary windings of the transformer is not equivalent to reinforced insulation. - Creepage distance of the windings is not sufficient. - The pins of the plug are too short. - The pins of the plug can break. <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60950.</p>	Voluntary withdrawal from the market.

E&E: ELECTRICAL APPLIANCES			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Travel charger for iPhone 4/3GS/3G (NOT ORIGINAL PRODUCT)</p> <p>BRAND: Unknown</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Travel charger for iPhone 4/3GS/3G.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> · The wires to the live mains plugs pins are not secured independently of their soldered connections. · Creepage distances are insufficient between “live” and “accessible” printed tracks. · The insulation between the primary and secondary windings of the transformer is not equivalent to reinforced insulation. · Creepage distance of the windings is not sufficient. · The pins of the plug are too short. <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60950.</p>	Voluntary withdrawal from the market.
USA	<p>NAME OF PRODUCT: Kitchen Selectives® 6-Speed Blender</p> <p>UNITS: About 4,069</p> <p>IMPORTER: Select Brands Inc., of Lenexa, Kan.</p> <p>MANUFACTURER: Select Brands, of Lenexa, Kan.</p> <p>DESCRIPTION: The recalled products are Kitchen Selectives® 6-Speed Blenders, model BL-15. The model number is located on the bottom of the base. The blender consists of a six-inch tall, white electrical base with five, white speed-selector buttons labeled 1 through 5, one gray button labeled "Pulse/Off" and the logo "Kitchen Selectives®" in black letters on the front; a clear plastic pitcher with a handle with U.S. and metric volume measurement markings; a white plastic lid with a removable clear plastic lid stopper; and a white plastic blade assembly with two angled, stainless steel blades.</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: While in operation, the plastic pitcher can separate from the blade assembly, leaving the blade assembly in the base and exposing the rotating blades. This poses a laceration hazard to consumers.</p> <p>INCIDENTS/INJURIES: Select Brands has received no reports of incidents or injuries involving Kitchen Selectives® 6-speed blenders.</p>	Voluntary recall


E&E: ELECTRICAL APPLIANCES			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Travel Charger (with dual LED indication) for G600</p> <p>BRAND: Unknown</p> <p>TYPE/NUMBER OF MODEL: KJ-TC02A</p> <p>DESCRIPTION: Mobile phone travel charger packaged in cardboard box.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> · Insulation within the charger is wrongly positioned and does not cover the connections on the live plug. · Wires to the live mains plugs pins are not secured. · Creepage distance between "live" and "accessible" printed tracks are not sufficient. · Insulation between the primary and secondary windings of the transformer is not equivalent to reinforced insulation. · Creepage distances between primary and secondary windings are not sufficient. · It does not have sufficient mechanical strength and the pins can break. <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60950.</p>	Voluntary withdrawal from the market.
EU/CYPRUS	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Digital receiver "Digital Terrestrial Receiver"</p> <p>BRAND: Eurosan</p> <p>TYPE/NUMBER OF MODEL: SD1000</p> <p>Barcode: 5204689118031</p> <p>DESCRIPTION: Digital terrestrial receiver, 100-240V, 50/60Hz.COUNTRY OF ORIGIN: China</p>  	<p>ELECTRIC SHOCK, BURNS AND FIRE</p> <p>The product poses a risk of electric shock, fire and burns because:</p> <ul style="list-style-type: none"> - the supply cord has only basic insulation which comes into contact with the metal enclosure; - the resistance of the conductors in the supply cord is too high. <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60065.</p>	Sales ban ordered by the authorities.




E&E: ELECTRICAL APPLIANCES



NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FRANCE	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Differential circuit-breaker</p> <p>BRAND: Digital</p> <p>TYPE/NUMBER OF MODEL: Model: Digital JVL6-32 Ref. 3016 lot JR11-HXY0211</p> <p>DESCRIPTION: Phased circuit-breaker + differential neutral 30 mA gauge 2 X 16A type AC. Packaged in boxes of six units.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>FIRE AND ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock and fire because it does not function correctly in the event of over current or a short-circuit.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 61009.</p>	<p>Voluntary withdrawal from the market and recall from consumers.</p> <p>Products seized by the authorities.</p>
EU/FRANCE	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Differential circuit-breaker</p> <p>BRAND: Elmark</p> <p>TYPE/NUMBER OF MODEL: Model JEL 05</p> <p>DESCRIPTION: Differential circuit-breaker - voltage 230/240V - rated current 16A - rated differential operating current 0.03A - rated breaking capacity 6000A.</p> <p>COUNTRY OF ORIGIN: Bulgaria</p> 	<p>FIRE AND ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock and fire because it does not function correctly in the event of over current or a short-circuit.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 61009.</p>	<p>Voluntary withdrawal from the market and recall from consumers.</p>



E&E: ELECTRICAL APPLIANCES			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FRANCE	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Differential circuit-breaker</p> <p>BRAND: LS</p> <p>TYPE/NUMBER OF MODEL: Model: RKP C16A.</p> <p>DESCRIPTION: Differential circuit-breaker.</p> <p>COUNTRY OF ORIGIN: Korea</p> 	<p>ELECTRIC SHOCK AND FIRE</p> <p>The product poses a risk of electric shock and fire because it does not function correctly in the event of over current or a short-circuit.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 61009.</p>	Voluntary withdrawal from the market and recall from consumers.
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Charger For iPhone 3G 2.2 Charger (NOT ORIGINAL PRODUCT)</p> <p>BRAND: Unknown</p> <p>TYPE/NUMBER OF MODEL: LX008</p> <p>DESCRIPTION: Mains charger for iPhone in plastic and card packaging.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> · Creepage distances between "live" and "accessible" printed tracks are not sufficient. · Insulation between the primary and secondary windings of the transformer is not equivalent to reinforced insulation. · Creepage distances between primary and secondary windings are not sufficient. · It does not have sufficient mechanical strength and the pins can break. <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60950.</p>	Voluntary withdrawal from the market.



E&E: ELECTRICAL APPLIANCES



NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/UNITED KINGDOM	<p>CATEGORY: Electrical appliances and equipment</p> <p>PRODUCT: Charger For iPhone 3GS Accessories (NOT ORIGINAL PRODUCT)</p> <p>BRAND: Unknown</p> <p>TYPE/NUMBER OF MODEL: TC037</p> <p>DESCRIPTION: Mains charger for iPhone in plastic and card packaging.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because it does not have sufficient mechanical strength and the pins can break.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60950.</p>	Voluntary withdrawal from the market.

E&E: LIGHTING EQUIPMENTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: Incandescent floor light</p> <p>BRAND: Route US 66</p> <p>TYPE/NUMBER OF MODEL: Type: 204969/5603 Barcode: 6 410412 049698</p> <p>DESCRIPTION: Incandescent floor light, 40W-E27, 230V, cl. II, IP20.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because live parts are accessible.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 61347.</p>	Recall from consumers ordered by the authorities.
EU/HUNGARY	<p>CATEGORY: Lighting chains</p> <p>PRODUCT: Lighting chain "100 LED VILÁGIT" (100 LED light)</p> <p>BRAND: A.I.&E</p> <p>TYPE/NUMBER OF MODEL: Type: XN-714; Batch:354203</p> <p>DESCRIPTION: The lighting chain includes serial-parallel connected, non-replaceable 100 LED lamps. The product can be operated with a flashing control unit. Main parts of the lighting chain: two-pin plug ("2.5A 250V"), flashing control unit, single-insulated mains cable with single-core, without marking. Technical specifications: Class II. , F marking</p> <p>COUNTRY OF ORIGIN: Unknown</p>  	<p>ELECTRIC SHOCK AND FIRE</p> <p>The product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> - the wire ends soldered to terminals of the flashing switch and control unit and the LEDs are not adequately protected against pulling and twisting: - the accessible wires have only basic insulation and they come into contact with sharp edges of the flashing control unit. In case of damage, the live metal parts become accessible; - the decorative lighting chain is recommended for outdoor use although it is not protected against moisture. <p>The product poses a risk of fire because the cross-section area of the wires is less than the minimum requirement, thus, they can overheat.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60598.</p>	Withdrawal from the market and recall from consumers ordered by the authorities.



E&E: LIGHTING EQUIPMENTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/HUNGARY	<p>CATEGORY: Lighting chains</p> <p>PRODUCT: Lighting chain "140 LED Folyamatosan világít"</p> <p>BRAND: Unknown</p> <p>TYPE/NUMBER OF MODEL: Type: KD-140LED1 (on the product), XN-510 (on the packaging) Barcode: 5 998791 195102</p> <p>DESCRIPTION: The lighting chain includes serial-parallel connected, non-replaceable 140 LED lamps. The product can be operated with a flashing control unit. The main parts of the lighting chain: a two-pin plug ("WD QX 2.5A 250V CE"), flashing control unit with English-language marking and inscriptions, single-core, single-insulated mains cable. Packaging: Transparent plastic cylinder. Technical specifications: 230 V~, 50 Hz, 10.8 W, Class II. , F marking, 180 LED x 3,2 V, 0,02 A</p> <p>COUNTRY OF ORIGIN: Unknown</p> 	<p>ELECTRIC SHOCK AND FIRE</p> <p>The product poses a risk of electric shock because:</p> <ul style="list-style-type: none"> - the wire ends soldered to terminals of the flashing switch and control unit and the LEDs are not adequately protected against pulling and twisting; - the accessible wires have only basic insulation and they come into contact with sharp edges of the flashing control unit. In case of damage, the live metal parts become accessible; - the dimensions of the plug are substantially less than the requirement. During connection the user may touch the pins of the plugs; - the decorative lighting chain is recommended for outdoor use although it is not protected against moisture. <p>The product poses a risk of fire because the cross-section area of the wires is less than the minimum requirement thus they can overheat.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60598.</p>	<p>Withdrawal from the market and recall from consumers ordered by the authorities.</p>
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: LED Lamp</p> <p>BRAND: Winled</p> <p>TYPE/NUMBER OF MODEL: Type: PD-T8-120-FT/312PCS</p> <p>DESCRIPTION: LED-tube 18W-G13, 85-265V, 50/60Hz, 4050K</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because there is inadequate insulation between live parts and accessible metal parts.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standards EN 60968 and EN 60598.</p>	<p>Recall from consumers ordered by the authorities.</p>

E&E: LIGHTING EQUIPMENTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: Electronic control gear for LED module</p> <p>BRAND: ts light</p> <p>TYPE/NUMBER OF MODEL: Type: ZF120A-2401500 Barcode: 6 418157 160807. (art.16080)</p> <p>DESCRIPTION: Electronic control gear for LED module. Input: 100-240V, 50/60Hz, 2.0A, cl II, IP20 Output: 24Vdc, 1.5A</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because there is inadequate insulation between live parts and accessible metal parts.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 61347.</p>	Recall from consumers ordered by the authorities.
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: LED Lamp</p> <p>BRAND: Winled</p> <p>TYPE/NUMBER OF MODEL: Type: 216-15W20110516</p> <p>DESCRIPTION: LED-lamp 15W-E27, 85-265Vac, 50Hz, 4000-5000K</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because there is inadequate insulation between live parts and accessible metal parts.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standards EN 60968 and EN 60598.</p>	Recall from consumers ordered by the authorities.
AUSTRALIA	<p>Add Plus Noosa—Bali Table Lights</p> <p>PRODUCT DESCRIPTION Styles: Angel, Elephant, Melasti People, Bulb Light, Stool Light</p> <p>IDENTIFYING FEATURES N/A</p> <p>TRADERS WHO SOLD THIS PRODUCT Add Plus Noosa</p> <p>SUPPLIER Add Plus Noosa</p> <p>SUPPLIER'S WEB SITE http://bagatellebali.com</p> <p>No picture available.</p>	<p>HAZARDS Risk of electrical shock, possibly resulting in severe injury or death.</p> <p>DEFECTS The wiring from the base to the bulb was not earthed or double insulated.</p>	Consumers should return the lights to Add Plus Noosa for a full refund or repair.

E&E: LIGHTING EQUIPMENTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: Children's lamp "Lastenhuoneen LED-valaisin"</p> <p>BRAND: Unknown</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Children's lamp supplied with mains transformer (Type: NFED-6510 Barcode: 6 410412 257994)</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The mains transformer supplied with the product poses a risk of electric shock because there is inadequate insulation between live parts and accessible metal parts.</p> <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 61347.</p>	<p>Recall from consumers ordered by the authorities.</p>
EU/HUNGARY	<p>CATEGORY: Lighting chains</p> <p>PRODUCT: Lighting chain "RICH Fényfűzér"</p> <p>BRAND: Ante</p> <p>TYPE/NUMBER OF MODEL: DCH</p> <p>DESCRIPTION: Lighting chain with 181 miniature lamps. Packaged in cardboard box</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>TYPE OF RISK: ELECTRIC SHOCK AND FIRE</p> <p>The product poses a risk of electric shock and fire because:</p> <ul style="list-style-type: none"> - the cross-section area of the external wires is less than required; - the wire ends soldered to terminals of flashing control unit are not adequately protected against pulling and twisting; - the accessible wires have only basic insulation; - the insulation resistance is not sufficient. <p>The product does not comply with the Low Voltage Directive and the relevant European standard EN 60598.</p>	<p>Withdrawal from the market and recall from consumers ordered by the authorities.</p>



E&E: LIGHTING EQUIPMENTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Portfolio 7-inch reflector assembly with glass lens</p> <p>UNITS: About 21,000</p> <p>DISTRIBUTOR: Cooper Lighting LLC, of Peachtree City, Ga.</p> <p>DESCRIPTION: This recall involves circular, 7-inch diameter Portfolio aluminum reflector with glass lens designed to be inserted into a light fixture. This reflector is intended for use in indoor, commercial applications, such as office buildings, schools and shopping malls. There are four springs attached to the lip of the reflector. Reflectors marked with a barcoded stamp on their outside surface are not subject this recall. The recall includes reflectors with the following catalogue descriptions: 7080*G, 7081*G, 7280*G, 7281*G, 7380*G, 7381*G, 7780*G, 7781*G, MSP5429*, MSP5443*, OLD-7280KLI4G and 7-inch reflectors with glass lens with the "PDR" (Product Deviation Request or customized product designation) prefix; however, this description does not appear on the product. The recalled assembly is used in the following lighting fixtures: C7018*, C7042*, C7113*, C7118*, C7126*, C7142*, C7213*, C7218*, C7226*, C7242*HD7*, and MD7*.</p> <p>MANUFACTURED IN: United States</p> 	<p>HAZARD: The reflector can fall out of its fixture to the ground, which could result in an injury hazard.</p> <p>INCIDENTS/INJURIES: Cooper Lighting has received 23 reports of reflectors falling. No injuries have been reported to the firm.</p>	Voluntary recall.
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: LED lamp "LED Spot"</p> <p>BRAND: E-Saver</p> <p>TYPE/NUMBER OF MODEL: Type: ES-3GU10 Barcode: 6 430036 900045</p> <p>DESCRIPTION: LED lamp (3x1WLED), 230V, 50Hz, IP20, 2800K, 240lm</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because the insulation between the live parts and the accessible metal body is inadequate.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60968.</p>	Recall from consumers ordered by the authorities.



E&E: LIGHTING EQUIPMENTS



NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: LED lamp "LED-Lamppu"</p> <p>BRAND: Energy+</p> <p>TYPE/NUMBER OF MODEL: Type: 6 438114 133705, Barcode: 6 43811 4133705</p> <p>DESCRIPTION: LED lamp 7W-E27, 220-240V, 50-60Hz, 530lm, 3000K.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The product poses a risk of electric shock because the insulation between the live parts and accessible metal parts is inadequate.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60968.</p>	<p>Recall from consumers ordered by the authorities.</p>
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: Night-light "Motion Fun Light"</p> <p>BRAND: Briloner</p> <p>TYPE/NUMBER OF MODEL: Type: 2806/014 Barcode: 4 002707 149798</p> <p>DESCRIPTION: Night-light 1x5W-E14, 230V, 50Hz, class II, IP20</p> <p>COUNTRY OF ORIGIN: Unknown</p> 	<p>ELECTRIC SHOCK</p> <p>It is possible to change the lamp whilst the product is connected to the supply. Consequently, it is possible to touch the metallic lamp socket when the lamp socket is electrified.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 60598.</p>	<p>Recall from consumers ordered by the authorities.</p>

E&E: LIGHTING EQUIPMENTS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: LED Clip-On Desk Lamps</p> <p>UNITS: About 33,000</p> <p>IMPORTER: L G Sourcing, Inc., of North Wilkesboro, N.C.</p> <p>MANUFACTURER: He Shan Lide of China</p> <p>DESCRIPTION: This recall conducted by He Shan Lide involves pink and blue plastic LED desk lamps with a flexible metal neck approximately 12" long and a clamp at the base. The power cord has a silver label attached to it. On one side of the label "MET," "Electrical Safety," "E113152" and "Apr. 2011" are printed. The other side of the label includes the model number F3044-AC-01 (pink lamps) or F3044-AC-02 (blue lamps). The plug on the power cord is labeled "KENIC KE 01P E155176."</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: The power cord for the lamp can detach where it meets the clamp, exposing energized wires, posing an electric shock risk to consumers.</p> <p>INCIDENTS/INJURIES: The firm has received five reports of cords detaching, including one reported electric shock and one report of a child receiving burns to her hand and leg.</p>	Voluntary recall.
EU/FINLAND	<p>CATEGORY: Lighting equipment</p> <p>PRODUCT: Christmas decoration</p> <p>BRAND: Joulumaisema TV</p> <p>TYPE/NUMBER OF MODEL: YH-GS-0600/225003 Barcode: 6 410412 250032</p> <p>DESCRIPTION: Christmas lights.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>ELECTRIC SHOCK</p> <p>The mains adaptor supplied with the product poses a risk of electric shock because there is inadequate insulation between the primary and secondary circuits.</p> <p>The product does not comply with the Low Voltage Directive (LVD) and the relevant European standard EN 61347.</p>	Recall from consumers ordered by the authorities.



HARDLINES: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Doll "Fashionable"</p> <p>BRAND: Star Glary</p> <p>TYPE/NUMBER OF MODEL: Model number: 898, article number: 895, barcode: 8429283208958</p> <p>DESCRIPTION: The product is a small doll measuring 16 cm in height; it has blonde hair with pink streaks collected in a ponytail. The doll wears a red dress and high-heeled detachable shoes. A pink ribbon is attached to the chest. It is packed in a small cardboard box (18x4x3 cm) with a transparent plastic window on the front. The following is written on the side of the box: "They are the most popular styles".</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHEMICAL</p> <p>The product poses a chemical risk because it contains 20% by weight of bis (2-ethylhexyl) phthalate (DEHP).</p> <p>According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles, while phthalates DINP, DIDP and DNOP are prohibited in toys or childcare articles that can be placed in the mouth by children.</p>	Withdrawal from the market ordered by the authorities.
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Set of rattles "Baby toys set"</p> <p>BRAND: Hand Bell Toys</p> <p>TYPE/NUMBER OF MODEL: Item No 29-306AB, barcode: 8 349029 293065</p> <p>DESCRIPTION: Rattles in different shapes and colours: a chain of four teddy bears in blue, white, green and red separated by a yellow part. Also other parts in the shape of aeroplanes or small animals, packaged in a pale yellow cardboard box with a transparent window through which the rattles can be seen. On the top left of the box is written the indication "Hand Bell toys" in a pink circle and the bottom of the box is marked with the indication: "The best gift for children".</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING</p> <p>The products pose a risk of choking because the rattles can easily break generating small parts which could be swallowed by children.</p> <p>The product does not comply with the Toy Safety Directive and with the relevant European standards EN-71-1.</p>	Withdrawal from the market and recall from consumers ordered by the authorities.

HARDLINES: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/GERMANY	<p>CATEGORY: Toys</p> <p>PRODUCT: Balloons "Happy Party"</p> <p>BRAND: Tib</p> <p>TYPE/NUMBER OF MODEL: P/O 985/2011 bar code 4 002727 168021</p> <p>DESCRIPTION: Pear-shaped balloons in white, yellow, orange, pink, red, blue, lilac and purple colours; length c. 8-10 cm</p> <p>COUNTRY OF ORIGIN: Malaysia</p> 	<p>CHEMICAL</p> <p>The product poses a chemical risk because it contains nitrosamines. Total content: 0.846 mg/kg, of which NDMA 0.468 mg/kg, NDnBA 0.378 mg/kg.</p> <p>The product does not comply with the Toys Safety Directive.</p>	Voluntary withdrawal from the market.
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Plastic flute</p> <p>BRAND: Eleiven</p> <p>TYPE/NUMBER OF MODEL: Ref. 14028 Barcode: 8643568140287</p> <p>DESCRIPTION: Plastic flute with detachable mouthpiece. Packaged in a plastic bag with a label showing the make, the reference and the importer.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING</p> <p>The product poses a risk of choking because it contains a removable mouth-piece which is a small part that could be placed in the mouth and swallowed.</p> <p>In addition, there is no compliance with the labelling requirements.</p> <p>The product does not comply with the Toys Safety Directive and with the relevant European standard EN 71-1.</p>	Withdrawal from the market ordered by the authorities.


HARDLINES: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Soft toys</p> <p>BRAND: Master Gift</p> <p>TYPE/NUMBER OF MODEL: Code: 32597 Barcode: 8432748325978</p> <p>DESCRIPTION: Battery-operated moving soft toys, approximately 25-30 cm tall; one is a dog and the other a panda. They have a label indicating the importer's details, the CE mark and the barcode. They are packed in small cardboard boxes with warnings about electrical toys.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING AND CHEMICAL</p> <p>The product poses a risk of choking because the battery compartment is accessible and can be easily opened. Therefore, children have access to batteries and may put them in the mouth and swallow them.</p> <p>The product does not comply with the Toys Safety Directive and the relevant European standard EN 71-1.</p>	Import rejected by the customs authorities.
EU/GERMANY	<p>CATEGORY: Toys</p> <p>PRODUCT: Balloons "Round 8 balloons"</p> <p>BRAND: Globos</p> <p>TYPE/NUMBER OF MODEL: Article No 30100, EAN-Code 4007937301008, Batch No AX 09 (item 30100 PP; order no GLH 09/2012)</p> <p>DESCRIPTION: Balloons in six different colours, 4 packs, each containing 8 items.</p> <p>COUNTRY OF ORIGIN: Mexico</p> 	<p>TYPE OF RISK: CHEMICAL</p> <p>The product poses a chemical risk because it contains nitrosamines (219 µg/kg) which are classified as a category 2 carcinogen. The release value for N-nitrosamines exceeds the established maximum quantity for N-Nitrosamine.</p> <p>The product does not comply with the Toys Safety Directive.</p>	Voluntary recall from consumers.

HARDLINES: TOYS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Plastic flute</p> <p>BRAND: Sucesso</p> <p>TYPE/NUMBER OF MODEL:</p> <p>Barcode: 8800824004343</p> <p>DESCRIPTION: White plastic flute with a removable mouth-piece. Sold in a plastic bag, which is transparent on one side and blue on the other. It has a label bearing the brand and importer's name, among other information.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING</p> <p>The product poses a risk of choking because it contains a removable mouth-piece which is a small part that could be placed in the mouth and swallowed.</p> <p>In addition, the labelling requirements are not met.</p> <p>The product does not comply with the Toy Safety Directive and with the relevant European standard EN 71-1.</p>	<p>Withdrawal from the market ordered by the authorities.</p>
EU/AUSTRIA	<p>CATEGORY: Toys</p> <p>PRODUCT: Toy music box "Dragon Musical Box"</p> <p>BRAND: Trousselier</p> <p>TYPE/NUMBER OF MODEL: 6000BE0065/12</p> <p>DESCRIPTION: Plastic musical box in the shape of a dragon; blue with coloured spots, four feet, and a wind-up mechanism with two dragon figurines on the top made from plastic.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING</p> <p>The product poses a risk of choking because it contains small parts.</p> <p>The product does not comply with the Toy Safety Directive and with the relevant European standard EN 71-1</p>	<p>Voluntary stop of sales.</p>



HARDLINES: TOYS

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Toys</p> <p>PRODUCT: Plastic soap bubble gun</p> <p>BRAND: Franga Toys</p> <p>NAME: Bubble New Style</p> <p>TYPE/NUMBER OF MODEL: Model 0906V123 Barcode: 8499660020398</p> <p>DESCRIPTION: Bubble gun in the form of an aircraft, the pilot of which is a sheep.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>MICROBIOLOGICAL</p> <p>The product poses a microbiological risk because the mesophilic aerobic microorganism count in the soapy water is too high (2.4x10⁵ CFU/g of aerobic mesophilic bacteria).</p> <p>The product does not comply with the Toys Safety Directive.</p>	Withdrawal from the market.
USA	<p>NAME OF PRODUCT: Imaginarium 5-Sided Activity Center</p> <p>UNITS: About 24,000</p> <p>IMPORTER: Toys “R” Us Inc. of Wayne, N.J.</p> <p>DESCRIPTION: This recall involves the Imaginarium 5-Sided Activity Center. The multi-sided center has two triangle-shaped ends with a wooden multi-colored xylophone on one and a mirror on the other. The three sides are square-shaped and include moveable block letters, rotating gears and sliding shapes. The name “Imaginarium” appears in a blue, oval-shaped logo underneath the mirror on one end. The second ‘i’ in the logo is dotted with a shooting star. The recalled product has model number 46284; Toys “R” Us item number 295909; and has the barcode number 000799985462841. The model number is printed on the back of the box, directly above the bar code. These numerical markings do not appear on the actual product.</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: The small wooden knobs attaching the xylophone keys to the end can detach, causing a choking hazard to young children.</p> <p>INCIDENTS/INJURIES: Toys “R” Us has received eight reports of the knobs detaching. No injuries have been reported to the firm.</p>	Voluntary recall.


HARDLINES: JUVENILE ITEMS

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: crib tents and play yard tents</p> <p>UNITS: NA</p> <p>MANUFACTURER: Tots in Mind, Inc.</p> <p>RETAILOR:</p> <p>Amazon.com</p> <p>Bed Bath & Beyond / Buy Buy Baby</p> <p>Burlington Coat Factory</p> <p>Toys R Us/Babies R Us</p> <p>Walmart</p> <p>DESCRIPTION: Tots in Mind recalled the play yard tents in July 2010 and offered a repair kit that is no longer available. The company is no longer in business and has stopped all sales. CPSC staff urges parents and caregivers to stop using these crib tents and play yard tents immediately.</p> <p>MANUFACTURED IN: NA</p> 	<p>HAZARD: CPSC is warning parents and caregivers who own these products that infants and toddlers are at risk of serious injury or death due to strangulation and entrapment hazards presented by these products.</p> <p>INCIDENTS/INJURIES: CPSC is aware of 27 tent failures including one fatality and one serious injury that occurred between January 1997 and April 2012 from crib tents and play yard tents made by Tots in Mind, Inc. In 2008, a two year old boy died after becoming entrapped between the bottom rail of a play yard tent and the top rail of a play yard. The fatality was reported in a prior recall with the firm in July 15, 2010.</p>	Voluntary recall.



HARDLINES: HOME FURNISHING & HOUSEWARE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Food-imitating products</p> <p>PRODUCT: Wire headdress</p> <p>BRAND: Casactual Colección Navidad [Casactual Christmas Collection]</p> <p>TYPE/NUMBER OF MODEL: Barcode 2102027455424</p> <p>DESCRIPTION: A headdress made of twisted black wires with beads of different sizes and bright colours attached to their free ends, without packaging.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHOKING</p> <p>The product poses a risk of choking because it has detachable small parts and, due to its characteristic form, appearance, colour and size, the product may be mistaken for a foodstuff and placed in the mouth.</p> <p>The product does not comply with the Directive 87/357/EEC on products which, appearing to be other than they are, endanger the health or safety of consumers.</p>	<p>Withdrawal from the market ordered by the authorities.</p>
USA	<p>NAME OF PRODUCT: Circulon Cookware Set</p> <p>UNITS: About 4,600</p> <p>MANUFACTURER: Meyer Corporation U.S., of Vallejo, Calif.</p> <p>DESCRIPTION: The defective lid is 11 inches in diameter with a rubber and stainless steel handle and a metal rim. The code "IMCP1108" is stamped on the outside of the metal rim. The lid is part of the 13-Piece Circulon Premier Professional cookware set. The cookware is aluminum and stainless steel with rubber and stainless steel handles. In addition to the covered sauté pan, the sets include: 1-quart and 3-quart saucepans, a 4-quart saucepot, an 8-quart stockpot, 8.5-, 10- and 12-inch French skillets and four additional glass lids.</p> <p>MANUFACTURED IN: China and Thailand</p> 	<p>HAZARD: The glass lid used with the 5-quart covered sauté pan can crack, break or shatter, posing a laceration hazard to consumers.</p> <p>INCIDENTS/INJURIES: Meyer has received 65 reports of broken or shattered lids. No injuries have been reported.</p>	<p>Voluntary recall.</p>

HARDLINES: HOME FURNISHING & HOUSEWARE

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Toilet and Cabinet Locks</p> <p>UNITS: About 183,000 toilet locks and 685,000 cabinet locks</p> <p>IMPORTER: Dorel Juvenile Group (DJG) Inc., of Columbus, Ind.</p> <p>DESCRIPTION: This recall involves Safety 1st Sure Fit toilet locks with model numbers 48003 and 48103. The toilet lock is attached to the tank behind the lid and is intended to prevent a child's access to the toilet bowl. This recall also involves Safety 1st cabinet slide locks with model numbers 12013 and 12014. The cabinet slide lock is attached to cabinet knobs or handles to prevent access to the contents of the cabinet. Model numbers can be found on the back of the locks.</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: Young children can unexpectedly disengage the toilet locks and gain access to water in the toilet, posing the risk of drowning. The cabinet locks are being recalled because young children can disengage the lock, posing the risk of injury from dangerous or unsafe items stored in the cabinet.</p> <p>INCIDENTS/INJURIES: DJG has received 110 reports of toilet locks that did not adequately secure the lid, including eight reports of children, under the age of two, who were able to disengage or break the lock. In addition, DJG has received 278 reports of cabinet locks that did not adequately secure the cabinet, including 71 reports of children between the ages of eight months and five years old who were able to disengage the cabinet locks. In one of the reported incidents, a 13-month-old boy swallowed small, toxic beads from a craft kit. The child was admitted to the hospital, observed overnight and released the next day.</p>	Voluntary recall.


HARDLINES: HOME FURNISHING & HOUSEWARE


NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: Kitchen table sets</p> <p>UNITS: About 200</p> <p>IMPORTER: Vantage Sales, Inc., of Lake Zurich, Ill.</p> <p>DISTRIBUTOR: Mason Companies, Inc., of Chippewa Falls, Wis.</p> <p>DESCRIPTION: This recall involves three-piece oak table and chair sets. The table is square-shaped with four straight, rectangular legs. The chairs have a white padded cushion seat and a slatted backrest. Both the table and the wooden parts of the chairs are a light pine color. The set has the style number 404285 however this number does not appear anywhere on the set.</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: The chairs can collapse during normal use, causing a fall hazard.</p> <p>INCIDENTS/INJURIES: None reported.</p>	Voluntary recall
USA	<p>NAME OF PRODUCT: Century Mattresses</p> <p>UNITS: About 340</p> <p>IMPORTER: Chicago Century Furniture Corp., of Chicago (previously Century Furniture Corp.)</p> <p>DESCRIPTION: This recall involves Chicago Century Furniture Corp. twin-, full-, queen- and king-size mattresses with the model number "MG006." The mattresses are 3 inches thick with white and off-white fabric with a tone-on-tone swirl pattern. The model number can be found on a paper tag attached to the foot of the mattress. The words "Century Spring Mattress" appear on a fabric label on the top side near the foot of the mattress. A picture of a man and woman embracing also appear on the label.</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: The mattresses fail to meet the mandatory federal open flame standard for mattresses, posing a fire hazard to consumers.</p> <p>INCIDENTS/INJURIES: None reported.</p>	Voluntary recall

HARDLINES: HOME FURNISHING & HOUSEWARE


NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/ITALY	PRODUCT: steel knives MANUFACTURED IN: China No picture available.	CHEMICAL migration of chromium (19,5 mg/kg - ppm) and of nickel (0,3 mg/kg - ppm) from steel knives from China	re-dispatch
EU/FINLAND	PRODUCT: enamelled mugs MANUFACTURED IN: Serbia No picture available.	CHEMICAL colour migration and inner coating peeling off from enamelled mugs from Serbia	withdrawal from the market
EU/GERMANY	PRODUCT: silicone baking tin MANUFACTURED IN: China No picture available.	CHEMICAL migration of volatile organic constituents (1.2 %) from silicone baking tin from China	withdrawal from the market
EU/ITALY	PRODUCT: electric square ovens MANUFACTURED IN: China No picture available.	CHEMICAL migration of nickel (0.7 mg/kg - ppm) from electric square ovens from China	re-dispatch
EU/ITALY	PRODUCT: toaster oven MANUFACTURED IN: China No picture available.	CHEMICAL migration of nickel (23.4 mg/kg - ppm) and of manganese (9.9 mg/kg - ppm) from toaster oven from China	re-dispatch
EU/ITALY	PRODUCT: frying pan MANUFACTURED IN: China No picture available.	CHEMICAL migration of chromium (0,65 mg/l) and of manganese (12,3 mg/l) from frying pan from China	re-dispatch
EU/SLOVENIA	PRODUCT: bread maker MANUFACTURED IN: China No picture available.	CHEMICAL migration of primary aromatic amines (0.0154) from bread maker from China	withdrawal from the market
EU/ITALY	PRODUCT: forks MANUFACTURED IN: China No picture available.	CHEMICAL migration of chromium (23,04 mg/l) and of manganese (0,78 mg/l) from forks from China	recall from consumers

HARDLINES: HOME FURNISHING & HOUSEWARE


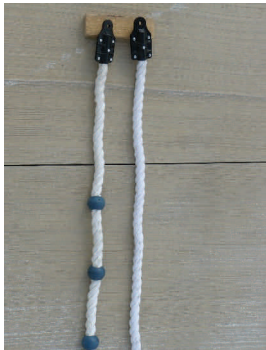
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/CYPRUS	<p>CATEGORY: Furniture</p> <p>PRODUCT: Sun Lounger</p> <p>BRAND: Carrefour Home</p> <p>TYPE/NUMBER OF MODEL: Model: GD51612 FLS 50018 Barcode: 3608143451405(assortment1), 3608143035360 (red), 3608143035346 (white), 3608143035353 (orange), 3608143035377 (pink), 3608143035384 (green)</p> <p>DESCRIPTION: A sun lounger in various fabric colours with a metal frame. Dimensions: 182 x 55 x 48 cm</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries to the fingers because the metal prop bar is not correctly fixed.</p> <p>The product does not comply with the relevant European standard EN 581.</p>	Voluntary withdrawal from the market and recall from consumers.

HARDLINES: HOME IMPROVEMENT & DIY			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
AUSTRALIA	<p>Rheem Australia Pty Ltd—Rheem 4 Star Gas Water Heater & Vulcan Freeloader 4 Star Gas Water Heater</p> <p>PRODUCT DESCRIPTION</p> <p>Storage water heaters designed for outdoor installation on residential premises connected to natural gas or LP gas.</p> <p>IDENTIFYING FEATURES</p> <p>Model numbers 347090NO, 347090PO, 347135NO, 347135PO, 347170NO, 347170PO, 648135NO, 648135PO, 648170NO, 648170PO and serial numbers between 4721293 and 4812343 Dates available for sale 24th January 2012 - 30th April 2012</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Plumbing Merchants and Hot Water Specialists</p> <p>SUPPLIER</p> <p>Rheem Australia Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://rheem.com.au</p> <p>No picture available.</p>	<p>HAZARDS</p> <p>There is a remote possibility of smoke and/or fire damage within the heater cabinet if the insulation comes in contact with the burner. This would normally self-extinguish due to use of fire retardant materials, however under certain conditions it can lead to a total failure of the water heater.</p> <p>DEFECTS</p> <p>These water heaters may have incorrect placement of the fibreglass insulation and its support material.</p>	<p>The water heater can continue to be used and we ask consumers to ensure that no combustibles are stored against or immediately adjacent to the water heater. Consumers are requested to contact our recall hotline on 1800 063018 to register their product for rectification work.</p>
USA	<p>NAME OF PRODUCT: ECHO Bear Cat log splitters</p> <p>UNITS: About 120</p> <p>MANUFACTURER: Crary Industries Inc. of West Fargo, N.D.</p> <p>DESCRIPTION: This recall involves ECHO Bear Cat brand hydraulic log splitter with model numbers LS27270 and LS27270T, with a date code of 012908 stamped on the hydraulic cylinder. The model number is printed on the main beam of the log splitters. The date code is stamped on the hydraulic cylinder near the capped end. The log splitters are black and orange with ECHO Bear Cat printed on the hydraulic cylinder.</p> <p>MANUFACTURED IN: USA</p> 	<p>HAZARD: The end cap of the log splitter's hydraulic cylinder can break away from the body of the log splitter, posing an impact hazard to the user or bystander.</p> <p>INCIDENTS/INJURIES: Crary Industries has received three reports of the hydraulic cylinder end caps detaching resulting in one injury from a cylinder reportedly striking a consumer in the head.</p>	<p>Voluntary recall.</p>



HARDLINES: PERSONAL & HOME CARE ITEMS

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/FINLAND	<p>CATEGORY: Jewellery</p> <p>PRODUCT: Earrings "Glowing earrings"</p> <p>BRAND: Lumica</p> <p>TYPE/NUMBER OF MODEL: Batch code / lot "03/16 N13"</p> <p>DESCRIPTION: A pair of metal earrings with a glowing plastic tube, which is available in different colours (blue, pink and green). Each pair of earrings is packed in a plastic bag.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHEMICAL</p> <p>The product poses a chemical risk because the metal knob releases 17-52 µg/cm²/week of nickel, exceeding the limit value of 0.5 µg/cm²/week.</p> <p>The product does not comply with the REACH Regulation.</p>	<p>Import rejected by the customs authorities.</p>



HARDLINES: SPORT & LEISURE GOODS

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/IRELAND	<p>CATEGORY: Other</p> <p>PRODUCT: Sky lantern "White Sky Lanterns"</p> <p>BRAND: Redwood Leisure</p> <p>TYPE/NUMBER OF MODEL: SL300</p> <p>DESCRIPTION: White sky lantern in plastic wrapping, fuel source connected to frame via chrysotile asbestos containing string.</p> <p>COUNTRY OF ORIGIN: United Kingdom</p> 	<p>CHEMICAL</p> <p>The product poses a chemical risk because the string supports to the burner of the sky lanterns contain chrysotile asbestos fibres.</p> <p>The product does not comply with the REACH Regulation.</p>	Voluntary withdrawal from the market by the retailer.
USA	<p>NAME OF PRODUCT: Porter Athletic Climbing Ropes</p> <p>UNITS: About 44</p> <p>DISTRIBUTOR: Porter Athletic, a division of Litanía Sports Group, Inc., of Champaign, Ill.</p> <p>DESCRIPTION: This recall involves two models of Porter Athletic climbing ropes. Model number 00118 is a white soft dacron rope with vinyl boot end sold in 12', 16', 20' and 24' lengths. Model number 00119 is a white soft dacron rope with vinyl boot end and rubber knots every 12" sold in 12', 16', 20' and 24' lengths.</p> <p>MANUFACTURED IN: USA</p> 	<p>HAZARD: The climbing rope can slip through the clamp that connects at the top, posing a fall hazard for climbers.</p> <p>INCIDENTS/INJURIES: Porter has received three reports of the rope slipping through the clamp, including one that resulted in back and wrist injuries.</p>	Voluntary recall.


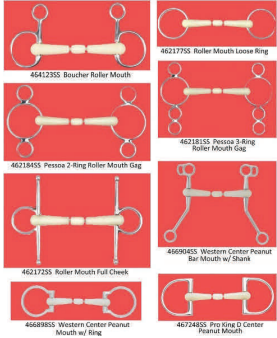
HARDLINES: SPORT & LEISURE GOODS



NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
USA	<p>NAME OF PRODUCT: First Fitness® Trampolines with Handlebars</p> <p>UNITS: About 40,000</p> <p>MANUFACTURER: Aqua-Leisure Industries Inc., of Avon, Mass.</p> <p>DESCRIPTION: This recall involves First Fitness Kid’s First trampolines with handlebars. The child-size toy trampolines have a red and blue metal handlebar, a blue nylon deck guard and a black jumping deck. “First Fitness” is embossed on the jumping deck in white letters. The trampolines can be identified by model number FF-6902TR and Toys R Us SKN 491463. The model and store numbers can be found on the lower right corner of the back of the packaging. A sewn-in tag on the bottom of the deck lists the factory date code of five numbers followed by “GLTX.”</p> <p>MANUFACTURED IN: China</p> 	<p>HAZARD: Metal fatigue can cause the handlebar to break away during use, posing a risk of laceration from exposed metal surfaces or other injury from a fall.</p> <p>INCIDENTS/INJURIES: Aqua-Leisure has received four reports of handlebars breaking from the metal connection joint during use. No injuries have been reported.</p>	Voluntary recall.
USA	<p>NAME OF PRODUCT: 4ZA Threadless Carbon Bicycle Handlebar Stem</p> <p>UNITS: About 105</p> <p>DISTRIBUTOR: Sinclair Imports, of Reno, Nev., and Quality Bicycle Products, of Bloomington, Minn.</p> <p>MANUFACTURER: Race Productions NV, Belgium</p> <p>DESCRIPTION: The recall involves all 4ZA 31.8 threadless bicycle handlebar stems sold as individual aftermarket components. The stems are black and have the words "4ZA Cycling Performance" painted on the carbon extension between the steerer clamp and handlebar clamp. The recalled stems range in extension lengths from 90mm to 130mm, approximately 3.5 to 5 inches.</p> <p>MANUFACTURED IN: Taiwan</p> 	<p>HAZARD: The bicycle handlebar stems can crack or break, posing a fall hazard.</p> <p>INCIDENTS/INJURIES: The firm received one report of a handlebar stem breaking resulting in minor injuries.</p>	Voluntary recall.



HARDLINES: SPORT & LEISURE GOODS

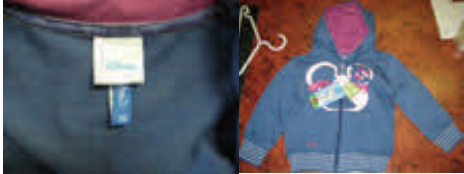

NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
<p>AUSTRALIA</p>	<p>Salsa Cycles - Salsa Minimalist Bicycle Rack</p> <p>PRODUCT DESCRIPTION</p> <p>Salsa Minimalist aluminium front bicycle rack in black or silver</p> <p>IDENTIFYING FEATURES</p> <p>Salsa part numbers: RK8000 (black) and RK8010 (silver)</p> <p>Dirt Works Australia part numbers: SAG-RKFMINK (black) and SAG-RKFMINS (silver)</p> <p>TRADERS WHO SOLD THIS PRODUCT</p> <p>Independent bicycle stores in NSW, ACT, VIC and TAS.</p> <p>SUPPLIER</p> <p>Dirt Works Australia Pty Ltd</p> <p>SUPPLIER'S WEB SITE</p> <p>http://www.dirtworks.com.au</p> 	<p>HAZARDS</p> <p>If the rack fails while the bicycle is in use, this poses a fall hazard to the rider.</p> <p>DEFECTS</p> <p>The steel mounting bracket on these bicycle racks with the single fork tab may crack or break.</p>	<p>Contact the place of purchase to arrange for a free inspection and reinstallation, or a full refund if reinstallation without the steel mounting bracket is not possible.</p>
<p>EU/IRELAND</p>	<p>CATEGORY: Other</p> <p>PRODUCT: Sky lantern "DeLuxe White Sky Lantern Eco Wedding Pack"</p> <p>BRAND: Unknown</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Sky lantern in plastic wrapping, fuel source connected to frame via chrysotile asbestos containing string.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>CHEMICAL</p> <p>The string in the product contains chrysotile asbestos.</p> <p>The product does not comply with the REACH Regulation.</p>	<p>Voluntary withdrawal from the market.</p>



HARDLINES: MISCELLANEOUS

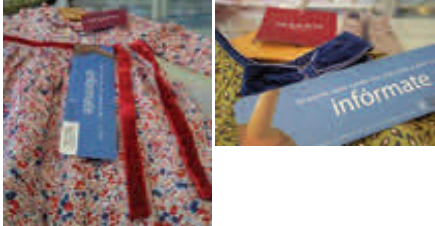
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/DENMARK	<p>CATEGORY: Pyrotechnic articles</p> <p>PRODUCT: Fireworks "Show of fireworks"</p> <p>BRAND: Jorge</p> <p>TYPE/NUMBER OF MODEL: Model: JW98 Registration number: CE 1395-F2-0002/2009 Required CE number: CE 0589</p> <p>DESCRIPTION: Small battery of fireworks with exposed, instantaneous fuse.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>BURNS</p> <p>The product poses a risk of burns because the battery is equipped with an exposed instantaneous fuse.</p> <p>The product does not comply with the Directive 2007/23/EC on pyrotechnic articles and the relevant European standard 15947.</p>	Withdrawal from the market ordered by the authorities.
USA	<p>NAME OF PRODUCT: Happy Mouth Wire Mouth Bits</p> <p>UNITS: About 3,400</p> <p>IMPORTER: English Riding Supply Inc., of Scranton, Pa.</p> <p>MANUFACTURER: Soyo International Corp, of Kobe, Japan</p> <p>DESCRIPTION: This recall involves eight models of Happy Mouth wire mouth bits used with a bridle in horseback riding. The bits involved in this recall have steel braided wire running through the plastic mouthpiece and most with a metal ring on each end. Model numbers included in the recall are 462172SS, 462177SS, 462181SS, 462184SS, 464123SS, 466898SS, 466904SS and 467248SS. Model numbers can be found on a label attached to the product. "Happy Mouth" is engraved on the plastic mouthpiece.</p> <p>MANUFACTURED IN: Korea</p> 	<p>HAZARD: The steel braided wire in the mouthpiece that connects the bit on either side of the horse's cheeks can become frayed, rusted or worn, which can cause the bit to break. If this happens, the rider can lose control and fall from the horse.</p> <p>INCIDENTS/INJURIES: The firm has received four reports of wire bits that have broken and resulted in reports of injuries including broken and fractured bones, bruises and back pain from falls.</p>	Voluntary recall.

SOFTLINES: WEARING APPARELS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/HUNGARY	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's jacket</p> <p>BRAND: H&S</p> <p>TYPE/NUMBER OF MODEL: Model: J-7891C, Bar code: 1290000007027</p> <p>DESCRIPTION: Children's jacket in red colour with hood and zip-fastener. The hood includes an elastic drawstring with plastic toggles on the ends. Size: 92, 98</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>STRANGULATION AND INJURIES</p> <p>The drawstring in the hood poses a risk of strangulation. If a child pulls the elastic drawstring the toggles may spring back into the eyes and face causing injuries.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Withdrawal from the market and recall from consumers ordered by the authorities.
EU/HUNGARY	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's sweater</p> <p>BRAND: Glo-Story</p> <p>TYPE/NUMBER OF MODEL: GFY-4588, Bar code: 5999032745889</p> <p>DESCRIPTION: Children's striped sweater with hood, zip-fastener and two pockets. The hood includes a drawstring with free ends. Sizes: 140,146,158,164</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>STRANGULATION</p> <p>The product poses a risk of strangulation due to the presence of drawstrings in the hood.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Withdrawal from the market and recall from consumers ordered by the authorities.

SOFTLINES: WEARING APPARELS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/BULGARIA	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's set</p> <p>BRAND: Talaman</p> <p>TYPE/NUMBER OF MODEL: Item 7353</p> <p>DESCRIPTION: Children's set, intended for children up to 7 years of age. The set consists of two parts – a dress and trousers. The dress has red and white checked patterns and a belt around the waist which has not been fixed in one point. When the belt is untied and both ends are aligned, it hangs about 430 mm below the lower edge of the garment.</p> <p>COUNTRY OF ORIGIN: Spain</p> 	<p>INJURIES</p> <p>The product poses a risk of injuries because of the presence of a belt in the waistband of the dress which is too long.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Sales ban and withdrawal from the market ordered by the authorities.
EU/BULGARIA	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's jacket</p> <p>BRAND: Turk Mali</p> <p>TYPE/NUMBER OF MODEL: Unknown</p> <p>DESCRIPTION: Children's anorak with a hood supplied with functional cords in the head and neck area. It is available in various colours – white, cream colour, burgundy and cyclamen. On the front there is an embroidered cat and the inscription "Kids Clup". The product is sold in transparent packaging.</p> <p>COUNTRY OF ORIGIN: Turkey</p> 	<p>STRANGULATION</p> <p>The product poses a risk of strangulation because of the presence of drawstrings in the hood.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Withdrawal from the market ordered by the authorities.

SOFTLINES: WEARING APPARELS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/HUNGARY	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's sweater</p> <p>BRAND: Glo-Story Disney (THE PRODUCT MAY BE COUNTERFEIT) Type/number of model: Model: DGPO-6283 Bar code: 5999032762831</p> <p>DESCRIPTION: Children's sweater with hood and zip-fastener. The hood includes an unattached drawstring with free ends. The product is decorated with a figure of Mickey Mouse and an inscription: "Mickey ". Size: 98-128</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>STRANGULATION</p> <p>The products pose a risk of strangulation because of the presence of drawstrings in the hood.</p> <p>The products do not comply with the relevant European standard EN 14682.</p>	Withdrawal from the market and recall from consumers ordered by the authorities.
EU/SPAIN	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's bed sheets "Super Heroes"</p> <p>BRAND: Ram's</p> <p>TYPE/NUMBER OF MODEL: Model J.S. V 90 CM Super Heroes – Red. Barcode: 8432456037903</p> <p>DESCRIPTION: Three-piece sheet set for children printed with "Super Heroes" - red. The bottom sheet fits size 190/200cm beds. The packaging is made of plastic and includes a cardboard label of various colours, predominantly red, with a photograph of the product, the composition, "Linea Mireia" and the importer's details.</p> <p>COUNTRY OF ORIGIN: Pakistan</p> 	<p>BURNS</p> <p>The product poses a risk of burns because in case it catches fire, the flames propagate too quickly.</p> <p>In addition, the labelling requirements are not met.</p> <p>The product does not comply with the relevant European standard EN 14878.</p>	Withdrawal from the market ordered by the authorities.

SOFTLINES: WEARING APPARELS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/HUNGARY	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Children's coat</p> <p>BRAND: Beyond</p> <p>TYPE/NUMBER OF MODEL: Type: MA-031</p> <p>DESCRIPTION: Children's coat with hood and zip fastener. The hood includes an elastic drawstring with plastic toggles.</p> <p>Size: 110,116</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>STRANGULATION AND INJURIES</p> <p>The product poses a risk of strangulation and injuries due to the presence of an elastic drawstring and plastic toggles in the hood area.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Withdrawal from the market and recall from consumers ordered by the authorities.
EU/HUNGARY	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Sweatshirt</p> <p>BRAND: E-Jeans</p> <p>TYPE/NUMBER OF MODEL: CQF-3273</p> <p>DESCRIPTION: Children's blue-grey striped sweatshirt with kangaroo pockets. The hood includes an unattached drawstring with knotted ends. The product is decorated with inscriptions: "E-Jeans, Fashion Jeans, Since 1989, Tyle 1989".Size: 146/152</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>STRANGULATION</p> <p>The product poses a risk of strangulation because of the presence of a drawstring in the hood.</p> <p>The product does not comply with the relevant European standard EN 14682.</p>	Withdrawal and recall from consumers ordered by authorities.

SOFTLINES: WEARING APPARELS			
NOTIFYING COUNTRY	PRODUCT	DANGER	MEASURES ADOPTED
EU/SPAIN	<p>CATEGORY: Clothing, textiles and fashion items</p> <p>PRODUCT: Girls' dresses</p> <p>BRAND: Neck & Neck</p> <p>TYPE/NUMBER OF MODEL: Ref. 11/01129 (size 12M) and ref. 11/01119 (size 4A)</p> <p>DESCRIPTION: The products are dresses. One of them (ref. 11/01129) has decorative cords (red) at the chest and waist. The other (ref. 11/01119) has a decorative motif (blue) at the neck.</p> <p>COUNTRY OF ORIGIN: China</p> 	<p>STRANGULATION AND INJURIES</p> <p>Both products pose a risk of strangulation because the decorative cords in the chest and waist area and the decorative motif sewn in the neck area, are too long. In addition, the products pose a risk of injuries because if the cords becomes trapped they can pull on the child unexpectedly, causing the child to fall and suffer injuries.</p> <p>The products do not comply with the relevant European standard EN 14682</p>	Withdrawal from the market ordered by the authorities.

GCSC has compiled the below sources:

PRODUCT RECALLS IN EUROPE

The Rapid Alert System for Non-Food Products (RAPEX) - Weekly overview reports of RAPEX notifications.

http://ec.europa.eu/consumers/dyna/rapex/rapex_archives_en.cfm

The official contact points of the Member and EFTA-EEA States provide the information published in these weekly overviews. Under the terms of Annex II.10 to the General Product Safety Directive (2001/95/EC) responsibility for the information provided lies with the notifying party. The Commission does not take any responsibility for the accuracy of the information provided.

The Rapid Alert System for food and feed (RASFF)-Weekly overview reports of RASFF notifications.

http://ec.europa.eu/food/food/rapidalert/index_en.htm

Disclaimer: The Commission cannot and does not take any responsibility for the accuracy of the information in these weekly overviews. The information is published as it has been received from the official contact points in the Member States/EEA-EFTA countries. In the event that further information received from a contact point regarding an already published notification leads to modification or withdrawal of the information, the Commission shall respectively include a corrigendum or a notice of withdrawal in the next weekly overview to be published.

PRODUCT RECALLS IN THE USA

Recalls and Product Safety News

www.cpsc.gov/cpsc/pub/prerel/prerel.html

US Food and Drug Administration (FDA)

www.fda.gov/opacom/7/alerts.html (US Cosmetics recalls)

Environmental Protection Agency (EPA)

www.epa.gov/pesticides/alerts.htm (US Pesticides recalls)

PRODUCT RECALLS IN AUSTRALIA

<http://www.recalls.gov.au/>

FOR ENQUIRIES

gcsc@sgs.com

www.sgs.com/regulatorycompliance

© 2012 SGS SA. All rights reserved. SGS's services including compilation(s) of data into this Factsheet are based on publicly available sources as of the date stated herein for which SGS bears no responsibility. Although every effort has been made to ensure accuracy, SGS makes no warranty as to error, omissions and does not accept any liability, without limitation, for indirect or consequential loss or damage, or any loss or damages arising from any use in connection with this document.

WHEN YOU NEED TO BE SURE

SGS